Accessibility Survey



City of Downey Earnshaw Avenue - Golden Street To Century Boulevard

Golden Street To Century Boulevard Downey, CA 90242

Date of Inspection 11/28/2016

Prepared By

Disability Access Consultants

(800) 743-7067

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Century Boulevard @ 33.907105916192, - 118.149259239435

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

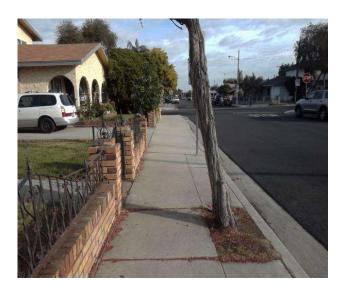

Code Reference ADA 206, 302

| Record Number | 310751 | Resolution | None |
|----------------------|-------------|-----------------------|------------|
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of Century Boulevard @ 33.905761352735, - 118.149988800287

Curb Ramp : Parallel Curb Ramp Right Side Slope

Finding

The running slope is greater than allowed.

On-Site Finding 8.60 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.2,CA 11B-406

Progress

Record Number310756ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of Century Boulevard @ 33.905761352735, -118.149988800287

Curb Ramp : Appurtenances

Finding

Utilities, gratings or other appurtenances are located on the curb ramp.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp free of appurtenances.

See Recommendation Recommendation

Costing Info (Estimated)

Install curb ramp \$1,440



Code Reference ADA 303.3,CA 11B-303.3

Progress

| Record Number | 310757 | Resolution | None |
|----------------------|-------------|-----------------------|------------|
| Progress | Not_Started | Priority | Seven |
| Actual Date | | Projected Date | 06/30/2032 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |

No Comments

New Value 0 **Assignment** None

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner Of Century Boulevard @ 33.905761352735, - 118.149988800287

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.60 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp, Landings and Transitions: Top Landing Slope

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

| Record Number | 310758 | Resolution | None |
|-------------------------|-------------|-----------------------|------------|
| Progress | Not_Started | Priority | Seven |
| Actual Date | | Projected Date | 06/30/2032 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner Of Century Boulevard @ 33.905761352735, - 118.149988800287

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.80 percent


Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260

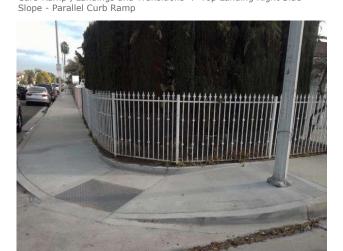

Curb Ramp , Landings and Transitions : Top Landing Right Side

Code Reference ADA 406.4, 403.3, 406.1,CA 11B-406.5.3

| Record Number | 310759 | Resolution | None |
|-------------------------|-------------|-----------------------|------------|
| Progress | Not_Started | Priority | Seven |
| Actual Date | | Projected Date | 06/30/2032 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Century Boulevard @ 33.905828136189, - 118.150136321783

Curb Ramp : Appurtenances

Finding

Utilities, gratings or other appurtenances are located on the curb ramp.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp free of appurtenances.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$1,440



Code Reference ADA 303.3,CA 11B-303.3

Progress

| Record Number | 310763 | Resolution | None |
|----------------------|-------------|-----------------------|------------|
| Progress | Not_Started | Priority | Seven |
| Actual Date | | Projected Date | 06/30/2032 |
| Actual Cost | \$0.00 | Contractor | |

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner Of Century Boulevard @ 33.905828136189, - 118.150136321783

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 4.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions : Top Landing Slope

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

| Record Number | 310764 | Resolution | None |
|----------------------|-------------|-----------------------|------------|
| Progress | Not_Started | Priority | Seven |
| Actual Date | | Projected Date | 06/30/2032 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner Of Century Boulevard @ 33.905828136189, - 118.150136321783

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.50 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions : Top Landing Right Side

Slope - Parallel Curb Ramp

Code Reference ADA 406.4, 403.3, 406.1,CA 11B-406.5.3

| Record Number | 310765 | Resolution | None |
|-------------------------|-------------|-----------------------|------------|
| Progress | Not_Started | Priority | Seven |
| Actual Date | | Projected Date | 06/30/2032 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of Golden Street @ 33.908866727982, -118.147889971733

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 47.50 inches


Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240

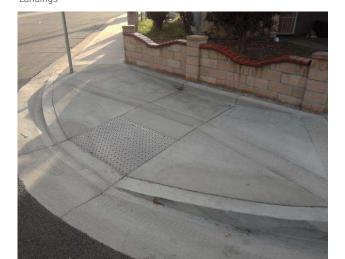

Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

| Record Number | 310766 | Resolution | None |
|---------------|-------------|-----------------------|------------|
| Progress | Not_Started | Priority | Seven |
| Actual Date | | Projected Date | 06/30/2032 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |

Comments No Comments

New Value **Assignment** 0 None

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of Prichard Street @ 33.907246159172, - 118.148992359638

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 45.50 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number 310753 Resolution None **Progress** Not_Started **Priority** Seven **Actual Date Projected Date** 06/30/2032 Contractor **Actual Cost** \$0.00 Comments No Comments **New Value Assignment** 0 None **Designated Staff**

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Golden Street @ 33.908871180052, - 118.147895336151

Bottom Landing

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 5.40 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Curb Ramp : Bottom Landing Slope

Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

Designated Staff

Record Number 310760 Resolution None **Priority Progress** Not_Started Seven **Actual Date Projected Date** 06/30/2032 **Actual Cost** \$0.00 Contractor **Comments** No Comments **Assignment New Value** None

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner Of Golden Street @ 33.908871180052, - 118.147895336151

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp, Landings and Transitions: Top Landing Slope

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

| Record Number | 310761 | Resolution | None |
|-------------------------|-------------|-----------------------|------------|
| Progress | Not_Started | Priority | Seven |
| Actual Date | | Projected Date | 06/30/2032 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner Of Golden Street @ 33.908871180052, - 118.147895336151

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 46.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number 310762 Resolution None **Progress** Not_Started **Priority** Seven **Actual Date Projected Date** 06/30/2032 Contractor **Actual Cost** \$0.00 Comments No Comments **New Value Assignment** 0 None

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South Of Golden Street @ 33.908821094255, -118.147922158241

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 28.00 inches for 3.00 feet


Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260

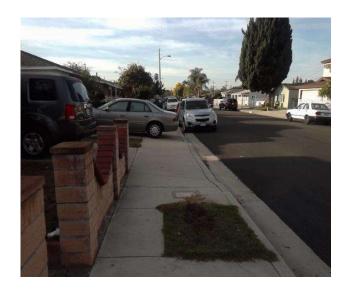

Code Reference ADA 206, 302,CA 11B-403.5.1

Progress

| Record Number | 310754 | Resolution | None |
|----------------------|-------------|-----------------------|------------|
| Progress | Not_Started | Priority | Seven |
| Actual Date | | Projected Date | 06/30/2032 |

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Tree South Of Prichard Street @ 33.906257775156, -118.149660229683

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 66.00 inches


Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned

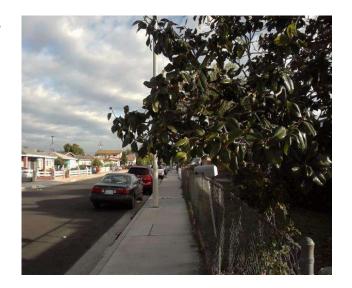

Code Reference ADA 206, 307.4,CA 11B-307.4

| Record Number | 310755 | Resolution | None |
|----------------------|-------------|-----------------------|------------|
| Progress | Not_Started | Priority | Seven |
| Actual Date | | Projected Date | 06/30/2032 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Sidewalks - Exterior : Sidewalks

West Side

Prichard Street West Crossing @ 33.907357462960, -118.149079531431

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 5.50 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

| Record Number | 310752 | Resolution | None |
|---------------|-------------|------------|-------|
| Progress | Not_Started | Priority | Seven |

Actual Date Projected Date 06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

West Side

Sidewalk North Of Prichard Street @ 33.907728103527, -118.148831427097

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 39.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

| Record Number | 310750 | Resolution | None |
|-------------------------|-------------|-----------------------|------------|
| Progress | Not_Started | Priority | Seven |
| Actual Date | | Projected Date | 06/30/2037 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |



Earnshaw Avenue - Golden Street To Century Boulevard

Golden Street To Century Boulevard Downey, CA 90242

Date of Inspection 11/28/2016

*Estimated Facility Total: \$16,270

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using

