

Accessibility Survey



City of Downey

Rio Hondo Drive - Dinwiddie Street To Cul-de-sac

Dinwiddie Street To Cul-de-sac
Downey, CA 90241

Date of Inspection
2/13/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Rio Hondo Drive - Dinwiddie Street To Cul-de-sac

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Pellet Street @ 33.953314612475, -118.155614733696

Sidewalks , Change in Level : Change in Level - Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation not exceed a .5 beveled inch.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	360355	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Rio Hondo Drive - Dinwiddie Street To Cul-de-sac

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Dinwiddie Street @ 33.953523750320, - 118.155641555786

Sidewalks , Change in Level : Change in Level - Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation not exceed a .5 beveled inch.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	360352	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Rio Hondo Drive - Dinwiddie Street To Cul-de-sac

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South Of Cul-de-sac @ 33.954680673795, -118.154348731041

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 379.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	360354	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Rio Hondo Drive - Dinwiddie Street To Cul-de-sac

Sidewalks - Exterior : Sidewalks

East Side @ 33.954680673795, -118.154348731041

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

Record Number	360353	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Rio Hondo Drive - Dinwiddie Street To Cul-de-sac

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Dinwiddie Street @ 33.954249054184, - 118.154579401016

Sidewalks , Change in Level : Change in Level - Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation not exceed a .5 beveled inch.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	360351	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Rio Hondo Drive - Dinwiddie Street To Cul-de-sac

Sidewalks - Exterior : Sidewalks

West Side @ 33.952624898917, -118.156725168228

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

Record Number	360350	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Rio Hondo Drive - Dinwiddie Street To Cul-de-sac



Rio Hondo Drive - Dinwiddie Street To Cul-de-sac

**Dinwiddie Street To Cul-de-sac
Downey, CA 90241**

Date of Inspection
2/13/2017

***Estimated Facility Total: \$6,654**

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using

