

Accessibility Survey



City of Downey Dorion Street - Barlin Avenue To Blodgett Avenue

Barlin Avenue To Blodgett Avenue
Downey, CA 90242

Date of Inspection
11/28/2016

Prepared By
Disability Access Consultants
(800) 743-7067

Dorion Street - Barlin Avenue To Blodgett Avenue

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Barlin Avenue @ 33.905889354309, -118.147554695606

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	310792	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Dorion Street - Barlin Avenue To Blodgett Avenue

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Blodgett Avenue @ 33.905724621813, - 118.147168457508

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 14.90 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

Record Number	310791	Resolution	None
Progress	Not_Started	Priority	Four
Actual Date		Projected Date	06/30/2023
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Dorion Street - Barlin Avenue To Blodgett Avenue

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Blodgett Avenue @ 33.90597733053, - 118.147262334824

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 14.70 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

Record Number	310790	Resolution	None
Progress	Not_Started	Priority	Four
Actual Date		Projected Date	06/30/2023
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Dorion Street - Barlin Avenue To Blodgett Avenue



Dorion Street - Barlin Avenue To Blodgett Avenue

**Barlin Avenue To Blodgett Avenue
Downey, CA 90242**

Date of Inspection
11/28/2016

***Estimated Facility Total: \$2,718**

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using

