# **Accessibility Survey**



# 4th Street - Paramount Boulevard to Downey Avenue

Paramount Boulevard to Downey Avenue Downey, CA 90242

Date of Inspection 7/21/2017

Prepared By

**Disability Access Consultants** 

(800) 743-7067

#### North Side

# Change in Level East of Myrtle Street @ 33.943737105901, -118.132999688387

Sidewalks , Change in Level : Change in Level Non Beveled

### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 2.00 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



**Code Reference** ADA 206, 302 Notes: Surface is Rough And Uneven

Record Number	473329	Resolution	None
Progress	Not_Started	Priority	One
Actual Date		Projected Date	06/30/2018
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

#### North Side

### Change in Level East of Myrtle Street @ 33.943770482751, -118.133039921522

Sidewalks , Change in Level : Change in Level Non Beveled

### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 1.50 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



**Code Reference** ADA 206, 302 Notes: Surface is Rough And Uneven

### **Progress**

**Record Number** 473324 Resolution None Not\_Started **Progress** Priority One **Actual Date Projected Date** 06/30/2018 \$0.00 Contractor **Actual Cost** Comments No Comments

Assignment None New Value 0

#### **North Side**

# Change in Level East of La Reina Avenue @ 33.943384423046, -118.132351934910

Sidewalks , Change in Level : Change in Level Non Beveled

#### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches


#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198

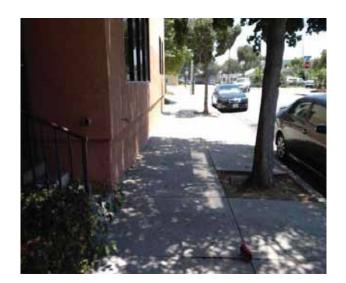

Code Reference ADA 206, 302

Record Number	473330	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

#### **North Side**

# Change in Level East of La Reina Avenue @ 33.943486779104, -118.132539689541

Sidewalks , Change in Level : Change in Level Non Beveled

#### **Finding**

There is a change in elevation greater than recommended value.

**On-Site Finding** 1.12 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	473335	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

#### North Side

# Change in Level East of La Reina Avenue @ 33.943496792190, -118.132549077272

Sidewalks , Change in Level : Change in Level Non Beveled

# **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198



Code Reference ADA 206, 302

# **Progress**

Record Number	473341	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		<b>Projected Date</b>	06/30/2021
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

#### **North Side**

# Change in Level East of La Reina Avenue @ 33.943532394264, -118.132606744766

Sidewalks , Change in Level : Change in Level Non Beveled

# **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches


#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

# Costing Info (Estimated)

Remove tripping hazards \$198

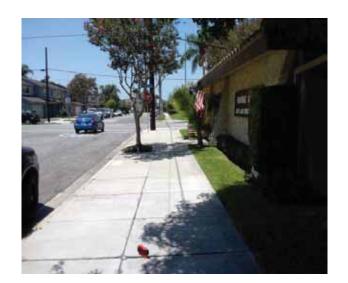

Code Reference ADA 206, 302

Record Number	473328	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

#### North Side

#### Change in Level East of Myrtle Street @ 33.943778270681, -118.133066743612

Sidewalks , Change in Level : Change in Level Non Beveled

### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 1.25 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



**Code Reference** ADA 206, 302 Notes: Surface is Rough And Uneven

# **Progress**

**Record Number** 473323 Resolution None Not\_Started **Progress** Priority Two **Projected Date** 06/30/2020 **Actual Date** \$0.00 Contractor Actual Cost

No Comments

**Assignment** None **New Value** 0

**Designated Staff** 

Comments

#### North Side

# Change in Level East of Myrtle Street @ 33.943811647516, -118.133119046688

Sidewalks , Change in Level : Change in Level Non Beveled

### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	473333	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

#### North Side

### Change in Level East of New Street @ 33.943021725589, -118.131655901670

Sidewalks , Change in Level : Change in Level Non Beveled

# **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

# **Progress**

Record Number	473338	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
	¢0.00	Combination	

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### **North Side**

# Change in Level East of New Street @ 33.943021725589, -118.131655901670

Sidewalks , Change in Level : Change in Level Non Beveled

#### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.87 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	473342	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

#### **North Side**

# Change in Level East of Paramount Boulevard @ 33.945019880113, - 118.134503066540

### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

### Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

#### **Progress**

Record Number	473340	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### North Side

# Change in Level East of Paramount Boulevard @ 33.945285777986, - 118.135011345148

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches


# Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

### Costing Info (Estimated)

Remove tripping hazards \$198

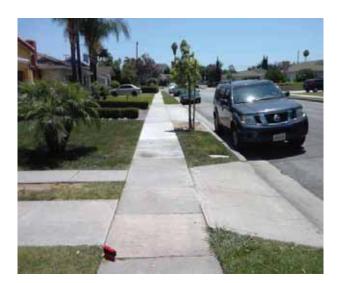

Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

#### **Progress**

Record Number	473325	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

No Comments

Assignment None New Value 0

**Designated Staff** 

Comments

#### North Side

Change in Level East of Paramount Boulevard @ 33.945476022398, - 118.135306388140

### **Finding**

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.50 inches

# Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

### Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

#### **Progress**

Record Number	473322	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### North Side

Change in Level East of Paramount Boulevard @ 33.945511623644, - 118.135335892439

### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

### Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

#### **Progress**

Record Number	473332	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### South Side

### Change in Level West of La Reina Avenue @ 33.944352350411, -118.133958578110

Sidewalks , Change in Level : Change in Level Non Beveled

# **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	473288	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

#### South Side

# Change in Level West of Myrtle Street @ 33.944881924404, -118.134572803974

Sidewalks , Change in Level : Change in Level Non Beveled

#### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198



0

Code Reference ADA 206, 302

# **Progress**

Record Number	473286	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None New Value

#### South Side

# Change in Level West of Myrtle Street @ 33.945523861569, -118.135571926832

Sidewalks , Change in Level : Change in Level Non Beveled

# **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198



Code Reference ADA 206, 302

# **Progress**

Record Number	473290	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

#### South Side

# Change in Level West of Myrtle Street @ 33.945550562490, -118.135608136654

Sidewalks , Change in Level : Change in Level Non Beveled

#### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198



Code Reference ADA 206, 302

# **Progress**

Record Number	473284	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

#### South Side

# Change in Level West of New Street @ 33.943359946579, -118.132629543543

Sidewalks , Change in Level : Change in Level Non Beveled

#### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

# **Costing Info (Estimated)**

Remove tripping hazards \$198



Code Reference ADA 206, 302

# **Progress**

Record Number	473291	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

#### South Side

### Change in Level West of New Street @ 33.943359946579, -118.132629543543

Sidewalks , Change in Level : Change in Level Non Beveled

#### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 1.25 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198



Code Reference ADA 206, 302

# **Progress**

Record Number	473292	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### South Side

### Change in Level West of La Reina Avenue @ 33.944396852554, -118.133959919214

Sidewalks , Change in Level : Change in Level Non Beveled

#### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches


#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198

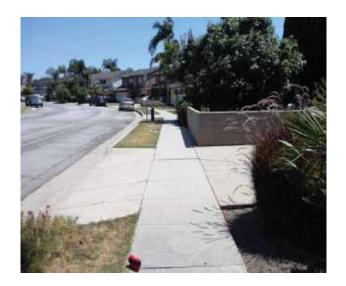

Code Reference ADA 206, 302

Record Number	473293	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

# Northeast Corner of Paramount Boulevard @ 33.945757494345, - 118.135565221310

**Bottom Landing** 

# **Finding**

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 9.60 percent

#### Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

# Costing Info (Estimated)

Repave landing \$1,260



**Code Reference** ADA 406, 406.2,CA 11B-406.5.8

### **Progress**

Record Number473358ResolutionNoneProgressNot\_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# **Curb Ramps - Exterior : Curb Ramp , Landings And Transitions**

# Northeast Corner of Paramount Boulevard @ 33.945757494345, - 118.135565221310

**Bottom Landing** 

#### **Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.75 inches

#### Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

#### Costing Info (Estimated)

Patch lip at curb ramp \$255

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level  $\,$ 



**Code Reference** ADA 302, 303, 406.2, 303.1

#### **Progress**

Record Number	473359	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

# **Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

# Northeast Corner of Paramount Boulevard @ 33.945757494345, - 118.135565221310

Landings

**Top Landing** 

# **Finding**

There is not enough top landing clear length.

On-Site Finding 30.00 inches

#### Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

### Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

**Code Reference** ADA 406, 406.4, CA 11B-406.5.3

# **Progress**

Record Number	473360	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

# Northeast Corner of Paramount Boulevard @ 33.945757494345, - 118.135565221310

Curb Ramp : No Detectable Warnings

#### **Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

#### Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

# **Costing Info (Estimated)**

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

#### **Progress**

Record Number473821ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Northeast Corner of Paramount Boulevard @ 33.945757494345, - 118.135565221310

Curb Ramp : Curb Ramp Slope

### **Finding**

The running slope is greater than allowed.

On-Site Finding 11.80 percent

#### Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

No Comments

# **Progress**

Record Number473822ResolutionNoneProgressNot\_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Assignment None New Value 0

**Designated Staff** 

Comments

# Northeast Corner of Paramount Boulevard @ 33.945757494345, - 118.135565221310

Curb Ramp : Side Flare Slope

# **Finding**

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 33.00 percent

#### Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)** 

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3, CA 11B-406.2.2

Record Number	473823	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

# Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Landings

# Northwest Corner of La Reina Avenue @ 33.943719304908, -118.132936656475

**Top Landing** 

# **Finding**

There is not enough top landing clear length.

On-Site Finding 24.00 inches

#### Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

### Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -



**Code Reference** ADA 406, 406.4, CA 11B-406.5.3

# **Progress**

Record Number	473308	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

# Northwest Corner of La Reina Avenue @ 33.943719304908, - 118.132936656475

Curb Ramp : No Detectable Warnings

#### **Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

#### Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

# **Costing Info (Estimated)**

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

#### **Progress**

Record Number473814ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Northwest Corner of La Reina Avenue @ 33.943719304908, - 118.132936656475

Curb Ramp : Curb Ramp Slope

### **Finding**

The running slope is greater than allowed.

On-Site Finding 10.20 percent

#### Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2,CA 11B-406

# **Progress**

Record Number	473815	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Northwest Corner of La Reina Avenue @ 33.943719304908, - 118.132936656475

Curb Ramp : Side Flare Slope

### **Finding**

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 22.80 percent

#### Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)** 

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3, CA 11B-406.2.2

# **Progress**

**Record Number** 473816 Resolution None Not\_Started Six **Progress** Priority **Actual Date Projected Date** 06/30/2027 \$0.00 Contractor Actual Cost Comments No Comments New Value Assignment None 0 **Designated Staff** 

# Southeast Corner of Paramount Boulevard @ 33.945563912948, - 118.135692626238

Curb Ramp : No Detectable Warnings

#### **Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

#### Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

# **Costing Info (Estimated)**

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

#### **Progress**

Record Number473267ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Southeast Corner of Paramount Boulevard @ 33.945563912948, - 118.135692626238

Curb Ramp : Curb Ramp Width

### **Finding**

The width of the curb ramp is less than required.

On-Site Finding 43.00 inches

#### Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

**Costing Info (Estimated)** 

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.5,CA 11B-406.5.2

# **Progress**

**Record Number** 473268 Resolution None **Progress** Not\_Started Priority Six **Actual Date Projected Date** 06/30/2027 \$0.00 Contractor Actual Cost Comments No Comments New Value Assignment None 0 **Designated Staff** 

# Southeast Corner of Paramount Boulevard @ 33.945563912948, - 118.135692626238

Curb Ramp : Curb Ramp Slope

### **Finding**

The running slope is greater than allowed.

On-Site Finding 10.60 percent

#### Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

**Costing Info (Estimated)** 

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2,CA 11B-406

# **Progress**

Record Number	473269	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

# Southeast Corner of Paramount Boulevard @ 33.945563912948, - 118.135692626238

Curb Ramp : Side Flare Slope

### **Finding**

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 20.10 percent

#### Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3, CA 11B-406.2.2

# **Progress**

**Record Number** 473270 Resolution None Not\_Started Six **Progress** Priority **Actual Date Projected Date** 06/30/2027 \$0.00 Contractor Actual Cost Comments No Comments New Value Assignment None 0 **Designated Staff** 

# Southeast Corner of Paramount Boulevard @ 33.945563912948, - 118.135692626238

**Bottom Landing** 

## **Finding**

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 8.30 percent

#### Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

## Costing Info (Estimated)

Repave landing \$1,260



Curb Ramp : Bottom Landing Slope

**Code Reference** ADA 406, 406.2,CA 11B-406.5.8

# **Progress**

Record Number	473271	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

## Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

# Southeast Corner of Paramount Boulevard @ 33.945563912948, - 118.135692626238

**Bottom Landing** 

## **Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.75 inches

#### Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

## Costing Info (Estimated)

Patch lip at curb ramp \$255



Curb Ramp , Landings And Transitions : Bottom Landing Change in

**Code Reference** ADA 302, 303, 406.2, 303.1

#### **Progress**

Record Number	473272	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

# Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

# Southeast Corner of Paramount Boulevard @ 33.945563912948, - 118.135692626238

**Bottom Landing** 

## **Finding**

The overlayment causes a noncompliant change in level.

On-Site Finding 0.87 inches

#### Recommendation

Ensure the change in elevation is within the recommended height.

Recommendation Up to 0.50 inches

## Costing Info (Estimated)

Provide smooth surface \$150



Curb Ramp , Landings And Transitions : Bottom Landing Change in

**Code Reference** ADA 303.2, 303.3,CA 11B-303.3,CA 11B-303.2

## **Progress**

Record Number	473273	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

No Comments

Assignment None New Value 0

**Designated Staff** 

Comments

## **Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

# Southeast Corner of Paramount Boulevard @ 33.945563912948, - 118.135692626238

**Top Landing** 

## **Finding**

The slope at the top landing is greater than allowed.

On-Site Finding 5.00 percent

#### Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

## Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions  $\,:\,$  Top Landing Slope

**Code Reference** ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

## **Progress**

Record Number	473274	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

## Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

# Southwest Corner of La Reina Avenue @ 33.943585797347, - 118.133019804955

**Top Landing** 

## **Finding**

The slope at the top landing is greater than allowed.

On-Site Finding 2.50 percent


#### Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

## Costing Info (Estimated)

Provide compliant landing \$1,260

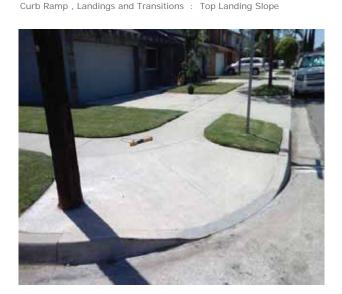

**Code Reference** ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

## **Progress**

Record Number	473312	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

# Southwest Corner of La Reina Avenue @ 33.943585797347, - 118.133019804955

Curb Ramp : No Detectable Warnings

#### **Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

#### Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

## **Costing Info (Estimated)**

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

#### **Progress**

Record Number473817ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Southwest Corner of La Reina Avenue @ 33.943585797347, - 118.133019804955

Curb Ramp : Curb Ramp Slope

## **Finding**

The running slope is greater than allowed.

On-Site Finding 10.60 percent

#### Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

## **Progress**

Record Number473818ResolutionNoneProgressNot\_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

# Southwest Corner of La Reina Avenue @ 33.943585797347, - 118.133019804955

Curb Ramp : Side Flare Slope

## **Finding**

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 18.60 percent

#### Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)** 

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3, CA 11B-406.2.2

## **Progress**

**Designated Staff** 

**Record Number** 473819 Resolution None **Progress** Not\_Started Six Priority **Actual Date Projected Date** 06/30/2027 \$0.00 Contractor Actual Cost Comments No Comments New Value Assignment None  $\bigcirc$ 

# Sidewalks - Exterior : Sidewalks , Vehicular Traffic

#### North Side

## Alley East of Myrtle Street @ 33.943932916571, -118.133347034454

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

## **Finding**

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

# **Costing Info (Estimated)**

Install compliant detectable \$190 warnings



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

## **Progress**

Record Number	473348	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

## Sidewalks - Exterior : Sidewalks

## **North Side**

## Alley East of Myrtle Street @ 33.943932916571, -118.133347034454

Sidewalks : Vehicular Traffic Cross Slope

# **Finding**

Cross slope at vehicular traffic is not compliant.

On-Site Finding 7.30 percent

#### Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



0

**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	473349	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		<b>Projected Date</b>	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None New Value

# Sidewalks - Exterior : Sidewalks , Vehicular Traffic

#### North Side

## Alley East of Paramount Boulevard @ 33.945445983835, -118.135275542736

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

## **Finding**

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found


#### Recommendation

Provide detectable warnings.

See Recommendation Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings

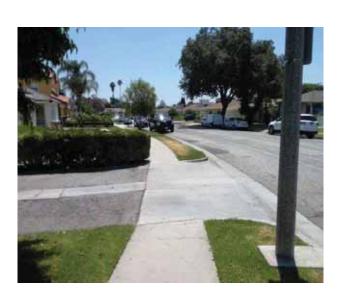

**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

## **Progress**

Record Number	473350	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

\$0.00 Contractor **Actual Cost** 

Comments No Comments

**Assignment** None New Value 0

#### Sidewalks - Exterior : Sidewalks

#### North Side

## Alley East of Paramount Boulevard @ 33.945445983835, -118.135275542736

Sidewalks : Vehicular Traffic Cross Slope

## **Finding**

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.60 percent

#### Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	473351	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

## **North Side**

## Bush East of Myrtle Street @ 33.944086449622, -118.133621960878

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

# **Finding**

Sidewalk width at the obstruction is not compliant.

On-Site Finding 30.00 inches

#### Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

**Costing Info (Estimated)** 

\$1,260



**Code Reference** ADA 206, 302, 403.5.1,CA 11B-403.5

Record Number	473327	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

## **North Side**

## Bush East of Paramount Boulevard @ 33.945061044273, -118.134559392929

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

## **Finding**

Sidewalk width at the obstruction is not compliant.

On-Site Finding 23.00 inches

#### Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

**Costing Info (Estimated)** 

\$1,260



**Code Reference** ADA 206, 302, 403.5.1,CA 11B-403.5

Record Number	473337	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

## **North Side**

## Bush East of Paramount Boulevard @ 33.945700755015, -118.135524988174

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

## **Finding**

Sidewalk width at the obstruction is not compliant.

On-Site Finding 38.00 inches

#### Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

**Costing Info (Estimated)** 

\$1,260



**Code Reference** ADA 206, 302, 403.5.1,CA 11B-403.5

Record Number	473331	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		<b>Projected Date</b>	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

#### North Side

## Curb East of Myrtle Street @ 33.943917340739, -118.133309483528

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

## **Finding**

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

**Costing Info (Estimated)** 

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

## **Progress**

Record Number	473326	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### North Side

## Curb East of Myrtle Street @ 33.943948492400, -118.133371174335

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

## **Finding**

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

**Costing Info (Estimated)** 

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

## **Progress**

Record Number	473339	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

## **North Side**

# Curb Northeast Corner of La Reina Avenue @ 33.943630299891, -118.132807910442

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

## **Finding**

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

## **Progress**

Record Number	473336	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Sidewalks - Exterior : Sidewalks , Vehicular Traffic

#### North Side

## Driveway East of La Reina Avenue @ 33.943269828617, -118.132129311562

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

## **Finding**

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

#### Recommendation

Provide detectable warnings.

See Recommendation Recommendation

# Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

## **Progress**

Record Number	473345	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Comments

Assignment New Value 0 None

#### Sidewalks - Exterior : Sidewalks

#### North Side

## Driveway East of La Reina Avenue @ 33.943269828617, -118.132129311562

Sidewalks : Vehicular Traffic Cross Slope

# **Finding**

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.30 percent

#### Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	473346	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None New Value 0

# Sidewalks - Exterior : Sidewalks , Vehicular Traffic

#### North Side

## Driveway East of New Street @ 33.942873753483, -118.131384998560

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

## **Finding**

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

# Costing Info (Estimated)

Install compliant detectable \$190 warnings



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	473353	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

#### Sidewalks - Exterior : Sidewalks

#### North Side

## Driveway East of New Street @ 33.942873753483, -118.131384998560

Sidewalks : Vehicular Traffic Cross Slope

## **Finding**

Cross slope at vehicular traffic is not compliant.

On-Site Finding 7.30 percent

#### Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	473354	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
	¢0.00	0	

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Sidewalks - Exterior : Sidewalks , Vehicular Traffic

#### North Side

## Driveway East of New Street @ 33.942977222727, -118.131587505341

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

## **Finding**

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

# **Costing Info (Estimated)**

Install compliant detectable \$190 warnings



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

## **Progress**

Record Number	473343	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

#### Sidewalks - Exterior : Sidewalks

#### North Side

## Driveway East of New Street @ 33.942977222727, -118.131587505341

Sidewalks : Vehicular Traffic Cross Slope

## **Finding**

Cross slope at vehicular traffic is not compliant.

On-Site Finding 7.80 percent

#### Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

## **Progress**

Record Number	473344	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### Sidewalks - Exterior : Sidewalks

#### North Side

## Driveway East of New Street @ 33.943077354134, -118.131755143404

Sidewalks : Vehicular Traffic Cross Slope

## **Finding**

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.40 percent

#### Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	473347	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

## **North Side**

## Guy Wire East of New Street @ 33.942817012232, -118.131299167871

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

## **Finding**

Overhead obstruction height is not compliant.

On-Site Finding 65.00 inches

#### Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

**Costing Info (Estimated)** 

Unassigned



**Code Reference** ADA 206, 307.4,CA 11B-307.4

# **Progress**

Record Number	473334	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

## Sidewalks - Exterior : Sidewalks

#### North Side

## La Reina Avenue North Crossing @ 33.943667014472, -118.132874965668

Sidewalks : Vehicular Traffic Slope

## **Finding**

Slope at vehicular traffic is not compliant.

On-Site Finding 9.30 percent

#### Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

## Costing Info (Estimated)

Repave surface \$1,092



#### **Code Reference**

## **Progress**

Record Number	473352	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

#### North Side

## Sidewalk East of La Reina Avenue @ 33.943639200397, -118.132786452770

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

**On-Site Finding** 5.70 percent for 159.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	473315	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

#### North Side

## Sidewalk East of Myrtle Street @ 33.943778270681, -118.133066743612

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

On-Site Finding 6.20 percent for 30.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	473316	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		<b>Projected Date</b>	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

#### North Side

## Sidewalk East of Myrtle Street @ 33.943909552821, -118.133316189051

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

**On-Site Finding** 4.00 percent for 76.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	473314	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

#### North Side

## Sidewalk East of Myrtle Street @ 33.944896387513, -118.134256303310

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

On-Site Finding 3.90 percent for 166.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	473320	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

#### North Side

# Sidewalk East of Paramount Boulevard @ 33.945182311548, -118.134815543890

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

**On-Site Finding** 5.80 percent for 137.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	473321	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

#### North Side

# Sidewalk East of Paramount Boulevard @ 33.945432633359, -118.135250061750

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

On-Site Finding 4.30 percent for 95.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	473317	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

## **North Side**

# Sidewalk East of Paramount Boulevard @ 33.945655141017, -118.135475367308

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

**On-Site Finding** 7.00 percent for 95.00 feet


#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

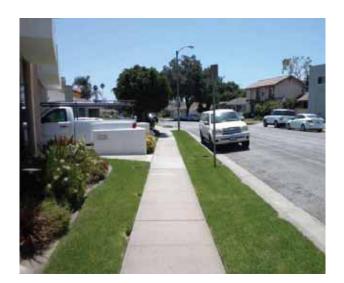

**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	473318	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

# Sidewalks - Exterior : Sidewalks , Surface

## **North Side**

## Sidewalk East of Paramount Boulevard @ 33.945655141017, -118.135475367308

Sidewalks , Surface : Running Slope

# **Finding**

Sidewalk running slope is not compliant.

On-Site Finding 7.00 percent for 5.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended running slope.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)** 

Repave surface \$1,184



Code Reference ADA 206, 302

Record Number	473319	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

# North Side @ 33.945751931667, -118.135554492474

Sidewalks : 60X60 Turn Area

# **Finding**

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

#### Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

**Costing Info (Estimated)** 

\$2,400



Code Reference ADA 206, 302

## **Progress**

**Record Number** 473820 Resolution None **Progress** Not\_Started Priority Six **Actual Date Projected Date** 06/30/2027 Actual Cost \$0.00 Contractor Comments No Comments New Value Assignment None 0 **Designated Staff** 

#### South Side

# Alley West of Myrtle Street @ 33.945313591523, -118.135368078947

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

#### **Finding**

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

**Costing Info (Estimated)** 

Install compliant detectable \$190

warnings



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

#### **Progress**

Record Number	473303	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### Sidewalks - Exterior : Sidewalks

#### South Side

# Alley West of Myrtle Street @ 33.945313591523, -118.135368078947

Sidewalks : Vehicular Traffic Cross Slope

# **Finding**

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.60 percent

#### Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	473304	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

#### South Side

# Curb Southeast Corner La Reina Avenue @ 33.943517930923, -118.132901787758

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

#### **Finding**

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

# **Progress**

Record Number	473289	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### South Side

# Curb West of Myrtle Street @ 33.945302466109, -118.135349303484

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

#### **Finding**

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

# **Progress**

Record Number	473283	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### South Side

# Curb West of Myrtle Street @ 33.945332504723, -118.135394901037

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

#### **Finding**

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

# **Progress**

Record Number	473285	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### South Side

#### Driveway West of Downey Avenue @ 33.942765833816, -118.131497651339

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

#### **Finding**

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

# **Costing Info (Estimated)**

Install compliant detectable \$190 warnings



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

#### **Progress**

Record Number	473295	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### South Side

#### Driveway West of Downey Avenue @ 33.942888216934, -118.131743073463

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

# **Finding**

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

#### Recommendation


Provide detectable warnings.

Recommendation See Recommendation

**Costing Info (Estimated)** 

Install compliant detectable \$190

warnings

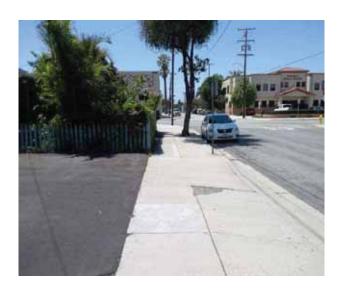

**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

# **Progress**

Record Number	473294	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### South Side

# Driveway West of Myrtle Street @ 33.945437083518, -118.135502189398

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

# **Finding**

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

# **Costing Info (Estimated)**

Install compliant detectable \$190 warnings



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

# **Progress**

Record Number	473299	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

#### Sidewalks - Exterior : Sidewalks

#### South Side

# Driveway West of Myrtle Street @ 33.945437083518, -118.135502189398

Sidewalks : Vehicular Traffic Cross Slope

# **Finding**

Cross slope at vehicular traffic is not compliant.

On-Site Finding 10.50 percent

#### Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	473300	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

#### South Side

#### Driveway West of New Street @ 33.943314331326, -118.132530301809

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

#### **Finding**

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

**Costing Info (Estimated)** 

Install compliant detectable \$190

warnings



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Notes: Surface is Rough And Uneven

# **Progress**

Record Number	473301	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### Sidewalks - Exterior : Sidewalks

#### South Side

#### Driveway West of New Street @ 33.943314331326, -118.132530301809

Sidewalks : Vehicular Traffic Cross Slope

#### **Finding**

Cross slope at vehicular traffic is not compliant.

On-Site Finding 2.70 percent

#### Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

Notes: Surface is Rough And Uneven

#### **Progress**

Record Number	473302	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### South Side

# Guy Wire West of New Street @ 33.943252027527, -118.132382780313

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

# **Finding**

Overhead obstruction height is not compliant.

On-Site Finding 65.00 inches

#### Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



**Code Reference** ADA 206, 307.4,CA 11B-307.4

# **Progress**

Record Number	473287	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

#### Sidewalks - Exterior : Sidewalks

#### South Side

# La Reina Avenue South Crossing @ 33.943552420424, -118.132974207401

Sidewalks : Vehicular Traffic Slope

#### **Finding**

Slope at vehicular traffic is not compliant.

On-Site Finding 10.40 percent

#### Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

#### Costing Info (Estimated)

Repave surface \$1,092



#### **Code Reference**

#### **Progress**

Record Number	473298	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### South Side

# Myrtle Street South Crossing @ 33.944822959395, -118.134442716837

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

#### **Finding**

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

# **Costing Info (Estimated)**

Install compliant detectable \$190 warnings



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

# **Progress**

Record Number	473296	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

#### Sidewalks - Exterior : Sidewalks

#### South Side

# Myrtle Street South Crossing @ 33.944822959395, -118.134442716837

Sidewalks : Vehicular Traffic Cross Slope

#### **Finding**

Cross slope at vehicular traffic is not compliant.

On-Site Finding 2.80 percent

#### Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

#### **Progress**

Record Number	473297	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Sidewalks - Exterior : Sidewalks , Surface

#### South Side

# Sidewalk West of Downey Avenue @ 33.942941620421, -118.131839632988

Sidewalks , Surface : Cross Slope

#### **Finding**

Sidewalk cross slope is not compliant.

On-Site Finding 5.20 percent

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

Notes: Surface is Rough And Uneven

# **Progress**

Record Number	473281	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

#### South Side

# Sidewalk West of Downey Avenue @ 33.942941620421, -118.131839632988

Sidewalks , Surface : Running Slope

#### **Finding**

Sidewalk running slope is not compliant.

On-Site Finding 13.40 percent for 1.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended running slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,184



**Code Reference** ADA 206, 302 Notes: Surface is Rough And Uneven

# **Progress**

Record Number	473282	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
001111101110	110 0011111101110		
Assignment	None	New Value	0

Sidewalks - Exterior : Sidewalks , Surface

#### South Side

#### Sidewalk West of La Reina Avenue @ 33.943585797347, -118.133043944836

Sidewalks , Surface : Cross Slope

#### **Finding**

Sidewalk cross slope is not compliant.

**On-Site Finding** 3.50 percent for 215.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	473276	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

#### South Side

# Sidewalk West of Myrtle Street @ 33.944953127378, -118.134688138962

Sidewalks , Surface : Cross Slope

# **Finding**

Sidewalk cross slope is not compliant.

**On-Site Finding** 4.30 percent for 143.00 feet


#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

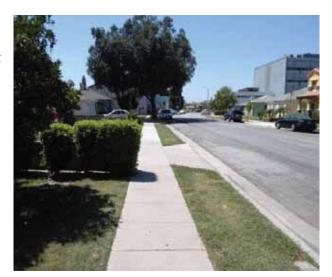

**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	473278	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

#### Sidewalks - Exterior : Sidewalks

#### South Side

# Sidewalk West of Myrtle Street @ 33.944953127378, -118.134688138962

Sidewalks : Opening

#### **Finding**

Ground surface has an opening that is not compliant.

On-Site Finding Not Compliant


#### Recommendation

Make sure that the surface opening does not allow passage of a sphere more than  $\frac{1}{2}$  inch in diameter.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned

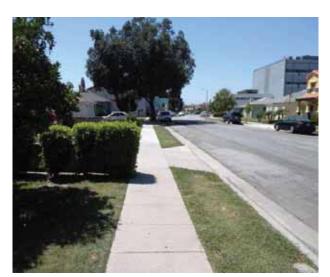

Code Reference ADA 302

# **Progress**

Record Number473279ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

#### South Side

# Sidewalk West of Myrtle Street @ 33.945276877652, -118.135303705931

Sidewalks , Surface : Cross Slope

#### **Finding**

Sidewalk cross slope is not compliant.

On-Site Finding 4.30 percent for 23.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number473277ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

#### South Side

# Sidewalk West of Myrtle Street @ 33.945472684780, -118.135531693697

Sidewalks , Surface : Cross Slope

#### **Finding**

Sidewalk cross slope is not compliant.

On-Site Finding 3.00 percent for 55.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

#### **Progress**

Record Number	473280	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### Sidewalks - Exterior : Sidewalks

# South Side @ 33.942646788250, -118.131288439035

Sidewalks : 60X60 Turn Area

# Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

#### Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

**Costing Info (Estimated)** 

\$2,400



Code Reference ADA 206, 302

# **Progress**

Record Number	473275	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			



4th Street - Paramount Boulevard to Downey Avenue

# Paramount Boulevard to Downey Avenue Downey, CA 90242

Date of Inspection 7/21/2017

\*Estimated Facility Total: \$77,276

\*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

**Disability Access Consultants** 

(800) 743-7067

Prepared Using



# **Accessibility Survey**



# 4th Street - Rives Avenue To Paramount Boulevard

Rives Avenue To Paramount Boulevard Downey, CA 90241

Date of Inspection 2/1/2017

Prepared By **Disability Access Consultants**(800) 743-7067

#### North Side

#### Change In Level East Of Rives Avenue @ 33.947705521712, -118.139288127422

Sidewalks , Change in Level : Change in Level Non Beveled

#### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198



Code Reference ADA 206, 302

# **Progress**

Record Number	348796	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

#### **North Side**

# Change In Level East Of Smallwood Avenue @ 33.946334898310, - 118.136636763811

Sidewalks , Change in Level : Change in Level Non Beveled

#### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

#### **Progress**

Record Number	350409	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

#### **North Side**

# Change In Level East Of Smallwood Avenue @ 33.946346023589, - 118.136659562588

#### **Finding**

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.50 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

#### **Progress**

Record Number	350410	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

#### North Side

# Change In Level East Of Smallwood Avenue @ 33.946381624472, - 118.136725276709

#### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

#### **Progress**

Record Number	350411	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### **North Side**

# Change In Level East Of Smallwood Avenue @ 33.946506227443, - 118.136984109879

#### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

#### **Progress**

Record Number	350417	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### North Side

# Change In Level East Of Smallwood Avenue @ 33.946570753910, - 118.137095421553

#### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 1.12 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

#### **Progress**

Record Number	350416	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### North Side

# Change In Level East Of Smallwood Avenue @ 33.946623042562, - 118.137198686600

#### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

#### **Progress**

Record Number	350415	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### North Side

# Change In Level East Of Smallwood Avenue @ 33.946709819405, - 118.137377053499

# **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

#### **Progress**

Record Number	350414	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### **North Side**

# Change In Level East Of Smallwood Avenue @ 33.946973486960, - 118.137882649899

#### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

#### **Progress**

Record Number	350407	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### **North Side**

# Change In Level East Of Smallwood Avenue @ 33.947145927324, - 118.138187080622

#### **Finding**

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.75 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

#### **Progress**

Record Number	348794	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### North Side

# Change In Level East Of Smallwood Avenue @ 33.947160390048, - 118.138217926025

#### **Finding**

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.50 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

#### **Progress**

Record Number	348799	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### South Side

Change In Level West Of Paramount Boulevard @ 33.946726507249, - 118.137681484222

## **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

## Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

### **Progress**

Record Number	350445	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### South Side

# Change In Level West Of Paramount Boulevard @ 33.946916748441, - 118.138052970171

## **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches


### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

# Costing Info (Estimated)

Remove tripping hazards \$198

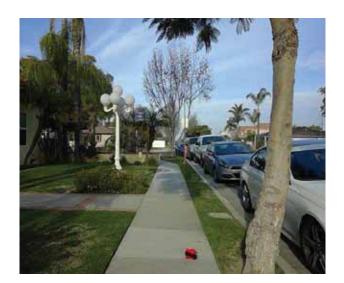

Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

#### **Progress**

Record Number	350450	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### North Side

## Change In Level East Of Rives Avenue @ 33.947774497306, -118.139411509037

Sidewalks , Change in Level : Change in Level Non Beveled

### **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches


#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198

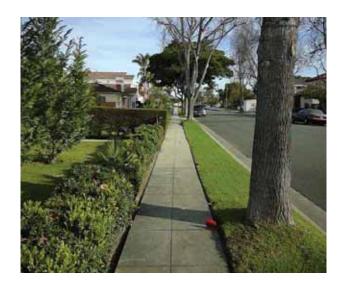

Code Reference ADA 206, 302

## **Progress**

Record Number	348797	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None

New Value 0

### **North Side**

## Change In Level East Of Rives Avenue @ 33.947798972504, -118.139459788799

Sidewalks , Change in Level : Change in Level Non Beveled

## **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198



Code Reference ADA 206, 302

## **Progress**

Record Number	348798	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

### **North Side**

# Change In Level East Of Smallwood Avenue @ 33.946453938718, - 118.136858046055

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches


### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

### Costing Info (Estimated)

Remove tripping hazards \$198

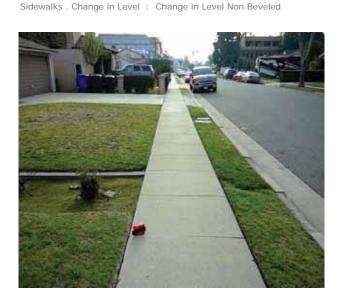

Code Reference ADA 206, 302

### **Progress**

Record Number	350412	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

### South Side

Change In Level West Of Paramount Boulevard @ 33.946140205696, - 118.136541545391

## **Finding**

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.37 inches

### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

## Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

### **Progress**

Record Number	350447	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

#### South Side

Change In Level West Of Paramount Boulevard @ 33.946208070029, - 118.136674314737

## **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

## Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

#### **Progress**

Record Number350448ResolutionNoneProgressNot\_StartedPriorityThreeActual DateProjected Date12/31/2022Actual Cost\$0.00Contractor

**Comments** No Comments

Assignment None New Value 0

#### 4th Street - Rives Avenue To Paramount Boulevard

## **Curb Ramps - Exterior : Curb Ramp**

### Northeast Corner Of Rives Avenue - 1st

Curb Ramp : Detectable Warning Domes Direction

## Finding

Detectable warning domes are not aligned in the direction of travel.

On-Site Finding Not Compliant

#### Recommendation

Provide compliant detectable warnings with domes aligned in the direction of travel.

Recommendation See Recommendation

## **Costing Info (Estimated)**

Install compliant detectable \$190 warnings



#### **Code Reference**

## **Progress**

Record Number	348781	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Northeast Corner Of Rives Avenue - 1st @ 33.947963623649, - 118.139762878418

**Top Landing** 

## **Finding**

There is not enough top landing clear length.

On-Site Finding 46.00 inches

#### Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

## Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

**Code Reference** ADA 406, 406.4, CA 11B-406.5.3

#### **Progress**

Record Number348782ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### 4th Street - Rives Avenue To Paramount Boulevard

## Curb Ramps - Exterior : Curb Ramp

### Northeast Corner Of Rives Avenue - 2nd

Curb Ramp : Detectable Warning Domes Direction

## **Finding**

Detectable warning domes are not aligned in the direction of travel.

On-Site Finding Not Compliant

#### Recommendation

Provide compliant detectable warnings with domes aligned in the direction of travel.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



#### **Code Reference**

# **Progress**

**Record Number** 348786 Resolution None **Progress** Not\_Started **Priority** Six

06/30/2027 **Actual Date Projected Date** 

**Actual Cost** \$0.00 Contractor

Comments No Comments

**New Value**  $\bigcirc$ Assignment None

# Northeast Corner Of Rives Avenue - 2nd @ 33.947963623649, - 118.139762878418

Curb Ramp : Not Wholly Contained Within The Marked Crossing

#### **Finding**

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

#### Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

## **Progress**

Record Number348783ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Northeast Corner Of Rives Avenue - 2nd @ 33.947963623649, - 118.139762878418

Curb Ramp : Parallel Curb Ramp Left Side Cross Slope

## **Finding**

The cross slope is greater than allowed.

On-Site Finding 2.70 percent

#### Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



**Code Reference** ADA 406.1, 405.3,CA 11B-406.5.7

## **Progress**

Record Number348784ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Northeast Corner Of Rives Avenue - 2nd @ 33.947963623649, - 118.139762878418

Curb Ramp : Parallel Curb Ramp Right Side Width

## **Finding**

The width of the curb ramp is less than required.

On-Site Finding 47.00 inches

#### Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



**Code Reference** ADA 406.1,CA 11B-406.5.2,CA 11B-406

## **Progress**

Record Number348785ResolutionNoneProgressNot\_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

# Northeast Corner Of Rives Avenue - 2nd @ 33.947963623649, - 118.139762878418

**Top Landing** 

#### **Finding**

The slope at the top landing is greater than allowed.

On-Site Finding 3.20 percent

#### Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

## Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp, Landings and Transitions: Top Landing Slope

**Code Reference** ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

### **Progress**

Record Number	348787	Resolution	None
Progress	Not_Started	Priority	Six
A - +   D - + -		Descionate d Desc	0//20

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Northeast Corner Of Rives Avenue - 2nd @ 33.947963623649, - 118.139762878418

**Top Landing** 

#### **Finding**

The slope at the top landing is greater than allowed.

On-Site Finding 2.80 percent

#### Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

## Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions : Top Landing Right Side

**Code Reference** ADA 406.4, 403.3, 406.1,CA 11B-406.5.3

### **Progress**

Record Number	348788	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

•

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Northwest Corner Of Paramount Boulevard @ 33.945933274772, - 118.135814666748

Curb Ramp : No Detectable Warnings

#### **Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

#### Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

## **Costing Info (Estimated)**

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

#### **Progress**

Record Number350431ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Northwest Corner Of Paramount Boulevard @ 33.945933274772, - 118.135814666748

Curb Ramp : Not Wholly Contained Within The Marked Crossing

#### **Finding**

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

#### Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

## **Progress**

Record Number350432ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Northwest Corner Of Paramount Boulevard @ 33.945933274772, - 118.135814666748

Curb Ramp : Curb Ramp Width

## **Finding**

The width of the curb ramp is less than required.

On-Site Finding 46.50 inches

#### Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.5, CA 11B-406.5.2

## **Progress**

Record Number	350433	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

# Northwest Corner Of Paramount Boulevard @ 33.945933274772, - 118.135814666748

Curb Ramp : Side Flare Slope

## **Finding**

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 15.00 percent

#### Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)** 

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3, CA 11B-406.2.2

## **Progress**

Record Number	350434	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

# Northwest Corner Of Paramount Boulevard @ 33.945933274772, - 118.135814666748

**Top Landing** 

## **Finding**

The slope at the top landing is greater than allowed.

On-Site Finding 3.20 percent


#### Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

## Costing Info (Estimated)

Provide compliant landing \$1,260

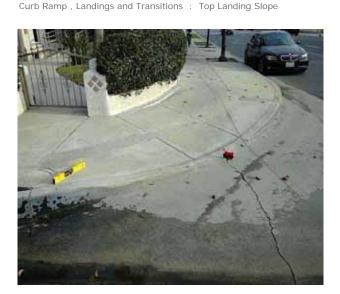

**Code Reference** ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

### **Progress**

Record Number	350435	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

# Northwest Corner Of Paramount Boulevard @ 33.945933274772, - 118.135814666748

**Top Landing** 

## **Finding**

There is not enough top landing clear length.

On-Site Finding 47.00 inches

#### Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

## Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

**Code Reference** ADA 406, 406.4, CA 11B-406.5.3

### **Progress**

Record Number	350436	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		<b>Projected Date</b>	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Southeast Corner Of Rives Avenue - 1st @ 33.947813435117, - 118.139867484570

Curb Ramp : Not Wholly Contained Within The Marked Crossing

#### **Finding**

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

#### Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

### **Progress**

Record Number350427ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Southeast Corner Of Rives Avenue - 1st @ 33.947813435117, - 118.139867484570

Curb Ramp : Detectable Warning Domes Direction

### **Finding**

Detectable warning domes are not aligned in the direction of travel.

On-Site Finding Not Compliant

#### Recommendation

Provide compliant detectable warnings with domes aligned in the direction of travel.

Recommendation See Recommendation

# **Costing Info (Estimated)**

Install compliant detectable \$190 warnings



#### **Code Reference**

## **Progress**

Record Number	350428	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Southeast Corner Of Rives Avenue - 1st @ 33.947813435117, - 118.139867484570

**Top Landing** 

#### Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.90 percent

#### Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

## Costing Info (Estimated)

Provide compliant landing \$1,260



**Code Reference** ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

### **Progress**

Record Number	350429	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Commonts	No Commonts		

Comments No Comments

Assignment None New Value 0

# Southeast Corner Of Rives Avenue - 1st @ 33.947813435117, - 118.139867484570

Landings

**Top Landing** 

## **Finding**

There is not enough top landing clear length.

On-Site Finding 46.50 inches

#### Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

## Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

**Code Reference** ADA 406, 406.4, CA 11B-406.5.3

### **Progress**

Record Number	350430	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Southeast Corner Of Rives Avenue - 2nd @ 33.947813435117, - 118.139867484570

Curb Ramp : Not Wholly Contained Within The Marked Crossing

#### **Finding**

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

#### Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

### **Progress**

Record Number350456ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Southeast Corner Of Rives Avenue - 2nd @ 33.947813435117, - 118.139867484570

Curb Ramp : Parallel Curb Ramp Left Side Width

## **Finding**

The width of the curb ramp is less than required.

On-Site Finding 46.00 inches

#### Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



**Code Reference** ADA 406.1,CA 11B-406.5.2,CA 11B-406

## **Progress**

Record Number350457ResolutionNoneProgressNot\_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Southeast Corner Of Rives Avenue - 2nd @ 33.947813435117, - 118.139867484570

Curb Ramp : Parallel Curb Ramp Right Side Width

## **Finding**

The width of the curb ramp is less than required.

On-Site Finding 42.00 inches

#### Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

**Costing Info (Estimated)** 

Install curb ramp \$1,300



**Code Reference** ADA 406.1,CA 11B-406.5.2,CA 11B-406

## **Progress**

Record Number350458ResolutionNoneProgressNot\_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Southeast Corner Of Rives Avenue - 2nd @ 33.947813435117, - 118.139867484570

Curb Ramp : Detectable Warning Domes Direction

## **Finding**

Detectable warning domes are not aligned in the direction of travel.

On-Site Finding Not Compliant

#### Recommendation

Provide compliant detectable warnings with domes aligned in the direction of travel.

Recommendation See Recommendation

# **Costing Info (Estimated)**

Install compliant detectable \$190 warnings



#### **Code Reference**

## **Progress**

Record Number	350459	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Southwest Corner Of Paramount Boulevard @ 33.945809783497, - 118.135905861855

Curb Ramp : No Detectable Warnings

#### **Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

#### Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

## **Costing Info (Estimated)**

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

#### **Progress**

Record Number350419ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Southwest Corner Of Paramount Boulevard @ 33.945809783497, - 118.135905861855

Curb Ramp : Not Wholly Contained Within The Marked Crossing

#### **Finding**

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

#### Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

## **Progress**

Record Number350420ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Southwest Corner Of Paramount Boulevard @ 33.945809783497, - 118.135905861855

Curb Ramp : Curb Ramp Width

## **Finding**

The width of the curb ramp is less than required.

On-Site Finding 46.00 inches

#### Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

**Costing Info (Estimated)** 

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.5,CA 11B-406.5.2

## **Progress**

Record Number350421ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Southwest Corner Of Paramount Boulevard @ 33.945809783497, - 118.135905861855

Curb Ramp : Curb Ramp Slope

## **Finding**

The running slope is greater than allowed.

On-Site Finding 9.60 percent

#### Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

## **Progress**

Record Number350422ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Southwest Corner Of Paramount Boulevard @ 33.945809783497, - 118.135905861855

Curb Ramp : Side Flare Slope

## **Finding**

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 17.90 percent

#### Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)** 

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3, CA 11B-406.2.2

## **Progress**

Record Number350423ResolutionNoneProgressNot\_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

**Comments** No Comments

Assignment None New Value 0

# Southwest Corner Of Paramount Boulevard @ 33.945809783497, - 118.135905861855

**Bottom Landing** 

### **Finding**

The curb ramp landing accumulates water.

On-Site Finding Accumulates Water

#### Recommendation

Provide sufficient clear space at the bottom of the curb ramp that does not accumulate water.

Recommendation See Recommendation

## Costing Info (Estimated)

Provide compliant landing \$255



Curb Ramp , Landings and Transitions : Landing Accumulates Water

**Code Reference** ADA 405, 406.1, 405.10

### **Progress**

Record Number	350424	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Southwest Corner Of Paramount Boulevard @ 33.945809783497, -118.135905861855

**Top Landing** 

#### Finding

The slope at the top landing is greater than allowed.

On-Site Finding 4.60 percent


#### Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

## Costing Info (Estimated)

Provide compliant landing \$1,260

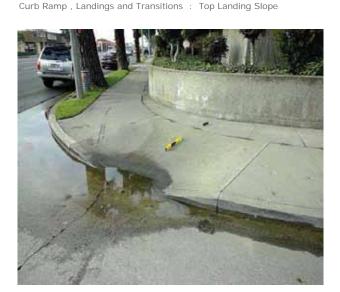

Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

### **Progress**

Record Number	350425	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None New Value

# **Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

# Southwest Corner Of Paramount Boulevard @ 33.945809783497, - 118.135905861855

**Top Landing** 

## **Finding**

There is not enough top landing clear length.

On-Site Finding 32.00 inches

#### Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

## Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

**Code Reference** ADA 406, 406.4, CA 11B-406.5.3

#### **Progress**

Record Number350426ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

## **North Side**

## Bush East Of Smallwood Avenue @ 33.945941062504, -118.135868310928

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

## **Finding**

Sidewalk width at the obstruction is not compliant.

On-Site Finding 36.00 inches

#### Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

**Costing Info (Estimated)** 

\$1,260



**Code Reference** ADA 206, 302, 403.5.1,CA 11B-403.5

## **Progress**

Record Number	350406	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

## **North Side**

## Bush East Of Smallwood Avenue @ 33.946004476867, -118.135983645916

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

## **Finding**

Sidewalk width at the obstruction is not compliant.

On-Site Finding 28.00 inches

#### Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

**Costing Info (Estimated)** 

\$1,260



**Code Reference** ADA 206, 302, 403.5.1,CA 11B-403.5

## **Progress**

Record Number	350405	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

## **North Side**

## Bush East Of Smallwood Avenue @ 33.946146880879, -118.136266618967

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

## **Finding**

Sidewalk width at the obstruction is not compliant.

On-Site Finding 38.00 inches

#### Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



0

**Code Reference** ADA 206, 302, 403.5.1,CA 11B-403.5

## **Progress**

Record Number	350413	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

**Designated Staff** 

Assignment

None

## **North Side**

## Bush East Of Smallwood Avenue @ 33.946291509709, -118.136545568705

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

## **Finding**

Sidewalk width at the obstruction is not compliant.

On-Site Finding 32.00 inches

#### Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

**Costing Info (Estimated)** 

\$1,260



**Code Reference** ADA 206, 302, 403.5.1,CA 11B-403.5

## **Progress**

Record Number	350418	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

## **North Side**

## Bush East Of Smallwood Avenue @ 33.946463951455, -118.136890232563

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

## **Finding**

Sidewalk width at the obstruction is not compliant.

On-Site Finding 38.00 inches

#### Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

**Costing Info (Estimated)** 

\$1,260



**Code Reference** ADA 206, 302, 403.5.1,CA 11B-403.5

## **Progress**

Record Number	350408	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		<b>Projected Date</b>	06/30/2027
Actual Cost	\$0.00	Contractor	

Assignment None New Value 0

No Comments

**Designated Staff** 

Comments

## **North Side**

# Change In Level East Of Smallwood Avenue @ 33.946267034078, - 118.136510699987

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

On-Site Finding 2.80 percent for 80.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

## **Progress**

Record Number	350402	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

## **North Side**

# Curb East Of Rives Avenue @ 33.947182640388, -118.138252794743

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

## **Finding**

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

**Costing Info (Estimated)** 

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

## **Progress**

Record Number	348793	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

## **North Side**

# Curb East Of Rives Avenue @ 33.947271641692, -118.138417750597

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

## **Finding**

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

**Costing Info (Estimated)** 

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

## **Progress**

Record Number	348795	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

## **North Side**

# Sidewalk East Of Rives Avenue @ 33.947733334458, -118.139336407185

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

**On-Site Finding** 3.20 percent for 68.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)** 

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

# **Progress**

Record Number	348791	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

## Sidewalks - Exterior : Sidewalks , Surface

#### North Side

## Sidewalk East Of Rives Avenue @ 33.947939148499, -118.139737397432

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

On-Site Finding 2.80 percent for 80.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

## **Progress**

Record Number	348790	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### North Side

# Sidewalk East Of Smallwood Avenue @ 33.946004476867, -118.135983645916

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

On-Site Finding 2.90 percent for 36.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

## **Progress**

Record Number	350403	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### North Side

# Sidewalk East Of Smallwood Avenue @ 33.946282609481, -118.136540204287

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

On-Site Finding 3.80 percent for 16.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

## **Progress**

Record Number	350404	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

#### North Side

# Sidewalk East Of Smallwood Avenue @ 33.947145927324, -118.138187080622

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

On-Site Finding 3.20 percent for 65.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

## **Progress**

Record Number	348792	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

## Sidewalks - Exterior : Sidewalks

# North Side @ 33.947963623649, -118.139762878418

Sidewalks : 60X60 Turn Area

## Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

#### Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

## **Progress**

Record Number	350401	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

## Sidewalks - Exterior : Sidewalks

## South Side

## Alley West Of Paramount Boulevard @ 33.945945512636, -118.136168718338

Sidewalks : Vehicular Traffic Cross Slope

## **Finding**

Cross slope at vehicular traffic is not compliant.

On-Site Finding 6.10 percent

#### Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

## **Progress**

Record Number	350455	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

## South Side

## Bush West Of Paramount Boulevard @ 33.946417225339, -118.137076646090

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

## **Finding**

Sidewalk width at the obstruction is not compliant.

On-Site Finding 18.00 inches

#### Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

**Costing Info (Estimated)** 

\$1,260



**Code Reference** ADA 206, 302, 403.5.1,CA 11B-403.5

## **Progress**

Record Number	350444	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

## South Side

Change In Level West Of Paramount Boulevard @ 33.946250346144, - 118.136762827635

## **Finding**

Overhead obstruction height is not compliant.

On-Site Finding 70.00 inches

#### Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



**Code Reference** ADA 206, 307.4,CA 11B-307.4

## **Progress**

Record Number	350446	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### South Side

## Curb West Of Paramount Boulevard @ 33.945936612372, -118.136132508516

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

## **Finding**

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

**Costing Info (Estimated)** 

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

## **Progress**

Record Number	350451	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### South Side

## Curb West Of Paramount Boulevard @ 33.947049138259, -118.138353377581

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

## **Finding**

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

**Costing Info (Estimated)** 

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

## **Progress**

Record Number350453ResolutionNoneProgressNot\_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### South Side

## Curb West Of Paramount Boulevard @ 33.947138139702, -118.138521015644

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

## **Finding**

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

**Costing Info (Estimated)** 

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

## **Progress**

Record Number	350449	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Sidewalks - Exterior : Sidewalks , Vehicular Traffic

#### South Side

## Driveway West Of Paramount Boulevard @ 33.945875423026, -118.136014491320

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

## **Finding**

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

**Costing Info (Estimated)** 

Install compliant detectable \$190 warnings



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

## **Progress**

7434	Resolution	None
_Started	Priority	Six
	Projected Date	06/30/2027
	_	_Started Priority

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

## South Side

# Sidewalk West Of Paramount Boulevard @ 33.946140205696, -118.136541545391

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

On-Site Finding 3.00 percent for 50.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

## **Progress**

Record Number	350439	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

# Sidewalks - Exterior : Sidewalks , Surface

#### South Side

## Sidewalk West Of Paramount Boulevard @ 33.946617479941, -118.137483755

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

On-Site Finding 3.90 percent for 64.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

## **Progress**

Record Number	350438	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Trojected bate

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

# Sidewalks - Exterior : Sidewalks , Surface

#### South Side

# Sidewalk West Of Paramount Boulevard @ 33.946932323724, -118.138097226620

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

On-Site Finding 3.90 percent for 88.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

## **Progress**

Record Number	350441	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

## Sidewalks - Exterior : Sidewalks , Surface

#### South Side

# Sidewalk West Of Paramount Boulevard @ 33.947155939979, -118.138561248779

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

On-Site Finding 3.30 percent for 110.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

## **Progress**

Record Number	350442	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

#### South Side

## Sidewalk West Of Paramount Boulevard @ 33.947506382182, -118.139233142138

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

**On-Site Finding** 3.90 percent for 148.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

## **Progress**

Record Number	350443	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

#### South Side

# Sidewalk West Of Paramount Boulevard v @ 33.947371768046, -118.138975650072

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

On-Site Finding 3.90 percent for 25.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

## **Progress**

Record Number	350440	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

## South Side

## Tree West Of Paramount Boulevard @ 33.946476189243, -118.137201368809

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

## **Finding**

Overhead obstruction height is not compliant.

On-Site Finding 52.00 inches

## Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



**Code Reference** ADA 206, 307.4,CA 11B-307.4

## **Progress**

Record Number	350452	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

# South Side @ 33.945809783497, -118.135905861855

Sidewalks : 60X60 Turn Area

## **Finding**

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

#### Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

**Costing Info (Estimated)** 

\$2,400



Code Reference ADA 206, 302

## **Progress**

Record Number	350437	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0



4th Street - Rives Avenue To Paramount Boulevard

# Rives Avenue To Paramount Boulevard Downey, CA 90241

Date of Inspection 2/1/2017

\*Estimated Facility Total: \$67,281

\*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

**Disability Access Consultants** 

(800) 743-7067

Prepared Using

