
Accessibility Survey

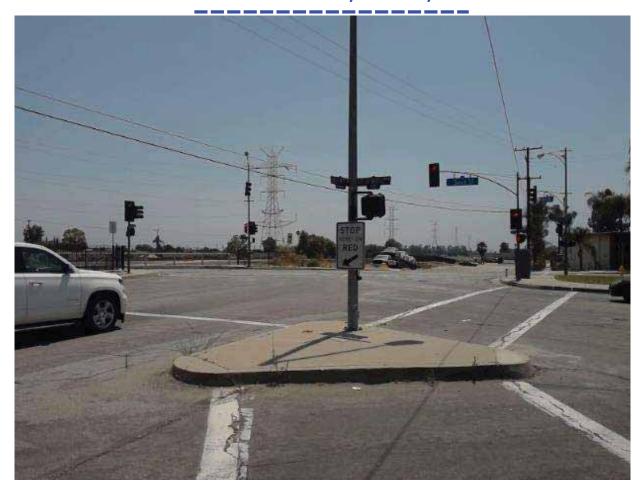

City of Downey Suva Street & Bluff Road/ Foster Bridge Boulevard

Suva Street & Bluff Road/ Foster Bridge Boulevard Downey, CA 90242

Date of Inspection 6/23/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

Southeast Corner of Suva Street @ 33.965242435225, -118.136329650879

Bottom Landing

Finding

The overlayment causes a noncompliant change in level.

On-Site Finding 0.75 inches

Recommendation

Ensure the change in elevation is within the recommended height.

Up to 0.50 inches Recommendation

Costing Info (Estimated)

Provide smooth surface \$150 Curb Ramp , Landings And Transitions : Bottom Landing Change in Level due to Overlayment



Code Reference ADA 303.2, 303.3,CA 11B-303.3,CA 11B-303.2

Progress

Record Number	457406	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None

New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner of Suva Street @ 33.965242435225, - 118.136329650879

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 5.30 percent


Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260

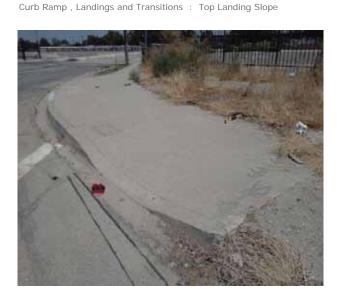

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	457407	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner of Suva Street @ 33.965242435225, - 118.136329650879

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 24.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240

Curb Ramp , Landings and Transitions $\,:\,$ Top Landing Clear Length - Landings



Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

Record Number	457408	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Suva Street @ 33.965242435225, - 118.136329650879

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number457577ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Suva Street @ 33.965242435225, - 118.136329650879

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

Record Number	457578	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Suva Street @ 33.965242435225, - 118.136329650879

Curb Ramp : Curb Ramp Width

Finding

The width of the curb ramp is less than required.

On-Site Finding 40.00 inches

Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.5, CA 11B-406.5.2

Progress

Record Number457579ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Suva Street @ 33.965242435225, - 118.136329650879

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 11.30 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number	457580	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Suva Street @ 33.965242435225, - 118.136329650879

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.10 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3,CA 11B-406.5.7

Progress

Record Number	457581	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Suva Street @ 33.965242435225, - 118.136329650879

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 22.50 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

Record Number 457582 Resolution None Not_Started Six **Progress** Priority **Actual Date Projected Date** 06/30/2027 \$0.00 Contractor Actual Cost Comments No Comments New Value Assignment None \bigcirc **Designated Staff**

Intersections - Exterior : Intersections , Walking Surface

Intersection

Bluff Road North Crossing @ 33.965403715781, -118.136262595654

Intersections , Walking Surface : Change In Level - Curb Ramp on Path of Travel

Finding

Curb ramp is on the path of travel.

On-Site Finding See Above

Recommendation

Make sure that the curb ramp is not on path of travel for the intersection walking surface.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 303

Progress

Record Number	457338	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

Bluff Road North Crossing @ 33.965403715781, -118.136262595654

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	457339	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

Bluff Road North Crossing @ 33.965403715781, -118.136262595654

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Progress

Record Number	457340	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

Bluff Road South Crossing @ 33.965284701883, -118.136416822672

Intersections , Walking Surface : Change In Level - Curb Ramp on Path of Travel

Finding

Curb ramp is on the path of travel.

On-Site Finding See Above

Recommendation

Make sure that the curb ramp is not on path of travel for the intersection walking surface.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 303

Notes: Crosswalk Missing, Faded And Or Damaged

Progress

Record Number457348ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

Bluff Road South Crossing @ 33.965284701883, -118.136416822672

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Notes: Crosswalk Missing, Faded And Or Damaged

Progress

Record Number	457349	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Walking Surface

Intersection

Bluff Road South Crossing @ 33.965284701883, -118.136416822672

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Notes: Crosswalk Missing, Faded And Or Damaged

Progress

Record Number	457350	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Walking Surface

Intersection

Bluff Road/ Foster Bridge Boulevard West Crossing @ 33.965486024362, - 118.136103004217

Finding

Curb ramp is on the path of travel.

On-Site Finding See Above

Recommendation

Make sure that the curb ramp is not on path of travel for the intersection walking surface.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Intersections , Walking Surface : Change In Level - Curb Ramp on

Code Reference ADA 303

Progress

Record Number457351ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

Bluff Road/ Foster Bridge Boulevard West Crossing @ 33.965486024362, - 118.136103004217

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number457352ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

Bluff Road/ Foster Bridge Boulevard West Crossing @ 33.965486024362, - 118.136103004217

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Progress

Record Number457353ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Median

Intersection

Island @ 33.965512719019, -118.136001080275

Intersections , Median : Raised Island - Entrance

Finding

A curb ramp is required for raised island median entrance but none was provided.

On-Site Finding Not Found

Recommendation

Install a compliant curb ramp for the raised island at median entrance.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 1104, 1103

Progress

Record Number	457335	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Median

Intersection

Island @ 33.965512719019, -118.136001080275

Intersections , Median : Raised Island - Exit

Finding

A curb ramp is required for raised island median exit but none was provided.

On-Site Finding Not Found

Recommendation

Install a compliant curb ramp for the raised island at median exit.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 1104, 1103

Progress

Record Number	457336	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Median

Intersection

Island @ 33.965512719019, -118.136001080275

Intersections , Median : Raised Island - Slope

Finding

Median raised landing is not compliant.

On-Site Finding 5.80 percent

Recommendation

Provide a compliant raised landing for the median.

Recommendation Up to 2.00 percent

Costing Info (Estimated)

\$1,260



Code Reference ADA 1104, 1103

Progress

Record Number457337ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965512719019, -118.136001080275

Finding

The clear ground space is not level.

On-Site Finding 3.40 percent


Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260

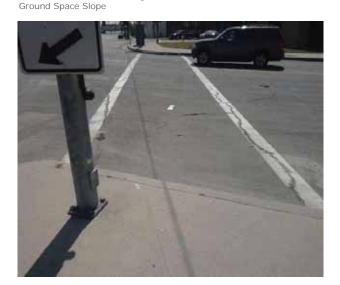

Intersections , Pedestrian Signal Controls : Push Button - Clear

Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

Record Number	457354	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965512719019, -118.136001080275

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	457355	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None New Value

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965512719019, -118.136001080275

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	457356	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965512719019, -118.136001080275

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	457357	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965512719019, -118.136001080275

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7,CA MUTCD 4E.08

Progress

Record Number	457358	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

None

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965512719019, -118.136001080275

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number457359ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965512719019, -118.136001080275

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457360ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965512719019, -118.136001080275

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457361ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965512719019, -118.136001080275

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457362ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965512719019, -118.136001080275

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	457363	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner of Suva Street to West Crossing @ 33.965407052617, - 118.136328309774

Finding

Push button face is not parallel to crosswalk.

On-Site Finding Not Parallel

Recommendation

Push button face must be parallel to crosswalk.

Recommendation See Recommendation Costing Info (Estimated)

\$900



Intersections , Pedestrian Signal Controls : Push Button Face

Code Reference CA MUTCD 4E.08

Progress

Record Number	457388	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner of Suva Street to West Crossing @ 33.965407052617, - 118.136328309774

Finding

Push button diameter is not compliant.

On-Site Finding 0.37 inches

Recommendation

Provide a compliant push button.

Recommendation At least 2.00 inches

Costing Info (Estimated)

\$900



Intersections , Pedestrian Signal Controls : Push Button Diameter

Code Reference CA MUTCD 4E.08

Progress

Record Number	457389	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	00.02	Contractor	

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner of Suva Street to West Crossing @ 33.965407052617, - 118.136328309774

Finding

The clear ground space is not level.

On-Site Finding 2.70 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Intersections , Pedestrian Signal Controls : Push Button - Clear

Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

Record Number	457390	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner of Suva Street to West Crossing @ 33.965407052617, - 118.136328309774

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Intersections , Pedestrian Signal Signage : Tactile Arrow

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457391ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner of Suva Street to West Crossing @ 33.965407052617, - 118.136328309774

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Intersections , Pedestrian Signal Signage : Universal Tactile

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457392ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner of Suva Street to West Crossing @ 33.965407052617, - 118.136328309774

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Intersections , Pedestrian Signal Signage : Street Name Information

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457393ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner of Suva Street to West Crossing @ 33.965407052617, - 118.136328309774

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7,CA MUTCD 4E.08

No Comments

Progress

Record Number457394ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Assignment None New Value 0

Designated Staff

Comments

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner of Suva Street to West Crossing @ 33.965407052617, - 118.136328309774

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Intersections , Pedestrian Signal Signage : Crosswalk Map

Code Reference CA MUTCD 4E.08

Progress

Record Number457395ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner of Suva Street to West Crossing @ 33.965407052617, - 118.136328309774

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Intersections , Pedestrian Signal Indicator : Locator Tone

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457396ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner of Suva Street to West Crossing @ 33.965407052617, - 118.136328309774

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457397ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner of Suva Street to West Crossing @ 33.965407052617, - 118.136328309774

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457398ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner of Suva Street to West Crossing @ 33.965407052617, - 118.136328309774

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Intersections , Pedestrian Signal Indicator : Speech Walk Message

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457399ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

......

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965429298187, -118.136230409145

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 101.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Intersections , Pedestrian Signal Controls : Push Button - Distance

Code Reference CA MUTCD 4E.08

Progress

Record Number457364ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965429298187, -118.136230409145

Intersections , Pedestrian Signal Controls : Push Button Face

Finding

Push button face is not parallel to crosswalk.

On-Site Finding Not Parallel

Recommendation

Push button face must be parallel to crosswalk.

Recommendation See Recommendation Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number	457365	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965429298187, -118.136230409145

Finding

The clear ground space is not level.

On-Site Finding 2.50 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Intersections , Pedestrian Signal Controls : Push Button - Clear

Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

Record Number	457366	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Actual Cost \$0.00 Contracto

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965429298187, -118.136230409145

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number 457367 Resolution None **Progress** Not_Started **Priority** Six **Actual Date Projected Date** 06/30/2027 **Actual Cost** \$0.00 Contractor Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965429298187, -118.136230409145

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	457368	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965429298187, -118.136230409145

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457369ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965429298187, -118.136230409145

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7,CA MUTCD 4E.08

Progress

Record Number457370ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965429298187, -118.136230409145

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number457371ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965429298187, -118.136230409145

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457372ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965429298187, -118.136230409145

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457373ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965429298187, -118.136230409145

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457374ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner of Bluff Road/ Foster Bridge Boulevard to West Crossing @ 33.965429298187, -118.136230409145

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number 457375 Resolution None **Progress** Not_Started **Priority** Six **Actual Date Projected Date** 06/30/2027 **Actual Cost** \$0.00 Contractor Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner of Suva Street to West Crossing @ 33.965336979036, - 118.136524111032

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 136.00 inches


Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900

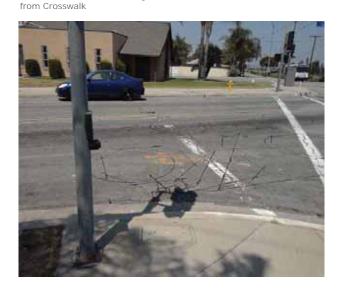

Intersections , Pedestrian Signal Controls : Push Button - Distance

Code Reference CA MUTCD 4E.08

Progress

Record Number457376ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner of Suva Street to West Crossing @ 33.965336979036, - 118.136524111032

Finding

Push button face is not parallel to crosswalk.

On-Site Finding Not Parallel

Recommendation

Push button face must be parallel to crosswalk.

Recommendation See Recommendation Costing Info (Estimated)

\$900



Intersections , Pedestrian Signal Controls : Push Button Face

Code Reference CA MUTCD 4E.08

Progress

Record Number	457377	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner of Suva Street to West Crossing @ 33.965336979036, - 118.136524111032

Finding

The clear ground space is not level.

On-Site Finding 4.20 percent


Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260

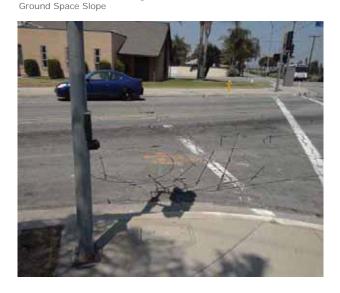

Intersections , Pedestrian Signal Controls : Push Button - Clear

Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

Record Number	457378	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner of Suva Street to West Crossing @ 33.965336979036, - 118.136524111032

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Intersections , Pedestrian Signal Signage : Tactile Arrow

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457379ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner of Suva Street to West Crossing @ 33.965336979036, - 118.136524111032

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Intersections , Pedestrian Signal Signage : Universal Tactile

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457380ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner of Suva Street to West Crossing @ 33.965336979036, - 118.136524111032

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Intersections , Pedestrian Signal Signage : Street Name Information

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457381ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner of Suva Street to West Crossing @ 33.965336979036, - 118.136524111032

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7,CA MUTCD 4E.08

Progress

Record Number457382ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner of Suva Street to West Crossing @ 33.965336979036, - 118.136524111032

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Intersections , Pedestrian Signal Signage : Crosswalk Map

Code Reference CA MUTCD 4E.08

Progress

Record Number457383ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner of Suva Street to West Crossing @ 33.965336979036, - 118.136524111032

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Intersections , Pedestrian Signal Indicator : Locator Tone

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457384ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner of Suva Street to West Crossing @ 33.965336979036, - 118.136524111032

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457385ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner of Suva Street to West Crossing @ 33.965336979036, - 118.136524111032

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457386ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner of Suva Street to West Crossing @ 33.965336979036, - 118.136524111032

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Intersections , Pedestrian Signal Indicator : Speech Walk Message

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number457387ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

Suva Street West Crossing @ 33.965360336903, -118.136420845985

Intersections , Walking Surface : Slope

Finding

Intersection walking surface slope is not compliant.

On-Site Finding 9.00 percent

Recommendation

Repave the walking surface with recommended slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

\$1,260



Code Reference

Progress

Record Number	457341	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

Suva Street West Crossing @ 33.965360336903, -118.136420845985

Intersections , Walking Surface : Change In Level - Curb Ramp on Path of Travel

Finding

Curb ramp is on the path of travel.

On-Site Finding See Above

Recommendation

Make sure that the curb ramp is not on path of travel for the intersection walking surface.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 303

Progress

Record Number457342ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

Suva Street West Crossing @ 33.965360336903, -118.136420845985

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	457343	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

Suva Street West Crossing @ 33.965360336903, -118.136420845985

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Progress

Record Number	457344	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Suva Street & Bluff Road/ Foster Bridge Boulevard

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing from Island to Northwest Corner of Bluff Road/ Foster Bridge Boulevard @ 33.965557210096, -118.135962188244

Finding

Curb ramp is on the path of travel.

On-Site Finding See Above

Recommendation

Make sure that the curb ramp is not on path of travel for the intersection walking surface.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Intersections , Walking Surface : Change In Level - Curb Ramp on

Code Reference ADA 303

Progress

Record Number457345ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Suva Street & Bluff Road/ Foster Bridge Boulevard

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing from Island to Northwest Corner of Bluff Road/ Foster Bridge Boulevard @ 33.965557210096, -118.135962188244

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	457346	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Suva Street & Bluff Road/ Foster Bridge Boulevard

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing from Island to Northwest Corner of Bluff Road/ Foster Bridge Boulevard @ 33.965557210096, -118.135962188244

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Progress

Record Number457347ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0



Suva Street & Bluff Road/ Foster Bridge Boulevard

Suva Street & Bluff Road/ Foster Bridge Boulevard Downey, CA 90242

Date of Inspection 6/23/2017

*Estimated Facility Total: \$50,054

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Suva Street & Paramount Boulevard

Suva Street & Paramount Boulevard Downey, CA 90242

Date of Inspection 4/14/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Curb Ramps - Exterior : Curb Ramp

Northeast Corner @ 33.959906657082, -118.125041574240

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 9.00 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number	406154	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Northeast Corner @ 33.959906657082, -118.125041574240

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 6.00 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

Record Number406155ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Northwest Corner @ 33.960033464947, -118.125316500664

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 7.00 percent


Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260

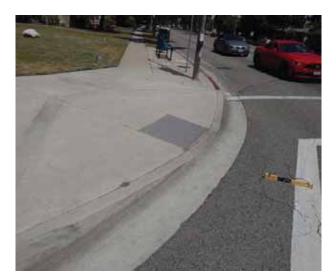

Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

Record Number406249ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner @ 33.960033464947, -118.125316500664

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	406250	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner @ 33.959754264923, -118.125164955854

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 5.60 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

Record Number	406251	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner @ 33.959754264923, -118.125164955854

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.60 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	406252	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner @ 33.959875511261, -118.125455975533

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 2.80 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

Record Number	406156	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner @ 33.959875511261, -118.125455975533

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 6.50 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

Record Number	406157	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner @ 33.959875511261, -118.125455975533

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 6.40 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	406158	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Reach Ranges - Exterior : Reach Range , Clear Floor Space Width

Northeast Corner To East Crossing

Pedestrian Control - Other

Reach Range , Clear Floor Space Width : Clear Floor Space Width

Finding

The clear floor space width is not compliant.

On-Site Finding 0.00 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 30.00 inches

Costing Info (Estimated)

Redesign space \$2,200



Code Reference ADA 304, 305.3,CA 11B-305

Progress

Record Number406159ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Reach Ranges - Exterior : Reach Range , Clear Floor Space Length

Northeast Corner To East Crossing

Pedestrian Control - Other

Reach Range, Clear Floor Space Length: Clear Floor Space Length

Finding

The clear floor space length is not complaint.

On-Site Finding 0.00 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Redesign space \$2,200



Code Reference ADA 304, 305.3,CA 11B-305,CA 11B-309.2

Progress

Record Number406160ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Reach Ranges - Exterior : Reach Range , Front Approach

Northeast Corner To East Crossing

Pedestrian Control - Other

Reach Range, Front Approach: Reach Depth

Finding

Element reach depth is not compliant.

On-Site Finding 65.00 inches

Recommendation

Make sure that the element is within allowed reach range with recommended reach depth.

Recommendation Up to 25.00 inches Costing Info (Estimated)

\$550



Code Reference ADA 308

Progress

Record Number406161ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Reach Ranges - Exterior : Reach Range , Element

Northeast Corner To East Crossing

Pedestrian Control - Other

Reach Range , Element : Element on Accessible Route

Finding

The element is not located on the accessible route.

On-Site Finding None


Recommendation

The element must be located on the accessible route.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260

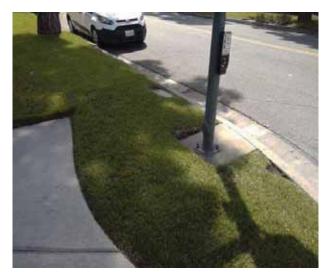

Code Reference ADA 206, 304

Progress

Record Number	406162	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Reach Ranges - Exterior : Reach Range , Clear Floor Space Width

Northeast Corner To North Crossing

Pedestrian Control - Other

Reach Range , Clear Floor Space Width : Clear Floor Space Width

Finding

The clear floor space width is not compliant.

On-Site Finding 0.00 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 30.00 inches

Costing Info (Estimated)

Redesign space \$2,200



Code Reference ADA 304, 305.3,CA 11B-305

Progress

Record Number406151ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Reach Ranges - Exterior : Reach Range , Clear Floor Space Length

Northeast Corner To North Crossing

Pedestrian Control - Other

Reach Range , Clear Floor Space Length : Clear Floor Space Length

Finding

The clear floor space length is not complaint.

On-Site Finding 0.00 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Redesign space \$2,200



Code Reference ADA 304, 305.3,CA 11B-305,CA 11B-309.2

Progress

Record Number406152ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Reach Ranges - Exterior : Reach Range , Element

Northeast Corner To North Crossing

Pedestrian Control - Other

Reach Range , Element : Element on Accessible Route

Finding

The element is not located on the accessible route.

On-Site Finding None

Recommendation

The element must be located on the accessible route.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 304

Progress

Record Number406153ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

North Crossing @ 33.959978959835, -118.125186413527

Intersections , Walking Surface : Slope

Finding

Intersection walking surface slope is not compliant.

On-Site Finding 9.20 percent

Recommendation

Repave the walking surface with recommended slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

\$1,260



Code Reference

Progress

Record Number	406163	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

North Crossing @ 33.959978959835, -118.125186413527

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	406164	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To East Crossing @ 33.959874398910, -118.125034868717

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 210.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number406229ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To East Crossing @ 33.959874398910, -118.125034868717

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Length

Finding

There is not enough clear ground space at the push button.

On-Site Finding 1.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

Record Number	406230	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To East Crossing @ 33.959874398910, -118.125034868717

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Width

Finding

There is not enough clear ground space at the push button.

On-Site Finding 1.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 32.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

Record Number	406231	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northeast Corner To East Crossing @ 33.959874398910, -118.125034868717

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406232	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
	* • • • • •		

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northeast Corner To East Crossing @ 33.959874398910, -118.125034868717

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406233	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northeast Corner To East Crossing @ 33.959874398910, -118.125034868717

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number406234ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northeast Corner To East Crossing @ 33.959874398910, -118.125034868717

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	406235	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northeast Corner To East Crossing @ 33.959874398910, -118.125034868717

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	406236	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northeast Corner To East Crossing @ 33.959874398910, -118.125034868717

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number406237ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northeast Corner To East Crossing @ 33.959874398910, -118.125034868717

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number406238ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northeast Corner To East Crossing @ 33.959874398910, -118.125034868717

Intersections , Pedestrian Signal Signage : Speech Tone Sound Level

Finding

Speech tone sound level is not complaint.

On-Site Finding 4.00 decibels

Recommendation

Provide compliant speech tone for the pedestrian signal.

Recommendation 30.00 - 89.00 decibels

Costing Info (Estimated)

\$900



Code Reference MUTCD 4E.06, PROWAG 2.5.2.2 G, CA MUTCD 4E.08

Progress

Record Number406239ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To North Crossing @ 33.959924454688, -118.125041574240

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 141.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number406217ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To North Crossing @ 33.959924454688, -118.125041574240

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Length

Finding

There is not enough clear ground space at the push button.

On-Site Finding 1.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

Record Number406218ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To North Crossing @ 33.959924454688, -118.125041574240

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Width

Finding

There is not enough clear ground space at the push button.

On-Site Finding 1.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 32.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

Record Number406219ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northeast Corner To North Crossing @ 33.959924454688, -118.125041574240

Intersections , Pedestrian Signal Signage : Tactile Arrow Direction

Finding

Tactile arrow does not point in direction of travel.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow points the direction of travel.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406220	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northeast Corner To North Crossing @ 33.959924454688, -118.125041574240

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406221	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Assignment None New Value 0

No Comments

Designated Staff

Comments

Intersection

Northeast Corner To North Crossing @ 33.959924454688, -118.125041574240

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number406222ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northeast Corner To North Crossing @ 33.959924454688, -118.125041574240

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406223	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersection

Northeast Corner To North Crossing @ 33.959924454688, -118.125041574240

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number406224ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northeast Corner To North Crossing @ 33.959924454688, -118.125041574240

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	406225	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northeast Corner To North Crossing @ 33.959924454688, -118.125041574240

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406226	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northeast Corner To North Crossing @ 33.959924454688, -118.125041574240

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

 Record Number
 406227
 Resolution
 None

 Progress
 Not_Started
 Priority
 Six

 Actual Pate
 Projected Pate
 04/26

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northeast Corner To North Crossing @ 33.959924454688, -118.125041574240

Intersections , Pedestrian Signal Signage : Speech Tone Sound Level

Finding

Speech tone sound level is not complaint.

On-Site Finding 4.00 decibels

Recommendation

Provide compliant speech tone for the pedestrian signal.

Recommendation 30.00 - 89.00 decibels

Costing Info (Estimated)

\$900



Code Reference MUTCD 4E.06, PROWAG 2.5.2.2 G, CA MUTCD 4E.08

Progress

Record Number406228ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To North Crossing @ 33.959980072185, -118.125185072422

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 162.00 inches

Recommendation

Provide a compliant push button.

Costing Info (Estimated)

Recommendation Up to 60.00 inches

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number406188ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To North Crossing @ 33.959980072185, -118.125185072422

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 4.10 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number406189ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northwest Corner To North Crossing @ 33.959980072185, -118.125185072422

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406190	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Northwest Corner To North Crossing @ 33.959980072185, -118.125185072422

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406191	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersection

Northwest Corner To North Crossing @ 33.959980072185, -118.125185072422

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406192	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Northwest Corner To North Crossing @ 33.959980072185, -118.125185072422

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	406193	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner To North Crossing @ 33.959980072185, -118.125185072422

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	406194	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner To North Crossing @ 33.959980072185, -118.125185072422

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406195	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner To North Crossing @ 33.959980072185, -118.125185072422

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406196	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northwest Corner To North Crossing @ 33.959980072185, -118.125185072422

Intersections , Pedestrian Signal Signage : Speech Tone Sound Level

Finding

Speech tone sound level is not complaint.

On-Site Finding 4.00 decibels

Recommendation

Provide compliant speech tone for the pedestrian signal.

Recommendation 30.00 - 89.00 decibels

Costing Info (Estimated)

\$900



Code Reference MUTCD 4E.06,PROWAG 2.5.2.2 G,CA MUTCD 4E.08

Progress

Record Number	406197	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
	+		

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To West Crossing @ 33.960016779713, -118.125358074903

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 189.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number406198ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To West Crossing @ 33.960016779713, -118.125358074903

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 3.50 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number	406199	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersection

Northwest Corner To West Crossing @ 33.960016779713, -118.125358074903

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406200	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Northwest Corner To West Crossing @ 33.960016779713, -118.125358074903

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406201	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersection

Northwest Corner To West Crossing @ 33.960016779713, -118.125358074903

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406202	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Camananta	No Commonto		

Comments No Comments

Assignment None New Value 0

Intersection

Northwest Corner To West Crossing @ 33.960016779713, -118.125358074903

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	406203	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersection

Northwest Corner To West Crossing @ 33.960016779713, -118.125358074903

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	406204	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northwest Corner To West Crossing @ 33.960016779713, -118.125358074903

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406205	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner To West Crossing @ 33.960016779713, -118.125358074903

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406206	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
	* • • • • •		

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Northwest Corner To West Crossing @ 33.960016779713, -118.125358074903

Intersections , Pedestrian Signal Signage : Speech Tone Sound Level

Finding

Speech tone sound level is not complaint.

On-Site Finding 4.00 decibels

Recommendation

Provide compliant speech tone for the pedestrian signal.

Recommendation 30.00 - 89.00 decibels

Costing Info (Estimated)

\$900



Code Reference MUTCD 4E.06,PROWAG 2.5.2.2 G,CA MUTCD 4E.08

Progress

Record Number	406207	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

South Crossing @ 33.959810994882, -118.125309795141

Intersections , Walking Surface : Slope

Finding

Intersection walking surface slope is not compliant.

On-Site Finding 7.20 percent

Recommendation

Repave the walking surface with recommended slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

\$1,260



Code Reference

Progress

Record Number	406165	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

South Crossing @ 33.959810994882, -118.125309795141

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	406166	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To East Crossing @ 33.959759826685, -118.125123381615

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 178.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number406240ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southeast Corner To East Crossing @ 33.959759826685, -118.125123381615

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406241	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Southeast Corner To East Crossing @ 33.959759826685, -118.125123381615

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406242	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Designated Staff

Intersection

Southeast Corner To East Crossing @ 33.959759826685, -118.125123381615

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406243	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersection

Southeast Corner To East Crossing @ 33.959759826685, -118.125123381615

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	406244	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersection

Southeast Corner To East Crossing @ 33.959759826685, -118.125123381615

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	406245	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southeast Corner To East Crossing @ 33.959759826685, -118.125123381615

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406246	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.959759826685, -118.125123381615

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number406247ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southeast Corner To East Crossing @ 33.959759826685, -118.125123381615

Intersections , Pedestrian Signal Signage : Speech Tone Sound Level

Finding

Speech tone sound level is not complaint.

On-Site Finding 4.00 decibels

Recommendation

Provide compliant speech tone for the pedestrian signal.

Recommendation 30.00 - 89.00 decibels

Costing Info (Estimated)

\$900



Code Reference MUTCD 4E.06, PROWAG 2.5.2.2 G, CA MUTCD 4E.08

Progress

Record Number	406248	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To South Crossing @ 33.959750927865, -118.125179708004

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 130.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number406168ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To South Crossing @ 33.959750927865, -118.125179708004

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 2.80 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number406169ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southeast Corner To South Crossing @ 33.959750927865, -118.125179708004

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406170	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southeast Corner To South Crossing @ 33.959750927865, -118.125179708004

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406171	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southeast Corner To South Crossing @ 33.959750927865, -118.125179708004

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406172	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southeast Corner To South Crossing @ 33.959750927865, -118.125179708004

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number406173ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southeast Corner To South Crossing @ 33.959750927865, -118.125179708004

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	406174	Resolution	None
Progress	Not Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southeast Corner To South Crossing @ 33.959750927865, -118.125179708004

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406175	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.959750927865, -118.125179708004

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number406176ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southeast Corner To South Crossing @ 33.959750927865, -118.125179708004

Intersections , Pedestrian Signal Signage : Speech Tone Sound Level

Finding

Speech tone sound level is not complaint.

On-Site Finding 4.00 decibels

Recommendation

Provide compliant speech tone for the pedestrian signal.

Recommendation 30.00 - 89.00 decibels

Costing Info (Estimated)

\$900



Code Reference MUTCD 4E.06, PROWAG 2.5.2.2 G, CA MUTCD 4E.08

Progress

Record Number406177ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To South Crossing @ 33.959848814834, -118.125447928905

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 204.00 inches

Recommendation

Provide a compliant push button.

Costing Info (Estimated)

Recommendation Up to 60.00 inches

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number	406208	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southwest Corner To South Crossing @ 33.959848814834, -118.125447928905

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406209	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southwest Corner To South Crossing @ 33.959848814834, -118.125447928905

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406210	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Projected Date

\$0.00 Contractor **Actual Cost**

Comments No Comments

New Value **Assignment** None 0

Intersection

Southwest Corner To South Crossing @ 33.959848814834, -118.125447928905

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406211	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
	* • • • • •		

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southwest Corner To South Crossing @ 33.959848814834, -118.125447928905

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	406212	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersection

Southwest Corner To South Crossing @ 33.959848814834, -118.125447928905

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	406213	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southwest Corner To South Crossing @ 33.959848814834, -118.125447928905

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406214	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.959848814834, -118.125447928905

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number406215ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southwest Corner To South Crossing @ 33.959848814834, -118.125447928905

Intersections , Pedestrian Signal Signage : Speech Tone Sound Level

Finding

Speech tone sound level is not complaint.

On-Site Finding 4.00 decibels

Recommendation

Provide compliant speech tone for the pedestrian signal.

Recommendation 30.00 - 89.00 decibels

Costing Info (Estimated)

\$900



Code Reference MUTCD 4E.06, PROWAG 2.5.2.2 G, CA MUTCD 4E.08

Progress

Record Number	406216	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.959909994133, -118.125466704369

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 204.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number406178ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.959909994133, -118.125466704369

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 2.60 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number406179ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southwest Corner To West Crossing @ 33.959909994133, -118.125466704369

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406180	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Southwest Corner To West Crossing @ 33.959909994133, -118.125466704369

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406181	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersection

Southwest Corner To West Crossing @ 33.959909994133, -118.125466704369

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406182	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersection

Southwest Corner To West Crossing @ 33.959909994133, -118.125466704369

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found


Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158

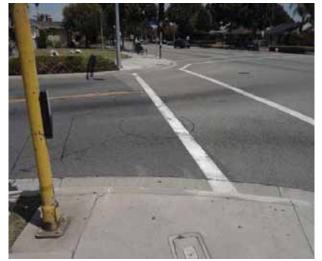

Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	406183	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersection

Southwest Corner To West Crossing @ 33.959909994133, -118.125466704369

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	406184	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.959909994133, -118.125466704369

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406185	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.959909994133, -118.125466704369

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	406186	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersection

Southwest Corner To West Crossing @ 33.959909994133, -118.125466704369

Intersections , Pedestrian Signal Signage : Speech Tone Sound Level

Finding

Speech tone sound level is not complaint.

On-Site Finding 4.00 decibels

Recommendation

Provide compliant speech tone for the pedestrian signal.

Recommendation 30.00 - 89.00 decibels

Costing Info (Estimated)

\$900



Code Reference MUTCD 4E.06,PROWAG 2.5.2.2 G,CA MUTCD 4E.08

Progress

Record Number	406187	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing @ 33.959952263441, -118.125406354666

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	406167	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0



Suva Street & Paramount Boulevard

Suva Street & Paramount Boulevard Downey, CA 90242

Date of Inspection 4/14/2017

*Estimated Facility Total: \$76,492

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Suva Street - Brookshire Avenue to Cul-De-Sac

Brookshire Avenue to Cul-De-Sac Downey, CA 90242

Date of Inspection 7/13/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Brookshire Avenue @ 33.954056604528, -118.117980659008

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	469360	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Northeast Corner of Brookshire Avenue @ 33.954137811662, - 118.118042349815

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.60 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3,CA 11B-406.5.7

Progress

Record Number468686ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Brookshire Avenue @ 33.953970947605, - 118.118216693401

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.10 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3,CA 11B-406.5.7

Progress

Record Number468688ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner of Brookshire Avenue @ 33.953970947605, - 118.118216693401

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.00 percent


Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260

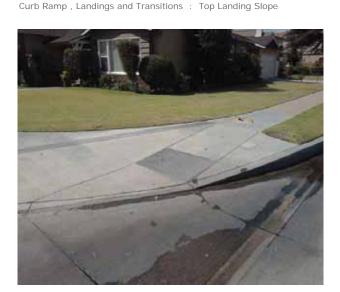

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number468689ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

North Side

Sidewalk East of Brookshire Avenue @ 33.953548223864, -118.116962760687

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 218.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	469357	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Brookshire Avenue @ 33.953652792564, -118.116387426853

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.80 percent for 49.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	469359	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Suva Street - Brookshire Avenue to Cul-De-Sac

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Brookshire Avenue @ 33.953830781545, -118.117585033178

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.60 percent for 131.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	469358	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Brookshire Avenue @ 33.953998758304, -118.117917627096

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.50 percent for 21.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	469356	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

North Side @ 33.954137811662, -118.118042349815

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

Record Number 469355 Resolution None **Progress** Not_Started Priority Five **Projected Date Actual Date** 06/30/2025 Actual Cost \$0.00 Contractor Comments No Comments

New Value 0 Assignment None

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Bush West of Cul-De-Sac @ 33.953238966745, -118.116587251425

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 24.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1,CA 11B-403.5

Progress

Record Number	468684	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Curb Southwest Corner of Bellder Drive @ 33.953617194723, -118.117476403713

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

Finding

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



Code Reference ADA 402, 303, 406, 403.4, 303.4

Progress

Record Number	468685	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West of Cul-De-Sac @ 33.953275677181, -118.116768300533

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 208.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	468683	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Suva Street - Brookshire Avenue to Cul-De-Sac

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Cul-De-Sac @ 33.953790734057, -118.116123229265

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.80 percent for 167.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	468682	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side @ 33.953830781545, -118.116144686937

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

Record Number	468681	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0



Suva Street - Brookshire Avenue to Cul-De-Sac

Brookshire Avenue to Cul-De-Sac Downey, CA 90242

Date of Inspection 7/13/2017

*Estimated Facility Total: \$19,506

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By


Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey

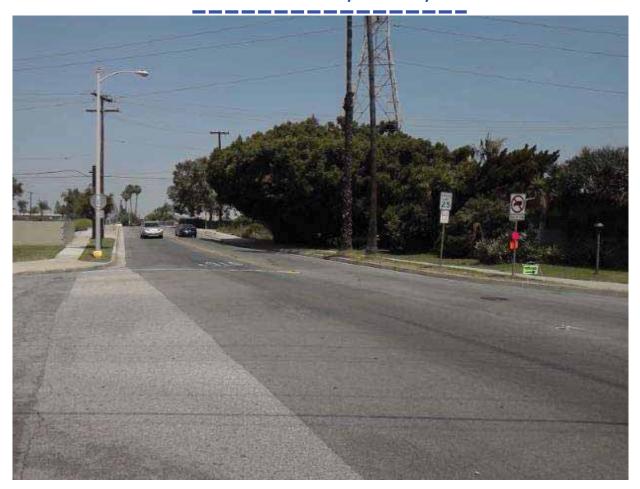

City of Downey Suva Street - Guatemala Avenue to City of Bell Gardens

Guatemala Avenue to City of Bell Gardens Downey, CA 90242

Date of Inspection 6/23/2017

Prepared By **Disability Access Consultants**(800) 743-7067

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Bluff Road @ 33.964538358591, -118.134606331587

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	457298	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Bluff Road @ 33.964658485822, -118.134843707085

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.87 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	457303	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Bluff Road @ 33.964930996042, -118.135427087545

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.87 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	457306	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Bluff Road @ 33.965261343995, -118.136037290096

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302 Notes: Surface is Rough And Uneven.

Progress

Record Number	457297	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of City of Bell Gardens @ 33.965588353837, - 118.136711865664

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

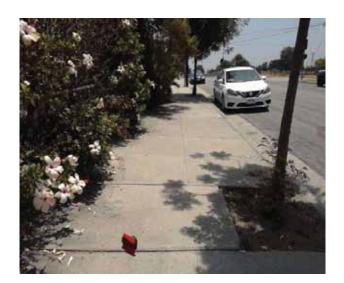

Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	457299	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of City of Bell Gardens @ 33.965662876312, - 118.136870115995

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	457300	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/201

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Designated Staff

9

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of City of Bell Gardens @ 33.965675111339, - 118.136890232563

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302 Notes: Surface is Rough And Uneven.

Progress

Record Number	457305	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of City of Bell Gardens @ 33.965692907738, - 118.136938512325

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302 Notes: Surface is Rough And Uneven.

Progress

Record Number	457301	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2019

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of City of Bell Gardens @ 33.965721826880, - 118.136990815401

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 4.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302 Notes: Surface is Rough And Uneven.

Progress

Record Number	457307	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2019

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Bluff Road @ 33.965612823910, -118.137136995792

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

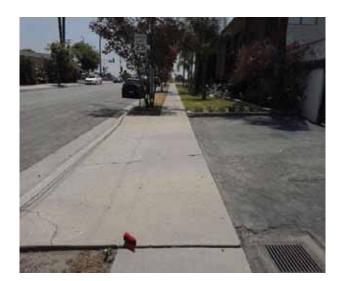

Code Reference ADA 206, 302

Progress

Record Number	457325	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Bluff Road @ 33.965636181701, -118.137205392122

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.25 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

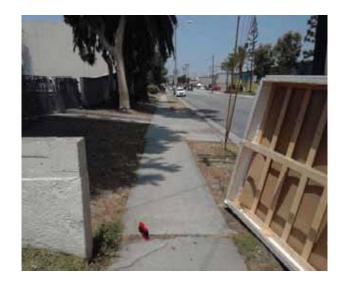

Code Reference ADA 206, 302

Progress

Record Number	457324	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Guatemala Avenue @ 33.964466059713, - 118.134799450636

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number457322ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2019Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Guatemala Avenue @ 33.964719661662, - 118.135256767273

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	457321	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Guatemala Avenue @ 33.965206842233, - 118.136157989502

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.25 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

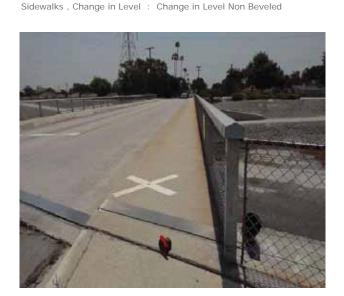

Code Reference ADA 206, 302

Progress

Record Number	457323	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Guatemala Avenue @ 33.964424904939, - 118.134760558605

Bottom Landing

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 12.50 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Curb Ramp : Bottom Landing Slope

Code Reference ADA 406, 406.2,CA 11B-406.5.8

None

Progress

Record Number	457285	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

Southeast Corner of Guatemala Avenue @ 33.964424904939, - 118.134760558605

Level

Bottom Landing

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.75 inches

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$255



Curb Ramp , Landings And Transitions : Bottom Landing Change in

Code Reference ADA 302, 303, 406.2, 303.1

Progress

Record Number	457286	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner of Guatemala Avenue @ 33.964424904939, - 118.134760558605

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.40 percent


Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260

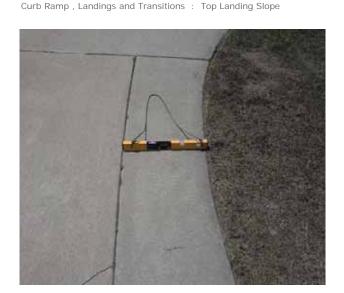

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	457287	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner of Guatemala Avenue @ 33.964424904939, - 118.134760558605

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 22.50 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240

Curb Ramp , Landings and Transitions $\,:\,$ Top Landing Clear Length - Landings



Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

Record Number	457288	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Guatemala Avenue @ 33.964424904939, - 118.134760558605

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number457591ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Guatemala Avenue @ 33.964424904939, - 118.134760558605

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 12.50 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



0

Code Reference ADA 406, 406.1, 405.2,CA 11B-406

None

Progress

Record Number	457592	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Guatemala Avenue @ 33.964424904939, - 118.134760558605

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 21.90 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Record Number	457593	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

North Side

Curb Northwest Corner of Guatemala Avenue @ 33.964516112789, - 118.134536594152

Finding

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



Sidewalks , Hazards & Gratings : Curb is on Path of Travel

Code Reference ADA 402, 303, 406, 403.4, 303.4

Progress

Record Number457302ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

North Side

Driveway East of Bluff Road @ 33.964738570549, -118.135005980730

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	457312	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

North Side

Driveway East of Bluff Road @ 33.964738570549, -118.135005980730

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457313	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

North Side

Driveway East of Bluff Road @ 33.964826441204, -118.135180324316

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	457308	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
	¢0.00	0	

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

North Side

Driveway East of Bluff Road @ 33.964826441204, -118.135180324316

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457309	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

North Side

Driveway East of City of Bell Gardens @ 33.965821931525, -118.137216120958

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	457310	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
	40.00		

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

North Side

Driveway East of City of Bell Gardens @ 33.965821931525, -118.137216120958

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.00 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457311	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Bluff Road @ 33.964804195477, -118.135123997927

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.50 percent for 84.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457296	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Bluff Road @ 33.964930996042, -118.135427087545

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.00 percent for 66.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457295	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Bluff Road @ 33.965273579080, -118.136043995619

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.80 percent for 16.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457292	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Bluff Road @ 33.965273579080, -118.136043995619

Sidewalks , Surface : Running Slope

Finding

Sidewalk running slope is not compliant.

On-Site Finding 9.60 percent for 3.00 feet

Recommendation

Repave the sidewalk surface with the recommended running slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,184



Code Reference ADA 206, 302

Progress

Record Number	457293	Resolution	None
Progress	Not Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of City of Bell Gardens @ 33.965471564752, -118.136463761330

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.30 percent for 46.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457294	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of City of Bell Gardens @ 33.965799686059, -118.137167841196

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 9.40 percent for 190.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457290	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of City of Bell Gardens @ 33.966039936789, -118.137692213058

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.20 percent for 144.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	457291	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

North Side

Tree East of City of Bell Gardens @ 33.965588353837, -118.136711865664

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 53.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Record Number	457304	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

North Side @ 33.966039936789, -118.137692213058

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Record Number	457594	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Bluff Road @ 33.965579455626, -118.137087374926

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found


Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings

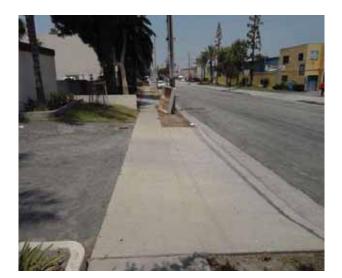

Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	457333	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Bluff Road @ 33.965579455626, -118.137087374926

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 8.90 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457334	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Bluff Road @ 33.965696244563, -118.137297928333

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	457329	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Bluff Road @ 33.965696244563, -118.137297928333

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 4.50 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457330	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Guatemala Avenue @ 33.964615106564, -118.135087788105

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found


Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings

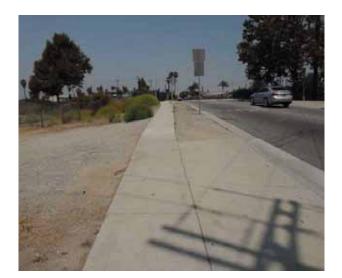

Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	457326	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Guatemala Avenue @ 33.964615106564, -118.135087788105

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 5.30 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

Record Number	457327	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Guatemala Avenue @ 33.964615106564, -118.135087788105

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.80 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457328	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Guatemala Avenue @ 33.964765265441, -118.135351985693

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	457331	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Guatemala Avenue @ 33.964765265441, -118.135351985693

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 2.50 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457332	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Bluff Road @ 33.965313621163, -118.136526793242

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.60 percent for 144.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457315	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Bluff Road @ 33.965612823910, -118.137136995792

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.40 percent for 161.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457316	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Guatemala Avenue @ 33.964570614994, -118.134989887476

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 6.30 percent for 63.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

-7000		
5/320	Resolution	None
ot_Started	Priority	Six
	Projected Date	06/30/2027
0.00	Contractor	
0	t_Started	t_Started Priority Projected Date

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West of Guatemala Avenue @ 33.964794184898, -118.135394901037

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 44.50 inches for 40.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-403.5.1

Progress

Record Number	457317	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West of Guatemala Avenue @ 33.965206842233, -118.136157989502

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 41.00 inches for 20.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-403.5.1

Progress

Record Number	457318	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Guatemala Avenue @ 33.965206842233, -118.136157989502

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 6.90 percent for 36.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number457319ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side @ 33.964451599929, -118.134782016277

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Record Number	457595	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			



Suva Street - Guatemala Avenue to City of Bell Gardens

Guatemala Avenue to City of Bell Gardens Downey, CA 90242

Date of Inspection 6/23/2017

*Estimated Facility Total: \$40,625

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Suva Street - Guatemala Avenue to Horley Avenue

Guatemala Avenue to Horley Avenue Downey, CA 90242

Date of Inspection 6/25/2017

Prepared By **Disability Access Consultants**(800) 743-7067

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Guatemala Avenue @ 33.962933309029, -118.131409138441

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	458001	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Guatemala Avenue @ 33.963236969377, -118.132011294365

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	458002	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Guatemala Avenue @ 33.963317055442, -118.132169544697

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



0

Code Reference ADA 206, 302

None

Progress

Record Number	458003	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Guatemala Avenue @ 33.963361547668, -118.132250010967

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.12 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

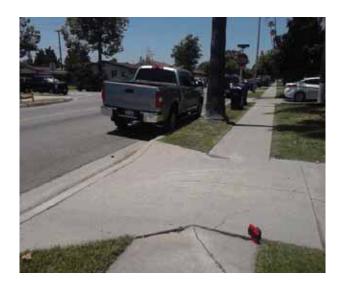

Code Reference ADA 206, 302

Progress

Record Number	458000	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Horley Avenue @ 33.962596278142, -118.131081908941

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	458020	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Horley Avenue @ 33.963054550836, -118.132015317678

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	458016	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Horley Avenue @ 33.963101267817, -118.132093101740

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

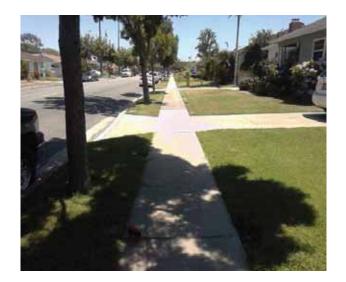

Code Reference ADA 206, 302

Record Number	458014	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Horley Avenue @ 33.963135749381, -118.132170885801

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	458019	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Horley Avenue @ 33.963242530912, -118.132372051477

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	458017	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Horley Avenue @ 33.963288135483, -118.132486045361

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	458013	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Wiley Burke Avenue @ 33.963414938308, - 118.132724761963

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	458011	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Wiley Burke Avenue @ 33.963414938308, - 118.132724761963

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number458021ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2019

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Wiley Burke Avenue @ 33.963442745920, - 118.132774382830

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

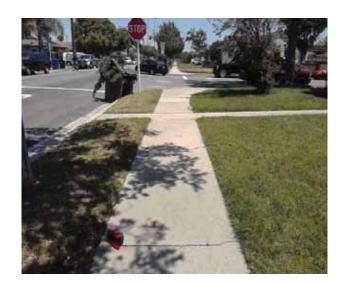

Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	458018	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2019

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Wiley Burke Avenue @ 33.963481676561, - 118.132857531309

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number458015ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2019Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Wiley Burke Avenue @ 33.963562874698, - 118.133013099432

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	458012	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2019

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

North Side

Curb Northeast Corner of Guatemala Avenue @ 33.964428241813, - 118.134335428476

Finding

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



Sidewalks , Hazards & Gratings : Curb is on Path of Travel

Code Reference ADA 402, 303, 406, 403.4, 303.4

Progress

Record Number458004ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Guatemala Avenue @ 33.963055663145, -118.131649196148

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.50 percent for 343.00 feet


Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

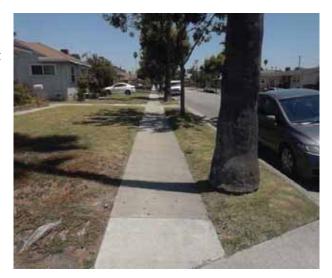

Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457997	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Guatemala Avenue @ 33.963361547668, -118.132250010967

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 7.90 percent for 134.00 feet


Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

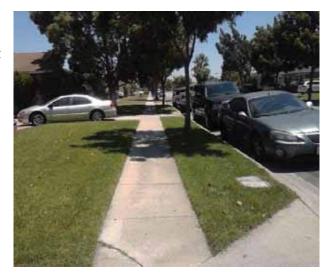

Code Reference ADA 206, 302,CA 11B-403.3

Record Number	457996	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Guatemala Avenue @ 33.963711923132, -118.132958114147

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 6.20 percent for 194.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457999	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Guatemala Avenue @ 33.964275857754, -118.134065866470

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.00 percent for 361.00 feet


Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

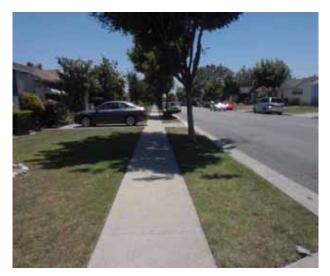

Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	457998	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

North Side @ 33.964410445149, -118.134323358536

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

Record Number458040ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Horley Avenue @ 33.962406072003, -118.130735903978

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.80 percent for 374.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	458007	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Wiley Burke Avenue @ 33.963442745920, -118.132774382830

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.60 percent for 25.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number458006ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Wiley Burke Avenue @ 33.963522831791, -118.132936656475

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.80 percent for 143.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	458008	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Wiley Burke Avenue @ 33.963522831791, -118.132936656475

Sidewalks , Surface : Running Slope

Finding

Sidewalk running slope is not compliant.

On-Site Finding 6.00 percent for 4.00 feet


Recommendation

Repave the sidewalk surface with the recommended running slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,184

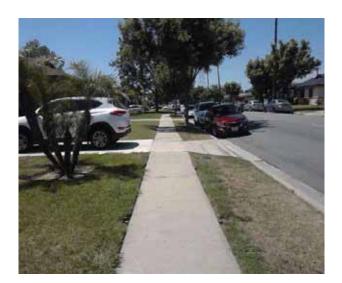

Code Reference ADA 206, 302

Progress

Record Number	458009	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West of Wiley Burke Avenue @ 33.963719709237, -118.133338987827

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 437.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	458010	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side @ 33.962399398096, -118.130709081888

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

Record Number	458041	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0



Suva Street - Guatemala Avenue to Horley Avenue

Guatemala Avenue to Horley Avenue Downey, CA 90242

Date of Inspection 6/25/2017

*Estimated Facility Total: \$20,358

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By


Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey

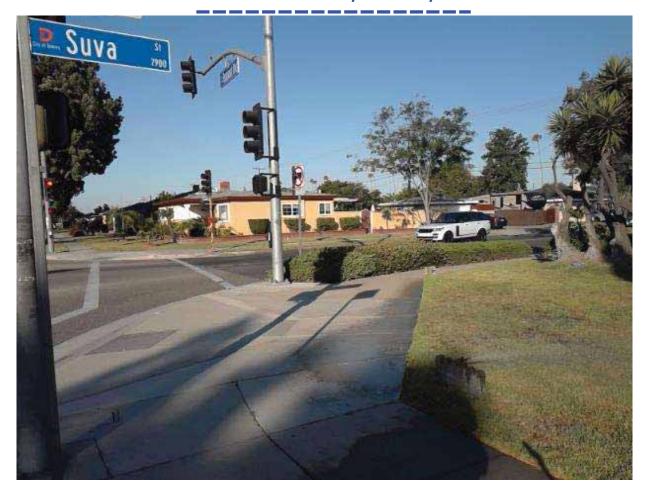

City of Downey Suva Street - Paramount Boulevard to Horley Avenue

Paramount Boulevard to Horley Avenue Downey, CA 90242

Date of Inspection 6/26/2017

Prepared By **Disability Access Consultants**(800) 743-7067

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Horley Avenue @ 33.962018984511, -118.129585236311

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

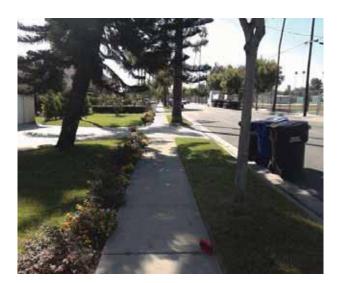

Code Reference ADA 206, 302

Progress

Record Number	458062	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Horley Avenue @ 33.962054578837, -118.129657655954

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	458059	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Horley Avenue @ 33.962129104408, -118.129811882973

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	458067	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Horley Avenue @ 33.962318198848, -118.130188733339

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	458068	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Horley Avenue @ 33.962330434356, -118.130208849907

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	458058	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Rives Avenue @ 33.960872171862, -118.127317428589

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.87 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



0

Code Reference ADA 206, 302

None

Progress

Record Number	458069	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Rives Avenue @ 33.961125784526, -118.127840459347

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302 Notes: Surface is Rough And Uneven.

Record Number	458065	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Rives Avenue @ 33.961125784526, -118.127840459347

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number458070ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2019

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Samoline Avenue @ 33.960114666376, -118.125586062670

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

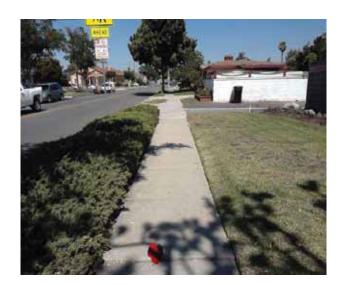

Code Reference ADA 206, 302

Progress

Record Number	458061	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Samoline Avenue @ 33.960134688634, -118.125645071268

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	458064	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Samoline Avenue @ 33.960239249240, -118.125926703215

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 2.25 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	458066	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Samoline Avenue @ 33.960260383814, -118.125995099545

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	458057	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Rives Avenue @ 33.962099071723, -118.130102902651

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	458090	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Rives Avenue @ 33.962099071723, -118.130102902651

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

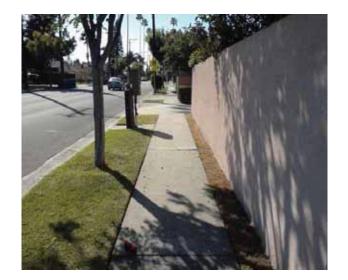

Code Reference ADA 206, 302

Record Number	458091	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Tweedy Lane @ 33.961015663330, -118.127937018871

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.12 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	458089	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Tweedy Lane @ 33.961312656532, -118.128519058228

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.87 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	458087	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Tweedy Lane @ 33.961479506190, -118.128843605518

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.25 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	458094	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Tweedy Lane @ 33.961486180169, -118.128877133131

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	458093	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Tweedy Lane @ 33.961589626785, -118.129071593285

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	458085	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Tweedy Lane @ 33.961816541501, -118.129546344280

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	458086	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Tweedy Lane @ 33.961892179605, -118.129684478045

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	458092	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp

North Side East of Samoline Avenue - 1st @ 33.960180294872, - 118.125775158405

Bottom Landing

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 5.80 percent


Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260

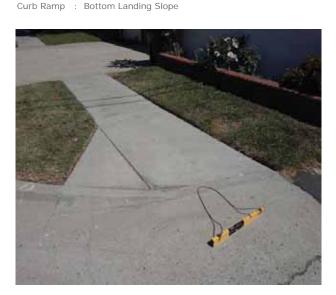

Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

Record Number	458110	Resolution	None
Progress	Not_Started	Priority	Six
Actual Dato		Projected Date	06/30

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

North Side East of Samoline Avenue - 1st @ 33.960180294872, - 118.125775158405

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number458170ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

North Side East of Samoline Avenue - 2nd @ 33.960146924457, - 118.125698715448

Bottom Landing

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 6.30 percent


Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260

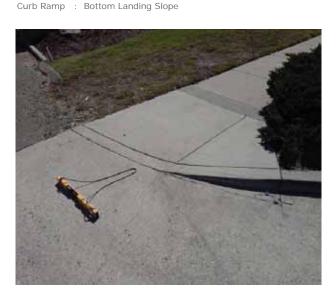

Code Reference ADA 406, 406.2, CA 11B-406.5.8

None

Progress

Assignment

Record Number	458113	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

North Side East of Samoline Avenue - 2nd @ 33.960146924457, - 118.125698715448

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions $\,:\,$ Top Landing Slope

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Record Number	458114	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp

North Side East of Samoline Avenue - 2nd @ 33.960146924457, - 118.125698715448

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number	458171	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

North Side East of Samoline Avenue - 2nd @ 33.960146924457, - 118.125698715448

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 5.10 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)
Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Record Number	458172	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp

Northeast Corner of Samoline Avenue @ 33.960326012197, - 118.126133233309

Bottom Landing

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 6.40 percent


Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260

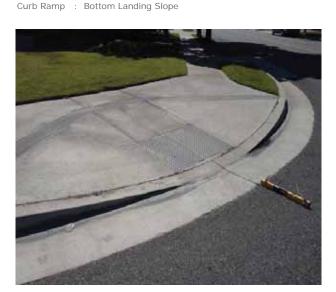

Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

Record Number	458043	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner of Samoline Avenue @ 33.960326012197, - 118.126133233309

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 45.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240





Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

Record Number458044ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Northeast Corner of Samoline Avenue @ 33.960326012197, - 118.126133233309

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 2.70 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3,CA 11B-406.5.7

Progress

Record Number	458160	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Landings

Northwest Corner of Samoline Avenue @ 33.960381629432, - 118.126286119223

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 45.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

Record Number	458115	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

South Side West of Paramount Boulevard - 1st @ 33.960027903203, - 118.125785887241

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number458045ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

South Side West of Paramount Boulevard - 1st @ 33.960027903203, - 118.125785887241

Curb Ramp : Curb Ramp Width

Finding

The width of the curb ramp is less than required.

On-Site Finding 47.00 inches

Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.5, CA 11B-406.5.2

Progress

Record Number	458046	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

South Side West of Paramount Boulevard - 1st @ 33.960027903203, - 118.125785887241

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.80 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

Record Number	458047	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

South Side West of Paramount Boulevard - 1st @ 33.960027903203, - 118.125785887241

Bottom Landing

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 5.90 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Curb Ramp : Bottom Landing Slope

Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

Record Number	458048	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

South Side West of Paramount Boulevard - 1st @ 33.960027903203, - 118.125785887241

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.60 percent


Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260

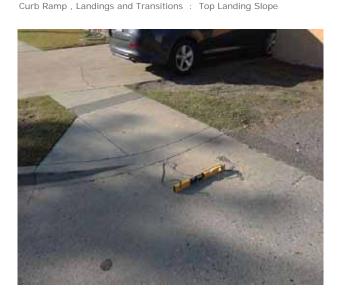

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	458049	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

South Side West of Paramount Boulevard - 2nd @ 33.960054599573, - 118.125863671303

Bottom Landing

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 5.80 percent


Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260

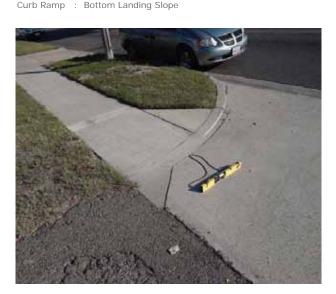

Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

Record Number458108ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

South Side West of Paramount Boulevard - 2nd @ 33.960054599573, - 118.125863671303

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number458167ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

South Side West of Paramount Boulevard - 2nd @ 33.960054599573, - 118.125863671303

Curb Ramp : Curb Ramp Width

Finding

The width of the curb ramp is less than required.

On-Site Finding 47.00 inches

Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.5, CA 11B-406.5.2

Progress

Record Number	458168	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Curb Ramps - Exterior : Curb Ramp

South Side West of Paramount Boulevard - 2nd @ 33.960054599573, - 118.125863671303

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 2.90 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3,CA 11B-406.5.7

Progress

Record Number	458169	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Rives Avenue @ 33.961912201445, - 118.129747509956

Bottom Landing

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 7.50 percent


Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260

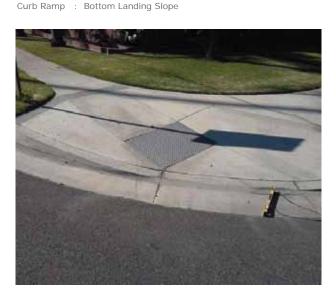

Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

Record Number458104ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Rives Avenue @ 33.961912201445, - 118.129747509956

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 9.30 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number	458165	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Rives Avenue @ 33.961912201445, - 118.129747509956

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.70 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3,CA 11B-406.5.7

Progress

Record Number	458166	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Samoline Avenue @ 33.960190305994, - 118.126237839460

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number458117ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Samoline Avenue @ 33.960190305994, - 118.126237839460

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 9.80 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

Record Number458118ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Samoline Avenue @ 33.960190305994, - 118.126237839460

Bottom Landing

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 14.50 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

Record Number458119ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner of Samoline Avenue @ 33.960190305994, - 118.126237839460

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	458120	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

None

Curb Ramps - Exterior : Curb Ramp

Southwest Corner of Rives Avenue @ 33.961912201445, - 118.129747509956

Bottom Landing

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 13.70 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Curb Ramp : Bottom Landing Slope

Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

Record Number458116ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner of Samoline Avenue @ 33.960253709739, - 118.126392066479

Bottom Landing

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 9.60 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

Record Number458075ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner of Samoline Avenue @ 33.960253709739, - 118.126392066479

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.50 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions $\,:\,$ Top Landing Slope

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	458076	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner of Samoline Avenue @ 33.960253709739, - 118.126392066479

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number458162ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner of Samoline Avenue @ 33.960253709739, - 118.126392066479

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 8.80 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

Record Number458163ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

North Side

Alley East of Samoline Avenue @ 33.960168059054, -118.125732243061

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	458071	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Sidewalks - Exterior : Sidewalks

North Side

Alley East of Samoline Avenue @ 33.960168059054, -118.125732243061

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 4.90 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



0

Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	458072	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Actual Cost \$0.00

Comments No Comments

Assignment None New Value

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

North Side

Northeast Corner of Rives Avenue @ 33.961855472886, -118.129259347916

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

Finding

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



Code Reference ADA 402, 303, 406, 403.4, 303.4

Progress

Record Number	458063	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

North Side

Northwest Corner of Rives Avenue @ 33.961889954956, -118.129329085350

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

Finding

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



Code Reference ADA 402, 303, 406, 403.4, 303.4

Progress

Record Number	458060	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Horley Avenue @ 33.962151350834, -118.129854798317

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.80 percent for 64.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	458056	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Horley Avenue @ 33.962154687798, -118.129868209362

Sidewalks , Surface : Running Slope

Finding

Sidewalk running slope is not compliant.

On-Site Finding 6.20 percent for 4.00 feet

Recommendation

Repave the sidewalk surface with the recommended running slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,184



Code Reference ADA 206, 302

Progress

Record Number	458055	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Horley Avenue @ 33.962348231455, -118.130245059729

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.50 percent for 19.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number458053ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Rives Avenue @ 33.961132458533, -118.127836436033

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 8.00 percent for 10.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	458052	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Rives Avenue @ 33.961409429373, -118.128382265568

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 7.90 percent for 130.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	458054	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East of Samoline Avenue @ 33.960260383814, -118.125995099545

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.90 percent for 77.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	458051	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

North Side @ 33.962407184321, -118.130360394716

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

Record Number 458161 Resolution None **Progress** Not_Started Priority Six **Projected Date Actual Date** 06/30/2027 Contractor Actual Cost \$0.00 Comments No Comments New Value 0 Assignment None **Designated Staff**

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Alley West of Paramount Boulevard @ 33.960046813133, -118.125834167004

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705, CA 11B-705.1.2.5, CA 11B-247.1.2.5

Progress

Record Number	458097	Resolution	None
Progress	Not_Started	Priority	Six

Actual Date Projected Date 06/30/2027

\$0.00 Contractor Actual Cost

No Comments Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Alley West of Paramount Boulevard @ 33.960046813133, -118.125834167004

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 7.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number458098ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Tweedy Lane @ 33.960782072444, -118.127462267876

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	458095	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Tweedy Lane @ 33.960782072444, -118.127462267876

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 8.00 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	458096	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Tweedy Lane @ 33.960967832868, -118.127831071615

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	458099	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Tweedy Lane @ 33.960967832868, -118.127831071615

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 8.90 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number458100ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Guy Wire West of Tweedy Lane @ 33.961461708908, -118.128832876682

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 65.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Progress

Record Number	458088	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West of Paramount Boulevard @ 33.960104655245, -118.126003146172

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 47.00 inches for 58.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-403.5.1

Progress

Record Number	458080	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Paramount Boulevard @ 33.960104655245, -118.126003146172

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.70 percent for 58.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number458081ResolutionNoneProgressNot_StartedPrioritySix

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Rives Avenue @ 33.962099071723, -118.130102902651

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.90 percent for 69.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	458079	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West of Tweedy Lane @ 33.960300428258, -118.126461803913

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 46.50 inches for 175.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-403.5.1

Progress

Record Number	458083	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
	+		

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Tweedy Lane @ 33.960300428258, -118.126461803913

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.80 percent for 80.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	458084	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Tweedy Lane @ 33.961412766366, -118.128728270531

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.70 percent for 130.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



0

Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	458082	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
	\$0.00	•	

Actual Cost \$0.00 Contractor

No Comments

Assignment None New Value

Designated Staff

Comments

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Tweedy Lane @ 33.961726443083, -118.129353225231

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.10 percent for 92.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	458078	Resolution	None
Progress	Not_Started	Priority	Six
Actual Date		Projected Date	06/30/2027
Actual Cost	00.00	Contractor	

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Tweedy Lane South Crossing @ 33.960601873322, -118.127144426107

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 5.80 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

Record Number	458101	Resolution	None
Progress	Not Started	Priority	Six

Actual Date Projected Date 06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side @ 33.959904432380, -118.125474750996

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)


\$2,400



Code Reference ADA 206, 302

Progress

Record Number 458164 Resolution None **Progress** Not_Started Priority Six **Projected Date Actual Date** 06/30/2027 Contractor Actual Cost \$0.00 Comments No Comments New Value 0 Assignment None **Designated Staff**

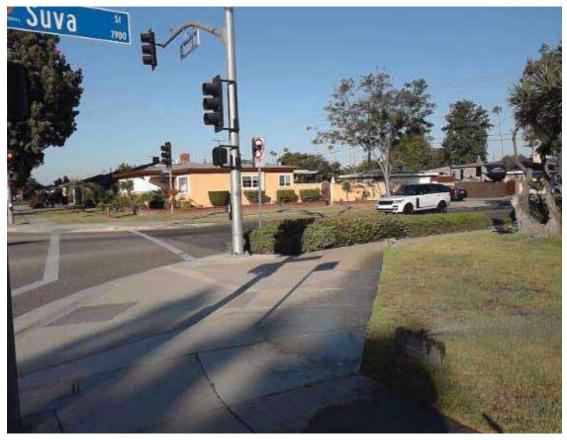

Suva Street - Paramount Boulevard to Horley Avenue

Paramount Boulevard to Horley Avenue Downey, CA 90242

Date of Inspection 6/26/2017

*Estimated Facility Total: \$66,150

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Suva Street - Paramount Boulevard to Orizaba Avenue

Paramount Boulevard to Orizaba Avenue Downey, CA 90242

Date of Inspection 7/7/2017

Prepared By **Disability Access Consultants**(800) 743-7067

Suva Street - Paramount Boulevard to Orizaba Avenue

Sidewalks - Exterior : Sidewalks

North Side @ 33.959859938347, -118.124989271164

Sidewalks : No Sidewalk

Finding

No sidewalk exists at the location.

On-Site Finding Not Found

Recommendation

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 206

Progress

Record Number466501ResolutionNoneProgressNot_StartedPrioritySixActual DateProjected Date06/30/2027

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Suva Street - Paramount Boulevard to Orizaba Avenue

Sidewalks - Exterior : Sidewalks

South Side @ 33.959733130222, -118.125142157078

Sidewalks : No Sidewalk

Finding

No sidewalk exists at the location.

On-Site Finding Not Found

Recommendation

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 206

Progress

Record Number 466502 Resolution None **Progress** Not_Started Priority Six **Projected Date Actual Date** 06/30/2027 Contractor **Actual Cost** \$0.00 Comments No Comments

Assignment None New Value 0



Suva Street - Paramount Boulevard to Orizaba Avenue

Paramount Boulevard to Orizaba Avenue Downey, CA 90242

Date of Inspection 7/7/2017

*Estimated Facility Total: \$0

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Suva Street - Stamps Avenue to Manzanar Avenue

Stamps Avenue to Manzanar Avenue Downey, CA 90242

Date of Inspection 7/11/2017

Prepared By **Disability Access Consultants**(800) 743-7067

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Stamps Avenue @ 33.955926573792, -118.120673596859

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	467965	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
A - + 1 O +	40.00	Contractor	

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change in Level East of Stamps Avenue @ 33.955947709438, -118.120697736740

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	467966	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Sidewalks - Exterior : Sidewalks

North Side

Sidewalk East of Stamps Avenue @ 33.955900988529, -118.120640069246

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 60.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, CA 11B-302, CA 11B-206

Progress

Record Number467963ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2019

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

North Side

Sidewalk East of Stoakes Avenue @ 33.955730790715, -118.120327591896

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 593.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, CA 11B-302, CA 11B-206

Progress

Record Number467964ResolutionNoneProgressNot_StartedPriorityTwo

Actual Date Projected Date 06/30/2019

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West of Manzanar Avenue @ 33.954658425415, -118.119081705809

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 623.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, CA 11B-302, CA 11B-206

Progress

Record Number 467962 Resolution None Not_Started **Progress** Priority Two **Actual Date Projected Date** 06/30/2019 Contractor

\$0.00 Actual Cost

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Manzanar Avenue @ 33.955712992231, -118.120646774769

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.90 percent for 68.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number467961ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2019

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0



Suva Street - Stamps Avenue to Manzanar Avenue

Stamps Avenue to Manzanar Avenue Downey, CA 90242

Date of Inspection 7/11/2017

*Estimated Facility Total: \$5,268

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using

