Accessibility Survey



City of Downey Telegraph Road & Birchbark Avenue

Telegraph Road & Birchbark Avenue Downey, CA 90242

Date of Inspection 4/29/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Curb Ramps - Exterior : Curb Ramp

Southeast Corner @ 33.964631790897, -118.113784343004

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number415484ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner @ 33.964631790897, -118.113784343004

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 8.80 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number	415485	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner @ 33.964631790897, -118.113784343004

Bottom Landing

Curb Ramp , Landings and Transitions $\,:\,$ Bottom Landing Of Diagonal Curb Ramp - Clear Space

Finding

There is less than the required clear space.

On-Site Finding 1.00 inches

Recommendation

Provide sufficient clear space at the bottom of the curb ramp that does not accumulate water.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$255



Code Reference ADA 406, 406.6, 406.1, 405.10

Progress

Record Number	415486	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner @ 33.964631790897, -118.113784343004

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 10.10 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

Record Number415487ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner @ 33.964631790897, -118.113784343004

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 47.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number	415488	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner @ 33.964778612884, -118.113917112350

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Notes: Bottom landing spalled

Progress

Record Number415489ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner @ 33.964778612884, -118.113917112350

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 11.50 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Notes: Bottom landing spalled

Progress

Record Number	415490	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner @ 33.964778612884, -118.113917112350

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 20.00 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Notes: Bottom landing spalled

Progress

Record Number415491ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner @ 33.964778612884, -118.113917112350

Bottom Landing

Curb Ramp , Landings and Transitions $\,:\,$ Bottom Landing Of Diagonal Curb Ramp - Clear Space

Finding

There is less than the required clear space.

On-Site Finding 14.00 inches

Recommendation

Provide sufficient clear space at the bottom of the curb ramp that does not accumulate water.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$255



Code Reference ADA 406, 406.6, 406.1, 405.10

Progress

Record Number415492ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner @ 33.964778612884, -118.113917112350

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 11.20 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

Record Number415493ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner @ 33.964778612884, -118.113917112350

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 5.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number415494ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner @ 33.964778612884, -118.113917112350

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Change in Level - Curb Ramps

Finding

The transition from the top of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding Not Beveled

Recommendation

Patch the transition area at the top of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

Costing Info (Estimated)

Patch lip at curb ramp \$155



Code Reference ADA 302, 406.2

Progress

Record Number415495ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Landings

Southwest Corner @ 33.964778612884, -118.113917112350

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 35.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number	415496	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

East Crossing @ 33.964599534517, -118.113715946674

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Notes: Curb on path of travel -- Spalled for 5 feet

Progress

Record Number	415505	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

East Crossing @ 33.964599534517, -118.113715946674

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Notes: Curb on path of travel -- Spalled for 5 feet

Progress

Record Number	415506	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

South Crossing @ 33.964702977346, -118.113859444857

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Notes: Spalled concrete continues for 61 feet.

Progress

Record Number	415503	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

South Crossing @ 33.964702977346, -118.113859444857

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Notes: Spalled concrete continues for 61 feet.

Progress

Record Number	415504	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.964615106564, -118.113725334406

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415520	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.964615106564, -118.113725334406

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

None

Progress

Record Number	415521	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.964615106564, -118.113725334406

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



0

Code Reference CA MUTCD, CA MUTCD 4E.08

None

Progress

Record Number	415522	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.964615106564, -118.113725334406

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	415523	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.964615106564, -118.113725334406

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	415524	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.964615106564, -118.113725334406

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415525	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.964615106564, -118.113725334406

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415526	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.964615106564, -118.113725334406

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415527	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.964615106564, -118.113725334406

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415528	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			



Telegraph Road & Birchbark Avenue

Telegraph Road & Birchbark Avenue Downey, CA 90242

Date of Inspection 4/29/2017

*Estimated Facility Total: \$17,925

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By


Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey

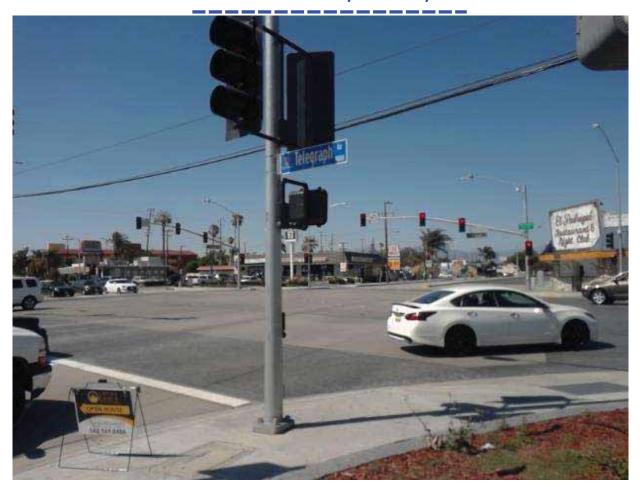

City of Downey Telegraph Road & Lakewood Boulevard

Telegraph Road & Lakewood Boulevard Downey, CA 90242

Date of Inspection 4/29/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Curb Ramps - Exterior : Curb Ramp

Southeast Corner @ 33.960783184783, -118.110039979219

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

Record Number	415619	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Landings

Southeast Corner @ 33.960783184783, -118.110039979219

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 46.50 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number	415620	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

East Crossing @ 33.960906654330, -118.109963536263

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	415625	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

East Crossing @ 33.960906654330, -118.109963536263

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	415626	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

South Crossing @ 33.960874396538, -118.110186159611

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	415623	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

South Crossing @ 33.960874396538, -118.110186159611

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	415624	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To East Crossing @ 33.960787634139, -118.110014498234

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 175.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number415627ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To East Crossing @ 33.960787634139, -118.110014498234

Intersections , Pedestrian Signal Controls : Push Button Face

Finding

Push button face is not parallel to crosswalk.

On-Site Finding Not Parallel

Recommendation

Push button face must be parallel to crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number415628ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Trojected Bate 00/30/1

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To East Crossing @ 33.960787634139, -118.110014498234

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 3.10 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number415629ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.960787634139, -118.110014498234

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant


Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900

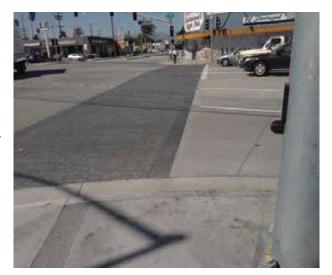

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number415630ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.960787634139, -118.110014498234

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number415631ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.960787634139, -118.110014498234

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number415632ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.960787634139, -118.110014498234

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number415633ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.960787634139, -118.110014498234

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number415634ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.960787634139, -118.110014498234

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415635	Resolution	None
Progress	Not_Started	Priority	Five
Actual Data		Drainated Data	04/20/

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.960787634139, -118.110014498234

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number415636ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.960787634139, -118.110014498234

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number415637ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.960787634139, -118.110014498234

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number415638ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To South Crossing @ 33.960777623087, -118.110069483519

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 183.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number415649ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.960777623087, -118.110069483519

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415650	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.960777623087, -118.110069483519

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415651	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
0 - 1 1 0 1	¢0.00	Contractor	

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.960777623087, -118.110069483519

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415652	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

No Comments

Assignment None New Value 0

Designated Staff

Comments

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.960777623087, -118.110069483519

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	415653	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.960777623087, -118.110069483519

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	415654	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.960777623087, -118.110069483519

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415655	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.960777623087, -118.110069483519

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415656	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.960777623087, -118.110069483519

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415657	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.960777623087, -118.110069483519

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

See Recommendation Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415658	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None

New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To South Crossing @ 33.960954484827, -118.110306859016

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 162.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number415639ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.960954484827, -118.110306859016

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number 415640 Resolution None **Progress** Not_Started Priority Five **Projected Date Actual Date** 06/30/2025 \$0.00 Contractor Actual Cost Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.960954484827, -118.110306859016

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415641	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.960954484827, -118.110306859016

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415642	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.960954484827, -118.110306859016

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	415643	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.960954484827, -118.110306859016

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number415644ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.960954484827, -118.110306859016

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415645	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Assignment None New Value 0

No Comments

Designated Staff

Comments

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.960954484827, -118.110306859016

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number415646ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.960954484827, -118.110306859016

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number415647ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.960954484827, -118.110306859016

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415648	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.961015663330, -118.110320270061

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 168.00 inches


Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900

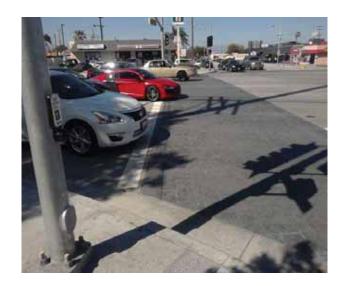

Code Reference CA MUTCD 4E.08

Progress

Record Number415659ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.961015663330, -118.110320270061

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Length

Finding

There is not enough clear ground space at the push button.

On-Site Finding 40.00 inches


Recommendation

Provide compliant clear ground space at the push button.

At least 48.00 inches Recommendation

Costing Info (Estimated)

Unassigned

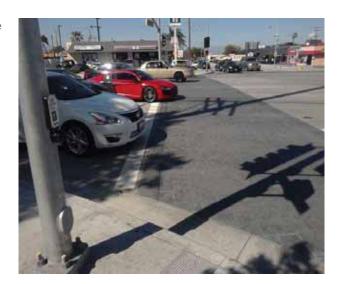

Code Reference CA MUTCD 4E.08

Progress

Record Number 415660 Resolution None Not_Started Five **Progress** Priority **Actual Date Projected Date** 06/30/2025

\$0.00 Contractor **Actual Cost**

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.961015663330, -118.110320270061

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415661	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.961015663330, -118.110320270061

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number415662ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.961015663330, -118.110320270061

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found


Recommendation

Provide compliant signage that includes street name.

See Recommendation Recommendation

Costing Info (Estimated)

\$158

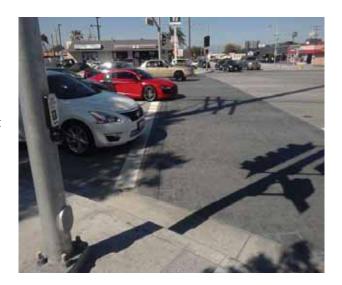

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number 415663 Resolution None Not_Started Five **Progress** Priority **Actual Date Projected Date** 06/30/2025 \$0.00 Contractor Actual Cost Comments No Comments New Value 0

Assignment None

Telegraph Road & Lakewood Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.961015663330, -118.110320270061

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number415664ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Telegraph Road & Lakewood Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.961015663330, -118.110320270061

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number415665ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.961015663330, -118.110320270061

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found


Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900

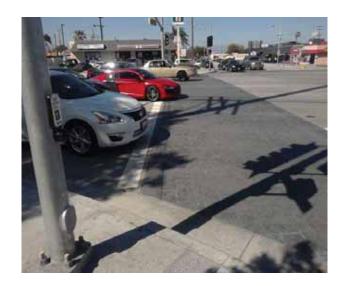

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415666	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Telegraph Road & Lakewood Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.961015663330, -118.110320270061

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found


Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150

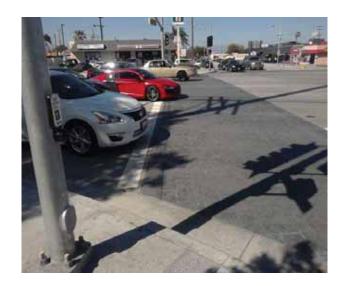

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415667	Resolution	None
Progress	Not_Started	Priority	Five
Actual Data		Projected Date	06/20/

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.961015663330, -118.110320270061

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found


Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900

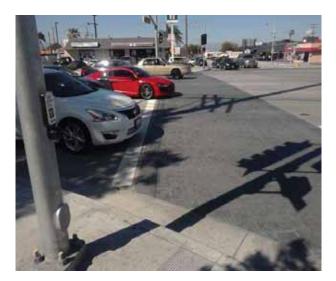

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415668	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.961015663330, -118.110320270061

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found


Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900

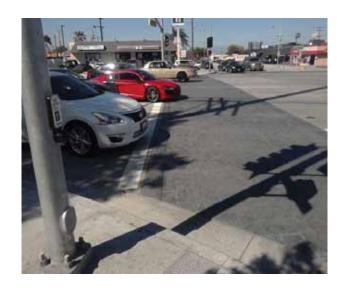

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415669	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Telegraph Road & Lakewood Boulevard

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing @ 33.961109099506, -118.110265284777

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	415621	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Telegraph Road & Lakewood Boulevard

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing @ 33.961109099506, -118.110265284777

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	415622	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0



Telegraph Road & Lakewood Boulevard

Telegraph Road & Lakewood Boulevard Downey, CA 90242

Date of Inspection 4/29/2017

*Estimated Facility Total: \$36,296

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Telegraph Road & Paramount Boulevard

Telegraph Road & Paramount Boulevard Downey, CA 90242

Date of Inspection 5/11/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Curb Ramps - Exterior : Curb Ramp

Southeast Corner @ 33.966871910925, -118.115833550692

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 9.00 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number	425072	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner @ 33.966871910925, -118.115833550692

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 10.30 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

Record Number425073ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner @ 33.966871910925, -118.115833550692

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	425074	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Landings

Southeast Corner @ 33.966871910925, -118.115833550692

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 47.00 inches


Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240

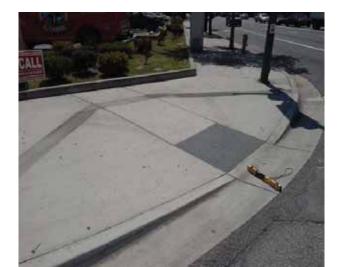

Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number425075ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner @ 33.967102148319, -118.116037398577

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 11.30 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

Record Number425076ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Landings

Southwest Corner @ 33.967102148319, -118.116037398577

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 46.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number	425077	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

East Crossing @ 33.966954218085, -118.115720897913

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	425078	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

South Crossing @ 33.966988698087, -118.115950226784

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	425081	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner to East Crossing @ 33.966860788330, -118.115798681974

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 126.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number425104ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner to East Crossing @ 33.966860788330, -118.115798681974

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Clear Ground Space Length

Finding

There is not enough clear ground space at the push button.

On-Site Finding 40.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

Record Number425105ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner to East Crossing @ 33.966860788330, -118.115798681974

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 8.90 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

Record Number425106ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner to East Crossing @ 33.966860788330, -118.115798681974

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	425107	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner to East Crossing @ 33.966860788330, -118.115798681974

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	425108	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None New Value

Designated Staff

0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner to East Crossing @ 33.966860788330, -118.115798681974

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	425109	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner to East Crossing @ 33.966860788330, -118.115798681974

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	425110	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner to East Crossing @ 33.966860788330, -118.115798681974

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	425111	Resolution	None
Progress	Not_Started	Priority	Five
Actual Data		Drainated Data	04/20/

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner to East Crossing @ 33.966860788330, -118.115798681974

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	425112	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner to East Crossing @ 33.966860788330, -118.115798681974

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	425113	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner to East Crossing @ 33.966860788330, -118.115798681974

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number 425114 Resolution None Not_Started Five **Progress** Priority **Actual Date Projected Date** 06/30/2025 \$0.00 Contractor Actual Cost

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner to East Crossing @ 33.966860788330, -118.115798681974

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	425115	Resolution	None
Record Number	425115	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner to South Crossing @ 33.966861900590, -118.115876466036

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 128.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number425082ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner to South Crossing @ 33.966861900590, -118.115876466036

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Length

Finding

There is not enough clear ground space at the push button.

On-Site Finding 40.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

Record Number425083ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner to South Crossing @ 33.966861900590, -118.115876466036

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	425084	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner to South Crossing @ 33.966861900590, -118.115876466036

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	425085	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner to South Crossing @ 33.966861900590, -118.115876466036

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	425086	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner to South Crossing @ 33.966861900590, -118.115876466036

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	425087	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner to South Crossing @ 33.966861900590, -118.115876466036

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	425088	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner to South Crossing @ 33.966861900590, -118.115876466036

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	425089	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner to South Crossing @ 33.966861900590, -118.115876466036

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	425090	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner to South Crossing @ 33.966861900590, -118.115876466036

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



0

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	425091	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None New Value

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner to South Crossing @ 33.966861900590, -118.115876466036

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	425092	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner to South Crossing @ 33.967072117390, -118.116044104099

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 136.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number425093ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner to South Crossing @ 33.967072117390, -118.116044104099

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 3.50 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number425094ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner to South Crossing @ 33.967072117390, -118.116044104099

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number425095ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025Actual Cost\$0.00Contractor

No Comments

Assignment None New Value 0

Designated Staff

Comments

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner to South Crossing @ 33.967072117390, -118.116044104099

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number425096ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner to South Crossing @ 33.967072117390, -118.116044104099

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number425097ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025Actual Cost\$0.00Contractor

Actual 003t \$0.00

No Comments

Assignment None New Value 0

Designated Staff

Comments

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner to South Crossing @ 33.967072117390, -118.116044104099

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number425098ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Date 00/30/2

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner to South Crossing @ 33.967072117390, -118.116044104099

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	425099	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner to South Crossing @ 33.967072117390, -118.116044104099

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	425100	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

No Comments Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner to South Crossing @ 33.967072117390, -118.116044104099

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number425101ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner to South Crossing @ 33.967072117390, -118.116044104099

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number425102ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner to South Crossing @ 33.967072117390, -118.116044104099

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number 425103 Resolution None Not_Started Five **Progress** Priority **Actual Date Projected Date** 06/30/2025 \$0.00 Contractor Actual Cost Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner to West Crossing @ 33.967129954726, -118.116037398577

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 178.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number425116ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner to West Crossing @ 33.967129954726, -118.116037398577

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 5.30 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number425117ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner to West Crossing @ 33.967129954726, -118.116037398577

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



0

Code Reference CA MUTCD, CA MUTCD 4E.08

None

Progress

Record Number	425118	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner to West Crossing @ 33.967129954726, -118.116037398577

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	425119	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
	¢0.00	0	

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner to West Crossing @ 33.967129954726, -118.116037398577

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number 425120 Resolution None Not_Started **Progress** Priority Five **Actual Date Projected Date** 06/30/2025 \$0.00 Contractor Actual Cost

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner to West Crossing @ 33.967129954726, -118.116037398577

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	425121	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner to West Crossing @ 33.967129954726, -118.116037398577

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	425122	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner to West Crossing @ 33.967129954726, -118.116037398577

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number425123ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner to West Crossing @ 33.967129954726, -118.116037398577

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number425124ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner to West Crossing @ 33.967129954726, -118.116037398577

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number425125ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner to West Crossing @ 33.967129954726, -118.116037398577

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	425126	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

No Comments

Assignment None New Value 0

Designated Staff

Comments

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing @ 33.967176669468, -118.115931451321

Intersections , Walking Surface : Slope

Finding

Intersection walking surface slope is not compliant.

On-Site Finding 5.80 percent

Recommendation

Repave the walking surface with recommended slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

\$1,260



Code Reference

Progress

Record Number	425079	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing @ 33.967176669468, -118.115931451321

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	425080	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0



Telegraph Road & Paramount Boulevard

Telegraph Road & Paramount Boulevard Downey, CA 90242

Date of Inspection 5/11/2017

*Estimated Facility Total: \$39,196

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Telegraph Road & Passons Boulevard

Telegraph Road & Passons Boulevard Downey, CA 90242

Date of Inspection 4/29/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Curb Ramps - Exterior : Curb Ramp

Southwest Corner To South Crossing @ 33.955759713243, - 118.102773874998

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.60 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

Record Number	415578	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner To West Crossing @ 33.955781961335, - 118.102767169476

Bottom Landing

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 6.80 percent


Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260

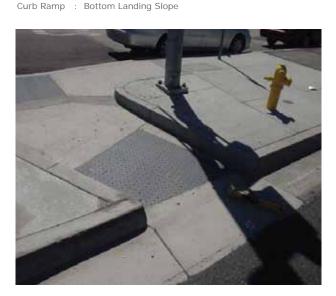

Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

Record Number	415579	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

South Crossing @ 33.955694081338, -118.102684020996

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Notes: Spalled concrete

Progress

Record Number	415581	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Date Projected Date

\$0.00 Contractor **Actual Cost**

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To South Crossing @ 33.955644023071, -118.102561980486

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 118.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number415594ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To South Crossing @ 33.955644023071, -118.102561980486

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 5.30 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number	415595	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.955644023071, -118.102561980486

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415596	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.955644023071, -118.102561980486

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

None

Progress

Record Number	415597	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.955644023071, -118.102561980486

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415598	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.955644023071, -118.102561980486

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

No Comments

Progress

Record Number	415599	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Assignment None New Value 0

Designated Staff

Comments

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.955644023071, -118.102561980486

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	415600	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.955644023071, -118.102561980486

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415601	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.955644023071, -118.102561980486

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415602	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.955644023071, -118.102561980486

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



0

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415603	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None New Value

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.955644023071, -118.102561980486

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415604	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To South Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Controls : Push Button Location

Finding

Push button is not located at least 10 feet from other accessible pedestrian signals.

On-Site Finding Not Located

Recommendation

Push button must be located at least 10 feet from other accessible pedestrian signals.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,800



Code Reference CA MUTCD 4E.08

Record Number	415582	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To South Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 151.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number	415583	Resolution	None
Progress	Not_Started	Priority	Five
Actual Data		Projected Date	04/20/

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To South Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 7.50 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

Record Number	415584	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415585	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415586	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415587	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	415588	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	415589	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Actual Cost \$0.00

No Comments

Assignment None New Value 0

Designated Staff

Comments

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415590	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415591	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415592	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415593	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Controls : Push Button Location

Finding

Push button is not located at least 10 feet from other accessible pedestrian signals.

On-Site Finding Not Located

Recommendation

Push button must be located at least 10 feet from other accessible pedestrian signals.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,800



Code Reference CA MUTCD 4E.08

Record Number	415605	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 95.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number	415606	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Controls : Push Button Face

Finding

Push button face is not parallel to crosswalk.

On-Site Finding Not Parallel

Recommendation

Push button face must be parallel to crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Record Number	415607	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Length

Finding

There is not enough clear ground space at the push button.

On-Site Finding 28.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

Record Number 415608 Resolution None Five **Progress** Not_Started Priority **Actual Date Projected Date** 06/30/2025 \$0.00 Contractor **Actual Cost** Comments No Comments **Assignment** None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 8.10 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number415609ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415610	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415611	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415612	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	415613	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	415614	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415615	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



0

Code Reference CA MUTCD, CA MUTCD 4E.08

None

Progress

Record Number	415616	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415617	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.955779736526, -118.102781921625

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415618	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing @ 33.955896538917, -118.102728277445

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	415580	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0



Telegraph Road & Passons Boulevard

Telegraph Road & Passons Boulevard Downey, CA 90242

Date of Inspection 4/29/2017

*Estimated Facility Total: \$33,912

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Telegraph Road & Serapis Avenue

Telegraph Road & Serapis Avenue Downey, CA 90242

Date of Inspection 4/29/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Curb Ramps - Exterior : Curb Ramp

Southeast Corner @ 33.958313756212, -118.106478005648

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 10.70 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number	415576	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None

New Value 0

Curb Ramps - Exterior : Curb Ramp , Ramp Run

Southeast Corner @ 33.958313756212, -118.106478005648

Curb Ramp , Ramp Run : Grade Break

Finding

Curb ramp run surface has a grade break.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$1,440



Code Reference CA 11B-406.5.6

Record Number	415577	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Walking Surface

Intersection

East Crossing @ 33.958414981945, -118.106362670660

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	415529	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

i i ojesteu zute

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

South Crossing @ 33.958367150020, -118.106567859650

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	415530	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To East Crossing @ 33.958297070640, -118.106417655945

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 211.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number415565ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To East Crossing @ 33.958297070640, -118.106417655945

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 3.10 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number415566ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.958297070640, -118.106417655945

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415567	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.958297070640, -118.106417655945

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415568	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None New Value

Designated Staff

0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.958297070640, -118.106417655945

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415569	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.958297070640, -118.106417655945

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number415570ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.958297070640, -118.106417655945

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	415571	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.958297070640, -118.106417655945

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415572	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.958297070640, -118.106417655945

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415573	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.958297070640, -118.106417655945

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415574	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.958297070640, -118.106417655945

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415575	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To South Crossing @ 33.958302632497, -118.106516897678

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 158.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number	415532	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To South Crossing @ 33.958302632497, -118.106516897678

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Width

Finding

There is not enough clear ground space at the push button.

On-Site Finding 15.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 32.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

Record Number	415533	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To South Crossing @ 33.958302632497, -118.106516897678

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 3.00 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number	415534	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.958302632497, -118.106516897678

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415535	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.958302632497, -118.106516897678

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415536	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.958302632497, -118.106516897678

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415537	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.958302632497, -118.106516897678

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	415538	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assianment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.958302632497, -118.106516897678

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	415539	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
	* • • • • •		

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.958302632497, -118.106516897678

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415540	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.958302632497, -118.106516897678

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415541	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.958302632497, -118.106516897678

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415542	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.958302632497, -118.106516897678

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415543	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To South Crossing @ 33.958396071652, -118.106636255980

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 170.00 inches

Recommendation

Provide a compliant push button.

Costing Info (Estimated)

Recommendation Up to 60.00 inches

4

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number415555ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.958396071652, -118.106636255980

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415556	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.958396071652, -118.106636255980

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415557	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.958396071652, -118.106636255980

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415558	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.958396071652, -118.106636255980

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	415559	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
	\$0.00	-	00/00/2020

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.958396071652, -118.106636255980

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	415560	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.958396071652, -118.106636255980

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415561	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.958396071652, -118.106636255980

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415562	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.958396071652, -118.106636255980

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415563	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.958396071652, -118.106636255980

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415564	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.958470600428, -118.106656372547

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 202.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number	415544	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.958470600428, -118.106656372547

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 2.50 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number415545ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.958470600428, -118.106656372547

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415546	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.958470600428, -118.106656372547

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415547	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Comments	NO COMMITTERITS		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.958470600428, -118.106656372547

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415548	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.958470600428, -118.106656372547

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	415549	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.958470600428, -118.106656372547

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	415550	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.958470600428, -118.106656372547

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415551	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.958470600428, -118.106656372547

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415552	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.958470600428, -118.106656372547

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415553	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.958470600428, -118.106656372547

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415554	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing @ 33.958536230192, -118.106550425291

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

Record Number	415531	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0



Telegraph Road & Serapis Avenue

Telegraph Road & Serapis Avenue Downey, CA 90242

Date of Inspection 4/29/2017

*Estimated Facility Total: \$35,116

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Telegraph Road & True Avenue

Telegraph Road & True Avenue Downey, CA 90242

Date of Inspection 4/29/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Intersections - Exterior : Intersections , Walking Surface

Intersection

East Crossing @ 33.951717138359, -118.096560537815

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Notes: Curb on path of travel

Record Number	415670	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Walking Surface

Intersection

East Crossing @ 33.951717138359, -118.096560537815

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

See Recommendation Recommendation

Costing Info (Estimated)

\$240



Code Reference

Notes: Curb on path of travel

Progress

Record Number 415671 Resolution None Not_Started Five **Progress** Priority **Actual Date Projected Date** 06/30/2025 Contractor

\$0.00 **Actual Cost**

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

South Crossing @ 33.951672640043, -118.096775114536

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Notes: Curbs (2) in path of travel

Progress

Record Number	415675	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

South Crossing @ 33.951672640043, -118.096775114536

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Notes: Curbs (2) in path of travel

Progress

Record Number	415676	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To East Crossing @ 33.951623691869, -118.096661120653

Intersections , Pedestrian Signal Controls : Push Button Face

Finding

Push button face is not parallel to crosswalk.

On-Site Finding Not Parallel

Recommendation

Push button face must be parallel to crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number	415699	Resolution	None
Progress	Not_Started	Priority	Five
Actual Data		Projected Date	04/20

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To East Crossing @ 33.951623691869, -118.096661120653

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Length

Finding

There is not enough clear ground space at the push button.

On-Site Finding 44.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

Record Number415700ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.951623691869, -118.096661120653

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415701	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.951623691869, -118.096661120653

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Comments

Record Number	415702	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.951623691869, -118.096661120653

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number 415703 Resolution None Not_Started Five **Progress** Priority **Actual Date Projected Date** 06/30/2025 \$0.00 Contractor **Actual Cost**

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.951623691869, -118.096661120653

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	415704	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.951623691869, -118.096661120653

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	415705	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.951623691869, -118.096661120653

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415706	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Actual Cost \$0.00 Contracto

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.951623691869, -118.096661120653

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415707	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.951623691869, -118.096661120653

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number415708ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.951623691869, -118.096661120653

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415709	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To South Crossing @ 33.951608117444, -118.096725493670

Intersections , Pedestrian Signal Controls : Push Button Face

Finding

Push button face is not parallel to crosswalk.

On-Site Finding Not Parallel

Recommendation

Push button face must be parallel to crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number	415677	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To South Crossing @ 33.951608117444, -118.096725493670

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Length

Finding

There is not enough clear ground space at the push button.

On-Site Finding 19.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

Record Number415678ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.951608117444, -118.096725493670

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	415679	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.951608117444, -118.096725493670

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415680	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.951608117444, -118.096725493670

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415681	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.951608117444, -118.096725493670

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

Record Number	415682	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To South Crossing @ 33.951608117444, -118.096725493670

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	415683	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.951608117444, -118.096725493670

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415684	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.951608117444, -118.096725493670

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



0

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415685	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None New Value

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.951608117444, -118.096725493670

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415686	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To South Crossing @ 33.951608117444, -118.096725493670

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	415687	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To South Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Controls : Push Button Location

Finding

Push button is not located at least 10 feet from other accessible pedestrian signals.

On-Site Finding Not Located

Recommendation

Push button must be located at least 10 feet from other accessible pedestrian signals.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,800



Code Reference CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number 415710 Resolution None **Progress** Not_Started Priority Five **Projected Date Actual Date** 06/30/2025 \$0.00 Contractor

Actual Cost

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To South Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Length

Finding

There is not enough clear ground space at the push button.

On-Site Finding 39.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number 415711 Resolution None Not_Started Five **Progress** Priority

Actual Date Projected Date 06/30/2025

\$0.00 Contractor **Actual Cost**

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To South Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 8.80 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number	415712	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



0

Code Reference CA MUTCD, CA MUTCD 4E.08

None

Notes: Surface is rough and uneven.

Progress

Record Number	415713	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number	415714	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number	415715	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number	415716	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To South Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number415717ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number	415718	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	00.02	Contractor	

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number	415719	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number	415720	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To South Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number	415721	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Controls : Push Button Location

Finding

Push button is not located at least 10 feet from other accessible pedestrian signals.

On-Site Finding Not Located

Recommendation

Push button must be located at least 10 feet from other accessible pedestrian signals.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,800



Code Reference CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number415688ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Controls : Push Button Diameter

Finding

Push button diameter is not compliant.

On-Site Finding 0.37 inches

Recommendation

Provide a compliant push button.

Recommendation At least 2.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number	415689	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number	415690	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number	415691	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number	415692	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number 415693 Resolution None **Progress** Not_Started **Priority** Five **Actual Date Projected Date** 06/30/2025 \$0.00 Contractor **Actual Cost** Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number415694ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number	415695	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number	415696	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number	415697	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.951723813104, -118.096850216389

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Notes: Surface is rough and uneven.

Progress

Record Number	415698	Resolution	None
Progress	Not_Started	Priority	Five
Actual Data		Projected Date	06/20

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing @ 33.951810584745, -118.096756339073

Intersections , Walking Surface : Slope

Finding

Intersection walking surface slope is not compliant.

On-Site Finding 5.80 percent

Recommendation

Repave the walking surface with recommended slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

\$1,260



Code Reference

Notes: Curb in path of tavel

Progress

Record Number415672ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing @ 33.951810584745, -118.096756339073

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Notes: Curb in path of tavel

Progress

Record Number415673ResolutionNoneProgressNot_StartedPriorityFiveActual DateProjected Date06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing @ 33.951810584745, -118.096756339073

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Notes: Curb in path of tavel

Progress

Record Number	415674	Resolution	None
Progress	Not_Started	Priority	Five

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0



Telegraph Road & True Avenue

Telegraph Road & True Avenue Downey, CA 90242

Date of Inspection 4/29/2017

*Estimated Facility Total: \$36,536

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Telegraph Road - City of Santa Fe Springs to Lakewood Boulevard

City of Santa Fe Springs to Lakewood Boulevard Downey, CA 90242

Date of Inspection 8/18/2017

Prepared By **Disability Access Consultants**(800) 743-7067

Telegraph Road - City of Santa Fe Springs to Lakewood Boulevard

Curb Ramps - Exterior : Curb Ramp

South Side West of Hasty Avenue - 1st @ 33.954363633831, -118.100760877132

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number 482040 Resolution None **Progress** Not_Started **Priority** Two **Actual Date Projected Date**

06/30/2020

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value

Curb Ramps - Exterior : Curb Ramp

South Side West of Hasty Avenue - 1st @ 33.954363633831, - 118.100760877132

Curb Ramp : Curb Ramp Width

Finding

The width of the curb ramp is less than required.

On-Site Finding 47.00 inches

Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.5, CA 11B-406.5.2

Progress

Record Number	482041	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment Category_1 New Value 0

Curb Ramps - Exterior : Curb Ramp

South Side West of Hasty Avenue - 1st @ 33.954363633831, - 118.100760877132

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 10.50 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

Record Number	482042	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Curb Ramps - Exterior : Curb Ramp

South Side West of Hasty Avenue - 1st @ 33.954363633831, - 118.100760877132

Bottom Landing

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 13.20 percent


Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260

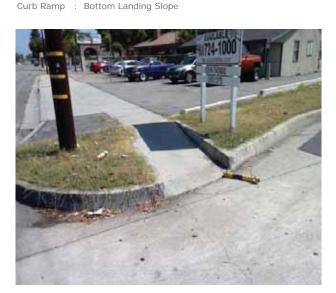

Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

Record Number482043ResolutionNoneProgressNot_StartedPriorityTwo

Actual Date Projected Date 06/30/2020

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value C

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

South Side West of Hasty Avenue - 1st @ 33.954363633831, - 118.100760877132

Bottom Landing

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.75 inches

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$255

Curb Ramp , Landings And Transitions $\,:\,$ Bottom Landing Change in Level



Code Reference ADA 302, 303, 406.2, 303.1

Progress

Record Number	482044	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Curb Ramps - Exterior : Curb Ramp

South Side West of Hasty Avenue - 2nd @ 33.954431491606, - 118.100848048925

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number481977ResolutionNoneProgressNot_StartedPriorityTwo

Actual Date Projected Date 06/30/2020

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value 0

Curb Ramps - Exterior : Curb Ramp

South Side West of Hasty Avenue - 2nd @ 33.954431491606, - 118.100848048925

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 8.70 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

Record Number481978ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2020Actual Cost\$0.00Contractor

Comments No Comments

Assignment Category_1 New Value 0

Curb Ramps - Exterior : Curb Ramp

South Side West of Hasty Avenue - 2nd @ 33.954431491606, - 118.100848048925

Bottom Landing

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 8.30 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Curb Ramp : Bottom Landing Slope

Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

Record Number481979ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2020

Tigotica Pate

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value C

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

South Side West of Hasty Avenue - 2nd @ 33.954431491606, - 118.100848048925

Bottom Landing

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.62 inches

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$255

Curb Ramp , Landings And Transitions $\,:\,$ Bottom Landing Change in Level



Code Reference ADA 302, 303, 406.2, 303.1

Category_1

Progress

Record Number	481980	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

0

Curb Ramps - Exterior : Curb Ramp

South Side West of True Avenue - 1st @ 33.953008691829, - 118.098816275597

Bottom Landing

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 15.50 percent


Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260

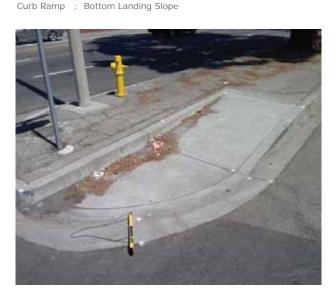

Code Reference ADA 406, 406.2,CA 11B-406.5.8

Notes: Top Landing is Rough And Uneven

Progress

Record Number481983ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2020

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

South Side West of True Avenue - 1st @ 33.953008691829, - 118.098816275597

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 4.50 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions $\,:\,$ Top Landing Slope

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Notes: Top Landing is Rough And Uneven

Progress

Record Number	481984	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0

Curb Ramps - Exterior : Curb Ramp

South Side West of True Avenue - 1st @ 33.953008691829, - 118.098816275597

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number482052ResolutionNoneProgressNot_StartedPriorityTwo

Actual Date Projected Date 06/30/2020

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value 0

Curb Ramps - Exterior : Curb Ramp

South Side West of True Avenue - 1st @ 33.953008691829, - 118.098816275597

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 8.80 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

Record Number482053ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2020Actual Cost\$0.00Contractor

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Arrignton Avenue South Crossing @ 33.959333794630, -118.107947856188

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 7.00 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

Record Number	482092	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2020

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Bench West of Lindell Avenue @ 33.960608547370, -118.109742254019

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 40.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1,CA 11B-403.5

Progress

Record Number	482061	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of City of Santa Fe Springs @ 33.950423340337, - 118.093740195036

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	482000	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value C

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of City of Santa Fe Springs @ 33.950694783685, - 118.094408065081

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	482001	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value C

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of City of Santa Fe Springs @ 33.950864991572, - 118.094838559628

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	481998	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value C

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of City of Santa Fe Springs @ 33.950873891322, - 118.094874769449

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.87 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	482005	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Category_1

Designated Staff

Assignment

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of City of Santa Fe Springs @ 33.950942864348, - 118.095054477453

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

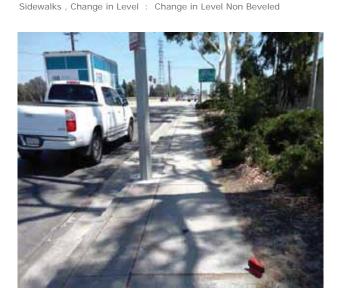

Code Reference ADA 206, 302

Progress

Record Number	482002	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2020

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value C

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Passons Boulevard @ 33.956888796571, - 118.104384541512

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number482004ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2020Actual Cost\$0.00Contractor

Comments No Comments

Assignment Category_1 New Value C

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Passons Boulevard @ 33.957184691793, - 118.104812353849

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	482067	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value C

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Passons Boulevard @ 33.957458338338, - 118.105206638575

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number482058ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2019Actual Cost\$0.00Contractor

Comments No Comments

Assignment Category_1 New Value C

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Passons Boulevard @ 33.957525081265, - 118.105319291353

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

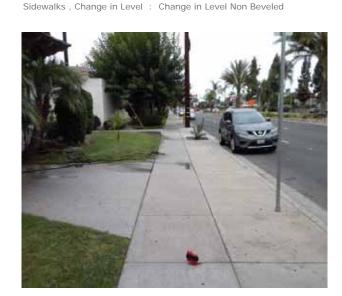

Code Reference ADA 206, 302

Progress

Record Number482057ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2019Actual Cost\$0.00Contractor

Comments No Comments

Assignment Category_1 New Value C

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Passons Boulevard @ 33.957674140277, - 118.105535209179

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	482059	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Passons Boulevard @ 33.957948897624, -118.105909377337

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	482066	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment Category_1 New Value

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Passons Boulevard @ 33.958180271544, - 118.106266111135

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

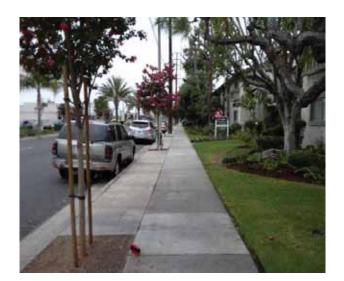

Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	482062	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value C

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Passons Boulevard @ 33.958271486090, - 118.106388151646

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	482063	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value C

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Passons Boulevard @ 33.958293733525, - 118.106414973736

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	482060	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value C

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Pico Vista Road @ 33.951610342362, -118.096657097340

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	482003	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Songfest Drive @ 33.953690615254, -118.099776506424

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	481999	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Songfest Drive @ 33.953887515454, -118.164843893

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	481997	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category 1	New Value	0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Arrignton Avenue @ 33.959677512564, -118.108411878347

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482087	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Commonts	No Commonts		

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Arrignton Avenue @ 33.959677512564, -118.108411878347

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 8.30 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	482088	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Arrignton Avenue @ 33.959835466618, -118.108635842800

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482069	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Arrignton Avenue @ 33.959835466618, -118.108635842800

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 8.90 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	482070	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Arrignton Avenue @ 33.960036801994, -118.108917474747

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482089	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022

\$0.00 Contractor Actual Cost

No Comments

Assignment New Value 0 Category_1

Designated Staff

Comments

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Arrignton Avenue @ 33.960090194721, -118.109004646540

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



0

Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Category_1

Progress

Record Number	482075	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of City of Santa Fe Springs @ 33.950851641946, -118.094798326492

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings

Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482014	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of City of Santa Fe Springs @ 33.950851641946, -118.094798326492

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.20 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	482015	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Hasty Avenue @ 33.954175634136, -118.100481927395

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	482012	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Hasty Avenue @ 33.954175634136, -118.100481927395

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 8.60 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	482013	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

9

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Hasty Avenue @ 33.954298848, -118.100661635399

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482022	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
	Category 1	New Value	0
Assignment	Category_1	New Value	0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Hasty Avenue @ 33.954298848, -118.100661635399

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 8.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	482023	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Hasty Avenue @ 33.954306900239, -118.100684434175

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	482008	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Hasty Avenue @ 33.954306900239, -118.100684434175

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.00 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	482009	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Hasty Avenue @ 33.954408130739, -118.100803792477

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482020	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Hasty Avenue @ 33.954408130739, -118.100803792477

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 5.10 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	482021	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Hasty Avenue @ 33.954537171642, -118.101934839

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482038	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Hasty Avenue @ 33.954537171642, -118.101934839

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 2.90 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	482039	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Hasty Avenue @ 33.954963227715, -118.101617842913

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482025	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
comments	No Comments		
Assignment	Category_1	New Value	0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Hasty Avenue @ 33.955191272518, -118.101928979158

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found


Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings

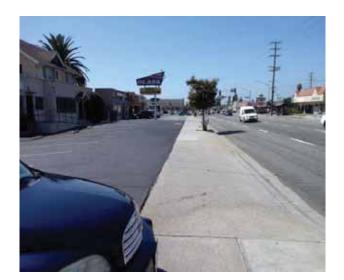

Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482034	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Hasty Avenue @ 33.955191272518, -118.101928979158

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 8.20 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	482035	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Hasty Avenue @ 33.955399293341, -118.102250844240

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482029	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Hasty Avenue @ 33.955399293341, -118.102250844240

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 8.90 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	482030	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Hasty Avenue @ 33.955516096254, -118.102419823408

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	482010	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Hasty Avenue @ 33.955516096254, -118.102419823408

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 8.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	482011	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Lindell Avenue @ 33.960509548932, -118.109632283449

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482084	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Lindell Avenue @ 33.960734241850, -118.109917938709

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

See Recommendation Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705, CA 11B-705.1.2.5, CA 11B-247.1.2.5

Progress

Record Number	482082	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

No Comments Comments

Assignment New Value 0 Category_1

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Lindell Avenue @ 33.960734241850, -118.109917938709

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 2.80 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	482083	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Passons Boulevard @ 33.955817558270, -118.102836906910

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482016	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022

Contractor **Actual Cost** \$0.00

No Comments

Assignment New Value 0 Category_1

Designated Staff

Comments

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Passons Boulevard @ 33.955817558270, -118.102836906910

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.20 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	482017	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value 0 Assignment Category_1

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Passons Boulevard @ 33.956787569022, -118.104246407747

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



0

Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Category_1

Progress

Record Number	482033	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Passons Boulevard @ 33.957112386665, -118.104723840952

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	482031	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Passons Boulevard @ 33.957112386665, -118.104723840952

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.40 percent


Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

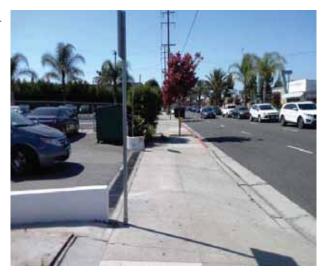

Code Reference ADA 206, 302,CA 11B-403.3

Record Number	482032	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Passons Boulevard @ 33.957240311081, -118.104912936687

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482090	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Passons Boulevard @ 33.957240311081, -118.104912936687

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.90 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	482091	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Passons Boulevard @ 33.957358223851, -118.105073869228

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482080	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022

Tional Pare

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Passons Boulevard @ 33.957358223851, -118.105073869228

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 4.30 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	482081	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Passons Boulevard @ 33.957619633654, -118.105446696281

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	482073	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Passons Boulevard @ 33.957834322806, -118.105748444796

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

See Recommendation Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	482074	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Pico Vista Road @ 33.951441248427, -118.096319139004

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings

Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482018	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Pico Vista Road @ 33.951441248427, -118.096319139004

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.30 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	482019	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Pico Vista Road @ 33.951525795437, -118.096508234739

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482028	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Pico Vista Road @ 33.951578081045, -118.096606135368

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482036	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Pico Vista Road @ 33.951578081045, -118.096606135368

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.10 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	482037	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Serapis Avenue @ 33.958640792762, -118.106913864613

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

See Recommendation Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	482076	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Serapis Avenue @ 33.958640792762, -118.106913864613

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.30 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	482077	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Serapis Avenue @ 33.958725332618, -118.107043951750

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482078	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Serapis Avenue @ 33.958725332618, -118.107043951750

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 7.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	482079	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Serapis Avenue @ 33.959066828287, -118.107520043850

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	482085	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Serapis Avenue @ 33.959066828287, -118.107520043850

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.00 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	482086	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Serapis Avenue @ 33.959193637404, -118.107727915049

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482071	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Serapis Avenue @ 33.959193637404, -118.107727915049

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 11.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	482072	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Songfest Drive @ 33.953282351804, -118.099189102650

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found


Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings

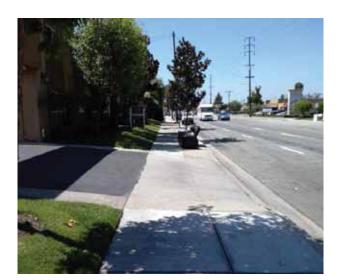

Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482026	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Songfest Drive @ 33.953282351804, -118.099189102650

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 8.30 percent


Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

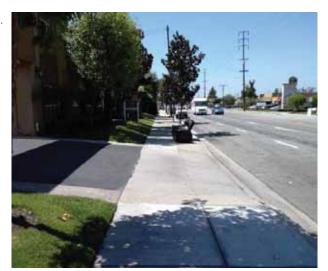

0

Code Reference ADA 206, 302,CA 11B-403.3

Category_1

Progress

Record Number	482027	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Songfest Drive @ 33.953769597875, -118.099890500307

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	482006	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Songfest Drive @ 33.953769597875, -118.099890500307

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.90 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	482007	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment Category_1

New Value 0

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Guy Wire West of Arrignton Avenue @ 33.960151373846, -118.109107911587

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 65.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Record Number	482065	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Guy Wire West of Lindell Avenue @ 33.960448370064, -118.109537065029

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 65.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Progress

Record Number	482068	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk Weat of Passons Boulevard @ 33.956367084068, -118.103648275137

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.30 percent for 345.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



0

Code Reference ADA 206, 302,CA 11B-403.3

Category_1

Progress

Record Number	481991	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West of City of Santa Fe Springs @ 33.950304305481, -118.093453198671

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 41.50 inches for 425.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-403.5.1

Progress

Record Number	481996	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
	N. 0		
Comments	No Comments		
Assignment	Category_1	New Value	0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of City of Santa Fe Springs @ 33.950851641946, -118.094798326492

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.30 percent for 270.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	481995	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Hasty Avenue @ 33.955549468486, -118.102466762066

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.20 percent for 30.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	481990	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Passons Boulevard @ 33.955817558270, -118.102836906910

Sidewalks , Surface : Not Slip Resistant

Finding

Sidewalk surface is not slip resistant.

On-Site Finding Not Compliant

Recommendation

Make sure that the sidewalk surface is firm, stable and slip resistant.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302 Notes: Surface is Rough And Uneven

Record Number	481986	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Passons Boulevard @ 33.955817558270, -118.102836906910

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.20 percent for 247.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Notes: Surface is Rough And Uneven

Progress

Record Number	481987	Resolution	None
Progress	Not_Started	Priority	Two
Actual Data		Drainated Data	04/20

Actual Date Projected Date 06/30/2020

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Passons Boulevard @ 33.957151320203, -118.104766756296

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.70 percent for 100.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	482055	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Passons Boulevard @ 33.957640768879, -118.105473518372

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.00 percent for 82.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	482056	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Pico Vista Road @ 33.951210968646, -118.095826953650

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.40 percent for 305.00 feet


Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

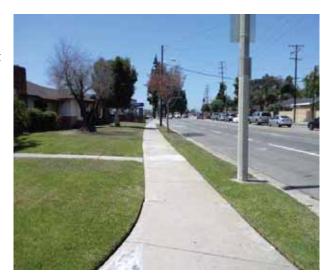

Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	481993	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Songfest Drive @ 33.953119935827, -118.098963797092

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.40 percent for 65.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	481994	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Songfest Drive @ 33.953545998997, -118.099563270807

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.90 percent for 62.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	481992	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of True Avenue @ 33.951689326914, -118.096862286329

Sidewalks , Surface : Not Slip Resistant

Finding

Sidewalk surface is not slip resistant.

On-Site Finding Not Compliant

Recommendation

Make sure that the sidewalk surface is firm, stable and slip resistant.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302 Notes: Surface is Rough And Uneven

Record Number	481988	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of True Avenue @ 33.951689326914, -118.096862286329

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.20 percent for 765.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Notes: Surface is Rough And Uneven

Progress

Record Number	481989	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Songfest Drive South Crossing @ 33.953060976526, -118.098888695240

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 5.70 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

Record Number	482024	Resolution	None
Progress	Not Started	Priority	Two

Actual Date Projected Date 06/30/2020

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Trash Can West of Lindell Avenue @ 33.960706433353, -118.109889775515

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 42.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1,CA 11B-403.5

Record Number	482064	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side @ 33.950292068244, -118.093443810940

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

Record Number 482263 Resolution None **Progress** Not_Started Priority Two **Actual Date Projected Date** 06/30/2020 Contractor Actual Cost \$0.00 Comments No Comments New Value Assignment Category_1 0 **Designated Staff**



Telegraph Road - City of Santa Fe Springs to Lakewood Boulevard

City of Santa Fe Springs to Lakewood Boulevard Downey, CA 90242

Date of Inspection 8/18/2017

*Estimated Facility Total: \$68,952

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By


Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey

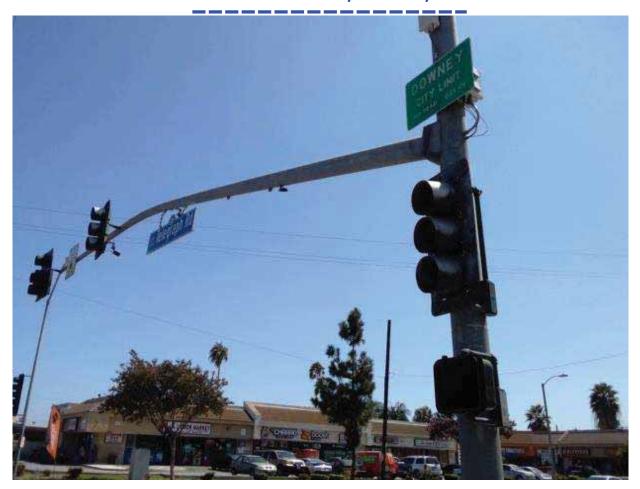

City of Downey

Telegraph Road - Paramount Boulevard to City Limits - South Side Only

Paramount Boulevard to City Limits Downey, CA 92040

Date of Inspection 8/14/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Telegraph Road - Paramount Boulevard to City Limits - South Side Only

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Lowman Avenue @ 33.968756057560, -118.117513954639

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	480363	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Lowman Avenue @ 33.970188603926, -118.118812143803

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	480356	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Lowman Avenue @ 33.970731363637, -118.119324445724

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	480353	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Lowman Avenue @ 33.970993844550, -118.119579255581

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	480350	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Lowman Avenue @ 33.970233092558, -118.118865787983

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	480354	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Lowman Avenue @ 33.971040557170, -118.119614124298

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	480349	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Lowman Avenue @ 33.971251875844, -118.119764328003

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	480352	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Lowman Avenue @ 33.971294139516, -118.119815289974

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

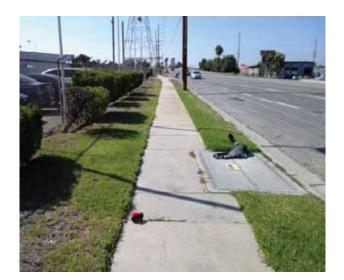

Code Reference ADA 206, 302

Record Number	480372	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Lowman Avenue @ 33.971454296397, -118.119968175888

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	480348	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Lowman Avenue Wine @ 33.969103074112, - 118.117827773094

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number480370ResolutionNoneProgressNot_StartedPriorityTwo

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Paramount Boulevard @ 33.967755040342, - 118.116551041603

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	480358	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Paramount Boulevard @ 33.967957469219, - 118.116722702980

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	480355	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Paramount Boulevard @ 33.967957469219, - 118.116722702980

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	480361	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Lowman Avenue @ 33.968607017965, -118.117382526398

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	480359	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Lowman Avenue @ 33.970157461871, -118.118793368340

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	480351	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level West of Paramount Boulevard @ 33.967817326202, - 118.116572499275

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number480366ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date12/31/2022Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Bush West of Paramount Boulevard @ 33.967817326202, -118.116572499275

Sidewalks , Hazards & Gratings : Protruding Object Height

Finding

The leading edge of the protruding object is more than 4 inches from the edge of sidewalk.

On-Site Finding 20.00 inches

Recommendation

Install side extensions, modify, relocate, or lower the protruding object so that the leading edge protrudes less than 4 inches from the edge of sidewalk.

Recommendation Up to 4.00 inches

Costing Info (Estimated)

Install wing walls or relocate \$640 object



Code Reference ADA 307.2,CA 11B-307.2

Progress

Record Number	480365	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Bush West of Paramount Boulevard @ 33.968115407898, -118.116800487041

Sidewalks , Hazards & Gratings : Protruding Object Height

Finding

The leading edge of the protruding object is more than 4 inches from the edge of sidewalk.

On-Site Finding 10.00 inches

Recommendation

Install side extensions, modify, relocate, or lower the protruding object so that the leading edge protrudes less than 4 inches from the edge of sidewalk.

Recommendation Up to 4.00 inches

Costing Info (Estimated)

Install wing walls or relocate \$640 object



Code Reference ADA 307.2,CA 11B-307.2

Progress

Record Number	480362	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Lowman Avenue @ 33.968607017965, -118.117382526398

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	480377	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Actual Cost \$0.00

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Lowman Avenue @ 33.968607017965, -118.117382526398

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 8.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	480378	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Lowman Avenue @ 33.968709343685, -118.117479085922

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	480391	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
	+ 0 0 0		

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Lowman Avenue @ 33.968709343685, -118.117479085922

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 8.20 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	480392	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Lowman Avenue @ 33.968956259590, -118.117653429508

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found


Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings

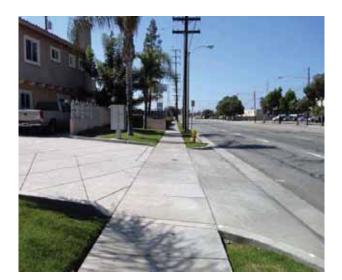

Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	480385	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Lowman Avenue @ 33.968956259590, -118.117653429508

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.80 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	480386	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

\$0.00

Comments No Comments

New Value 0 Assignment None

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Lowman Avenue @ 33.970092953290, -118.118777275085

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	480375	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Lowman Avenue @ 33.970092953290, -118.118777275085

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 6.30 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	480376	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Lowman Avenue @ 33.970339865178, -118.118959665298

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	480387	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Lowman Avenue @ 33.970339865178, -118.118959665298

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.30 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	480388	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Lowman Avenue @ 33.971131757925, -118.119678497314

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	480383	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Lowman Avenue @ 33.971131757925, -118.119678497314

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 6.90 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	480384	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Paramount Boulevard @ 33.967245629279, -118.116143345833

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	480373	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Paramount Boulevard @ 33.967245629279, -118.116143345833

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.00 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number480374ResolutionNoneProgressNot_StartedPriorityFive

Actual Date Projected Date 06/30/2025

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Paramount Boulevard @ 33.967646039978, -118.116505444050

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	480389	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Paramount Boulevard @ 33.967646039978, -118.116505444050

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.10 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	480390	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Paramount Boulevard @ 33.967817326202, -118.116572499275

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

See Recommendation Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	480381	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Paramount Boulevard @ 33.967817326202, -118.116572499275

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.00 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	480382	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway West of Paramount Boulevard @ 33.967957469219, -118.116722702980

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	480379	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway West of Paramount Boulevard @ 33.967957469219, -118.116722702980

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 13.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	480380	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Lowman Avenue @ 33.969007422255, -118.117720484734

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.50 percent for 149.00 feet


Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

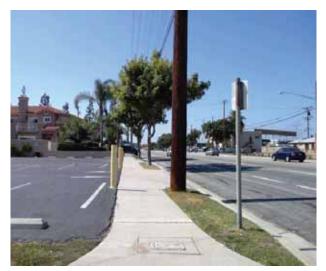

Code Reference ADA 206, 302,CA 11B-403.3

Record Number	480347	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Paramount Boulevard - Continued @ 33.967957469219, - 118.116722702980

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 6.80 percent for 476.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	480346	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
	#0.00	0	

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of Tweedy Lane @ 33.970233092558, -118.118865787983

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.80 percent for 70.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	480345	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Tree West of Lowman Avenue @ 33.970953805141, -118.119530975819

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 39.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Record Number	480371	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Tree West of Lowman Avenue @ 33.970297601032, -118.118908703327

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 60.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Record Number	480360	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Tree West of Lowman Avenue @ 33.970700221780, -118.119302988052

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 57.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Record Number	480368	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Tree West of Lowman Avenue @ 33.970731363637, -118.119324445724

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 76.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Record Number	480367	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Tree West of Paramount Boulevard @ 33.967957469219, -118.116722702980

Sidewalks , Hazards & Gratings : Protruding Object Height

Finding

The leading edge of the protruding object is more than 4 inches from the edge of sidewalk.

On-Site Finding 25.00 inches

Recommendation

Install side extensions, modify, relocate, or lower the protruding object so that the leading edge protrudes less than 4 inches from the edge of sidewalk.

Recommendation Up to 4.00 inches

Costing Info (Estimated)

Install wing walls or relocate \$640 object



Code Reference ADA 307.2,CA 11B-307.2

Progress

Record Number	480357	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Tree West of Paramount Boulevard @ 33.968059795720, -118.116770982742

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 26.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1,CA 11B-403.5

Progress

Record Number	480369	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Tree West of Paramount Boulevard @ 33.968115407898, -118.116800487041

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 63.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



0

Code Reference ADA 206, 307.4,CA 11B-307.4

None

Progress

Record Number	480364	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment



Telegraph Road - Paramount Boulevard to City Limits - South Side Only

Paramount Boulevard to City Limits Downey, CA 92040

Date of Inspection 8/14/2017

*Estimated Facility Total: \$22,444

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By


Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey

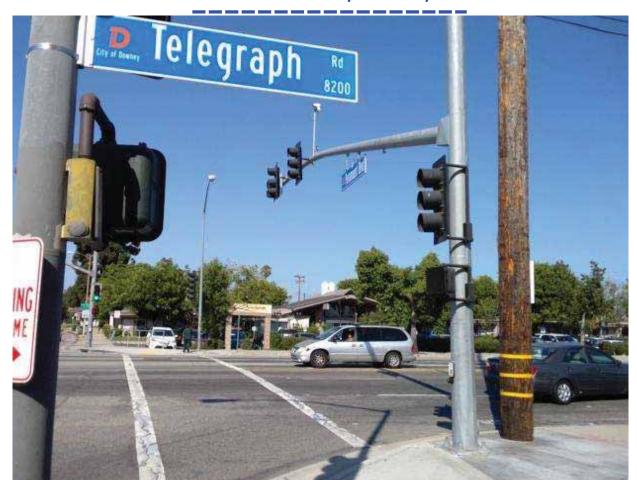

City of Downey

Telegraph Road - Paramount Boulevard to Lakewood Boulevard - South Side Only

Paramount Boulevard to Lakewood Boulevard Downey, CA 92040

Date of Inspection 8/14/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level East of Stamps Road @ 33.962551785516, -118.111913502216

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 2.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	480617	Resolution	None
Progress	Not_Started	Priority	One
Actual Date		Projected Date	06/30/2018
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level East of Birchbark Avenue @ 33.963641848155, -118.112871050835

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	480610	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level East of Paramount Boulevard @ 33.964847574639, - 118.113973438740

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	480614	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value C

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level East of Paramount Boulevard @ 33.964945455744, - 118.114059269428

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	480616	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value C

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level East of Paramount Boulevard @ 33.964776388310, - 118.113935887814

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	480606	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value C

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level East of Paramount Boulevard @ 33.966536007909, - 118.115499615669

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Progress

Record Number	480393	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value C

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level East of Stamps Road @ 33.962763125283, -118.112061023712

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	480609	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level East of Stoakes Avenue @ 33.961864371486, -118.111299276352

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	480608	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level East of Stoakes Avenue @ 33.961853248236, -118.111288547516

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.12 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	480613	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2019
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East of Manzanar Avenue @ 33.961145806546, -118.110545575619

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	480619	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East of Manzanar Avenue @ 33.961332678508, -118.110795021057

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	480627	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East of Paramount Boulevard @ 33.964687405316, -118.113850057125

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	480620	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East of Paramount Boulevard @ 33.965021091066, -118.114123642445

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found


Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings

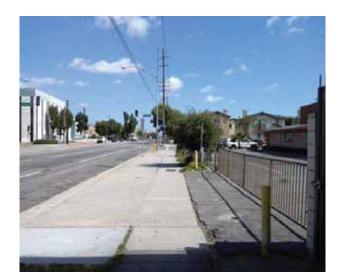

Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	480622	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East of Paramount Boulevard @ 33.965336979036, -118.114402592182

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	480630	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway East of Paramount Boulevard @ 33.965336979036, -118.114402592182

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 2.60 percent


Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

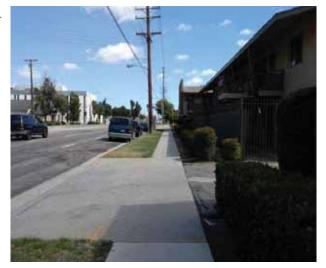

Code Reference ADA 206, 302,CA 11B-403.3

Record Number	480631	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East of Paramount Boulevard @ 33.965828605164, -118.114861249924

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	480628	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Driveway East of Paramount Boulevard @ 33.965828605164, -118.114861249924

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 2.50 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	480629	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East of Paramount Boulevard @ 33.966366943637, -118.115352094173

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	480394	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Driveway East of Paramount Boulevard @ 33.966366943637, -118.115352094173

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.50 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	480395	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East of Paramount Boulevard @ 33.966536007909, -118.115499615669

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	480396	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Driveway East of Paramount Boulevard @ 33.966536007909, -118.115499615669

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 2.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	480397	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East of Paramount Boulevard @ 33.966700622798, -118.115660548210

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	480398	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Driveway East of Paramount Boulevard @ 33.966700622798, -118.115660548210

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 5.80 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	480399	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East of Stamps Road @ 33.962120205836, -118.111529946327

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found


Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings

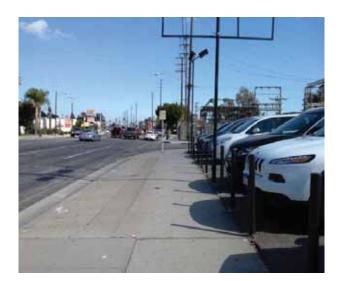

Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	480623	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East of Stamps Road @ 33.962275930715, -118.111682832241

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	480632	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East of Stamps Road @ 33.962551785516, -118.111913502216

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	480626	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East of Stamps Road @ 33.962580705726, -118.111951053143

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	480621	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East of Stamps Road @ 33.962647444633, -118.112007379532

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	480624	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Driveway East of Stamps Road @ 33.962647444633, -118.112007379532

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.50 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	480625	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East of Stamps Road @ 33.962798719297, -118.112109303474

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	480633	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Actual 003t \$0.00

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East of Stamps Road @ 33.962985587627, -118.112278282642

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	480634	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Driveway East of Stamps Road @ 33.962985587627, -118.112278282642

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.00 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	480635	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

South Side

Driveway East Ofparamount Boulevard @ 33.966211226247, -118.115220665932

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Record Number	480400	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Driveway East Ofparamount Boulevard @ 33.966211226247, -118.115220665932

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 5.20 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	480401	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Guy Wire East of Stamps Road @ 33.962478372632, -118.111827671528

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 60.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Progress

Record Number	480607	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0

Sidewalks : Missing Sidewalk

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk East of Paramount Boulevard - Continued @ 33.966122244753, - 118.115110695362

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 8.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	480605	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment Category_1 New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk East of Stamps Road @ 33.962763125283, -118.112061023712

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.00 percent for 125.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	480604	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Tree East of Birchbark Avenue @ 33.963472778130, -118.112720847130

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 77.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Record Number	480618	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2018
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Tree East of Birchbark Avenue @ 33.964064521746, -118.113251924515

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 74.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Record Number	480615	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2018
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Tree East of Manzanar Avenue @ 33.961112436510, -118.110462427139

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 57.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Record Number	480611	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2018
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Tree East of Paramount Boulevard @ 33.964945455744, -118.114059269428

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 40.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches


Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Record Number	480612	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2018
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	Category_1	New Value	0
Designated Staff			

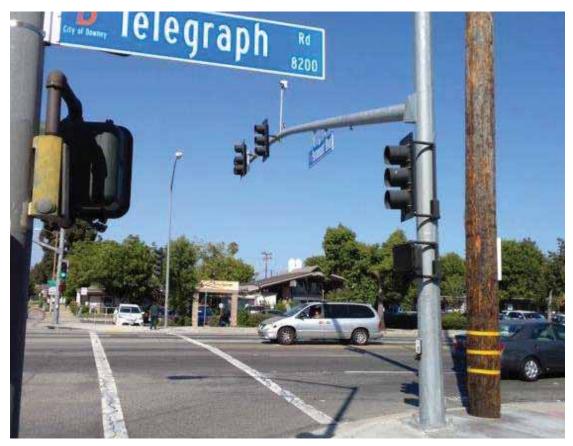

Telegraph Road - Paramount Boulevard to Lakewood Boulevard - South Side Only

Paramount Boulevard to Lakewood Boulevard Downey, CA 92040

Date of Inspection 8/14/2017

*Estimated Facility Total: \$16,100

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By


Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey

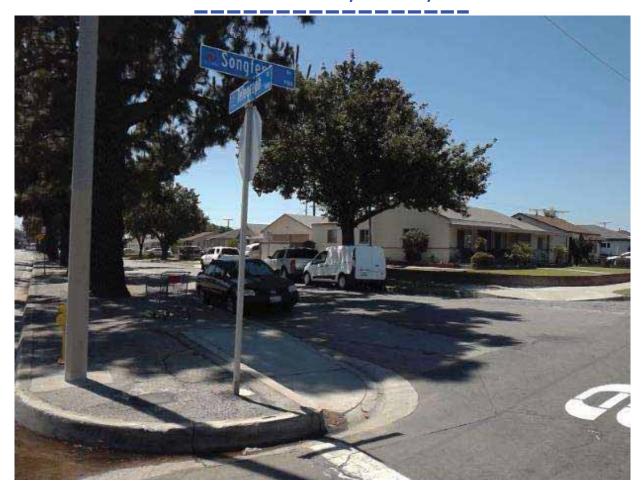

City of Downey Telegraph Road - Songfest Drive to True Avenue

Songfest Drive to True Avenue Downey, CA 90242

Date of Inspection 6/16/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change in Level East of Songfest Drive @ 33.952560377040, -118.098384439945

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	450813	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk East of Songfest Drive @ 33.952543690340, -118.098361641169

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 550.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	450810	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk East of Songfest Drive @ 33.952702770082, -118.098584264517

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.80 percent for 101.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

None

Progress

Assignment

Record Number	450812	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Designated Staff

New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk East of Songfest Drive @ 33.952866299298, -118.098816275597

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.70 percent for 58.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Record Number	450811	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Sidewalks - Exterior : Sidewalks

South Side @ 33.952866299298, -118.098816275597

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Record Number	450809	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			



Telegraph Road - Songfest Drive to True Avenue

Songfest Drive to True Avenue Downey, CA 90242

Date of Inspection 6/16/2017

*Estimated Facility Total: \$6,042

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Telegraph Road Bridge Over Rio Hondo

Telegraph Road Bridge Over Rio Hondo Downey, CA 90242

Date of Inspection 8/28/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Telegraph Road Bridge Over Rio Hondo

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West of City of Downey @ 33.972111603772, -118.120578378439

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 215.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Record Number	483299	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Telegraph Road Bridge Over Rio Hondo

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West of City of Downey @ 33.972322919784, -118.120772838593

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.60 percent for 68.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	483300	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side @ 33.972111603772, -118.120578378439

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Record Number	483298	Resolution	None
Progress	Not_Started	Priority	Five
Actual Date		Projected Date	06/30/2025
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			



Telegraph Road Bridge Over Rio Hondo

Telegraph Road Bridge Over Rio Hondo Downey, CA 90242

Date of Inspection 8/28/2017

*Estimated Facility Total: \$4,752

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using

