

Facilities Curb Ramp Schedule

Facility	Category	Description	Sub Description	Item	Finding	Recommendation	Progress	Resolution	12/31/17	Actual Completion Date
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Smallwood Avenue	Warning Sign	Parking Lot Warning Sign Wording Incorrect	There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the signage does not contain the correct wording and/or the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.	Provide a compliant warning sign regarding unauthorized use of accessible parking spaces in the parking lot. Fill in the blank spaces with are required to furnish point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Smallwood Avenue	Accessible Space next to Smallwood Avenue	No Van Accessible Signage	There is no additional signage marked "van accessible" at the van accessible parking space.	Van accessible parking spaces shall provide additional signage that states "van accessible" .	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Right Accessible Space next to Baseball Field 1	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Right Accessible Space next to Baseball Field 1	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Right Accessible Space next to Baseball Field 1	Outline is Faded, Damaged or Missing	The accessible parking space outline is faded, damaged, missing or otherwise not viewable.	Re-stripe the existing parking space marked as accessible to define the width of the space.	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Right Accessible Space next to Baseball Field 1	ISA is Faded or Damaged	ISA marking is faded and not viewable.	Repaint the ISA marking in the parking space.	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Baseball Field 1	Outline is Faded, Damaged or Missing	The accessible parking space outline is faded, damaged, missing or otherwise not viewable.	Re-stripe the existing parking space marked as accessible to define the width of the space.	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Baseball Field 1	Access Aisle is Faded or Damaged	The access aisle markings are faded, damaged, or otherwise not viewable.	Re-stripe the access aisle so as to discourage parking.	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Baseball Field 1	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Baseball Field 1	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Baseball Field 1	Parking Lot Warnings	There is no \$250.00 fine sign at the parking space.	Provide a \$250.00 fine sign at the parking space.	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Baseball Field 1	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Baseball Field 1	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Baseball Field 1	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Right Accessible Space next to Play Areas	Outline is Faded, Damaged or Missing	The accessible parking space outline is faded, damaged, missing or otherwise not viewable.	Re-stripe the existing parking space marked as accessible to define the width of the space.	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Right Accessible Space next to Play Areas	ISA is Faded or Damaged	ISA marking is faded and not viewable.	Repaint the ISA marking in the parking space.	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Right Accessible Space next to Play Areas	Access Aisle is Faded or Damaged	The access aisle markings are faded, damaged, or otherwise not viewable.	Re-stripe the access aisle so as to discourage parking.	Not_Started	None	6/30/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Right Accessible Space next to Play Areas	Parking Lot Warnings	There is no \$250.00 fine sign at the parking space.	Provide a \$250.00 fine sign at the parking space.	Not_Started	None	6/30/18	

Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Right Accessible Space next to Play Areas	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Right Accessible Space next to Play Areas	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Right Accessible Space next to Play Areas	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	6/30/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Right Accessible Space next to Play Areas	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Play Areas	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Play Areas	Parking Lot Warnings	There is no \$250.00 fine sign at the parking space.	Provide a \$250.00 fine sign at the parking space.	Not_Started	None	6/30/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Play Areas	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Play Areas	No Van Accessible Signage	There is no additional signage marked "van accessible" at the van accessible parking space.	Van accessible parking spaces shall provide additional signage that states "van accessible" .	Not_Started	None	6/30/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Play Areas	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Play Areas	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	6/30/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Play Areas	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Play Areas	Outline is Faded, Damaged or Missing	The accessible parking space outline is faded, damaged, missing or otherwise not viewable.	Re-stripe the existing parking space marked as accessible to define the width of the space.	Not_Started	None	6/30/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Play Areas	ISA is Faded or Damaged	ISA marking is faded and not viewable.	Repaint the ISA marking in the parking space.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Left Accessible Space next to Play Areas	Access Aisle is Faded or Damaged	The access aisle markings are faded, damaged, or otherwise not viewable.	Re-stripe the access aisle so as to discourage parking.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Center Accessible Space next to Play Areas	Outline is Faded, Damaged or Missing	The accessible parking space outline is faded, damaged, missing or otherwise not viewable.	Re-stripe the existing parking space marked as accessible to define the width of the space.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Center Accessible Space next to Play Areas	ISA is Faded or Damaged	ISA marking is faded and not viewable.	Repaint the ISA marking in the parking space.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Center Accessible Space next to Play Areas	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Center Accessible Space next to Play Areas	Parking Lot Warnings	There is no \$250.00 fine sign at the parking space.	Provide a \$250.00 fine sign at the parking space.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Parking	Parking Lot next to Rives Avenue	Center Accessible Space next to Play Areas	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Curb Ramps	Curb Ramp at the Left & Center Accessible Space next to Play Areas		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Curb Ramps	Curb Ramp at the Left & Center Accessible Space next to Play Areas		Curb Ramp Slope	The running slope is greater than allowed.	Provide a compliant curb ramp.	Not_Started	None	12/31/18

Apollo Park - 12544 Rives Avenue Downey, CA 90242	Curb Ramps	Curb Ramp at the Left & Center Accessible Space next to Play Areas		Side Flare Slope	The slope of the curb ramp side flare is greater than allowed.	Provide curb ramp side flares with a compliant slope.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Curb Ramps	Curb Ramp at the Left & Center Accessible Space next to Play Areas	Bottom Landing	Bottom Landing Change in Level	The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.	Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Curb Ramps	Curb Ramp next to the Right Accessible Space next to Play Areas		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Curb Ramps	Curb Ramp next to the Right Accessible Space next to Play Areas		Appurtenances	Utilities, gratings or other appurtenances are located on the curb ramp.	Provide a compliant curb ramp free of appurtenances.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Path of Travel	Walkway from Fitness Zone to Play Areas	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Path of Travel	Walkway from Fitness Zone to Play Areas	Exterior Walkway	Sidewalk Width	The width of the path of travel is insufficient.	Widen the primary path of travel to provide the correct width.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Path of Travel	Path of Travel from the Accessible Space next to Smallwood Avenue	Vehicular Traffic	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Path of Travel	Path of Travel from the Accessible Space next to Smallwood Avenue	Exterior Walkway	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Path of Travel	Sidewalk around Restroom Building next to Baseball Field 1	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Path of Travel	Walkway from the Public Right of Way next to Volleyball Courts	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Path of Travel	Walkway from Picnic Area next to Baseball Field 1 to Play Areas	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Path of Travel	Sidewalk from the Accessible Spaces next to Baseball Field 1 to Restroom Building	Vehicular Traffic	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Path of Travel	Sidewalk from the Accessible Spaces next to Baseball Field 1 to Restroom Building	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Path of Travel	Sidewalk from the Accessible Spaces next to Baseball Field 1 to Restroom Building	Exterior Walkway	Sidewalk Width	The width of the path of travel is insufficient.	Widen the primary path of travel to provide the correct width.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Path of Travel	Sidewalk from the Accessible Spaces next to Baseball Field 1 to Restroom Building	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Path of Travel	Sidewalk from the Right Accessible Space next to Play Areas	Vehicular Traffic	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Path of Travel	Sidewalk from the Right Accessible Space next to Play Areas	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Path of Travel	Walkway from Baseball Field 2 to Baseball Field 1	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Path of Travel	Sidewalk from the Public Right of Way next to Play Areas	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Path of Travel	Sidewalk from the Public Right of Way next to Play Areas	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	12/31/18

Apollo Park - 12544 Rives Avenue Downey, CA 90242	Doors	Baseball Field 1 Dugout next to 1st Base	Push / Pull	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Doors	Baseball Field 2 Entrance in Dugout next to 1st Base		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Doors	Baseball Field 2 Dugout next to 1st Base		Doorway Opening Width	The clear opening width of the doorway is not compliant.	Provide a compliant doorway at the location.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Doors	Baseball Field 2 Entrance in Dugout next to 3rd Base		Doorway Opening Width	The clear opening width of the doorway is not compliant.	Provide a compliant doorway at the location.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Doors	Mens Restroom next to Play Areas	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Doors	Mens Restroom next to Play Areas	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Doors	Mens Restroom next to Play Areas	Finger Pull - 1.5	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Doors	Mens Restroom next to Play Areas	Finger Pull - 1.5	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Doors	Womens Restroom next to Play Areas	Finger Pull - 1.5	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Doors	Womens Restroom next to Play Areas	Finger Pull - 1.5	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Signage	Directional Signage from the Public Right of Way on Imperial Highway		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Signage	Directional Signage from the Public Right of Way on Rives Avenue		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Signage	Baseball Field 2 Entrance in Dugout next to 1st Base, Baseball Field 2 Entrance in Dugout next to 3rd Base		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Signage	Baseball Field 2 Dugout next to 1st Base		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Telephones	Payphone next to Baseball Field 1		Highest Operable Parts	The highest operable part of the public telephone exceeds allowed maximum reach range.	Contact the telephone company that owns the public telephone regarding the height of all the operating devices on the telephone.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1		No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1		Compartment Door Swings In	The door to the compartment swings inward into the minimum required compartment area.	Modify the swing of the door so that it does not swing into the minimum required compartment area.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	12/31/18

Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1		Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1		Compartment Door Handle Height	The compartment door hardware is not at a compliant height.	Remove and relocate the door hardware.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1		Compartment Door Width	The clear opening width of the doorway to the compartment is less than required.	Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1		Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Female	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Paper Towel	Dispenser Operation	The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.	Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1		Clear Space in Front of Compartment	The approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction does not meet the minimum required clearance.	Provide clearance between the door side of the compartment and any obstruction that meets the minimum required clearance.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1		Toilet Compartment Length	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1		No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	12/31/18

Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Compartment Door Width	The clear opening width of the doorway to the compartment is less than required.	Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Toilet Compartment Door	The compartment door is located in front of the water closet.	Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Baseball Field 1	Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1	Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1	Urinal Rim Height	The height of the urinal rim in the restroom is greater than 17 inches above the finished floor.	Lower the urinal designated to be accessible in the restroom so that the rim height is not more than 17 inches above the finished floor.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1	Male	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1	No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Baseball Field 1	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Play Areas	Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	12/31/18	

Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Play Areas		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Play Areas		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Play Areas		Rear Grab Bar Length	The length of the rear grab bar is less than required.	Replace the rear grab bar with a compliant grab bar.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Play Areas		Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Play Areas		Rear Grab Bar Interferes	Rear grab bar interferes with the tank/flushometer.	Readjust the rear grab bar so that it does not interfere with the tank/flushometer.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Play Areas		Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Play Areas		Toilet Paper Dispenser Interferes with Grab Bar	The toilet paper dispenser interferes with the use of the grab bar.	Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Play Areas		Toilet Paper Dispenser Above Grab Bar	The toilet paper dispenser is located above the provided grab bar.	Remount the dispenser below the grab bar at 19" minimum.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Play Areas		Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Play Areas	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Mens Restroom next to Play Areas	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Play Areas	Lavatory	Lavatory Surface Height	The height of the counter surface is greater than allowed.	Relocate or replace the lavatory to provide a maximum counter surface height of no greater than recommended.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Play Areas	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Play Areas	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Play Areas		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Play Areas		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Play Areas		Seat Cover Dispenser	Seat cover dispenser interferes with use of grab bar.	Move the seat cover dispenser so it does not interfere with the use of the grab bars.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Play Areas		Compartment Door Swings In	The door to the compartment swings inward into the minimum required compartment area.	Modify the swing of the door so that it does not swing into the minimum required compartment area.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Play Areas		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Play Areas		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	12/31/18

Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Play Areas	Rear Grab Bar Length	The length of the rear grab bar is less than required.	Replace the rear grab bar with a compliant grab bar.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Play Areas	Rear Grab Bar Interferes	Rear grab bar interferes with the tank/flushometer.	Readjust the rear grab bar so that it does not interfere with the tank/flushometer.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Play Areas	Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Play Areas	Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Play Areas	Toilet Paper Dispenser Interferes with Grab Bar	The toilet paper dispenser interferes with the use of the grab bar.	Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Restrooms	Womens Restroom next to Play Areas	Toilet Paper Dispenser Above Grab Bar	The toilet paper dispenser is located above the provided grab bar.	Remount the dispenser below the grab bar at 19" minimum.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Drinking Fountains	Drinking Fountain next to Small Baseball Field	Drinking Fountain	The drinking fountain is not on accessible route.	Make sure the drinking fountain is on an accessible route.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Drinking Fountains	Drinking Fountain next to Small Baseball Field	Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Drinking Fountains	Drinking Fountain next to Small Baseball Field	Clear Floor Space Length	There is insufficient clear floor space in front of the drinking fountain.	Provide the required clear floor space that is on a primary path of travel.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Drinking Fountains	Drinking Fountain next to Small Baseball Field	Fountain Depth	Drinking fountain does not provide a required fountain depth.	Install a drinking fountain the meets the required minimum depth.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Drinking Fountains	Drinking Fountain next to Small Baseball Field	No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Drinking Fountains	Drinking Fountain next to Baseball Field 1	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Drinking Fountains	Drinking Fountain next to Baseball Field 1	Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space at the drinking fountain.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Drinking Fountains	Drinking Fountain next to Baseball Field 1	No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Outdoor Sports Areas	Baseball Field 1	Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Outdoor Sports Areas	Baseball Field 2	Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Outdoor Sports Areas	Small Baseball Field	Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	12/31/18	
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Play Area	Large Play Area	Elevated Equipment - Fibar	Platform Height	The transfer platform height is not compliant.	Provide compliant platform with recommended value at the transfer point.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Play Area	Large Play Area	Elevated Equipment - Fibar	Transfer Platform	The transfer platform is not located on shortest route from the play areas accessible point of access.	The transfer platform shall be located on the shortest route from the play areas accessible point of access.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue Downey, CA 90242	Play Area	Small Play Area	Change In Level	Change in Level	There is a change in level greater than allowed on the path of travel.	Provide a smooth transition.	In_Progress	None	12/31/18

Apollo Park - 12544 Rives Avenue										
Downey, CA 90242	Picnic Areas	Picnic Area next to Play Areas			At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue										
Downey, CA 90242	Picnic Areas	Picnic Area next to Fitness Zone			At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue										
Downey, CA 90242	Picnic Areas	Picnic Area next to Fitness Zone			Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue										
Downey, CA 90242	Picnic Areas	Picnic Tables next to Volleyball Courts			Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue										
Downey, CA 90242	Picnic Areas	Picnic Tables next to Volleyball Courts			At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue										
Downey, CA 90242	Picnic Areas	Picnic Area next to Restroom Building			At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue										
Downey, CA 90242	Picnic Areas	Picnic Tables next to Small Baseball Field			Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue										
Downey, CA 90242	Picnic Areas	Picnic Tables next to Small Baseball Field			At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue										
Downey, CA 90242	Reach Ranges	Apollo Park Walking Trail	Pet Waste Bag Dispenser	Reach Depth	Element reach depth is not compliant.		Make sure that the element is within allowed reach range with recommended reach depth.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue										
Downey, CA 90242	Reach Ranges	Apollo Park Walking Trail	Pet Waste Bag Dispenser	Element Highest Point of Operation	The highest point of operation for the element is not compliant.		Make sure that the highest point of operation is within the recommended value.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue										
Downey, CA 90242	Benches	Bench in Baseball Field 1 Dugout next to 1st Base			Clear Floor Space Width	Clear floor space width is not compliant for the bench.	Provide compliant clear floor space at the bench.	Not_Started	None	12/31/18
Apollo Park - 12544 Rives Avenue										
Downey, CA 90242	Benches	Benches in Baseball Field 2 Dugouts			Clear Floor Space	No clear floor space provided at the bench.	Provide compliant clear floor space for the bench at one end.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive										
Downey, CA 90240	Parking	Main Parking Lot	1st Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.		Pave the parking lot to provide a level surface.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive										
Downey, CA 90240	Parking	Main Parking Lot	1st Accessible Space From Left	Access Aisle Slope	The access aisle exceeds maximum slope.		Pave the parking lot to provide a level surface.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive										
Downey, CA 90240	Parking	Main Parking Lot	1st Accessible Space From Left	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.		Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive										
Downey, CA 90240	Parking	Main Parking Lot	1st Accessible Space From Left	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.		Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive										
Downey, CA 90240	Parking	Main Parking Lot	3rd Accessible Space From Left	Access Aisle Width	The access aisle does not meet the minimum required width.		Re-stripe the access aisle to meet the minimum required width and length for the space type.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive										
Downey, CA 90240	Parking	Main Parking Lot	3rd Accessible Space From Left	Access Aisle Slope	The access aisle exceeds maximum slope.		Pave the parking lot to provide a level surface.	Not_Started	None	12/31/18

Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Parking	Main Parking Lot	3rd Accessible Space From Left	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Parking	Main Parking Lot	2nd Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Parking	Main Parking Lot	4th Accessible Space From Left	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Parking	Main Parking Lot	4th Accessible Space From Left	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Parking	Parking Lot next to Apollo Park	Center Accessible Space	Access Aisle Width	The access aisle does not meet the minimum required width.	Re-stripe the access aisle to meet the minimum required width and length for the space type.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Parking	Parking Lot next to Apollo Park	Right Accessible Space	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Curb Ramps	Curb Ramp from Apollo Park		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Curb Ramps	Curb Ramp from Apollo Park	Bottom Landing	Bottom Landing Slope	The slope at the bottom landing is greater than allowed.	Provide a compliant bottom landing that does not exceed the maximum slope requirements.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Curb Ramps	Curb Ramp at the Main Entrance		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Curb Ramps	Curb Ramp at the Main Entrance		Curb Ramp Slope	The running slope is greater than allowed.	Provide a compliant curb ramp.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Curb Ramps	Curb Ramp at the Main Entrance	Bottom Landing	Bottom Landing Slope	The slope at the bottom landing is greater than allowed.	Provide a compliant bottom landing that does not exceed the maximum slope requirements.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Path of Travel	Sidewalk to Gallatin B Room Entrance	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Path of Travel	Sidewalk from Rives Avenue to Rio San Gabriel Room Entrance	Vehicular Traffic	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Path of Travel	Sidewalk from Rives Avenue to Rio San Gabriel Room Entrance	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Path of Travel	Sidewalk from Rives Avenue to Rio San Gabriel Room Entrance	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	12/31/18

Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Path of Travel	Sidewalk from Accessible Spaces to Main Entrance	Access Aisle	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Path of Travel	Sidewalk from Accessible Spaces to Main Entrance	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Path of Travel	Sidewalk from Rives Avenue to Entrance next to Office B	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Path of Travel	Sidewalk from Atrium Gate to Entrance	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Path of Travel	Sidewalk from Entrance next to Office B to Auditorium Entrance	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Path of Travel	Sidewalk from Park Accessible Spaces	Access Aisle	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Path of Travel	Sidewalk from Park Accessible Spaces	Exterior Walkway	Sidewalk Width	The width of the path of travel is insufficient.	Widen the primary path of travel to provide the correct width.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Path of Travel	Sidewalk from Quill Drive to Main Entrance	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Path of Travel	Sidewalk from Quill Drive to Main Entrance	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Path of Travel	Backstage	Lighting Control Panel	Protruding Objects - Protrusion Limit	The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.	Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Ramps	Ramp to Backstage Hallway Entrance	Run 1 Bottom Landing	Landing Change in Level	There is a change in elevation greater than allowed on the primary path of travel of the ramp that is not beveled.	Bevel the area or resurface the area to provide a smooth and level path of travel.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Ramps	Ramp to Backstage Hallway Entrance	Run 1 Left Handrail	Handrail Interrupted	The gripping surface of the handrails are interrupted by posts, or by a lack of smooth connections.	Replace the handrails on each side to provide a smooth and continuous gripping surface. The gripping surface shall be smooth and free from interruptions.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Platform Lifts	Platform Lift in Auditorium		Signage	There is no ISA symbol found at the platform lift.	Provide a compliant ISA symbol to the platform lift.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Platform Lifts	Platform Lift in Auditorium		Light in Car	There is no light in the car.	Provide a light in the car.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Platform Lifts	Platform Lift in Auditorium		Lowering device	Lift device is not red or orange or does not have use instructions.	Make sure that the lowering device is red or orange and has use instructions.	Not_Started	None	12/31/18

Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Platform Lifts	Platform Lift in Auditorium		Platform is located in a pit	Platform is not located in a pit.	Please make sure that the platform is located in a pit.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Platform Lifts	Platform Lift in Auditorium	Bottom Landing - Bottom - Push/Pull - End	Landing Slope	The slope of the landing is not compliant.	Provide a compliant level landing at the platform lift.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Platform Lifts	Platform Lift in Auditorium	Bottom Landing - Bottom - Push/Pull - End	Latch Side Clearance from Pull Side	There is not enough latch side clearance from the pull side of the platform lift door.	Make sure there is enough latch side clearance from the pull side of the platform lift door.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Stairs	Stairs to Backstage Hallway Entrance	Run 1 Right Handrail	Handrail Near Wall	The surface texture of the wall adjacent to the handrail is sharp and abrasive.	Modify the surface texture on the wall adjacent to the handrail so that the surface is smooth.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Stairs	Stairs to Backstage Hallway Entrance	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Stairs	Stairs to Backstage Hallway Entrance	Run 1 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Stairs	Stairs to the Stage	Run 1 Left Handrail	Handrail Distance From Wall	The distance between the handrail and the wall on the stairway is less than required.	Remount the handrails on the stairway so that the distance from the handrail to the adjacent wall is compliant.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Atrium Gate	Push Bar Only	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Downey Room, Auditorium	Push Bar / Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Downey Room, Auditorium	Push Bar / Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Gallatin A Room	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Gallatin A Room	Push Bar / Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Gallatin A Room	Push Bar / Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Entrance next to Office B, Entrance next to Kitchen, Entrance next to Library	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Gallatin A Room Entrance, Gallatin B Room Entrance	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/18

Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Gallatin A Room Entrance, Gallatin B Room Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Parks and Recreation Manager	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Parks and Recreation Manager	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Parks and Recreation Manager	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Parks and Recreation Manager	Lever	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Parks and Recreation Manager	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Coordinator	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Coordinator	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Coordinator	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Coordinator	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Coordinator	Lever	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Coordinator	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Backstage Hallway	Push Bar / Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Specialist	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Specialist	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	12/31/18

Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Specialist	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Specialist	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Specialist	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Office A, Office B, Coordinator Back Office	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Office A, Office B, Coordinator Back Office	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Office A, Office B, Coordinator Back Office	Lever	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Office A, Office B, Coordinator Back Office	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Backstage Hallway Entrance	Push Bar / Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Backstage Hallway Entrance	Push Bar / Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Backstage Hallway Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Gallatin B Room	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Gallatin B Room	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Gallatin B Room	Push Bar / Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Backstage	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Backstage	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	12/31/18

Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Backstage	Push Bar / Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Downey Room Entrance, Auditorium Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Crawford Room, Rives Room Library	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Crawford Room, Rives Room Library	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Crawford Room, Rives Room Library	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Rio Hondo Room	Lever	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Rio Hondo Room	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Rio Hondo Room		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Kitchen Unisex Restroom	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Kitchen Unisex Restroom	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Kitchen Unisex Restroom	Lever	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Kitchen Yard	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Kitchen Yard	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Kitchen Yard	Lever	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Kitchen Yard	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18

Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Kitchen	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Kitchen	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Kitchen	Lever	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Rio San Gabriel Room Entrance	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Rio San Gabriel Room Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Rio San Gabriel Room, Rio Hondo Room	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Rio San Gabriel Room, Rio Hondo Room	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Rio San Gabriel Room, Rio Hondo Room	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Mens Restroom next to Lobby	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Rio San Gabriel Room Courtyard Entrance	Push Bar / D Handle	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Right Kitchen Entrance	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Kitchen Entrance	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Doors	Kitchen Entrance	Lever	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Directional Signage from Quill Drive		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Backstage Hallway		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/18

Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Backstage	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Downey Room, Auditorium	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Coordinator, Parks and Recreation Manager, Specialist	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Rives Room Library	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Entrance next to Office B, Entrance next to Kitchen, Entrance next to Library	No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Office A, Office B, Coordinator Back Office	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Gallatin A Room Entrance, Gallatin A Room Entrance	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Crawford Room	Highest Tactile Character Height	Highest line of tactile characters are not at a compliant height.	Provide compliant signage at the location.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Main Entrance	No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Rio San Gabriel Room	Highest Tactile Character Height	Highest line of tactile characters are not at a compliant height.	Provide compliant signage at the location.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Rio Hondo Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Kitchen Entrance	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Right Kitchen Entrance	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Kitchen	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Signage	Hallway next to Kitchen	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/18

Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Public Telephones	Payphone next to Main Lobby		Highest Operable Parts	The highest operable part of the public telephone exceeds allowed maximum reach range.	Contact the telephone company that owns the public telephone regarding the height of all the operating devices on the telephone.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Mens Restroom next to Lobby		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Kitchen Unisex Restroom		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Kitchen Unisex Restroom		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Kitchen Unisex Restroom		Rear Grab Bar Length	The length of the rear grab bar is less than required.	Replace the rear grab bar with a compliant grab bar.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Kitchen Unisex Restroom		Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Kitchen Unisex Restroom		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Kitchen Unisex Restroom		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Kitchen Unisex Restroom		Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby - Alternate		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby - Alternate		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby - Alternate		Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby - Alternate		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	12/31/18

Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby - Alternate		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby - Alternate		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Kitchen Unisex Restroom		No Door Privacy Lock and Occupied Indicator	The restroom door does not provide a compliant privacy lock with occupancy indicator.	Install a compliant privacy lock with occupancy indicator to the door.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Kitchen Unisex Restroom		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Kitchen Unisex Restroom	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Feminine Products	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby - Standard		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby - Standard		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby - Standard		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby - Standard		Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby - Standard		Rear Grab Bar Length	The length of the rear grab bar is less than required.	Replace the rear grab bar with a compliant grab bar.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby - Standard		Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	12/31/18

Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby - Standard		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Womens Restroom next to Lobby - Standard		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Mens Restroom next to Lobby		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Mens Restroom next to Lobby		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Mens Restroom next to Lobby		Rear Grab Bar Length	The length of the rear grab bar is less than required.	Replace the rear grab bar with a compliant grab bar.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Mens Restroom next to Lobby		Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Mens Restroom next to Lobby		Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Mens Restroom next to Lobby		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Restrooms	Mens Restroom next to Lobby		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Drinking Fountains	Drinking Fountain in Gallatin B Room		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Kitchen		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Kitchen		Unstable floor mat	An unstable floor mat is provided within the drinking fountain clear floor space.	Provide a compliant floor mat.	Not_Started	None	12/31/18
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Food Service	Multipurpose Room		Minimum Required Seating	There is less than the required percentage of accessible tables/seating provided.	Provide the minimum required percentage of the total seating capacity with accessible seating.	Not_Started	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Food Service	Multipurpose Room	Service Counter	Tray Slide Height	The height of the tray slides is greater than required.	Lower the tray slides to a height no greater than required.	Not_Started	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Food Service	Multipurpose Room	Table	Table Knee Clearance	The knee space at the table is less than required.	Modify or replace one or more of the tables in the food service area to meet the required minimum accessible seating.	Not_Started	None	6/30/19

Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Break/Conference Room	Downey Room		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Break/Conference Room	Downey Room		Supply Lines	Supply lines are not wrapped for the break/conference room sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Break/Conference Room	Downey Room		Tables - Knee Clearance	The table knee clearance does not meet required standards.	Provide compliant tables.	Not_Started	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Break/Conference Room	Downey Room	Paper Towel	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Gallatin A Room Entrance		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Gallatin A Room Entrance		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Gallatin A Room Entrance	Paper Towel	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Kitchen		Sink - Knee Clearance	Sink knee clearance does not meet the standards.	Provide compliant sink.	Not_Started	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Kitchen		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Kitchen	Paper Towel	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Kitchen	Soap	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Rio Hondo Room - Child		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Rio Hondo Room - Child		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Rio Hondo Room - Child	Paper Towel	Sink	The height of the controls and operating mechanisms for the dispenser are greater than the allowed maximum height for the primary age group.	Relocate the dispenser to meet the required height for the primary age group.	Not_Started	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Rio Hondo Room - Child	Soap	Sink	The height of the controls and operating mechanisms for the dispenser are greater than the allowed maximum height for the primary age group.	Relocate the dispenser to meet the required height for the primary age group.	Not_Started	None	6/30/19

Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Rio San Gabriel Room		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Rio San Gabriel Room		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Rio San Gabriel Room	Paper Towel	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Rio Hondo Room - Adult		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Rio Hondo Room - Adult		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Rio Hondo Room - Adult	Paper Towel	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Kitchen Service		Sink - Counter Height	Sink counter height is not compliant.	Provide compliant sink.	Not_Started	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Kitchen Service		Sink - Knee Clearance	Sink knee clearance does not meet the standards.	Provide compliant sink.	Not_Started	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Kitchen Service		Toe Clearance	There is not enough toe clearance at the sink.	Provide minimum required toe clearance.	Not_Started	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Kitchen Service		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Kitchen Service		Toe Kick Not Removed	The toe kick for the sink is not removed.	Make sure there is no toe kick at the sink.	Not_Started	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Kitchen Service		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Sinks	Kitchen Service	Paper Towel	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Reach Ranges	Parking Lot next to Apollo Park	Electric Vehicle Charging Station	Element Highest Point of Operation	The highest point of operation for the element is not compliant.	Make sure that the highest point of operation is within the recommended value.	In_Progress	None	6/30/19
Barbara J Riley Community Center - 7810 Quill Drive Downey, CA 90240	Reach Ranges	Rives Room Library	Computer	Knee Height	The knee height is not compliant.	Adjust knee height to the recommended value.	Not_Started	None	6/30/19

Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Path of Travel	Left Sidewalk from Brookshire Avenue	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/19
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Path of Travel	Center Sidewalk from Brookshire Avenue	Exterior Walkway	Sidewalk Width	The width of the path of travel is insufficient.	Widen the primary path of travel to provide the correct width.	Not_Started	None	6/30/19
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Signage	Directional Signage from Brookshire Avenue		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/19
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Signage	Directional Signage from Bellder Drive		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/19
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Play Area		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/19
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Play Area		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/19
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Play Area		Clear Floor Space Length	There is insufficient clear floor space in front of the drinking fountain.	Provide the required clear floor space that is on a primary path of travel.	Not_Started	None	6/30/19
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Play Area	Play Area		Average Depth of Surface Material	The average depth of the surface material for the play area is not compliant.	Provide compliant surface material at the play area.	Not_Started	None	6/30/19
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Picnic Areas	Covered Picnic Areas		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/19
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Picnic Areas	Covered Picnic Areas		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/19
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Picnic Areas	Picnic Tables next to Play Area		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/19
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Picnic Areas	Picnic Tables next to Play Area		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/19

Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Reach Ranges	Covered Picnic Areas	Barbecue Grill	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/19	
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Reach Ranges	Covered Picnic Areas	Trash Receptacle	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/19	
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Reach Ranges	Park	Pet Waste Bag Dispenser	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/19	
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Reach Ranges	Park	Pet Waste Bag Dispenser	Element Highest Point of Operation	The highest point of operation for the element is not compliant.	Make sure that the highest point of operation is within the recommended value.	Not_Started	None	6/30/19	
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Reach Ranges	Park	Trash Receptacle	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/19	
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Benches	Benches next to Play Area		On Accessible Route	The bench is not on an accessible route.	Provide a compliant accessible route to the benches.	Not_Started	None	6/30/19	
Brookshire Childrens Park - 12520 Brookshire Avenue Downey, CA 90240	Benches	Benches next to Play Area		Clear Floor Space	No clear floor space provided at the bench.	Provide compliant clear floor space for the bench at one end.	Not_Started	None	6/30/19	
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Path of Travel	Sidewalk from 2nd Street to the Main Entrance	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/19	
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Path of Travel	Sidewalk from Brookshire Avenue to Patio Entrance	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/19	
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Path of Travel	Sidewalk around Patio	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/19	
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Path of Travel	Hallway Door next to Restrooms	Mirror	Protruding Objects - Protrusion Limit	The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.	Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.	In_Progress	None	6/30/19	
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Patio Gate	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/19	
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Patio Gate	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/19	
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Patio Gate	Push Bar Only	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/19	

Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Patio Gate	Push Bar Only	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Hallway Entrance, Conference Room Entrance		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Hallway Entrance, Conference Room Entrance	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Hallway Entrance, Conference Room Entrance	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Hallway Entrance, Conference Room Entrance	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Hallway Entrance, Conference Room Entrance	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Hallway Entrance, Conference Room Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom next to Lobby		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom next to Lobby	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom next to Lobby	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom next to Lobby	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom next to Lobby	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom next to Lobby	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom next to Lobby	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom next to Lobby	Single Knob	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/19

Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Small Business Development Center		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Small Business Development Center	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Small Business Development Center	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Hallway next to Restrooms		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Hallway next to Restrooms	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Hallway next to Restrooms	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Hallway next to Restrooms	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom next to Lobby		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom next to Lobby	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom next to Lobby	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom next to Lobby	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom next to Lobby	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom next to Lobby	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom next to Lobby	Single Knob	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Executive Director		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/19

Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Executive Director	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Kitchen in Hallway		Pocket Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and provide a compliant door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Kitchen in Hallway	Finger Pull - 1.5	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Kitchen in Conference Room	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Kitchen in Conference Room	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Conference Room		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Conference Room	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Work Room, File Room		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Work Room, File Room	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Doors	Work Room, File Room	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Signage	Directional Signage From The Public Right Of Way		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Signage	Conference Room		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Signage	Small Business Development Center		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Signage	Work Room, File Room		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Signage	Hallway next to Restrooms		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/19

Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Signage	Kitchen		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Signage	Hallway Entrance, Conference Room Entrance		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Signage	Main Entrance		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Signage	Executive Director		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Lavatory	Lavatory Control Type	The faucet controls on the lavatory require tight grasping, pinching, or twisting of the wrist and are not accessible.	Install accessible faucet controls. Lever-operated, push-type, touch-type or electronically controlled mechanisms are acceptable elements. If self-closing valves are used the faucet shall remain open for at least 10 seconds.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Lavatory	Lavatory Clear Floor Space Length	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Male	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/19

Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Toilet Clear Floor Space Length	There is not a minimum of 56 inches of clearance around the water closet measured perpendicular from the rear wall.	Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Lobby	Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Toilet Clear Floor Space Length	There is not a minimum of 56 inches of clearance around the water closet measured perpendicular from the rear wall.	Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	6/30/19

Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby		Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Lavatory	Lavatory Control Type	The faucet controls on the lavatory require tight grasping, pinching, or twisting of the wrist and are not accessible.	Install accessible faucet controls. Lever-operated, push-type, touch-type or electronically controlled mechanisms are acceptable elements. If self-closing valves are used the faucet shall remain open for at least 10 seconds.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Lavatory	Lavatory Clear Floor Space Length	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby	Female	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Lobby		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Kitchen		Sink - Counter Height	Sink counter height does not meet the standards.	Provide compliant sink.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Kitchen		Toe Kick Not Removed	The toe kick for the sink in break/conference room is not removed.	Remove the toe kick for the sink.	Not_Started	None	6/30/19

Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Kitchen		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Kitchen		Clear Floor Space Length	There is not enough clear floor space at the sink.	Provide enough clear floor space at the location.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Kitchen		Clear Floor Space Width	There is not enough clear floor space at the sink.	Provide enough clear floor space at the location.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Kitchen		Supply Lines	Supply lines are not wrapped for the break/conference room sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Kitchen	Paper Towel	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Kitchen	Refrigerator	Reach Height	Appliance Reach Height in the break/conference room is not compliant.	Make sure that the specified appliance reach height is compliant.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Kitchen	Other	Reach Height	Appliance Reach Height in the break/conference room is not compliant.	Make sure that the specified appliance reach height is compliant.	Not_Started	None	6/30/19
Chamber of Commerce - 11131 Brookshire Avenue Downey, CA 90240	Picnic Areas	Picnic Table		Clear Floor Space Slope	The slope of the clear floor space at the table is not compliant.	Provide compliant clear floor space at the table.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Parking	Parking Lot Next To Police Department		Less Than Minimum Required Parking Spaces	There are not enough accessible parking spaces marked in the parking lot and therefore does not meet the minimum number required.	Re-stripe any existing parking spaces marked accessible and create additional accessible parking spaces. Designate one parking space as "van-accessible".	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Parking	Parking Lot Next To Police Department	Warning Sign	Parking Lot Warning Sign Wording Incorrect	There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the signage does not contain the correct wording and/or the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.	Provide a compliant warning sign regarding unauthorized use of accessible parking spaces in the parking lot. Fill in the blank spaces with are required to furnish point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Parking	Parking Lot Next To Police Department	Right Accessible Space	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Parking	Parking Lot Next To Police Department	Right Accessible Space	Outline is Faded, Damaged or Missing	The accessible parking space outline is faded, damaged, missing or otherwise not viewable.	Re-stripe the existing parking space marked as accessible to define the width of the space.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Parking	Parking Lot Next To Police Department	Right Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Parking	Parking Lot Next To Police Department	Left Accessible Space	Must Travel Behind Parked Cars	The location of the accessible parking spaces requires individuals with disabilities to travel behind parked cars other than their own.	Stripe an access aisle at the head of the accessible parking spaces, install a wheel stop at the head of the accessible parking spaces and at the general parking spaces. Wheel stops shall be used to prevent vehicles from encroaching into access aisles or walkways, but shall not present additional encroachment into those areas.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Parking	Parking Lot Next To Police Department	Left Accessible Space	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Parking	Parking Lot Next To Police Department	Left Accessible Space	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Parking	Parking Lot Next To Police Department	Center Accessible Space	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/19

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Parking	Parking Lot Next To Police Department	Center Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Parking	Parking Lot Next To Police Department	Center Accessible Space	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Path of Travel	Mens Restroom Next To Credit Union	Shelf	Protruding Objects - Protrusion Limit	The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.	Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.	In_Progress	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Path of Travel	Break Room 223	Floor Mat	Mat or Runner	The mats or carpet runners do not adhere to the underlying floor surface and slip, thereby creating a hazardous path of travel.	Securely fasten the mats or carpet runners or replace with a mat or carpet runner that grips to the underlying floor surface to provide a firm, stable, continuous and relatively smooth path of travel surface. Mats or carpet runners along the primary path of travel shall provide beveled edges on all sides to prevent roll over.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Path of Travel	Mens Restroom Next To Council Office	Shelf	Protruding Objects - Protrusion Limit	The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.	Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.	In_Progress	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Path of Travel	Womens Restroom Next To Information Technology	Shelf	Protruding Objects - Protrusion Limit	The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.	Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.	In_Progress	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Path of Travel	Path Of Travel From The Accessible Spaces Next To The Police Department	Access Aisle	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Left Elevator		Emergency System	An emergency two-way communication system provides voice-only communication.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Left Elevator		Emergency System	An emergency communication system is provided, though the controls and emergency equipment are not identified by accessible symbols.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Left Elevator		Emergency System	No signage is provided adjacent to the emergency communication controls.	Provide compliant signage adjacent to the emergency communication controls.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Left Elevator	Elevator	Control Button Braille Location	All call buttons are not identified with Braille to the left of the call buttons.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Left Elevator	Elevator	Control Button, Main Floor Indication	The main entrance floor is not identified with a star to the left of the call button.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Left Elevator	Elevator	Door	The reopening device for the elevator door does not remain open for the required amount of time.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Left Elevator	Elevator	Space between Car and Floor	The space between the elevator car and the floor is not compliant.	Decrease the width of the space between the elevator car and the floor to a compliant value.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Left Elevator		Direction Lantern	The hall direction lanterns do not provide a single audible signal for the up direction and a double audible signal for the down direction .	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Left Elevator		Jamb Marking	The raised characters on the hoist way entrance are less than the required height.	All elevator hoist way entrances shall have raised and Braille floor designations provided on both jambs. The center line of the characters shall be 60 in (1525 mm) above finish floor. Such characters shall be 2 in (50 mm) high	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Left Elevator		Elevator - Jamb Marking	Braille is not located immediately below the raised letters.	Make sure that braille is located immediately below the raised letters.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Left Elevator		Jamb Marking	The raised characters on the hoist way entrance are less than the required height.	All elevator hoist way entrances shall have raised and Braille floor designations provided on both jambs. The center line of the characters shall be 60 in (1525 mm) above finish floor. Such characters shall be 2 in (50 mm) high	Not_Started	None	6/30/19

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Left Elevator		Elevator - Jamb Marking	Braille is not located immediately below the raised letters.	Make sure that braille is located immediately below the raised letters.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Left Elevator		Elevator - Jamb Marking	Main floor is not indicated with a star.	Make sure that main floor is indicated with a star.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Left Elevator		Jamb Marking	The raised characters on the hoist way entrance are less than the required height.	All elevator hoist way entrances shall have raised and Braille floor designations provided on both jamps. The center line of the characters shall be 60 in (1525 mm) above finish floor. Such characters shall be 2 in (50 mm) high	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Left Elevator		Elevator - Jamb Marking	Braille is not located immediately below the raised letters.	Make sure that braille is located immediately below the raised letters.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Right Elevator		Emergency System	An emergency communication system is provided, though the controls and emergency equipment are not identified by accessible symbols.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Right Elevator		Emergency System	No signage is provided adjacent to the emergency communication controls.	Provide compliant signage adjacent to the emergency communication controls.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Right Elevator		Emergency System	An emergency two-way communication system provides voice-only communication.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Right Elevator	Elevator	Control Button Braille Location	All call buttons are not identified with Braille to the left of the call buttons.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Right Elevator	Elevator	Control Button, Main Floor Indication	The main entrance floor is not identified with a star to the left of the call button.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Right Elevator	Elevator	Emergency System	Emergency controls are not located at the compliant height.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Right Elevator	Elevator	Door	The reopening device for the elevator door does not remain open for the required amount of time.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Right Elevator		Direction Lantern	The hall direction lanterns do not provide a single audible signal for the up direction and a double audible signal for the down direction .	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Right Elevator		Jamb Marking	The raised characters on the hoist way entrance are less than the required height.	All elevator hoist way entrances shall have raised and Braille floor designations provided on both jamps. The center line of the characters shall be 60 in (1525 mm) above finish floor. Such characters shall be 2 in (50 mm) high	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Right Elevator		Elevator - Jamb Marking	Braille is not located immediately below the raised letters.	Make sure that braille is located immediately below the raised letters.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Right Elevator		Jamb Marking	The raised characters on the hoist way entrance are less than the required height.	All elevator hoist way entrances shall have raised and Braille floor designations provided on both jamps. The center line of the characters shall be 60 in (1525 mm) above finish floor. Such characters shall be 2 in (50 mm) high	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Right Elevator		Elevator - Jamb Marking	Braille is not located immediately below the raised letters.	Make sure that braille is located immediately below the raised letters.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Right Elevator		Jamb Marking	The raised characters on the hoist way entrance are less than the required height.	All elevator hoist way entrances shall have raised and Braille floor designations provided on both jamps. The center line of the characters shall be 60 in (1525 mm) above finish floor. Such characters shall be 2 in (50 mm) high	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Right Elevator		Elevator - Jamb Marking	Braille is not located immediately below the raised letters.	Make sure that braille is located immediately below the raised letters.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Elevators	Right Elevator		Elevator - Jamb Marking	Main floor is not indicated with a star.	Make sure that main floor is indicated with a star.	Not_Started	None	6/30/19

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs To Council Member Seating			Stairway is marked as primary access. There is no other means of vertical access.	Provide a compliant means of vertical access.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs To Council Member Seating	Run 1	Risers Height	The risers on the stairway are not a compliant height.	Modify or replace the stairs to provide compliant riser height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs To Council Member Seating	Run 1	Stair Run Width	The width of the stairway does not meet the minimum required width.	Install a stairway with a minimum width as required.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs To Council Member Seating	Run 1	No Riser Striping	There is no detectable striping on the stairways.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs To Council Member Seating	Run 1 Left Handrail	Handrail Extension not Parallel	The handrail extension is not parallel with the floor surface at the bottom landing.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs To Council Member Seating	Run 1 Left Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 1	Risers Striping Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 1 Intermediate Landing	Landing Approach Stripe Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 1 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 1 Left Handrail	Handrail Extension not Parallel	The handrail extension is not parallel with the floor surface at the bottom landing.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 1 Left Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 1 Left Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 1 Left Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 1 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 1 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 1 Right Handrail	Handrail Extension not Parallel	The handrail extension is not parallel with the floor surface at the bottom landing.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 1 Right Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 2	Risers Striping Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 2 Floor Level Landing	Landing Approach Stripe Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 2 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/19

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 2 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 2 Left Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 2 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 2 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 2 Left Handrail	Handrail Extension not Parallel	The handrail extension is not parallel with the floor surface at the bottom landing.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 2 Left Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 3	Risers Striping Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 3 Intermediate Landing	Landing Approach Stripe Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 3 Left Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 3 Left Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 3 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 3 Right Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 3 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 4	Risers Striping Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 4 Floor Level Landing	Landing Approach Stripe Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 4 Right Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 4 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 4 Left Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 4 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	North Stairwell	Run 4 Left Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 4	Risers Striping Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 4 Floor Level Landing	Landing Approach Stripe Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 4 Left Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 4 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 4 Right Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 4 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 4 Right Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 3	Risers Striping Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 3 Intermediate Landing	Landing Approach Stripe Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 3 Right Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 3 Right Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 3 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 3 Left Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 3 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 3 Left Handrail	Handrail Extension not Parallel	The handrail extension is not parallel with the floor surface at the bottom landing.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 1	Risers Striping Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 1 Intermediate Landing	Landing Approach Stripe Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 1 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 1 Right Handrail	Handrail Extension not Parallel	The handrail extension is not parallel with the floor surface at the bottom landing.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 1 Right Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 1 Right Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 1 Right Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/19

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 1 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 1 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 1 Left Handrail	Handrail Extension not Parallel	The handrail extension is not parallel with the floor surface at the bottom landing.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 1 Left Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 2	Risers Striping	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 2	Risers Striping Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 2 Floor Level Landing	Landing Approach Stripe Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 2 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 2 Right Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 2 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 2 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 2 Right Handrail	Handrail Extension not Parallel	The handrail extension is not parallel with the floor surface at the bottom landing.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	West Stairwell	Run 2 Right Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs Next To Main Entrance	Run 1	No Riser Striping	There is no detectable striping on the stairways.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs Next To Main Entrance	Run 1	Risers Not Closed	The risers on the stairway are open.	Close the riser openings on the stairway. Open risers are not permitted.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs Next To Main Entrance	Run 1 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs Next To Main Entrance	Run 1 Left Handrail	Handrail Extension not Parallel	The handrail extension is not parallel with the floor surface at the bottom landing.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs Next To Main Entrance	Run 1 Left Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs Next To Main Entrance	Run 1 Right Handrail	Handrail Extension not Parallel	The handrail extension is not parallel with the floor surface at the bottom landing.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs Next To Main Entrance	Run 1 Right Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/19

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs Next To Main Entrance	Run 1 Right Handrail	Handrail Extension	The ends of the handrails are not rounded or returned smoothly to the wall or post.	Install handrail extensions that are rounded or returned smoothly to the wall post.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs Next To Main Entrance	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs Next To Main Entrance	Run 2	Risers Not Closed	The risers on the stairway are open.	Close the riser openings on the stairway. Open risers are not permitted.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs Next To Main Entrance	Run 2	No Riser Striping	There is no detectable striping on the stairways.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs Next To Main Entrance	Run 2 Right Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs Next To Main Entrance	Run 2 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs Next To Main Entrance	Run 2 Left Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Stairs	Stairs Next To Main Entrance	Run 2 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Council Chambers Break Room	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Council Chambers Break Room	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Council Chambers Break Room	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	North Main Entrance	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	North Main Entrance	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	North Main Entrance	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	North Main Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed for a vertical rise.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Council Chambers Conference Room	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Council Chambers Rear Entrances 100C, 100D	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Council Chambers Rear Entrances 100C, 100D	Push Bar / Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Council Chambers Rear Entrances 100C, 100D	Push Bar / Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Council Chambers Rear Entrances 100C, 100D		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Council Chambers Unisex Restroom		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/19

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Council Chambers Unisex Restroom	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Council Chambers Unisex Restroom	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom Next To Council Chambers		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom Next To Council Chambers	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom Next To Council Chambers	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom Next To Council Chambers	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	West Main Entrance		Automatic - Signage	There is no specific signage for the automatic door.	Provide compliant caution automatic door signage.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom Next To Council Chambers		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom Next To Council Chambers	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom Next To Council Chambers	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom Next To Council Chambers	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Doors Behind Council Member Seating 101C, 101H	Push Bar / Thumb Latch	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Doors Behind Council Member Seating 101C, 101H	Push Bar / Thumb Latch	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Doors Behind Council Member Seating 101C, 101H	Push Bar / Thumb Latch	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Room 107 Code Enforcement	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Employee Entrance Next To Fire Department	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Employee Entrance Next To Fire Department	Push Bar / D Handle	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Employee Entrance Next To Purchasing	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Employee Entrance Next To Purchasing	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Employee Entrance Next To Purchasing	Push Bar Only	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/19

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Employee Entrance Next To Purchasing	Push Bar Only	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Employee Entrance Next To Purchasing	Push Bar Only	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	1st Floor West Stairwell Entrance	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	1st Floor West Stairwell Entrance	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Council Chambers Lobby Entrances	Push Bar / Thumb Latch	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Council Chambers Lobby Entrances	Push Bar / Thumb Latch	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Council Chambers Lobby Entrances	Push Bar / Thumb Latch	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	12/31/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	1st Floor North Stairwell Entrance	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	12/31/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	1st Floor North Stairwell Entrance	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Offices 104, 111	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	12/31/19
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Office 105	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Conference Room 219	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Credit Union	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Offices 217, 220	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom Next To Engineering	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom Next To Engineering	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom Next To Engineering	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom Next To Engineering	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom Next To Credit Union	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom Next To Credit Union	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/20

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	2nd Floor North Stairwell Entrance	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	2nd Floor North Stairwell Entrance	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Office 214	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	2nd Floor West Stairwell Entrance	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	2nd Floor West Stairwell Entrance	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	2nd Floor West Stairwell Entrance	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom Next To Council Office	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom Next To Council Office	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Offices 305, 311 (City Manager)	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Gate Next To City Clerks Counter		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom Next To Information Technology	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom Next To Information Technology	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom Next To Information Technology	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom Next To Information Technology	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	3rd Floor North Stairwell Entrance	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	3rd Floor North Stairwell Entrance	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	3rd Floor North Stairwell Entrance	Push Bar / Thumb Latch	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	3rd Floor North Stairwell Entrance	Push Bar / Thumb Latch	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	3rd Floor West Stairwell Entrance	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	3rd Floor West Stairwell Entrance	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	3rd Floor West Stairwell Entrance	Push Bar / Thumb Latch	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	12/31/20

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Doors	3rd Floor West Stairwell Entrance	Push Bar / Thumb Latch	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Counters	Cashier		Counter Height	The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.	Provide a portion of counter at the compliant height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Counters	Code Enforcement		Knee Clearance Depth	The knee clearance depth provided is not compliant.	Provide compliant knee clearance depth at the counter for a forward approach.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Counters	Fire Department		Counter Height	The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.	Provide a portion of counter at the compliant height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Counters	Public Works		Knee Clearance Depth	The knee clearance depth provided is not compliant.	Provide compliant knee clearance depth at the counter for a forward approach.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Counters	Human Resources		Knee Clearance Depth	The knee clearance depth provided is not compliant.	Provide compliant knee clearance depth at the counter for a forward approach.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Counters	City Clerk		Knee Clearance Depth	The knee clearance depth provided is not compliant.	Provide compliant knee clearance depth at the counter for a forward approach.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Signage	Doors Behind Council Member Seating 101C, 101H		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Signage	Main Entrances		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Signage	Council Chambers Break Room, Council Chambers Conference Room		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Signage	West Stairwell	Run 4 Floor Level Landing	No Floor Level Signage	The stairs do not provide accessible signage stating the floor level and the upper and lower terminus of the stairway. The stairway provides access between two floor levels of the facility.	Install signage at the required height above the finished floor on the wall adjacent to the latch side of the entry doorway stating the floor level and the upper and lower terminus of the stairway. The sign shall provide raised Arabic numerals and raised Grade 2 Braille symbols and shall comply with the finish and contrast requirements set forth. Signage should be located where a person may approach within three inches of the sign without encountering protruding objects or standing within the swing of the door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Signage	West Stairwell	Run 2 Floor Level Landing	No Floor Level Signage	The stairs do not provide accessible signage stating the floor level and the upper and lower terminus of the stairway. The stairway provides access between two floor levels of the facility.	Install signage at the required height above the finished floor on the wall adjacent to the latch side of the entry doorway stating the floor level and the upper and lower terminus of the stairway. The sign shall provide raised Arabic numerals and raised Grade 2 Braille symbols and shall comply with the finish and contrast requirements set forth. Signage should be located where a person may approach within three inches of the sign without encountering protruding objects or standing within the swing of the door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Signage	1st Floor North Stairwell Entrance		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Signage	Break Room 223		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Signage	Conference Room 219		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Signage	Offices 204, 205, 207, 208, 209, 210, 212, 214, 220		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Signage	Training/Testing, Credit Union		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Signage	Conference Room 310		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/20

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Signage	Offices 305, 306, 307, 308, 312, 313	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/20	
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Signage	Room 316A	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/20	
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Signage	Offices 316B - 316F	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/20	
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Signage	Conference Room 316G	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/20	
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Signage	Break Area 309	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	12/31/20	
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers	Urinal Rim Height	The height of the urinal rim in the restroom is greater than 17 inches above the finished floor.	Lower the urinal designated to be accessible in the restroom so that the rim height is not more than 17 inches above the finished floor.	Not_Started	None	12/31/20	
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers	Width Between Urinal Shields	The width between urinal shields in the restroom is less than required.	Modify or replace the urinal shields in the restroom to provide the required shield-width clearance.	Not_Started	None	12/31/20	
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers	Urinal Flush Control Height	The height of the urinal flush control in the restroom is greater than the required maximum height.	Lower the flush control valve on the urinal to a height not greater than the required maximum height.	Not_Started	None	12/31/20	
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers	Lavatory	Lavatory Distance From Wall/Fixture partition or fixture.	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers	Male	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers	Male	No Contrasting Finish	The signage does not have contrasting finish from the door.	Restroom door signage should have contrasting finish.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers		No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers		No Back Wall Grab Bar	There is no back grab bar at the toilet compartment.	Install the required grab bars in the toilet compartment.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers		Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers		Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	12/31/20

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom		Toilet Clear Floor Space Width	There is not a minimum of 60 inches of clearance around the water closet measured perpendicular from the side wall.	Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom		No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom		Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom		Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom		Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom		Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers	Female	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers	Female	No Contrasting Finish	The signage does not have contrasting finish from the door.	Restroom door signage should have contrasting finish.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Council Chambers	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom		No Door Privacy Lock and Occupied Indicator	The restroom door does not provide a compliant privacy lock with occupancy indicator.	Install a compliant privacy lock with occupancy indicator to the door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom	Unisex	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Council Chambers Unisex Restroom	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers		No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers		No Back Wall Grab Bar	There is no back grab bar at the toilet compartment.	Install the required grab bars in the toilet compartment.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers		Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	12/31/20

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers		Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Chambers		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		No Back Wall Grab Bar	There is no back grab bar at the toilet compartment.	Install the required grab bars in the toilet compartment.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Female	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	12/31/20

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Female	No Contrasting Finish	The signage does not have contrasting finish from the door.	Restroom door signage should have contrasting finish.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Feminine Products	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		Urinal Rim Height	The height of the urinal rim in the restroom is greater than 17 inches above the finished floor.	Lower the urinal designated to be accessible in the restroom so that the rim height is not more than 17 inches above the finished floor.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		Width Between Urinal Shields	The width between urinal shields in the restroom is less than required.	Modify or replace the urinal shields in the restroom to provide the required shield-width clearance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union	Male	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union	Male	No Contrasting Finish	The signage does not have contrasting finish from the door.	Restroom door signage should have contrasting finish.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Credit Union	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering		No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering		No Back Wall Grab Bar	There is no back grab bar at the toilet compartment.	Install the required grab bars in the toilet compartment.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	12/31/20

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch. Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Compartment Door	Door does not close automatically.		Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Compartment Door Handle Height	The compartment door hardware is not at a compliant height.	Remove and relocate the door hardware.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Engineering	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology	Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology	No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology	Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology	No Back Wall Grab Bar	There is no back grab bar at the toilet compartment.	Install the required grab bars in the toilet compartment.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology	Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology	Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch. Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology	Compartment Door	Door does not close automatically.		Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology	Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	12/31/20

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology		Compartment Door Handle Height	The compartment door hardware is not at a compliant height.	Remove and relocate the door hardware.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology		Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology		Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology	Female	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology	Female	No Contrasting Finish	The signage does not have contrasting finish from the door.	Restroom door signage should have contrasting finish.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom Next To Information Technology	Feminine Products	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office		Urinal Rim Height	The height of the urinal rim in the restroom is greater than 17 inches above the finished floor.	Lower the urinal designated to be accessible in the restroom so that the rim height is not more than 17 inches above the finished floor.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office		Urinal Flush Control Height	The height of the urinal flush control in the restroom is greater than the required maximum height.	Lower the flush control valve on the urinal to a height not greater than the required maximum height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office		Width Between Urinal Shields	The width between urinal shields in the restroom is less than required.	Modify or replace the urinal shields in the restroom to provide the required shield-width clearance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Lavatory	Lavatory Surface Height	The height of the counter surface is greater than allowed.	Relocate or replace the lavatory to provide a maximum counter surface height of no greater than recommended.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Male	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Male	No Contrasting Finish	The signage does not have contrasting finish from the door.	Restroom door signage should have contrasting finish.	Not_Started	None	12/31/20

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	No Back Wall Grab Bar	There is no back grab bar at the toilet compartment.	Install the required grab bars in the toilet compartment.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom Next To Council Office	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Across From Council Chambers	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Across From Council Chambers	Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Across From Council Chambers	Unstable floor mat	An unstable floor mat is provided within the drinking fountain clear floor space.	Provide a compliant floor mat.	Not_Started	None	12/31/20

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Across From Council Chambers	No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Engineering	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Engineering	Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Credit Union	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Credit Union	Protruding Object	The drinking fountain is a protruding object.	Make sure that the fountain is not a protruding object.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Credit Union	Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Credit Union	No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Council Offices	No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Council Offices	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Council Offices	Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Council Offices	Stream Height	The height of the water stream is less than required.	Insure that the spout directs the water flow to the required height and in a trajectory that is parallel or nearly parallel to the front of the drinking fountain.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Information Technology	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Information Technology	Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Information Technology	Stream Height	The height of the water stream is less than required.	Insure that the spout directs the water flow to the required height and in a trajectory that is parallel or nearly parallel to the front of the drinking fountain.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Information Technology	No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Assembly Areas	Council Chambers	Access to Performing Area	Stairs connect the front of the stage in the theater/auditorium/performing arts center to the audience seating area, the stage is not accessible from a back entrance/ramp/hallway.	Provide a vertical platform lift or other means of vertical access between the level floor seating area and the stage. It is imperative as an ADA mandate to provide access to the stage for individuals with mobility impairments who need use of the stage for all programs, services and activities.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Assembly Areas	Council Chambers	Wheelchair Location	Wheelchair Locations are not dispersed among other seating.	Disperse the Wheelchairs among other seating	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Assembly Areas	Council Chambers	Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Emergency Warning Systems	Visual Alarms	Emergency Warning System	There are no visual warning devices at the facility.	Install visual warning devices integrated with the facility's alarm system in all common areas such as hallways, classrooms and general use rooms, and in accessible restrooms and other accessible rooms.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conferenc e Room	Council Chambers Break Room	Sink - Control Type	Sink controls needs twisting to operate.	Provide compliant controls for the sink in break/conference room.	Not_Started	None	12/31/20

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Council Chambers Break Room		Sink - Counter Height	Sink counter height does not meet the standards.	Provide compliant sink.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Council Chambers Break Room		Toe Kick Not Removed	The toe kick for the sink in break/conference room is not removed.	Remove the toe kick for the sink.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Council Chambers Break Room		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Council Chambers Break Room		Cabinet Door Hardware	The cabinet door hardware is not accessible.	Provide compliant hardware for the cabinet door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Council Chambers Break Room		Clear Floor Space Width	There is not enough clear floor space at the sink.	Provide enough clear floor space at the location.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Council Chambers Break Room		Supply Lines	Supply lines are not wrapped for the break/conference room sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Council Chambers Break Room	Paper Towel	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Council Chambers Break Room	Microwave	Reach Height	Appliance Reach Height in the break/conference room is not compliant.	Make sure that the specified appliance reach height is compliant.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Conference Room 116		Tables - Knee Clearance	The table knee clearance does not meet required standards.	Provide compliant tables.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room 223		Control Height	The side reach height of the controls on the vending machine is greater than the allowed maximum height.	Provide a compliant vending machine.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room 223		Sink - Counter Height	Sink counter height does not meet the standards.	Provide compliant sink.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room 223		Toe Kick Not Removed	The toe kick for the sink in break/conference room is not removed.	Remove the toe kick for the sink.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room 223		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room 223		Cabinet Door Hardware	The cabinet door hardware is not accessible.	Provide compliant hardware for the cabinet door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room 223		Supply Lines	Supply lines are not wrapped for the break/conference room sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room 223		Tables - Knee Depth	The table knee depth does not meet required standards.	Provide compliant tables.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room 223		Tables - Knee Depth	The table knee depth does not meet required standards.	Provide compliant tables.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room 223	Soap	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room 223	Microwave	Reach Height	Appliance Reach Height in the break/conference room is not compliant.	Make sure that the specified appliance reach height is compliant.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Area 309		Sink - Counter Height	Sink counter height does not meet the standards.	Provide compliant sink.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Area 309		Toe Kick Not Removed	The toe kick for the sink in break/conference room is not removed.	Remove the toe kick for the sink.	Not_Started	None	12/31/20

City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Area 309		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Area 309		Cabinet Door Hardware	The cabinet door hardware is not accessible.	Provide compliant hardware for the cabinet door.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Area 309		Clear Floor Space Width	There is not enough clear floor space at the sink.	Provide enough clear floor space at the location.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Area 309		Supply Lines	Supply lines are not wrapped for the break/conference room sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Area 309	Soap	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Area 309	Microwave	Reach Height	Appliance Reach Height in the break/conference room is not compliant.	Make sure that the specified appliance reach height is compliant.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Conference Room 316G		Tables - Knee Clearance	The table knee clearance does not meet required standards.	Provide compliant tables.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Lockers	Womens Restroom Next To Engineering		No Accessible Lockers Available	No accessible lockers were found.	At least one locker or 5% of the lockers should be accessible.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Lockers	Womens Restroom Next To Information Technology		No Accessible Lockers Available	No accessible lockers were found.	At least one locker or 5% of the lockers should be accessible.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Reach Ranges	Council Chambers	Podium	Knee Height	The knee height is not compliant.	Adjust knee height to the recommended value.	Not_Started	None	12/31/20
City Hall - 11111 Brookshire Avenue Downey, CA 90240	Reach Ranges	Council Chambers	Podium	Element Highest Point of Operation	The highest point of operation for the element is not compliant. There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the signage does not contain the correct wording and/or the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.	Make sure that the highest point of operation is within the recommended value. Provide a compliant warning sign regarding unauthorized use of accessible parking spaces in the parking lot. Fill in the blank spaces with are required to furnish point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Parking	Accessible Parking	Warning Sign	Parking Lot Warning Sign Wording Incorrect			Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Parking	Accessible Parking	Accessible Space	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Path of Travel	Sidewalk around Play Area	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Path of Travel	Sidewalk from Dinwiddie Street to Play Area	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Path of Travel	Path from the Accessible Space	Exterior Walkway	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Path of Travel	Path to Basketball Courts	Exterior Walkway	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Path of Travel	Path from Play Area to Canal	Exterior Walkway	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	12/31/20

Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Doors	Canal Gate	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Doors	Canal Gate	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Doors	Canal Gate	Push / Pull	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Doors	Canal Gate		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Signage	Directional Signage from Dinwiddie Street		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Basketball Court		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Basketball Court		Toe Clearance	The toe clearance is less than required.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Basketball Court		Drinking Fountain	The drinking fountain is not on accessible route.	Make sure the drinking fountain is on an accessible route.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Basketball Court		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Basketball Court		Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Basketball Court		Spout Distance to Front	The distance from the front edge of the unit (including bumpers) to the spout location, is greater than the allowed maximum distance.	Make sure that the distance from the front of the fountain to the flow of the water is not greater than the allowed maximum distance.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Basketball Court		Stream Height	The height of the water stream is less than required.	Insure that the spout directs the water flow to the required height and in a trajectory that is parallel or nearly parallel to the front of the drinking fountain.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Basketball Court		Clear Floor Space Length	There is insufficient clear floor space in front of the drinking fountain.	Provide the required clear floor space that is on a primary path of travel.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Basketball Court		Control Missing/Broken	The drinking fountain control is either missing or broken.	Provide compliant control for the drinking fountain.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Basketball Court		Fountain Depth	Drinking fountain does not provide a required fountain depth.	Install a drinking fountain the meets the required minimum depth.	Not_Started	None	12/31/20

Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Basketball Court		No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Play Area	Play Area		Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Play Area	Play Area		Change In Level	There is a change in level to the play area surface.	Provide a smooth transition from the play area access point to the play area surface.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Play Area	Play Area	Play Bench - Sand	Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Play Area	Play Area	Climbing - Sand	Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Play Area	Play Area	Counter - Sand	Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Play Area	Play Area	Bucket Swings - Sand	Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Picnic Areas	Picnic Area		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Reach Ranges	Picnic Area	Barbecue Grill	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	12/31/20
Crawford Park - 7000 Dinwiddie Street Downey, CA 90240	Benches	Benches next to Play Area		Clear Floor Space Slope	Clear floor space slope is not compliant for the bench.	Provide compliant clear floor space at the bench.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Parking	Parking Lot	Warning Sign	Parking Lot Warning Sign Wording Incorrect	There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the signage does not contain the correct wording and/or the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.	Provide a compliant warning sign regarding unauthorized use of accessible parking spaces in the parking lot. Fill in the blank spaces with are required to furnish point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Parking	Parking Lot	Right Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Parking	Parking Lot	Right Accessible Space	Vehicle Encroaches Into Path of Travel	There is no device at the head of the accessible parking space to prevent vehicles from encroaching into accessible aisles or walkways.	Install a wheel stop at the head of the accessible parking space.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Parking	Parking Lot	Left Accessible Space	Vehicle Encroaches Into Path of Travel	There is no device at the head of the accessible parking space to prevent vehicles from encroaching into accessible aisles or walkways.	Install a wheel stop at the head of the accessible parking space.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Parking	Parking Lot	Left Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	12/31/20

Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Parking	Parking Lot	Left Accessible Space	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Curb Ramps	Curb Ramp at the Accessible Spaces		Curb Ramp Slope	The running slope is greater than allowed.	Provide a compliant curb ramp.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Curb Ramps	Curb Ramp at the Accessible Spaces	Bottom Landing	Bottom Landing Slope	The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.	Ensure the bottom landing slope is compliant and provides a smooth transition.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Path of Travel	Sidewalk to Payphone	Step	Stairs or Steps Obstruction	There is a step or curb on the path of travel preventing access.	Provide a ramp or other means of vertical access.	In_Progress	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Path of Travel	Sidewalk from the Accessible Spaces To Play Areas next to Restroom Building	Tree Limb	Protruding Objects - Vertical Clearance	The vertical clearance height is less than required.	Provide recommended vertical clearance.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Path of Travel	Sidewalk from the Accessible Spaces To Play Areas next to Restroom Building	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Path of Travel	Sidewalk from the Accessible Spaces To Play Areas next to Restroom Building	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Path of Travel	Sidewalk from the Accessible Spaces To Play Areas next to Restroom Building	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Path of Travel	Path Of Travel From The Public Right Of Way		No Designated Accessible Route	There is no compliant accessible route from the public right of way to the accessible entrance of the facility.	Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Path of Travel	Sidewalk around Play Areas next to Restroom Building	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Path of Travel	Sidewalk around Play Areas next to Restroom Building	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Doors	Womens Restroom next to Play Areas		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Doors	Womens Restroom next to Play Areas	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Doors	Womens Restroom next to Play Areas	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Doors	Womens Restroom next to Play Areas	Push / Pull	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	12/31/20

Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Doors	Womens Restroom next to Play Areas	Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	12/31/20	
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Doors	Mens Restroom next to Play Areas	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Doors	Mens Restroom next to Play Areas	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Doors	Mens Restroom next to Play Areas		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Public Telephones	Payphone		Highest Operable Parts	The highest operable part of the public telephone exceeds allowed maximum reach range.	Contact the telephone company that owns the public telephone regarding the height of all the operating devices on the telephone.	In_Progress	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Public Telephones	Payphone		Clear Floor Space Length	There is not sufficient clear floor space provided in front of the telephone.	Contact the telephone company that owns the public telephone regarding the relocation of the public telephone to provide sufficient clear floor space in front of device.	In_Progress	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Restrooms	Mens Restroom next to Play Areas		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Restrooms	Mens Restroom next to Play Areas		Clear Space in Front of Compartment	The latch side approach to the compartment designated to be accessible in the restroom is not wide enough.	Provide a latch-side approach to the compartment designated to be accessible with a clear, unobstructed access width.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Restrooms	Mens Restroom next to Play Areas		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Restrooms	Mens Restroom next to Play Areas		No Back Wall Grab Bar	There is no back grab bar at the toilet compartment.	Install the required grab bars in the toilet compartment.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Restrooms	Mens Restroom next to Play Areas		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Restrooms	Mens Restroom next to Play Areas		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Restrooms	Mens Restroom next to Play Areas		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Restrooms	Mens Restroom next to Play Areas		Toilet Compartment Door	The compartment door is located in front of the water closet.	Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Restrooms	Mens Restroom next to Play Areas		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	12/31/20

Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Compartment Door Width	The clear opening width of the doorway to the compartment is less than required.	Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Compartment Door Swings In	The door to the compartment swings inward into the minimum required compartment area.	Modify the swing of the door so that it does not swing into the minimum required compartment area.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Side Grab Bar Height	The height of the side grab bar is not at the correct height.	Remount the grab bar so it is at the correct height.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Toilet Paper Dispenser Interferes with Grab Bar	The toilet paper dispenser interferes with the use of the grab bar.	Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Toilet Paper Dispenser Above Grab Bar	The toilet paper dispenser is located above the provided grab bar.	Remount the dispenser below the grab bar at 19" minimum.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas	Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	12/31/20

Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas	Female	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas		Urinal Flush Control Height	The height of the urinal flush control in the restroom is greater than the required maximum height.	Lower the flush control valve on the urinal to a height not greater than the required maximum height.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Male	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	12/31/20

Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Play Areas	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas		Clear Space in Front of Compartment	The latch side approach to the compartment designated to be accessible in the restroom is not wide enough.	Provide a latch-side approach to the compartment designated to be accessible with a clear, unobstructed access width.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas		No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas		Compartment Door Width	The clear opening width of the doorway to the compartment is less than required.	Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas		Toilet Compartment Door	The compartment door is located in front of the water closet.	Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas		Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125									
Arrington Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Play Areas		Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	12/31/20

Dennis The Menace Park - 9125	Restrooms	Womens Restroom next to Play Areas	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125	Restrooms	Womens Restroom next to Play Areas	Compartment Door Swings In	The door to the compartment swings inward into the minimum required compartment area.	Modify the swing of the door so that it does not swing into the minimum required compartment area.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125	Restrooms	Womens Restroom next to Play Areas	Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125	Restrooms	Womens Restroom next to Play Areas	Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125	Restrooms	Womens Restroom next to Play Areas	Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125	Restrooms	Womens Restroom next to Play Areas	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125	Restrooms	Womens Restroom next to Play Areas	Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125	Drinking Fountains	Drinking Fountain next to Parking Lot	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125	Drinking Fountains	Drinking Fountain next to Parking Lot	Toe Clearance	The toe clearance is less than required.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125	Drinking Fountains	Drinking Fountain next to Parking Lot	Drinking Fountain	The drinking fountain is not on accessible route.	Make sure the drinking fountain is on an accessible route.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125	Drinking Fountains	Drinking Fountain next to Parking Lot	Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125	Drinking Fountains	Drinking Fountain next to Parking Lot	Clear Floor Space Length	There is insufficient clear floor space in front of the drinking fountain.	Provide the required clear floor space that is on a primary path of travel.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125	Drinking Fountains	Drinking Fountain next to Play Areas	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125	Drinking Fountains	Drinking Fountain next to Play Areas	Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125	Drinking Fountains	Drinking Fountain next to Play Areas	Fountain Depth	Drinking fountain does not provide a required fountain depth.	Install a drinking fountain the meets the required minimum depth.	Not_Started	None	12/31/20

Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Play Areas		No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Play Area	Swings across from Picnic Shelter		Accessibility	The play area is not located on an accessible route.	Provide a compliant accessible route to the play area.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Play Area	Swings across from Picnic Shelter		Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Play Area	Swings across from Picnic Shelter		Point of Access	The play area provides no accessible point of access.	Provide compliant access to the play area.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Play Area	Swings across from Picnic Shelter	Bucket Swings - Sand	Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Play Area	South Large Play Area	Swings - Sand	Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Play Area	South Large Play Area	Store Window - Sand	Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Play Area	South Large Play Area	Store Window - Sand	Vertical Clearance Height	The vertical clearance height on route to the transfer platform/play equipment is not compliant.	Provide compliant vertical clearance.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Play Area	Small Play Area	Elevated Equipment - Rubberized Surface	Platform Height	The transfer platform height is not compliant.	Provide compliant platform with recommended value at the transfer point.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Play Area	Small Play Area	Elevated Equipment - Rubberized Surface	Means of Support	At least one means of support for transferring to the transfer platform is not provided at the steps.	Provide at least one means of support for transferring to assist when transferring.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Play Area	Small Play Area	Elevated Equipment - Rubberized Surface	Transfer Platform	The transfer platform is not located on shortest route from the play areas accessible point of access.	The transfer platform shall be located on the shortest route from the play areas accessible point of access.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Play Area	Small Play Area	Elevated Equipment - Rubberized Surface	One Means of Support	At least one means of support for transferring to the transfer platform is not provided at the steps.	Provide at least one means of support for transferring to assist when transferring.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Play Area	Small Play Area	Store Window/House - Sand	Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Play Area	North Large Play Area	Change In Level	Change in Level	There is a change in level greater than allowed on the path of travel.	Provide a smooth transition.	In_Progress	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240	Play Area	North Large Play Area	Steering Wheel - Rubberized Surface	Point of Operation Height	The point of operation height for the play equipment is not compliant.	Provide compliant play equipment.	Not_Started	None	12/31/20

Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Play Area	North Large Play Area	Talk Tube - Sand	Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Picnic Areas	Group Picnic Area		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Picnic Areas	Group Picnic Area		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Picnic Areas	Picnic Tables around Play Areas		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Picnic Areas	Picnic Tables around Play Areas		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Benches	Bench next to Swings across from Picnic Shelter		On Accessible Route	The bench is not on an accessible route.	Provide a compliant accessible route to the benches.	Not_Started	None	12/31/20
Dennis The Menace Park - 9125 Arrington Avenue Downey, CA 90240				Benches	Bench next to Swings across from Picnic Shelter		Clear Floor Space	No clear floor space provided at the bench.	Provide compliant clear floor space for the bench at one end.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Parking	Parking Lot	Entrance From Columbia Way	Parking Lot Warning Sign Wording Incorrect	There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the signage does not contain the correct wording and/or the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.	Provide a compliant warning sign regarding unauthorized use of accessible parking spaces in the parking lot. Fill in the blank spaces with are required to furnish point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Parking	Parking Lot	Entrance From Caring Way	No Parking Lot Warning Sign	There is no warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot.	Post a sign in a conspicuous place to the entrance of the parking lot, or immediately adjacent to and visible from each accessible parking space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that clearly and conspicuously states the following: "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities will be towed away at owner's expense. Towed vehicles may be reclaimed at ____ or by telephoning ____." Fill in the blank spaces with appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Parking	Parking Lot	3rd from the Left Accessible Space next to Space Center	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Parking	Parking Lot	1st from the Left Accessible Space next to Space Center	Access Aisle Width	The access aisle does not meet the minimum required width.	Re-stripe the access aisle to meet the minimum required width and length for the space type.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Parking	Parking Lot	1st from the Left Accessible Space next to Space Center	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Parking	Parking Lot	1st from the Left Accessible Space next to Space Center	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	12/31/20

Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	1st from the Left Accessible Space next to Space Center	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	2nd from the Left Accessible Space next to Space Center	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	2nd from the Left Accessible Space next to Space Center	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	2nd from the Left Accessible Space next to Space Center	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	2nd from the Left Accessible Space next to Space Center	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	2nd from the Left Accessible Space next to Space Center	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	3rd from the Left Accessible Space next to Baseball Fields	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	3rd from the Left Accessible Space next to Baseball Fields	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	3rd from the Left Accessible Space next to Baseball Fields	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	3rd from the Left Accessible Space next to Baseball Fields	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	3rd from the Left Accessible Space next to Baseball Fields	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	4th from the Left Accessible Space next to Baseball Fields	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	12/31/20

Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	4th from the Left Accessible Space next to Baseball Fields	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	4th from the Left Accessible Space next to Space Center	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	4th from the Left Accessible Space next to Space Center	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	1st from the Left Accessible Space next to Baseball Fields	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	1st from the Left Accessible Space next to Baseball Fields	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	1st from the Left Accessible Space next to Baseball Fields	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	1st from the Left Accessible Space next to Baseball Fields	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	1st from the Left Accessible Space next to Baseball Fields	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Parking	Parking Lot	2nd from the Left Accessible Space next to Baseball Fields	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Curb Ramps	Curb Ramp At The 2nd & 3rd from the Left Accessible Spaces next to Baseball Fields		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Curb Ramps	Curb Ramp At The 2nd & 3rd from the Left Accessible Spaces next to Baseball Fields		Curb Ramp Slope	The running slope is greater than allowed.	Provide a compliant curb ramp.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Curb Ramps	Curb Ramp at the 1st from the Left Accessible Space next to Space Center		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	12/31/20

Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Curb Ramps	Curb Ramp at the 1st from the Left Accessible Space next to Space Center		Curb Ramp Slope	The running slope is greater than allowed.	Provide a compliant curb ramp.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Path of Travel	Sidewalk from the 1st & 2nd Accessible Space from the Left next to Baseball Fields	Curb	Curb is on The Path of Travel	There is a curb on the designated path of travel.	Provide a compliant curb ramp.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Path of Travel	Sidewalk from the 3rd & 4th Accessible Space from the Left next to Baseball Fields	Curb	Curb is on The Path of Travel	There is a curb on the designated path of travel.	Provide a compliant curb ramp.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Path of Travel	Sidewalk from the 3rd Accessible Space from the Left next to Space Center	Curb	Curb is on The Path of Travel	There is a curb on the designated path of travel.	Provide a compliant curb ramp.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Path of Travel	Sidewalk from Baseball Fields to Space Center	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Path of Travel	Sidewalk from Baseball Fields to Space Center	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Path of Travel	Sidewalk from the 4th Accessible Space from the Left next to Space Center	Curb	Curb is on The Path of Travel	There is a curb on the designated path of travel.	Provide a compliant curb ramp.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Path of Travel	Sidewalk between West Diamond Baseball Field & Space Center	Tree Limb	Protruding Objects - Vertical Clearance	The vertical clearance height is less than required.	Provide recommended vertical clearance.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Path of Travel	Sidewalk between West Diamond Baseball Field & Space Center	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Elevators	Elevator		Emergency System	Elevator communication control mounting height is not compliant.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Elevators	Elevator	Elevator Car	Control Panel Location	The control panel is not located on the front wall for a center opening elevator doorway.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Elevators	Elevator	Elevator Car	Emergency System	Emergency controls are not located at the compliant height.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	12/31/20

Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Elevators	Elevator	Elevator	Door	The reopening device for the elevator door does not remain open for the required amount of time.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Stairs	Stairs next to Robotics Lab	Run 2 Right Handrail	Handrail Extension	The ends of the handrails are not rounded or returned smoothly to the wall or post.	Install handrail extensions that are rounded or returned smoothly to the wall post.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Stairs	Stairs next to Robotics Lab	Run 2 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Stairs	Stairs next to Robotics Lab	Run 2 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Stairs	Stairs next to Robotics Lab	Run 2 Middle Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Stairs	Stairs next to Robotics Lab	Run 2 Left Handrail	Handrail Extension	The ends of the handrails are not rounded or returned smoothly to the wall or post.	Install handrail extensions that are rounded or returned smoothly to the wall post.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Stairs	Stairs next to Robotics Lab	Run 2 Left Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Stairs	Stairs next to Robotics Lab	Run 2 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Stairs	Stairs next to Robotics Lab	Run 2 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Stairs	Stairs next to Robotics Lab	Run 1 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Stairs	Stairs next to Robotics Lab	Run 1 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Stairs	Stairs next to Robotics Lab	Run 1 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	12/31/20

Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Stairs	Stairs next to Robotics Lab	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	East Diamond Baseball Field	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	East Diamond Baseball Field	Lever	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	East Diamond Baseball Field		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	West Diamond Baseball Field	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	West Diamond Baseball Field	Lever	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	West Diamond Baseball Field		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	1st Floor Unisex Restroom	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Space Center Main Entrance	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Space Center Main Entrance	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Office in Robotics Lab	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	In_Progress	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Office in Robotics Lab	Push Bar / Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/20

Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Office in Robotics Lab	Push Bar / Lever	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Office in Robotics Lab	Push Bar / Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Patio Entrance	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Patio Entrance	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Projector Room	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Projector Room	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	1st Floor Mens Restroom	Pull Side	Latch Approach Clear Floor Space Width	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	1st Floor Mens Restroom	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Robotics Lab	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Robotics Lab	Push Bar / Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Robotics Lab	Push Bar / Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Gate next to 2nd Floor Mens Restroom	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	12/31/20

Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Gate next to 2nd Floor Mens Restroom	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Theatre	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Office next to Supervisors Office	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	2nd Floor Mens Restroom	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Launch Pad Room	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Office next to 2nd Floor Womens Restroom	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	12/31/20
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Office next to 2nd Floor Womens Restroom	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Office next to 2nd Floor Womens Restroom	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	Launch Pad Ride - 1st, Launch Pad Ride - 2nd		Open Doorway Height	The vertical clearance height of the open doorway is not compliant. Provide a compliant open doorway at the location.		Not_Started	None	6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Doors	2nd Floor Womens Restroom	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Signage	West Diamond Baseball Field		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Signage	East Diamond Baseball Field		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/21

Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Signage	Directional Signage from the Public Right Of Way on Columbia Way		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Signage	Directional Signage from the Public Right of Way on Caring Way		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Signage	Stairs next to Robotics Lab	Run 1 Floor Level Landing	No Floor Level Signage	The stairs do not provide accessible signage stating the floor level and the upper and lower terminus of the stairway. The stairway provides access between two floor levels of the facility.	Install signage at the required height above the finished floor on the wall adjacent to the latch side of the entry doorway stating the floor level and the upper and lower terminus of the stairway. The sign shall provide raised Arabic numerals and raised Grade 2 Braille symbols and shall comply with the finish and contrast requirements set forth. Signage should be located where a person may approach within three inches of the sign without encountering protruding objects or standing within the swing of the door.	Not_Started	None	6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Signage	Stairs next to Robotics Lab	Run 1 Bottom Landing	No Floor Level Signage	The stairs do not provide accessible signage stating the floor level and the upper and lower terminus of the stairway. The stairway provides access between two floor levels of the facility.	Install signage at the required height above the finished floor on the wall adjacent to the latch side of the entry doorway stating the floor level and the upper and lower terminus of the stairway. The sign shall provide raised Arabic numerals and raised Grade 2 Braille symbols and shall comply with the finish and contrast requirements set forth. Signage should be located where a person may approach within three inches of the sign without encountering protruding objects or standing within the swing of the door.	Not_Started	None	6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Signage	Robotics Lab		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Signage	Space Center Main Entrance		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Signage	Projector Room, Patio Entrance, Office in Robotics Lab		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Signage	Theatre, Launch Pad Room, Mission Control Room		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Signage	Office next to 2nd Floor Womens Restroom		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Signage	Supervisors Office, Kitchenette next to Supervisors Office, Supervisors Office, Office next to Supervisors Office		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	Womens Restroom next to East Diamond Baseball Field	Female	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/21

Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242									
Restrooms	Womens Restroom next to East Diamond Baseball Field	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None		6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242									
Restrooms	Womens Restroom next to East Diamond Baseball Field	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None		6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242									
Restrooms	Mens Restroom next to East Diamond Baseball Field		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None		6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242									
Restrooms	Mens Restroom next to East Diamond Baseball Field		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None		6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242									
Restrooms	Mens Restroom next to East Diamond Baseball Field		Compartment Door Swings In	The door to the compartment swings inward into the minimum required compartment area.	Modify the swing of the door so that it does not swing into the minimum required compartment area.	Not_Started	None		6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242									
Restrooms	Mens Restroom next to East Diamond Baseball Field		Toilet Paper Dispenser Height	The toilet paper dispenser is not mounted at the required height.	Remount the toilet paper dispenser in the compartment to the required height.	Not_Started	None		6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242									
Restrooms	Mens Restroom next to East Diamond Baseball Field	Male	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None		6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242									
Restrooms	Mens Restroom next to East Diamond Baseball Field	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None		6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242									
Restrooms	Mens Restroom next to East Diamond Baseball Field	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None		6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242									
Restrooms	Womens Restroom next to East Diamond Baseball Field		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None		6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242									
Restrooms	Womens Restroom next to East Diamond Baseball Field		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None		6/30/21
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242									
Restrooms	Womens Restroom next to East Diamond Baseball Field		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None		6/30/22

Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	Womens Restroom next to East Diamond Baseball Field		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	Womens Restroom next to East Diamond Baseball Field		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Unisex Restroom		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Unisex Restroom	Unisex	Unisex Restroom Signage	Signage does not include contrasting gender use symbols.	Provide compliant contrasting gender use unisex signage.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Unisex Restroom	Blower	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Unisex Restroom	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Womens Restroom - Standard		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Womens Restroom - Standard		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Womens Restroom - Standard		Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Womens Restroom - Standard		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Womens Restroom - Standard		Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Womens Restroom - Standard		Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/22

Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Unisex Restroom	Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Unisex Restroom	Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Unisex Restroom	Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Unisex Restroom	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Womens Restroom - Ambulatory	Shelf Height	The shelf is mounted at an incorrect height.	Mount the shelf at the recommended height.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Womens Restroom - Ambulatory	Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Womens Restroom - Ambulatory	Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Womens Restroom - Ambulatory	Compartment Door Width	The clear opening width of the doorway to the compartment is less than required.	Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Womens Restroom - Ambulatory	Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Womens Restroom - Ambulatory	Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Womens Restroom - Ambulatory	Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Womens Restroom - Ambulatory	Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/22

Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Womens Restroom - Ambulatory		Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Mens Restroom		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Mens Restroom	Male	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Mens Restroom	Blower	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Mens Restroom	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Mens Restroom		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Mens Restroom		Compartment Door Swings In	The door to the compartment swings inward into the minimum required compartment area.	Modify the swing of the door so that it does not swing into the minimum required compartment area.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Mens Restroom		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Mens Restroom		Rear Grab Bar Interferes	Rear grab bar interferes with the tank/flushometer.	Readjust the rear grab bar so that it does not interfere with the tank/flushometer.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Mens Restroom		Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Mens Restroom		Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Restrooms	1st Floor Womens Restroom		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/22

Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Restrooms	1st Floor Womens Restroom	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Restrooms	2nd Floor Womens Restroom		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Restrooms	2nd Floor Womens Restroom		Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Restrooms	2nd Floor Mens Restroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Restrooms	2nd Floor Mens Restroom	Male	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Restrooms	2nd Floor Mens Restroom	Male	No Contrasting Finish	The signage does not have contrasting finish from the door.	Restroom door signage should have contrasting finish.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Restrooms	2nd Floor Womens Restroom		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Restrooms	2nd Floor Mens Restroom		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Restrooms	2nd Floor Mens Restroom		Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Restrooms	2nd Floor Mens Restroom		Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Drinking Fountains	Drinking Fountain next to Soccer Field		Stream Height	The height of the water stream is less than required.	Insure that the spout directs the water flow to the required height and in a trajectory that is parallel or nearly parallel to the front of the drinking fountain.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242				Drinking Fountains	Drinking Fountain between West Diamond Baseball Field & Space Center		Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	6/30/22

Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Drinking Fountains	Drinking Fountain between West Diamond Baseball Field & Space Center	Stream Height	The height of the water stream is less than required.	Insure that the spout directs the water flow to the required height and in a trajectory that is parallel or nearly parallel to the front of the drinking fountain.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Drinking Fountains	Drinking Fountain between West Diamond Baseball Field & Space Center	Clear Floor Space Length	There is insufficient clear floor space in front of the drinking fountain.	Provide the required clear floor space that is on a primary path of travel.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Drinking Fountains	Drinking Fountain between West Diamond Baseball Field & Space Center	Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space at the drinking fountain.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Drinking Fountains	Drinking Fountain next to West Diamond Baseball Field - Right	No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Drinking Fountains	Drinking Fountain next to West Diamond Baseball Field - Left	No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Drinking Fountains	Drinking Fountain next to 1st Floor Womens Restroom	Spout Height for Standing Persons	The spout height for standing persons is not compliant.	Provide a compliant spout outlet height for standing persons.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Drinking Fountains	Drinking Fountain next to 1st Floor Womens Restroom	No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Assembly Areas	Outdoor Assembly Area	Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Outdoor Sports Areas	West Diamond Baseball Field	Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Outdoor Sports Areas	East Diamond Baseball Field	Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Emergency Warning Systems	Visual Alarms	Emergency Warning Systems	There are some visual warning devices, though visual warning devices are not located throughout the facility.	Install visual warning devices integrated with the facility's alarm system in all common areas such as hallways, classrooms and general use rooms, accessible restrooms and other accessible rooms.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Break/Conference Room	Kitchenette next to Supervisors Office	Supply Lines	Supply lines are not wrapped for the break/conference room sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/22

Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Break/Conference Room	Kitchenette next to Supervisors Office	Paper Towel	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Break/Conference Room	Theatre		Sink - Counter Height	Sink counter height does not meet the standards.	Provide compliant sink.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Break/Conference Room	Theatre		Toe Kick Not Removed	The toe kick for the sink in break/conference room is not removed.	Remove the toe kick for the sink.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Break/Conference Room	Theatre		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Break/Conference Room	Theatre		Supply Lines	Supply lines are not wrapped for the break/conference room sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Break/Conference Room	Theatre		Tables - Knee Depth	The table knee depth does not meet required standards.	Provide compliant tables.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Picnic Areas	Picnic Tables in Space Center Patio		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Picnic Areas	Picnic Tables in Space Center Patio		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Reach Ranges	1st Floor Museum	Computer Station	Knee Height	The knee height is not compliant.	Adjust knee height to the recommended value.	Not_Started	None	6/30/22
Discovery Sports Complex Park - 12400 Columbia Way Downey, CA 90242	Benches	Benches between West Diamond Baseball Field & Space Center		Clear Floor Space	No clear floor space provided at the bench.	Provide compliant clear floor space for the bench at one end.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Curb Ramps	Curb Ramp next to Courtyard Gate		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Curb Ramps	Curb Ramp next to Courtyard Gate		Curb Ramp Slope	The running slope is greater than allowed.	Provide a compliant curb ramp.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Curb Ramps	Curb Ramp next to Courtyard Gate		Side Flare Slope	The slope of the curb ramp side flare is greater than allowed.	Provide curb ramp side flares with a compliant slope.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Curb Ramps	Curb Ramp next to Courtyard Gate	Bottom Landing	Bottom Landing Change in Level - Curb Ramps	The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.	Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Curb Ramps	Curb Ramp next to Courtyard Gate	Top Landing	Top Landing Clear Length - Landings	There is not enough top landing clear length.	Provide a level top landing with enough clear length.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Curb Ramps	Curb Ramp next to Box Office Stairs		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Curb Ramps	Curb Ramp next to Box Office Stairs		Curb Ramp Slope	The running slope is greater than allowed.	Provide a compliant curb ramp.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Curb Ramps	Curb Ramp next to Box Office Stairs		Curb Ramp - Cross Slope	The cross slope is greater than allowed.	Provide a compliant curb ramp.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Curb Ramps	Curb Ramp next to Box Office Stairs		Side Flare Slope	The slope of the curb ramp side flare is greater than allowed.	Provide curb ramp side flares with a compliant slope.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Path of Travel	Sidewalk from Gate next to Library to Box Office	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Path of Travel	Sidewalk from Room 129 Entrance to Box Office	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Path of Travel	Sidewalk next to Main Entrance	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Path of Travel	Sidewalk from Brookshire Avenue to Performers Entrance	Exterior Walkway	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Path of Travel	Sidewalk from Brookshire Avenue to Performers Entrance	Curb	Curb is on The Path of Travel	There is a curb on the designated path of travel.	Provide a compliant curb ramp.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Path of Travel	Sidewalk from Brookshire Avenue to Performers Entrance - Continued	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Path of Travel	Sidewalk from Brookshire Avenue to Performers Entrance - Continued	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Path of Travel	Sidewalk from Brookshire Avenue to Box Office	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Path of Travel	Sidewalk from Brookshire Avenue to Box Office	Change In Level	Change In Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Path of Travel	Lobby	Stairway	Protruding Objects - Vertical Clearance	The vertical clearance height is less than required.	Provide recommended vertical clearance.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Path of Travel	Multipurpose Room	Light	Protruding Objects - Vertical Clearance	The vertical clearance height is less than required.	Provide recommended vertical clearance.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Path of Travel	Room 2	Paint Run Off Ditch	Curb Height	The curb height is not compliant.	Provide a curb with a compliant height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Path of Travel	Room 2	HVAC Unit	Protruding Objects - Vertical Clearance	The vertical clearance height is less than required.	Provide recommended vertical clearance.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Path of Travel	Wardrobe	Fire Extinguisher 311	Protruding Objects - Protrusion Limit	The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.	Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Ramps	Ramp next to Embassy Suites	Run 1	Ramp Run Edge Protection	The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.	Install compliant edge protection on each side of the ramp run.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Ramps	Ramp next to Embassy Suites	Run 1	No Handrail	There is only one handrail provided.	Provide compliant handrails on each side.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Ramps	Ramp next to Embassy Suites	Run 1 Top Landing	Landing Slope	The slope of the landing is greater than required.	Modify the landing to create a slope in any direction not exceeding the required maximum value.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Ramps	Ramp next to Embassy Suites	Run 1 Right Handrail	Handrail Diameter	The diameter of the handrail is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Ramps	Ramp next to Embassy Suites	Run 1 Right Handrail	Handrail Bottom Extension	There is not enough extension beyond the top or bottom of the ramp.	The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Ramps	Ramp next to Embassy Suites	Run 1 Right Handrail	Handrail Extension not Parallel	The handrail extension is not parallel to the floor or ground surface.	The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Ramps	Ramp next to Embassy Suites	Run 1 Right Handrail	Handrail Height	The height of the handrails on the ramp is not within the required range above the surface of the ramp.	Modify or replace the handrails on the ramp to provide a gripping surface height within the required range above the ramp surface.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Ramps	Ramp next to Left Aisle Seating	Run 2	No Handrails	There are no handrails.	Provide compliant handrails on each side.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Ramps	Ramp next to Left Aisle Seating	Run 2	Ramp Run Slope	The slope of the ramp is greater than the allowed slope.	Modify the run of the ramp to provide the required slope and cross slope.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435									
Downey, CA 90240	Ramps	Ramp next to Left Aisle Seating	Run 2	Ramp Run Cross Slope	The cross slope of the ramp is greater than the allowed cross slope.	Modify the run of the ramp to provide the required slope and cross slope.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Ramps	Ramp next to Left Aisle Seating	Run 2 Intermediate Landing	Landing Slope	The slope of the landing is greater than required.	Modify the landing to create a slope in any direction not exceeding the required maximum value.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Ramps	Ramp next to Left Aisle Seating	Run 1	No Handrails	There are no handrails.	Provide compliant handrails on each side.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Ramps	Ramp next to Left Aisle Seating	Run 1 Bottom Landing	Bottom Landing Length	The length of the bottom landing does not meet the required minimum length.	Modify or replace the bottom landing to provide the required minimum length and width.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Ramps	Ramp next to Left Aisle Seating	Run 1 Bottom Landing	Landing Slope	The slope of the landing is greater than required.	Modify the landing to create a slope in any direction not exceeding the required maximum value.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Ramps	Ramp next to Left Aisle Seating	Run 1 Intermediate Landing	Landing Slope	The slope of the landing is greater than required.	Modify the landing to create a slope in any direction not exceeding the required maximum value.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Ramps	Ramp next to Left Aisle Seating	Run 3	Ramp Run Slope	The slope of the ramp is greater than the allowed slope.	Modify the run of the ramp to provide the required slope and cross slope.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Ramps	Ramp next to Left Aisle Seating	Run 3	No Handrails	There are no handrails.	Provide compliant handrails on each side.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Ramps	Ramp next to Left Aisle Seating	Run 3 Top Landing	Landing Slope	The slope of the landing is greater than required.	Modify the landing to create a slope in any direction not exceeding the required maximum value.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Ramps	Ramp next to Right Aisle Seating	Run 1	Ramp Run Cross Slope	The cross slope of the ramp is greater than the allowed cross slope.	Modify the run of the ramp to provide the required slope and cross slope.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Ramps	Ramp next to Right Aisle Seating	Run 1	No Handrails	There are no handrails.	Provide compliant handrails on each side.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Ramps	Ramp next to Right Aisle Seating	Run 1 Bottom Landing	Bottom Landing Length	The length of the bottom landing does not meet the required minimum length.	Modify or replace the bottom landing to provide the required minimum length and width.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Ramps	Ramp next to Right Aisle Seating	Run 1 Intermediate Landing	Landing Slope	The slope of the landing is greater than required.	Modify the landing to create a slope in any direction not exceeding the required maximum value.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Ramps	Ramp next to Right Aisle Seating	Run 2	Ramp Run Slope	The slope of the ramp is greater than the allowed slope.	Modify the run of the ramp to provide the required slope and cross slope.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Ramps	Ramp next to Right Aisle Seating	Run 2	Ramp Run Cross Slope	The cross slope of the ramp is greater than the allowed cross slope.	Modify the run of the ramp to provide the required slope and cross slope.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Ramps	Ramp next to Right Aisle Seating	Run 2	No Handrails	There are no handrails.	Provide compliant handrails on each side.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Ramps	Ramp next to Right Aisle Seating	Run 2 Intermediate Landing	Landing Slope	The slope of the landing is greater than required.	Modify the landing to create a slope in any direction not exceeding the required maximum value.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Ramps	Ramp next to Right Aisle Seating	Run 3	Ramp Run Slope	The slope of the ramp is greater than the allowed slope.	Modify the run of the ramp to provide the required slope and cross slope.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Ramps	Ramp next to Right Aisle Seating	Run 3	No Handrails	There are no handrails.	Provide compliant handrails on each side.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Ramps	Ramp next to Right Aisle Seating	Run 3 Top Landing	Landing Slope	The slope of the landing is greater than required.	Modify the landing to create a slope in any direction not exceeding the required maximum value.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Room 115C	Run 1	No Riser Striping	There is no detectable striping on each tread of the exterior stairway.	Affix detectable contrasting striping to each tread of the stairway that clearly contrasts in color from the tread and is at least 2 inches in width placed no more than 1 inch from the tread nose or landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Room 115C	Run 1 Right Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Room 115C	Run 1 Right Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Room 115C	Run 1 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Room 115C	Run 1 Right Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Room 115C	Run 1 Left Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Room 115C	Run 1 Left Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Room 115C	Run 1 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Room 115C	Run 1 Left Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Room 115C	Run 1 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 1	No Riser Striping	There is no detectable striping on each tread of the exterior stairway.	Affix detectable contrasting striping to each tread of the stairway that clearly contrasts in color from the tread and is at least 2 inches in width placed no more than 1 inch from the tread nose or landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 1 Left Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 1 Left Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 1 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 1 Left Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 1 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 1 Right Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 1 Right Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 1 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 1 Right Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 2	No Riser Striping	There is no detectable striping on each tread of the exterior stairway.	Affix detectable contrasting striping to each tread of the stairway that clearly contrasts in color from the tread and is at least 2 inches in width placed no more than 1 inch from the tread nose or landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 2 Right Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 2 Right Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 2 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 2 Right Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 2 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 2 Left Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 2 Left Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 2 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 2 Left Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to 115 D	Run 2 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 2	No Riser Striping	There is no detectable striping on each tread of the exterior stairway.	Affix detectable contrasting striping to each tread of the stairway that clearly contrasts in color from the tread and is at least 2 inches in width placed no more than 1 inch from the tread nose or landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 2 Left Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 2 Left Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 2 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 2 Left Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 2 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 2 Right Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 2 Right Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 2 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 2 Right Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 2 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 1	No Riser Striping	There is no detectable striping on each tread of the exterior stairway.	Affix detectable contrasting striping to each tread of the stairway that clearly contrasts in color from the tread and is at least 2 inches in width placed no more than 1 inch from the tread nose or landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 1 Left Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 1 Left Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 1 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 1 Left Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 1 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 1 Right Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 1 Right Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 1 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 1 Right Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Theatre Office	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Right Stairs next to Theatre	Run 1	No Riser Striping	There is no detectable striping on each tread of the exterior stairway.	Affix detectable contrasting striping to each tread of the stairway that clearly contrasts in color from the tread and is at least 2 inches in width placed no more than 1 inch from the tread nose or landing.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Right Stairs next to Theatre	Run 1 Middle Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Right Stairs next to Theatre	Run 1 Middle Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Right Stairs next to Theatre	Run 1 Middle Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Right Stairs next to Theatre	Run 1 Left Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Right Stairs next to Theatre	Run 1 Left Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Right Stairs next to Theatre	Run 1 Left Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Right Stairs next to Theatre	Run 1 Left Handrail	Handrail Near Wall	The surface texture of the wall adjacent to the handrail is sharp and abrasive.	Modify the surface texture on the wall adjacent to the handrail so that the surface is smooth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Right Stairs next to Theatre	Run 1 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Right Stairs next to Theatre	Run 1 Right Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Right Stairs next to Theatre	Run 1 Right Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Right Stairs next to Theatre	Run 1 Right Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Right Stairs next to Theatre	Run 1 Right Handrail	Handrail Near Wall	The surface texture of the wall adjacent to the handrail is sharp and abrasive.	Modify the surface texture on the wall adjacent to the handrail so that the surface is smooth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Room 102 Entrance			Stairway is marked as primary access. There is no other means of vertical access.	Provide a compliant means of vertical access.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Room 102 Entrance	Run 1	No Riser Striping	There is no detectable striping on each tread of the exterior stairway.	Affix detectable contrasting striping to each tread of the stairway that clearly contrasts in color from the tread and is at least 2 inches in width placed no more than 1 inch from the tread nose or landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Room 102 Entrance	Run 1 Left Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Room 102 Entrance	Run 1 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Room 102 Entrance	Run 1 Left Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Room 102 Entrance	Run 1 Right Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Room 102 Entrance	Run 1 Right Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Room 102 Entrance	Run 1 Right Handrail	Handrail Near Wall	The surface texture of the wall adjacent to the handrail is sharp and abrasive.	Modify the surface texture on the wall adjacent to the handrail so that the surface is smooth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Room 102 Entrance	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1	No Riser Striping	There is no detectable striping on each tread of the exterior stairway.	Affix detectable contrasting striping to each tread of the stairway that clearly contrasts in color from the tread and is at least 2 inches in width placed no more than 1 inch from the tread nose or landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Right Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Right Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Right Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Right Handrail	Handrail Near Wall	The surface texture of the wall adjacent to the handrail is sharp and abrasive.	Modify the surface texture on the wall adjacent to the handrail so that the surface is smooth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Left Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Left Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Left Handrail	Handrail Near Wall	The surface texture of the wall adjacent to the handrail is sharp and abrasive.	Modify the surface texture on the wall adjacent to the handrail so that the surface is smooth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Left Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Left Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Middle Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Middle Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Middle Handrail	Handrail Near Wall	The surface texture of the wall adjacent to the handrail is sharp and abrasive.	Modify the surface texture on the wall adjacent to the handrail so that the surface is smooth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Middle Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Middle Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Middle Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Middle Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Left Stairs next to Theatre	Run 1 Middle Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Box Office	Run 1	No Riser Striping	There is no detectable striping on each tread of the exterior stairway.	Affix detectable contrasting striping to each tread of the stairway that clearly contrasts in color from the tread and is at least 2 inches in width placed no more than 1 inch from the tread nose or landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Box Office	Run 1 Middle Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Box Office	Run 1 Middle Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Box Office	Run 1 Middle Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Box Office	Run 1 Middle Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Box Office	Run 1 Right Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Box Office	Run 1 Middle Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Box Office	Run 1 Middle Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Box Office	Run 1 Middle Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Box Office	Run 1 Middle Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Balcony Seating			Stairway is marked as primary access. There is no other means of vertical access.	Provide a compliant means of vertical access.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Balcony Seating	Run 1	Risers Striping Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Balcony Seating	Run 1 Right Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Balcony Seating	Run 1 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Balcony Seating	Run 1 Left Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Balcony Seating	Run 1 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Stage Right			Stairway is marked as primary access. There is no other means of vertical access.	Provide a compliant means of vertical access.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Stage Right	Run 1	Stair Run Width	The width of the stairway does not meet the minimum required width.	Install a stairway with a minimum width as required.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Stage Right	Run 1	Risers Height	The risers on the stairway are not a compliant height.	Modify or replace the stairs to provide compliant riser height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Stage Right	Run 1	No Riser Striping	There is no detectable striping on the stairways.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Stage Right	Run 1 Right Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435									
Downey, CA 90240	Stairs	Stairs to Stage Right	Run 1 Right Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Stairs	Stairs to Stage Right	Run 1 Right Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Stairs	Stairs to Stage Right	Run 1 Right Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Stairs	Stairs to Stage Right	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Stairs	Stairs to Stage Left			Stairway is marked as primary access. There is no other means of vertical access.	Provide a compliant means of vertical access.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Stairs	Stairs to Stage Left	Run 1	Riser Tread Depth	The treads do not have a compliant depth.	Modify or replace the stairs to provide compliant treads.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Stairs	Stairs to Stage Left	Run 1	Risers Height	The risers on the stairway are not a compliant height.	Modify or replace the stairs to provide compliant riser height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Stairs	Stairs to Stage Left	Run 1	No Riser Striping	There is no detectable striping on the stairways.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Stairs	Stairs to Stage Left	Run 1 Left Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Stairs	Stairs to Stage Left	Run 1 Left Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Stairs	Stairs to Stage Left	Run 1 Left Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Stairs	Stairs to Stage Left	Run 1 Left Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Stairs	Stairs to Stage Left	Run 1 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom			Stairway is marked as primary access. There is no other means of vertical access.	Provide a compliant means of vertical access.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom	Run 2	No Handrail on One Side	There is no handrail provided on one side of the stairway.	Provide compliant handrails on the stairway.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom	Run 2	Riser Nosing not Smooth	The under nosing of the treads on the stairway are abrupt.	Modify the nosing on the stairway so that the nosing is curved or beveled and do not project more than required over the tread below.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom	Run 2	Risers Height	The risers on the stairway are not a compliant height.	Modify or replace the stairs to provide compliant riser height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom	Run 2	Risers Not Closed	The risers on the stairway are open.	Close the riser openings on the stairway. Open risers are not permitted.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom	Run 2	No Riser Striping	There is no detectable striping on the stairways.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom	Run 2 Right Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom	Run 2 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom	Run 2 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom	Run 1	No Handrail on One Side	There is no handrail provided on one side of the stairway.	Provide compliant handrails on the stairway.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom	Run 1	Riser Nosing not Smooth	The under nosing of the treads on the stairway are abrupt.	Modify the nosing on the stairway so that the nosing is curved or beveled and do not project more than required over the tread below.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom	Run 1	Risers Height	The risers on the stairway are not a compliant height.	Modify or replace the stairs to provide compliant riser height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom	Run 1	Risers Not Closed	The risers on the stairway are open.	Close the riser openings on the stairway. Open risers are not permitted.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom	Run 1	No Riser Striping	There is no detectable striping on the stairways.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom	Run 1 Right Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom	Run 1 Right Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Backstage Mens Restroom	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Set Fabrication			Stairway is marked as primary access. There is no other means of vertical access.	Provide a compliant means of vertical access.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Set Fabrication	Run 1	Riser Nosing not Smooth	The under nosing of the treads on the stairway are abrupt.	Modify the nosing on the stairway so that the nosing is curved or beveled and do not project more than required over the tread below.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Set Fabrication	Run 1	No Riser Striping	There is no detectable striping on the stairways.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Set Fabrication	Run 1 Right Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Set Fabrication	Run 1 Right Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Set Fabrication	Run 1 Left Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Set Fabrication	Run 1 Left Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Set Fabrication	Run 2	Riser Nosing not Smooth	The under nosing of the treads on the stairway are abrupt.	Modify the nosing on the stairway so that the nosing is curved or beveled and do not project more than required over the tread below.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Set Fabrication	Run 2	No Riser Striping	There is no detectable striping on the stairways.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Set Fabrication	Run 2 Left Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Set Fabrication	Run 2 Left Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Set Fabrication	Run 2 Right Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Set Fabrication	Run 2 Right Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Backstage Entrance	Run 1	No Riser Striping	There is no detectable striping on the stairways.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Backstage Entrance	Run 1 Left Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Backstage Entrance	Run 1 Left Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Backstage Entrance	Run 1 Right Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Backstage Entrance	Run 1 Right Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Backstage Entrance	Run 1 Right Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Right Production Booth			Stairway is marked as primary access. There is no other means of vertical access.	Provide a compliant means of vertical access.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Right Production Booth	Run 1	Stair Run Width	The width of the stairway does not meet the minimum required width.	Install a stairway with a minimum width as required.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Right Production Booth	Run 1	No Handrail on One Side	There is no handrail provided on one side of the stairway.	Provide compliant handrails on the stairway.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Right Production Booth	Run 1	Riser Tread Depth	The treads do not have a compliant depth.	Modify or replace the stairs to provide compliant treads.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Right Production Booth	Run 1	Risers Height	The risers on the stairway are not a compliant height.	Modify or replace the stairs to provide compliant riser height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Right Production Booth	Run 1	Risers Striping Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Right Production Booth	Run 1 Right Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs next to Right Production Booth	Run 1 Right Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Production Booth			Stairway is marked as primary access. There is no other means of vertical access.	Provide a compliant means of vertical access.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Production Booth	Run 1	Riser Nosing not Smooth	The under nosing of the treads on the stairway are abrupt.	Modify the nosing on the stairway so that the nosing is curved or beveled and do not project more than required over the tread below.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Production Booth	Run 1	Risers Striping Width	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Production Booth	Run 1 Right Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Production Booth	Run 1 Right Handrail	Handrail Interrupted	The gripping surface of the handrail is interrupted.	Remount the handrails so they are not interrupted. Otherwise, replace the handrails with ones that provide a smooth, uninterrupted gripping surface.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Production Booth	Run 1 Right Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Production Booth	Run 1 Right Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Production Booth	Run 1 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Production Booth	Run 1 Right Handrail	Handrail Extension not Parallel	The handrail extension is not parallel with the floor surface at the bottom landing.	Install a compliant extension to the handrail.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Production Booth	Run 1 Right Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Production Booth	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Main Floor			Stairway is marked as primary access. There is no other means of vertical access.	Provide a compliant means of vertical access.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Main Floor	Run 1	Riser Nosing not Smooth	The under nosing of the treads on the stairway are abrupt.	Modify the nosing on the stairway so that the nosing is curved or beveled and do not project more than required over the tread below.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Main Floor	Run 1	Risers Height	The risers on the stairway are not a compliant height.	Modify or replace the stairs to provide compliant riser height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Main Floor	Run 1	No Riser Striping	There is no detectable striping on the stairways.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Main Floor	Run 1 Left Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Main Floor	Run 1 Left Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Main Floor	Run 1 Right Handrail	No Top Handrail Extension	There are no top handrail extensions provided on the stairway.	Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Main Floor	Run 1 Right Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Orchestra Room			Stairway is marked as primary access. There is no other means of vertical access.	Provide a compliant means of vertical access.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Orchestra Room	Run 1	Risers Height	The risers on the stairway are not a compliant height.	Modify or replace the stairs to provide compliant riser height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Orchestra Room	Run 1	No Riser Striping	There is no detectable striping on the stairways.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Orchestra Room	Run 1 Left Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Orchestra Room	Run 1 Left Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Orchestra Room	Run 1 Left Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Orchestra Room	Run 1 Right Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Orchestra Room	Run 1 Right Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs to Orchestra Room	Run 1 Right Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Orchestra Room			Stairway is marked as primary access. There is no other means of vertical access.	Provide a compliant means of vertical access.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Orchestra Room	Run 1	Stair Run Width	The width of the stairway does not meet the minimum required width.	Install a stairway with a minimum width as required.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Orchestra Room	Run 1	Vertical Clearance Height	Stair run vertical clearance height is not compliant.	Provide compliant vertical clearance for the stair run.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Orchestra Room	Run 1	Risers Height	The risers on the stairway are not a compliant height.	Modify or replace the stairs to provide compliant riser height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Orchestra Room	Run 1	Risers Not Closed	The risers on the stairway are open.	Close the riser openings on the stairway. Open risers are not permitted.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Orchestra Room	Run 1	No Riser Striping	There is no detectable striping on the stairways.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Orchestra Room	Run 1 Left Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Orchestra Room	Run 1 Left Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Orchestra Room	Run 1 Left Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Orchestra Room	Run 1 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Orchestra Room	Run 1 Right Handrail	Handrail Diameter	The diameter of the handrails is not within the required range.	Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Orchestra Room	Run 1 Right Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Orchestra Room	Run 1 Right Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Stairs	Stairs in Orchestra Room	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Doors	Gate next to Ticket Office	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Doors	Gate next to Ticket Office	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Doors	Gate next to Ticket Office	Push / Pull	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Doors	Ticket Booth Unisex Restroom		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Doors	Ticket Booth Unisex Restroom	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Doors	Ticket Booth Unisex Restroom	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Ticket Booth Unisex Restroom	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Ticket Booth Unisex Restroom	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Ticket Booth Unisex Restroom	Single Knob	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Ticket Booth Unisex Restroom	Single Knob	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Ticket Office		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Ticket Office	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Ticket Office	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Ticket Office next to Restroom - 1st Door		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Ticket Office next to Restroom - 1st Door	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Ticket Office next to Restroom - 1st Door	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Ticket Office next to Restroom - 1st Door		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Snack Bar		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Snack Bar	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Snack Bar	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Ticket Office Entrance		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Ticket Office Entrance	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Gate next to Snack Bar	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Gate next to Snack Bar	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Gate next to Snack Bar	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Gate next to Snack Bar	Push / Pull	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Director Office		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Director Office	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Director Office	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Director Office	Single Knob	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Director Office	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Director Office		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Ticket Office next to Restroom - 2nd Door		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Ticket Office next to Restroom - 2nd Door	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Ticket Office next to Restroom - 2nd Door	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Gate next to Backstage Entrance	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Gate next to Backstage Entrance	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Gate next to Backstage Entrance	Lever	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Courtyard Gate	Push Bar Only	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Courtyard Gate	Push Bar Only	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Sound Station Hallway - 2nd Door		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Sound Station Hallway - 2nd Door	Push Bar / Thumb Latch	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Lobby Entrance next to Womens Restroom	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Lobby Entrance next to Womens Restroom	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Lobby Entrance next to Womens Restroom	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Lobby Entrance next to Womens Restroom		Bottom Door Panel Height	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Lobby Entrance next to Womens Restroom	Push Bar / D Handle	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Lobby Entrance next to Womens Restroom		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Sound Station Hallway - 1st Door	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Sound Station Hallway - 1st Door	Lever	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Lobby Entrance next to Mens Restroom	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Lobby Entrance next to Mens Restroom	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Lobby Entrance next to Mens Restroom		Bottom Door Panel Height	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Lobby Entrance next to Mens Restroom	Push Bar / D Handle	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Lobby Entrance next to Mens Restroom		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Hallway - 2nd Door		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Hallway - 2nd Door	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Hallway - 2nd Door	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Hallway - 2nd Door	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Hallway - 2nd Door	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Main Entrance	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Main Entrance		Bottom Door Panel Height	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Main Entrance	Push Bar / D Handle	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Main Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Lobby Mens Restroom	Pull Side	Latch Approach Clear Floor Space Width	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Hallway - 1st Door		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Hallway - 1st Door	Push Bar / Thumb Latch	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Hallway - 1st Door	Push Bar / Thumb Latch	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	119 Stage	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	119 Stage	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	119 Stage	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Backstage Entrance	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Backstage Entrance	Push Bar / Thumb Latch	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Exit - 1st Door		Width Between Doors When Open	There is less than the required clearance between the two doors in a series.	Remove the inner door in a series to provide an accessible entrance.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Exit - 1st Door	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Exit - 1st Door	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Hallway next to Room 120	Push Bar / Thumb Latch	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Hallway next to Room 120	Push Bar / Thumb Latch	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Exit - 2nd Door	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Theater Exit - 2nd Door	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Backstage Left, Backstage Right	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/22

Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Backstage Left, Backstage Right	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/22	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Backstage Left, Backstage Right	Pull Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/22	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Backstage Left, Backstage Right	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/22	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Theater Offices	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/22	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Theater Offices		Bottom Door Panel Height	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/22	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Theater Offices	Push Bar / D Handle	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/22	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Theater Office Entrance, Room 129 Entrance, Star Room Entrance	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/22	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Theater Office Entrance, Room 129 Entrance, Star Room Entrance	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/22	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Theater Office Entrance, Room 129 Entrance, Star Room Entrance		Bottom Door Panel Height	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/22	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Hallway next to 140 Mens Dressing Room		Bottom Door Panel Height	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/22	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Hallway next to 140 Mens Dressing Room	Push Bar / D Handle	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/22	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Office 126 in Hallway	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	6/30/22	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Office 126 in Hallway	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/22	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Office 126	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/22	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Office 126	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/22	

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240									
Doors	Set Fabrication next to Basement			Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240									
Doors	Set Fabrication next to Basement	Lever		Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240									
Doors	Set Fabrication	Lever		Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240									
Doors	Set Fabrication	Lever		Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240									
Doors	Hallway next to Basement	Push Bar / Thumb Latch		Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240									
Doors	Hallway next to Basement	Push Bar / Thumb Latch		Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240									
Doors	Entrance next to Loading Dock	Push Side		Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240									
Doors	Entrance next to Loading Dock	Push Side		Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240									
Doors	Entrance next to Loading Dock	Pull Side		Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/22
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240									
Doors	Entrance next to Loading Dock	Pull Side		Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240									
Doors	Set Fabrication Entrance	Push Side		Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240									
Doors	Set Fabrication Entrance	Pull Side		Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240									
Doors	Set Fabrication Entrance	Push Bar / Thumb Latch		Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240									
Doors	Star Room, Room 129	Single Knob		Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240									
Doors	Star Room, Room 129	Single Knob		Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/25

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Star Room, Room 129	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Mens Shower in Mens Restroom 141		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Mens Dressing Room	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Womens Restroom 133		Doorway Opening Width	The clear opening width of the doorway is not compliant.	Provide a compliant doorway at the location.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Entrance next to Room 129	Push Bar / D Handle	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Entrance next to Room 129		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Mens Restroom 141		Doorway Opening Width	The clear opening width of the doorway is not compliant.	Provide a compliant doorway at the location.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Womens Shower in Womens Restroom 133		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Womens Shower in Womens Restroom 133	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 129 Break Area		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 129 Break Area	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 129 Break Area	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 129 Break Area	Single Knob	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Mens Restroom 141 - Dressing Room	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 129 Green Room	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/25

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 129 Green Room	None	No Hardware	Door hardware broken or missing.	Provide compliant accessible door hardware.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 129 Green Room	None	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 129 Green Room	None	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Womens Dressing Room	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 143		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 143	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Womens Restroom 133 - Hallway		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Womens Restroom 133 - Hallway	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Mens Restroom 141 - Hallway		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Mens Restroom 141 - Hallway	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Mens Restroom 141 - Hallway	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Mens Restroom 141 - Hallway	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Balcony Seating	Push Bar / Thumb Latch	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Balcony Seating	Push Bar / Thumb Latch	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Balcony Seating	Push Bar / Thumb Latch	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/25

Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Unisex Restroom 218 - Hallway			Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Unisex Restroom 218 - Hallway	Push Side	Latch Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/25	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Unisex Restroom 218 - Hallway	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/25	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Unisex Restroom 218 - Hallway	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Control Room		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/25	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Control Room	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/25	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Control Room	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Right Production Booth	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Right Production Booth	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/25	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Sound Room		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/25	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Sound Room	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/25	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Sound Room	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/25	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Sound Room	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/25	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Sound Room	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25	
Downey Civic Theatre - 8435										
Firestone Boulevard Downey, CA 90240	Doors	Sound Room	Single Knob	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/25	

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Sound Room	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Production Control	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Production Control	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Production Control	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Production Control	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Unisex Restroom 218 - Control Room		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Unisex Restroom 218 - Control Room	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Unisex Restroom 218 - Control Room	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Office 221		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Office 221	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Office 221	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Office 221	Single Knob	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Office 221	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	210 Office	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	210 Office	Single Knob	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/25

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Multipurpose Room next to 210 Office	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Multipurpose Room next to 210 Office	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Multipurpose Room next to 210 Office	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Multipurpose Room	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Multipurpose Room	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Multipurpose Room	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Wardrobe	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 4		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 4	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 4 Entrance	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 4 Entrance	Pull Side	Latch Approach Clear Floor Space Width	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 4 Entrance	Pull Side	Latch Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 4 Entrance	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 4 Entrance	Single Knob	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 4 Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/25

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Orchestra Room	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Orchestra Room	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Orchestra Room	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Orchestra Room	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Orchestra Room	Single Knob	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Orchestra Room	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Doors	Room 2	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Counters	Ticket Office		Counter Height	The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.	Provide a portion of counter at the compliant height.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Counters	Ticket Office		Counter Length	The length of the counter or desk does not comply with length requirements. No equivalent facilitation is provided in the area.	Provide a counter or desk with the required length.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Counters	Ticket Office		Knee Clearance Depth	The knee clearance depth provided is not compliant.	Provide compliant knee clearance depth at the counter for a forward approach.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Counters	Wardrobe		Counter Height	The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.	Provide a portion of counter at the compliant height.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Counters	Wardrobe		Counter Length	The length of the counter or desk does not comply with length requirements. No equivalent facilitation is provided in the area.	Provide a counter or desk with the required length.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Ticket Office next to Restroom		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Snack Bar		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Directional Signage from the Public Right of Way		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/25

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Lobby Entrance	No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Sound Station Hallway	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Main Entrance	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	119 Stage	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Backstage Entrance	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Hallway next to Basement	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Office 126 in Hallway	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Office 126	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Set Fabrication	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Entrance next to Loading Dock	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Theater Office Entrance	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Room 129 Break Area	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Womens Dressing Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Room 143	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Entrance next to Room 129	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Room 129 Green Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Mens Dressing Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Mens Shower in Mens Restroom 141	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Balcony Seating	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Production Booth	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Control Room, Sound Room, Office 221	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Multipurpose Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	210 Office	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Signage	Room 2, 4, Wardrobe, Orchestra Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom	Toilet Clear Floor Space Width	There is not a minimum of 60 inches of clearance around the water closet measured perpendicular from the side wall.	Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom	No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom	Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom	Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom	Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/25

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom		Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom		No Door Privacy Lock and Occupied Indicator	The restroom door does not provide a compliant privacy lock with occupancy indicator.	Install a compliant privacy lock with occupancy indicator to the door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom	Lavatory	Lavatory Clear Floor Space Width	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom	Lavatory	Lavatory Clear Floor Space Length	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom	Unisex	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Ticket Booth Unisex Restroom	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Lobby Mens Restroom		Urinal Rim Height	The height of the urinal rim in the restroom is greater than 17 inches above the finished floor.	Lower the urinal designated to be accessible in the restroom so that the rim height is not more than 17 inches above the finished floor.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Lobby Mens Restroom		Urinal Clear Floor Space Length	There is less than the required clear floor space provided in front of the urinal in the restroom to allow an accessible forward approach.	Provide the required minimum clear floor space in front of the urinal designated to be accessible in the restroom, for a forward approach.	Not_Started	None	6/30/25

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Lobby Mens Restroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Lobby Mens Restroom	Male	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Lobby Womens Restroom		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Lobby Womens Restroom		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Lobby Womens Restroom		Compartment Door Width	The clear opening width of the doorway to the compartment is less than required.	Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Lobby Womens Restroom		Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Lobby Womens Restroom		Required Alternate Stall	There are 6 or more compartments located in the multiple accommodation restroom.	Create an accessible 36-inch wide alternate compartment in addition to the required accessible standard compartment in the multiple accommodation restroom. The accessible 36-inch wide alternate compartment shall include an outward swinging, self-closing door and parallel side grab bars and shall provide at least 66 inches in length for a compartment with a wall-mounted toilet or at least 69 inches in length for a compartment with a floor-mounted toilet.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Lobby Womens Restroom		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Lobby Womens Restroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Lobby Womens Restroom	Female	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Lobby Mens Restroom		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/25
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Lobby Mens Restroom		Compartment Door Width	The clear opening width of the doorway to the compartment is less than required.	Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133	Lavatory	Lavatory Control Type	The faucet controls on the lavatory require tight grasping, pinching, or twisting of the wrist and are not accessible.	Install accessible faucet controls. Lever-operated, push-type, touch-type or electronically controlled mechanisms are acceptable elements. If self-closing valves are used the faucet shall remain open for at least 10 seconds.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/26

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133	Female	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133	Female	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133	Feminine Products	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		Toilet Compartment Length	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/26

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		Compartment Door Width	The clear opening width of the doorway to the compartment is less than required.	Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		Toilet Compartment Door	The compartment door is located in front of the water closet.	Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		Compartment Door Swings In	The door to the compartment swings inward into the minimum required compartment area.	Modify the swing of the door so that it does not swing into the minimum required compartment area.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		Urinal Flush Control Height	The height of the urinal flush control in the restroom is greater than the required maximum height.	Lower the flush control valve on the urinal to a height not greater than the required maximum height.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141	Lavatory	Lavatory Control Type	The faucet controls on the lavatory require tight grasping, pinching, or twisting of the wrist and are not accessible.	Install accessible faucet controls. Lever-operated, push-type, touch-type or electronically controlled mechanisms are acceptable elements. If self-closing valves are used the faucet shall remain open for at least 10 seconds.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/26

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141	Male	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141	Male	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/26
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Mens Restroom 141	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		Toilet Compartment Length	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	6/30/27

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		Compartment Door Width	The clear opening width of the doorway to the compartment is less than required.	Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		Toilet Compartment Door	The compartment door is located in front of the water closet.	Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		Compartment Door Swings In	The door to the compartment swings inward into the minimum required compartment area.	Modify the swing of the door so that it does not swing into the minimum required compartment area.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Womens Restroom 133		Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218		No Door Privacy Lock and Occupied Indicator	The restroom door does not provide a compliant privacy lock with occupancy indicator.	Install a compliant privacy lock with occupancy indicator to the door.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218	Lavatory	Lavatory Clear Floor Space Length	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/27

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218	Unisex	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218	Unisex	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218		No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218		Toilet Clear Floor Space Length	There is not a minimum of 56 inches of clearance around the water closet measured perpendicular from the rear wall.	Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218		No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Restrooms	Unisex Restroom 218		Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Ticket Office		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Ticket Office		Protruding Object	The drinking fountain is a protruding object.	Make sure that the fountain is not a protruding object.	Not_Started	None	6/30/27

Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Ticket Office	Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None		6/30/27
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Ticket Office	Stream Height	The height of the water stream is less than required.	Insure that the spout directs the water flow to the required height and in a trajectory that is parallel or nearly parallel to the front of the drinking fountain.	Not_Started	None		6/30/27
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Ticket Office	No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None		6/30/27
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Lobby Womens Restroom	Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None		6/30/27
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Freight Elevator	Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None		6/30/27
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Freight Elevator	Fountain Depth	Drinking fountain does not provide a required fountain depth.	Install a drinking fountain the meets the required minimum depth.	Not_Started	None		6/30/27
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Assembly Areas	Theater	Accessible Seating Information	There is no signage at the ticket counter indicating the availability of accessible seating.	Post signage at the ticket counter indicating the availability and location of accessible seating areas.	Not_Started	None		6/30/27
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Assembly Areas	Theater	Access to Performing Area	Stairs connect the front of the stage in the theater/auditorium/performing arts center to the audience seating area, the stage is not accessible from a back entrance/ramp/hallway.	Provide a vertical platform lift or other means of vertical access between the level floor seating area and the stage. It is imperative as an ADA mandate to provide access to the stage for individuals with mobility impairments who need use of the stage for all programs, services and activities.	Not_Started	None		6/30/27
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Assembly Areas	Theater	Wheelchair Location	Wheelchair Locations are not dispersed among other seating.	Disperse the Wheelchairs among other seating	Not_Started	None		6/30/27
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Assembly Areas	Theater	Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None		6/30/27
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Assembly Areas	Theater	Ticket Booth	Ticket Booth Signage	There is no signage at the ticket booth counter indicating the availability of accessible seating.	Provide compliant signage at the ticket booth counter indicating the availability and location of accessible seating areas.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Assembly Areas	Theater	Ticket Booth	Ticket Booth Counter Height	The height of the ticket counter is greater than 34 inches.	Lower the counter to a height between 28 and 34 inches.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Assembly Areas	Theater	Ticket Booth	Assistive Listening System	There is no signage notifying patrons of the availability of Assistive Listening System at the ticket booth.	Provide a compliant Assistive Listening System.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Assembly Areas	Theater	Ticket Booth	Not Enough Listening Devices	There is not enough listening devices to service a minimum of 4% of the total seating.	Provide a compliant Assistive Listening System.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435									
Firestone Boulevard Downey, CA 90240	Break/Conference Room	Room 129 Break Area	Sink - Counter Height	Sink counter height does not meet the standards.	Provide compliant sink.	Not_Started	None		6/30/27

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Break/Conference Room	Room 129 Break Area		Toe Kick Not Removed	The toe kick for the sink in break/conference room is not removed.	Remove the toe kick for the sink.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Break/Conference Room	Room 129 Break Area		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Break/Conference Room	Room 129 Break Area		Cabinet Door Hardware	The cabinet door hardware is not accessible.	Provide compliant hardware for the cabinet door.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Break/Conference Room	Room 129 Break Area		Supply Lines	Supply lines are not wrapped for the break/conference room sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Break/Conference Room	Room 129 Break Area	Paper Towel	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Sinks	Snack Bar		Sink - Counter Height	Sink counter height is not compliant.	Provide compliant sink.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Sinks	Snack Bar		Toe Clearance	There is not enough toe clearance at the sink.	Provide minimum required toe clearance.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Sinks	Snack Bar		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Sinks	Snack Bar		Door Hardware	The cabinet door hardware is not accessible.	Provide compliant hardware for cabinet door.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Sinks	Snack Bar		Toe Kick Not Removed	The toe kick for the sink is not removed.	Make sure there is no toe kick at the sink.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Sinks	Snack Bar		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Sinks	Snack Bar	Soap	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Sinks	Snack Bar	Paper Towel	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Lockers	Mens Restroom 141		No Accessible Lockers Available	No accessible lockers were found.	At least one locker or 5% of the lockers should be accessible.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Lockers	Womens Shower in Womens Restroom 133		No Accessible Lockers Available	No accessible lockers were found.	At least one locker or 5% of the lockers should be accessible.	Not_Started	None	6/30/27

Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Accessible Showers	Womens Shower in Womens Restroom 133		Accessible Showers	There are not enough accessible showers with respect to the total number of showers available.	Provide the required amount of compliant accessible showers.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Accessible Showers	Mens Shower in Mens Restroom 141		Accessible Showers	There are not enough accessible showers with respect to the total number of showers available.	Provide the required amount of compliant accessible showers.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Reach Ranges	Room 143	Time Card Station	Reach Ranges	This element is a protruding object.	Make sure that the element is not a protruding object.	In_Progress	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Reach Ranges	Room 143	Time Card Station	Element Highest Point of Operation	The highest point of operation for the element is not compliant.	Make sure that the highest point of operation is within the recommended value.	In_Progress	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Reach Ranges	Mens Dressing Room	Makeup Counter	Knee Height	The knee height is not compliant.	Adjust knee height to the recommended value.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Reach Ranges	Womens Dressing Room	Makeup Counter	Knee Height	The knee height is not compliant.	Adjust knee height to the recommended value.	Not_Started	None	6/30/27
Downey Civic Theatre - 8435 Firestone Boulevard Downey, CA 90240	Benches	Benches in Courtyard		Clear Floor Space Slope	Clear floor space slope is not compliant for the bench.	Provide compliant clear floor space at the bench.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Parking	Parking Lot	Warning Sign	Parking Lot Warning Sign Wording Incorrect	There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the signage does not contain the correct wording and/or the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.	Provide a compliant warning sign regarding unauthorized use of accessible parking spaces in the parking lot. Fill in the blank spaces with are required to furnish point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Parking	Parking Lot	Left Accessible Space	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Parking	Parking Lot	Left Accessible Space	Must Travel Behind Parked Cars	The location of the accessible parking spaces requires individuals with disabilities to travel behind parked cars other than their own.	Stripe an access aisle at the head of the accessible parking spaces, install a wheel stop at the head of the accessible parking spaces and at the general parking spaces. Wheel stops shall be used to prevent vehicles from encroaching into access aisles or walkways, but shall not present additional encroachment into those areas.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Parking	Parking Lot	Right Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Parking	Parking Lot	Right Accessible Space	Accessible Signage is Faded or Damaged	Parking space has signage however sign is faded, damaged or otherwise not viewable.	Replace or repaint the sign.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Parking	Parking Lot	Center Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Parking	Parking Lot	Center Accessible Space	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Walkway From West Large Baseball Field to East Large Baseball Field	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Sidewalk to Drinking Fountain next to West Large Baseball Field	Exterior Walkway	Sidewalk Width	The width of the path of travel is insufficient.	Widen the primary path of travel to provide the correct width.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Path of Travel to Small Baseball Field next to Picnic Area 2	Exterior Walkway	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/27

Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Path of Travel to East Large Baseball Field	Exterior Walkway	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Sidewalk around Building 2	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Sidewalk from Large Play Area To YMCA	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Sidewalk from Large Play Area To YMCA	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Sidewalk from the Center & Left Accessible Spaces	Vehicular Traffic	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Sidewalk from the Public Right of Way on Rives Avenue - Right	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Walkway from Tennis Courts To West Large Baseball Field	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Walkway from Tennis Courts To West Large Baseball Field	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Sidewalk around Large Play Area	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Sidewalk around Large Play Area	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Sidewalk around Large Play Area	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Sidewalk around Large Play Area	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Sidewalk around Small Play Area	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Sidewalk from Large Play Area To Building 2	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Walkway from Large Play Area to Tennis Courts	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Path of Travel	Sidewalk to Small Play Area	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Conference Room		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Conference Room	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Conference Room	Push Bar / D Handle	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Office in Building 1		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Office in Building 1		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27

Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Office in Building 1	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Office in Building 1	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Office in Building 1	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Break Room		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Break Room		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Break Room	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Break Room	Lever	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Break Room	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Main Entrance - Right		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Main Entrance - Right		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Main Entrance - Right	Push Bar / Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Main Entrance - Right		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Entrance next to Office		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Entrance next to Office		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Entrance next to Office	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Entrance next to Office	Push Bar / D Handle	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Entrance next to Office		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Main Entrance - Left		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Main Entrance - Left		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Main Entrance - Left		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Building 1 Main Entrance - Left	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27

Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Building 1 Main Entrance - Left	Push Bar / D Handle	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Building 1 Main Entrance - Left		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Womens Restroom next to Basketball Court- Interior	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Mens Restroom next to Basketball Court - Exterior		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Mens Restroom next to Basketball Court - Exterior	Push Bar / D Handle	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Mens Restroom next to Basketball Court - Exterior		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Mens Restroom next to Basketball Court - Interior	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Mens Restroom next to Basketball Court - Interior	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Mens Restroom next to Basketball Court - Interior	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Womens Restroom next to Basketball Court- Exterior		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Womens Restroom next to Basketball Court- Exterior	Push Bar / D Handle	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Womens Restroom next to Basketball Court- Exterior		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Child Care Center Entrance next to Mens Restroom		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Child Care Center Entrance next to Mens Restroom		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Child Care Center Entrance next to Mens Restroom	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Child Care Center Entrance next to Mens Restroom	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Child Care Center Entrance next to Mens Restroom	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Child Care Center Main Entrance		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Child Care Center Main Entrance		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Child Care Center Main Entrance	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Child Care Center Main Entrance	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/27

Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Child Care Center Main Entrance	Push Bar / Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Child Care Center Entrance next to Womens Restroom		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Child Care Center Entrance next to Womens Restroom		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Child Care Center Entrance next to Womens Restroom	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Child Care Center Entrance next to Womens Restroom	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Room with Sink		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	West Large Baseball Field Dugouts	None	No Hardware	Door hardware broken or missing.	Provide compliant accessible door hardware.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	West Large Baseball Field Dugouts	None	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	West Large Baseball Field Practice Boxes	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	West Large Baseball Field Practice Boxes	None	No Hardware	Door hardware broken or missing.	Provide compliant accessible door hardware.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	West Large Baseball Field Practice Boxes	None	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	East Large Baseball Field Practice Box next to 1st Base	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	East Large Baseball Field Practice Box next to 1st Base	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	East Large Baseball Field Practice Box next to 1st Base	Lever	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	East Large Baseball Field Dugouts	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	East Large Baseball Field Dugouts	Lever	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	East Large Baseball Field Dugouts		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	East Large Baseball Field Practice Box next to 3rd Base	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	East Large Baseball Field Practice Box next to 3rd Base	Lever	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/27

Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Tennis Court - Right, Tennis Court - Center, Tennis Court - Left	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Tennis Court - Right, Tennis Court - Center, Tennis Court - Left	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Tennis Court - Right, Tennis Court - Center, Tennis Court - Left	Lever	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Door between Staff Break Room & Art Room	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Door between Staff Break Room & Art Room	Single Knob	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	YMCA Womens Restroom		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	YMCA Womens Restroom	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	YMCA Womens Restroom	Single Knob	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	YMCA Main Entrance	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	YMCA Main Entrance	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	YMCA Main Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Door between Break Room & Computer Room	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Door between Break Room & Computer Room	Single Knob	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	YMCA Unisex Restroom - Left		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	YMCA Unisex Restroom - Left	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	YMCA Unisex Restroom - Left	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	YMCA Unisex Restroom - Left	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	YMCA Unisex Restroom - Left	Single Knob	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Office next to Computer Room	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Doors	Office next to Computer Room	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/27

Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	YMCA Mens Restroom	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	YMCA Mens Restroom	Single Knob	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	YMCA Unisex Restroom - Right		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	YMCA Unisex Restroom - Right	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	YMCA Unisex Restroom - Right	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	YMCA Unisex Restroom - Right	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Break Room		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Break Room		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Break Room	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Break Room	Push Bar / Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Break Room	Push Bar / Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Break Room		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Computer Room	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Computer Room	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Computer Room	Single Knob	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Kids Lounge		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Kids Lounge		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Kids Lounge	Push Bar / Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Doors	Kids Lounge		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Counters	Front Counter		Counter Height	The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.	Provide a portion of counter at the compliant height.	Not_Started	None	6/30/27
Furman Park - 10419									
Rives Avenue									
Downey, CA 90241	Signage	Office in Building 1		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27

Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Building 1 Main Entrance - Right, Building 1 Main Entrance - Left	No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Office in Building 1 - Exterior	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Building 1 Break Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Building 1 Entrance next to Office	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Building 1 Conference Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Room with Sink	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Child Care Center Entrance next to Mens Restroom	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Child Care Center Main Entrance	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Child Care Center Entrance next to Womens Restroom	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	East Large Baseball Field Dugouts	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	West Large Baseball Field Dugouts	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	East Large Baseball Field Practice Box next to 3rd Base, East Large Baseball Field Practice Box next to 1st Base	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	West Large Baseball Field Practice Boxes	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Directional Signage from the Public Right of Way on Cherokee Drive	No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Directional Signage from the Public Right of Way on Rives Avenue	No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Tennis Court - Right, Tennis Court - Center, Tennis Court - Left	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Door between Break Room & Computer Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	YMCA Main Entrance	No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Kids Lounge	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Door between Staff Break Room & Art Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27

Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Computer Room, Office next to Computer Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Signage	Break Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Public Telephones	Payphone next to Womens Restroom	Highest Operable Parts	The highest operable part of the public telephone exceeds allowed maximum reach range.	Contact the telephone company that owns the public telephone regarding the height of all the operating devices on the telephone.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court	Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court	Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court	Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court	Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court	Toilet Paper Dispenser Interferes with Grab Bar	The toilet paper dispenser interferes with the use of the grab bar.	Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court	Toilet Paper Dispenser Above Grab Bar	The toilet paper dispenser is located above the provided grab bar.	Remount the dispenser below the grab bar at 19" minimum.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court	Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Womens Restroom next to Basketball Court	Compartment Door Swings In	The door to the compartment swings inward into the minimum required compartment area.	Modify the swing of the door so that it does not swing into the minimum required compartment area.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Womens Restroom next to Basketball Court	Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Womens Restroom next to Basketball Court	Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Womens Restroom next to Basketball Court	Toilet Paper Dispenser Interferes with Grab Bar	The toilet paper dispenser interferes with the use of the grab bar.	Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Womens Restroom next to Basketball Court	Toilet Paper Dispenser Above Grab Bar	The toilet paper dispenser is located above the provided grab bar.	Remount the dispenser below the grab bar at 19" minimum.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Womens Restroom next to Basketball Court	Lavatory	Lavatory Distance From Wall/Fixture partition or fixture.	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Womens Restroom next to Basketball Court	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Womens Restroom next to Basketball Court	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Womens Restroom next to Basketball Court	Female	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/27

Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Womens Restroom next to Basketball Court	Female	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Womens Restroom next to Basketball Court		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Womens Restroom next to Basketball Court		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Womens Restroom next to Basketball Court	Blower	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Womens Restroom next to Basketball Court	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court		Width Between Urinal Shields	The shields extend greater than 24" in front of the urinal. The width between the shields is less than required.	Modify or replace the urinal shields in the restroom to provide the required clearance between the shields for the urinal designated as accessible.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court	Male	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court	Male	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court	Blower	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	Mens Restroom next to Basketball Court	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Womens Restroom		Toilet Paper Dispenser Height	The toilet paper dispenser is not mounted at the required height.	Remount the toilet paper dispenser in the compartment to the required height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Right		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Right		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Right	Lavatory	Lavatory Clear Floor Space Length	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/27

Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Right	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Right	Unisex	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Right	Unisex	Unisex Restroom Signage	Signage does not include contrasting gender use symbols.	Provide compliant contrasting gender use unisex signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Right		No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Right		Toilet Clear Floor Space Length	There is not a minimum of 56 inches of clearance around the water closet measured perpendicular from the rear wall.	Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Right		Toilet Clear Floor Space Width	There is not a minimum of 60 inches of clearance around the water closet measured perpendicular from the side wall.	Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Right		No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Right		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Right		Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Left		No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Left		Toilet Clear Floor Space Length	There is not a minimum of 56 inches of clearance around the water closet measured perpendicular from the rear wall.	Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Left		Toilet Clear Floor Space Width	There is not a minimum of 60 inches of clearance around the water closet measured perpendicular from the side wall.	Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Left		No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Left		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Left		Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Left		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Left		Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Mens Restroom		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Mens Restroom	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Mens Restroom	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Mens Restroom	Male	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/27

Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Mens Restroom		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Mens Restroom		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Mens Restroom		Rear Grab Bar Interferes	Rear grab bar interferes with the tank/flushometer.	Readjust the rear grab bar so that it does not interfere with the tank/flushometer.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Mens Restroom		Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Mens Restroom		Toilet Paper Dispenser Height	The toilet paper dispenser is not mounted at the required height.	Remount the toilet paper dispenser in the compartment to the required height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Womens Restroom		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Womens Restroom	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Womens Restroom	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Womens Restroom	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Womens Restroom	Female	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Left		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Left		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Left	Lavatory	Lavatory Clear Floor Space Length	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Left	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Left	Unisex	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Restrooms	YMCA Unisex Restroom - Left	Unisex	Unisex Restroom Signage	Signage does not include contrasting gender use symbols.	Provide compliant contrasting gender use unisex signage.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to Mens Restroom		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to Mens Restroom		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to Mens Restroom		Fountain Depth	Drinking fountain does not provide a required fountain depth.	Install a drinking fountain the meets the required minimum depth.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to Mens Restroom		Detectable Warnings	The minimum of clear distance between the wing walls is not provided.	Provide wing walls on each side of the water fountain. The wing walls shall project out from the supporting wall the required distance, and are the required height from the floor or ground surface.	Not_Started	None	6/30/27

Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to Mens Restroom	Detectable Warnings	Wing walls are provided on the water fountain. The wing walls do not project out from the supporting wall at least as far as the water fountain to within 6 inches (152 mm) of the surface of the path of travel. There shall also be a minimum of 32 inches (813 mm) clear between the wing walls.	Wing walls shall be provided on each side of the water fountain. The wing walls shall project out from the supporting wall at least as far as the water fountain to within 6 inches (152 mm) of the surface of the path of travel. There shall also be a minimum of 32 inches (813 mm) clear between the wing walls.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to East Large Baseball Field	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to East Large Baseball Field	Protruding Object	The drinking fountain is a protruding object.	Make sure that the fountain is not a protruding object.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to East Large Baseball Field	Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to East Large Baseball Field	Fountain Depth	Drinking fountain does not provide a required fountain depth.	Install a drinking fountain the meets the required minimum depth.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to East Large Baseball Field	No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to Tennis Courts	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to Tennis Courts	Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to Tennis Courts	Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space at the drinking fountain.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to Tennis Courts	Fountain Depth	Drinking fountain does not provide a required fountain depth.	Install a drinking fountain the meets the required minimum depth.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to West Large Baseball Field	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to West Large Baseball Field	Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to West Large Baseball Field	Fountain Depth	Drinking fountain does not provide a required fountain depth.	Install a drinking fountain the meets the required minimum depth.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Drinking Fountains	Drinking Fountain next to West Large Baseball Field	No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Outdoor Sports Areas	West Large Baseball Field	Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Outdoor Sports Areas	East Large Baseball Field	Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Outdoor Sports Areas	Basketball Court	Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Play Area	Small Play Area	Elevated Equipment - Rubberized Surface	Route Width	The width of the route to the transfer platform/play equipment is not compliant.	Modify the width of the route to the transfer platform/play equipment.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Break/Conferenc e Room	Building 1 Conference Room	Tables - Knee Clearance	The table knee clearance does not meet required standards.	Provide compliant tables.	Not_Started	None	6/30/27	
Furman Park - 10419 Rives Avenue Downey, CA 90241	Break/Conferenc e Room	Building 1 Break Room	Sink - Counter Height	Sink counter height does not meet the standards.	Provide compliant sink.	Not_Started	None	6/30/27	

Furman Park - 10419 Rives Avenue Downey, CA 90241	Break/Conference Room	Building 1 Break Room		Toe Kick Not Removed	The toe kick for the sink in break/conference room is not removed.	Remove the toe kick for the sink.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Break/Conference Room	Building 1 Break Room		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Break/Conference Room	Building 1 Break Room		Clear Floor Space Length	There is not enough clear floor space at the sink.	Provide enough clear floor space at the location.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Break/Conference Room	Building 1 Break Room		Supply Lines	Supply lines are not wrapped for the break/conference room sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Break/Conference Room	Building 1 Break Room	Paper Towel	Break Room	The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.	Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Break/Conference Room	Building 1 Break Room	Paper Towel	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Break/Conference Room	Building 1 Break Room	Refrigerator	Reach Height	Appliance Reach Height in the break/conference room is not compliant.	Make sure that the specified appliance reach height is compliant.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Break/Conference Room	Building 1 Break Room	Microwave	Reach Height	Appliance Reach Height in the break/conference room is not compliant.	Make sure that the specified appliance reach height is compliant.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Break/Conference Room	Staff Break Room		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Break/Conference Room	Staff Break Room		Clear Floor Space Width	There is not enough clear floor space at the sink.	Provide enough clear floor space at the location.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Break/Conference Room	Staff Break Room		Supply Lines	Supply lines are not wrapped for the break/conference room sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Sinks	Sink in Child Care Center		Sink - Counter Height	Sink counter height is not compliant.	Provide compliant sink.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Sinks	Sink in Child Care Center		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Sinks	Sink in Child Care Center		Toe Kick Not Removed	The toe kick for the sink is not removed.	Make sure there is no toe kick at the sink.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Sinks	Sink in Child Care Center		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Sinks	Sink in Child Care Center	Paper Towel	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Sinks	Sink in Child Care Center	Paper Towel	Sink	The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.	Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Picnic Areas	Picnic Tables next to East Large Baseball Field		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Picnic Areas	Picnic Tables next to East Large Baseball Field		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Picnic Areas	Picnic Tables next to Basketball Court		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/27

Furman Park - 10419 Rives Avenue Downey, CA 90241	Picnic Areas	Picnic Area 2		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Picnic Areas	Picnic Area 2		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Picnic Areas	Picnic Area 1		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Picnic Areas	Picnic Area 1		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Picnic Areas	Picnic Tables next to Small Play Area		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Picnic Areas	Picnic Tables next to Small Play Area		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Picnic Areas	Picnic Tables next to Large Play Area		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Picnic Areas	Picnic Tables next to Large Play Area		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Reach Ranges	Furman Park Walking Trail	Pet Waste Bag Dispenser	Element Highest Point of Operation	The highest point of operation for the element is not compliant.	Make sure that the highest point of operation is within the recommended value.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Benches	Benches in Small Baseball Field next to East Large Baseball Field		On Accessible Route	The bench is not on an accessible route.	Provide a compliant accessible route to the benches.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Benches	Benches in Small Baseball Field next to East Large Baseball Field		Clear Floor Space	No clear floor space provided at the bench.	Provide compliant clear floor space for the bench at one end.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Benches	Bench next to Basketball Court		Clear Floor Space Slope	Clear floor space slope is not compliant for the bench.	Provide compliant clear floor space at the bench.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Benches	Benches around Small Play Area		Clear Floor Space Slope	Clear floor space slope is not compliant for the bench.	Provide compliant clear floor space at the bench.	Not_Started	None	6/30/27
Furman Park - 10419 Rives Avenue Downey, CA 90241	Trails	Furman Park Walking Trail	End Segment	Cross Slope	The cross slope of the trail is not compliant.	Provide a compliant cross slope on the trail. Post a sign in a conspicuous place to the entrance of the parking lot, or immediately adjacent to and visible from each accessible parking space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that clearly and conspicuously states the following; "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities will be towed away at owner's expense. Towed vehicles may be reclaimed at ____ or by telephoning ____." Fill in the blank spaces with appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Parking	Parking Lot		No Parking Lot Warning Sign	There is no warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot.		Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Parking	Parking Lot	Center Accessible Space	Outline is Faded, Damaged or Missing	The accessible parking space outline is faded, damaged, missing or otherwise not viewable.	Re-stripe the existing parking space marked as accessible to define the width of the space.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Parking	Parking Lot	Center Accessible Space	Vehicle Encroaches Into Path of Travel	There is no device at the head of the accessible parking space to prevent vehicles from encroaching into accessible aisles or walkways.	Install a wheel stop at the head of the accessible parking space.	Not_Started	None	6/30/27

Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242									
Parking	Parking Lot	Center Accessible Space	Parking Lot Warnings	There is no \$250.00 fine sign at the parking space.	Provide a \$250.00 fine sign at the parking space.	Not_Started	None	6/30/27	
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242									
Parking	Parking Lot	Center Accessible Space	ISA is Faded or Damaged	ISA marking is faded and not viewable.	Repaint the ISA marking in the parking space.	Not_Started	None	6/30/27	
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242									
Parking	Parking Lot	Center Accessible Space	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/27	
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242									
Parking	Parking Lot	Left Accessible Space	Outline is Faded, Damaged or Missing	The accessible parking space outline is faded, damaged, missing or otherwise not viewable.	Re-stripe the existing parking space marked as accessible to define the width of the space.	Not_Started	None	6/30/27	
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242									
Parking	Parking Lot	Left Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27	
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242									
Parking	Parking Lot	Left Accessible Space	Vehicle Encroaches Into Path of Travel	There is no device at the head of the accessible parking space to prevent vehicles from encroaching into accessible aisles or walkways.	Install a wheel stop at the head of the accessible parking space.	Not_Started	None	6/30/27	
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242									
Parking	Parking Lot	Left Accessible Space	Parking Lot Warnings	There is no \$250.00 fine sign at the parking space.	Provide a \$250.00 fine sign at the parking space.	Not_Started	None	6/30/27	
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242									
Parking	Parking Lot	Left Accessible Space	ISA is Faded or Damaged	ISA marking is faded and not viewable.	Repaint the ISA marking in the parking space.	Not_Started	None	6/30/27	
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242									
Parking	Parking Lot	Left Accessible Space	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/27	
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242									
Parking	Parking Lot	Left Accessible Space	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27	
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242									
Parking	Parking Lot	Left Accessible Space	Access Aisle is Faded or Damaged	The access aisle markings are faded, damaged, or otherwise not viewable.	Re-stripe the access aisle so as to discourage parking.	Not_Started	None	6/30/27	
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242									
Parking	Parking Lot	Left Accessible Space	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	6/30/27	
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242									
Parking	Parking Lot	Left Accessible Space	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/27	
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242									
Parking	Parking Lot	Right Accessible Space	Outline is Faded, Damaged or Missing	The accessible parking space outline is faded, damaged, missing or otherwise not viewable.	Re-stripe the existing parking space marked as accessible to define the width of the space.	Not_Started	None	6/30/27	
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242									
Parking	Parking Lot	Right Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27	

Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Parking	Parking Lot	Right Accessible Space	Vehicle Encroaches Into Path of Travel	There is no device at the head of the accessible parking space to prevent vehicles from encroaching into accessible aisles or walkways.	Install a wheel stop at the head of the accessible parking space.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Parking	Parking Lot	Right Accessible Space	Parking Lot Warnings	There is no \$250.00 fine sign at the parking space.	Provide a \$250.00 fine sign at the parking space.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Parking	Parking Lot	Right Accessible Space	ISA is Faded or Damaged	ISA marking is faded and not viewable.	Repaint the ISA marking in the parking space.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Parking	Parking Lot	Right Accessible Space	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Parking	Parking Lot	Right Accessible Space	Access Aisle is Faded or Damaged	The access aisle markings are faded, damaged, or otherwise not viewable.	Re-stripe the access aisle so as to discourage parking.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Parking	Parking Lot	Right Accessible Space	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Parking	Parking Lot	Right Accessible Space	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Curb Ramps	Curb Ramp Next To Accessible Spaces		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Curb Ramps	Curb Ramp Next To Accessible Spaces		Curb Ramp Slope	The running slope is greater than allowed.	Provide a compliant curb ramp.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Curb Ramps	Curb Ramp Next To Accessible Spaces		Side Flare Slope	The slope of the curb ramp side flare is greater than allowed.	Provide curb ramp side flares with a compliant slope.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Curb Ramps	Curb Ramp Next To Accessible Spaces	Bottom Landing	Bottom Landing Change in Level	The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.	Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Path of Travel	Sidewalk from The Public Right of Way to Gymnasium	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Path of Travel	Sidewalk next to Accessible Spaces	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Path of Travel	Sidewalk next to Accessible Spaces	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Path of Travel	Path From Accessible Parking	Access Aisle	Cross Walks and Detectable Warnings	There are no detectable warnings where the pedestrian route crosses vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/27

Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Path of Travel	Path From Accessible Parking	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Gymnasium Emergency Exit	Push Bar Only	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Gymnasium Emergency Exit	Push Bar Only	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Gymnasium Entrance	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Gymnasium Entrance	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Gymnasium Main Entrance	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Gymnasium Main Entrance	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Gymnasium Main Entrance	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Activity Room Patio Entrance	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Activity Room Patio Entrance	Push Bar Only	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Activity Room Patio Entrance	Push Bar Only	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Activity Room Patio Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Lobby Mens Restroom	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Lobby Mens Restroom	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Supervisor Office	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/27

Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Supervisor Office	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Supervisor Office	Lever	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Lobby Womens Restroom	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Activity Room Entrance		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Activity Room Entrance	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Activity Room Entrance	Push Bar / Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Activity Room Entrance	Push Bar / Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Activity Room Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Activity Room Hallway	Push Bar / Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Gymnasium Office	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Gymnasium Office	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Gymnasium Office	Lever	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Main Entrance	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Doors	Main Entrance	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue									
Downey, CA 90242	Signage	Directional Signage From The Public Right Of Way		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/27

Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Signage	Main Entrance		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Signage	Activity Room Hallway		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Signage	Activity Room Entrance		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Signage	Gymnasium Office		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Signage	Supervisor Office		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Signage	Gymnasium Entrance		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Signage	Gymnasium Main Entrance		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Signage	Activity Room Patio Entrance		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Signage	Activity Room		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Signage	Gymnasium Emergency Exit		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Mens Restroom	Lavatory	Lavatory Surface Height	The height of the counter surface is greater than allowed.	Relocate or replace the lavatory to provide a maximum counter surface height of no greater than recommended.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Mens Restroom	Male	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Mens Restroom		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Mens Restroom	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom		Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/27

Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom	Lavatory	Lavatory Surface Height	The height of the counter surface is greater than allowed.	Relocate or replace the lavatory to provide a maximum counter surface height of no greater than recommended.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom	Female	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom - Standard		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom - Standard		Rear Grab Bar Length	The length of the rear grab bar is less than required.	Replace the rear grab bar with a compliant grab bar.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom - Standard		Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom - Standard		Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom - Standard		Toilet Paper Dispenser Interferes with Grab Bar	The toilet paper dispenser interferes with the use of the grab bar.	Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom - Standard		Toilet Paper Dispenser Above Grab Bar	The toilet paper dispenser is located above the provided grab bar.	Remount the dispenser below the grab bar at 19" minimum.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom - Standard		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Mens Restroom		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Mens Restroom		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Mens Restroom		Rear Grab Bar Length	The length of the rear grab bar is less than required.	Replace the rear grab bar with a compliant grab bar.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Mens Restroom		Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Mens Restroom		Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/27

Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Mens Restroom	Toilet Paper Dispenser Interferes with Grab Bar	The toilet paper dispenser interferes with the use of the grab bar.	Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Mens Restroom	Toilet Paper Dispenser Above Grab Bar	The toilet paper dispenser is located above the provided grab bar.	Remount the dispenser below the grab bar at 19" minimum.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom - Alternate	Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom - Alternate	Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom - Alternate	Grab Bar Distance From Back Wall	The distance from the rear wall to the side grab bar is greater than allowed.	Remount the side grab bar so it meets the distance requirements from the back wall.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom - Alternate	Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom - Alternate	Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom - Alternate	Toilet Paper Dispenser Interferes with Grab Bar	The toilet paper dispenser interferes with the use of the grab bar.	Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Restrooms	Lobby Womens Restroom - Alternate	Toilet Paper Dispenser Above Grab Bar	The toilet paper dispenser is located above the provided grab bar.	Remount the dispenser below the grab bar at 19" minimum.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Drinking Fountains	Drinking Fountain Next To Gymnasium Office	Unstable floor mat	An unstable floor mat is provided within the drinking fountain clear floor space.	Provide a compliant floor mat.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Drinking Fountains	Drinking Fountain Next To Gymnasium Office	Fountain Depth	Drinking fountain does not provide a required fountain depth.	Install a drinking fountain the meets the required minimum depth.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Assembly Areas	Gymnasium	Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Sinks	Activity Room	Sink - Knee Clearance	Sink knee clearance does not meet the standards.	Provide compliant sink.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Sinks	Activity Room	Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Sinks	Activity Room	Toe Kick Not Removed	The toe kick for the sink is not removed.	Make sure there is no toe kick at the sink.	Not_Started	None	6/30/27

Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Sinks	Activity Room		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Sinks	Activity Room	Soap	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Gary P. McCaughan Gymnasium - 12544 Reves Avenue Downey, CA 90242	Sinks	Activity Room	Paper Towel	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot		Vehicles Encroach Into Path of Travel	There is no device at the head of the general parking spaces to prevent vehicles from encroaching into walkways.	Install a wheel stop at the head of the general parking spaces.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot		Parking Lot Warning Sign Wording Incorrect	There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the signage does not contain the correct wording and/or the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.	Provide a compliant warning sign regarding unauthorized use of accessible parking spaces in the parking lot. Fill in the blank spaces with are required to furnish point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	3rd Accessible Space From Left	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	3rd Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	3rd Accessible Space From Left	Vehicle Encroaches Into Path of Travel	There is no device at the head of the accessible parking space to prevent vehicles from encroaching into accessible aisles or walkways.	Install a wheel stop at the head of the accessible parking space.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	3rd Accessible Space From Left	Parking Space Accessible Signage Height	The bottom edge of the post-mounted signage designating the accessible parking space is not at the required height.	Modify the height or replace the post-mounted signage designating the accessible parking space. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	3rd Accessible Space From Left	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	3rd Accessible Space From Left	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	1st Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	1st Accessible Space From Left	Vehicle Encroaches Into Path of Travel	There is no device at the head of the accessible parking space to prevent vehicles from encroaching into accessible aisles or walkways.	Install a wheel stop at the head of the accessible parking space.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	1st Accessible Space From Left	Must Travel Behind Parked Cars	The location of the accessible parking spaces requires individuals with disabilities to travel behind parked cars other than their own.	Stripe an access aisle at the head of the accessible parking spaces, install a wheel stop at the head of the accessible parking spaces and at the general parking spaces. Wheel stops shall be used to prevent vehicles from encroaching into access aisles or walkways, but shall not present additional encroachment into those areas.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	1st Accessible Space From Left	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	1st Accessible Space From Left	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	4th Accessible Space From Left	Vehicle Encroaches Into Path of Travel	There is no device at the head of the accessible parking space to prevent vehicles from encroaching into accessible aisles or walkways.	Install a wheel stop at the head of the accessible parking space.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	4th Accessible Space From Left	Must Travel Behind Parked Cars	The location of the accessible parking spaces requires individuals with disabilities to travel behind parked cars other than their own.	Stripe an access aisle at the head of the accessible parking spaces, install a wheel stop at the head of the accessible parking spaces and at the general parking spaces. Wheel stops shall be used to prevent vehicles from encroaching into access aisles or walkways, but shall not present additional encroachment into those areas.	Not_Started	None	6/30/27

Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	4th Accessible Space From Left	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	2nd Accessible Space From Left	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	2nd Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	2nd Accessible Space From Left	Vehicle Encroaches Into Path of Travel	There is no device at the head of the accessible parking space to prevent vehicles from encroaching into accessible aisles or walkways.	Install a wheel stop at the head of the accessible parking space.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Parking	Parking Lot	2nd Accessible Space From Left	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Curb Ramps	Curb Ramp At The Access Aisle		Projects into Traffic	The curb ramp projects into vehicular traffic lanes, parking spaces, or parking access aisles.	Provide a compliant curb ramp.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Curb Ramps	Curb Ramp At The Access Aisle		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Curb Ramps	Curb Ramp At The Access Aisle	Top Landing	Top Landing Slope	The slope at the top landing is greater than allowed.	Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Media Room	Fire Extinguisher	Protruding Objects - Protrusion Limit	The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.	Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Hallway to Womens Restroom	Fire Extinguisher	Protruding Objects - Protrusion Limit	The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.	Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Multipurpose Room	Fire Extinguisher	Protruding Objects - Protrusion Limit	The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.	Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Path From Accessible Parking to Community and Center	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Path From Accessible Parking to Community and Center	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Path From Accessible Parking to Community and Center	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Large Play Area	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Path Of Travel Between Play Areas	Change In Level	Change in Level - Beveled	There is a change in elevation greater than recommended value.	Bevel the area or resurface the area to provide a smooth and level path of travel.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Sidewalk Around The Large Play Area	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	To Softball Concession Stand	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	To Softball Concession Stand	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Sidewalk Around Community Center	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27

Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Sidewalk from Basketball Court to Community Center	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Path from Prichard Street to Community Center	Exterior Walkway	Sidewalk Width	The width of the path of travel is insufficient.	Widen the primary path of travel to provide the correct width.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Sidewalk from Castana Avenue	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Sidewalk from Castana Avenue	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Sidewalk from Castana Avenue	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Softball Field	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Path from Softball Field to Prichard Street	Exterior Walkway	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Path to Softball Field Dugouts	Exterior Walkway	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Path Of Travel From Golden Street	Exterior Walkway	No Passing Space	The accessible route does not provide the required passing spaces.	Since the accessible route is less than the required width, provide compliant passing spaces.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Path Of Travel From Golden Street	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Path Of Travel From Golden Street	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Path of Travel	Path to Softball Field	Exterior Walkway	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Kitchen Front Entrance		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Kitchen Front Entrance	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Kitchen Front Entrance	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Kitchen Front Entrance	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Womens Restroom in Activity Center		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Womens Restroom in Activity Center		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Womens Restroom in Activity Center	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Womens Restroom in Activity Center	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Mens Restroom in Activity Center		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/27

Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Mens Restroom in Activity Center		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Mens Restroom in Activity Center	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Mens Restroom in Activity Center	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Kitchen Rear Entrance	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Kitchen Rear Entrance	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Activity Center Main Entrance	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Activity Center Main Entrance	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Activity Center Main Entrance	Push Bar / Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Activity Center Main Entrance	Push Bar / Lever	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Activity Center Main Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Womans Restroom Next to Activity Center		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Womans Restroom Next to Activity Center	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Womans Restroom Next to Activity Center	Push / Pull	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Hallway Entrance to Main Office And Media Room		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Hallway Entrance to Main Office And Media Room	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Multipurpose Entrance Room Next Kitchen Entrance	Push Bar Round	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Multipurpose Entrance Room Next Kitchen Entrance	Push Bar Round	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Multipurpose Entrance Room Next Kitchen Entrance	Push Bar Round	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Multipurpose Room 1st Exterior Entrances	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Multipurpose Room 1st Exterior Entrances	Push Bar Only	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/27

Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Multipurpose Room 1st Exterior Entrances	Push Bar Only	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Multipurpose Room 2nd Exterior Entrances		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Multipurpose Room 2nd Exterior Entrances		Width Between Doors When Open	There is less than the required clearance between the two doors in a series.	Remove the inner door in a series to provide an accessible entrance.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Multipurpose Room 2nd Exterior Entrances	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Multipurpose Room 2nd Exterior Entrances	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Multipurpose Room 2nd Exterior Entrances	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Restroom Hallway Entrance	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Restroom Hallway Entrance	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Mens Restroom Next to Activity Center		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Mens Restroom Next to Activity Center	Push / Pull	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Mens Restroom Next to Activity Center		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Media Room		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Media Room	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Multipurpose Room Entrance Next to Main Entrance	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Multipurpose Room Entrance Next to Main Entrance	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Multipurpose Room Entrance Next to Main Entrance	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Multipurpose Room Entrance Next to Main Entrance	Push Bar Round	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Multipurpose Room Entrance Next to Main Entrance	Push Bar Round	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Doors	Main Office		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Counters	Food Counter		Counter Height	The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.	Provide a portion of counter at the compliant height.	Not_Started	None	6/30/27

Golden Park - 8840 Golden Avenue Downey, CA 90240	Signage	Kitchen Entrances		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Signage	Door to Multipurpose Room Next to Main Entrance		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Signage	Activity Center Main Entrance		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Signage	Multipurpose Room Exterior Entrances		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Signage	Multipurpose Room 2nd Exterior Entrances		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Signage	Hallway Entrance to Main Office And Media Room		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Signage	Media Room		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Signage	Restroom Hallway Entrance		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Signage	Main Office		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Signage	Directional Signage From The Public Right Of Way		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Signage	Softball Concession Stand		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center		Urinal Rim Height	The height of the urinal rim in the restroom is greater than 17 inches above the finished floor.	Lower the urinal designated to be accessible in the restroom so that the rim height is not more than 17 inches above the finished floor.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center		Urinal Flush Control Height	The height of the urinal flush control in the restroom is greater than the required maximum height.	Lower the flush control valve on the urinal to a height not greater than the required maximum height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	Male	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27

Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center	Female	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center		No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center		No Back Wall Grab Bar	There is no back grab bar at the toilet compartment.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center		Toilet Compartment Door	The compartment door is located in front of the water closet.	Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center		Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center		Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/27

Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center	Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	6/30/27	
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/27	
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom in Activity Center	Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/27	
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/27	
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/27	
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/27	
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	No Back Wall Grab Bar	There is no back grab bar at the toilet compartment.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/27	
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/27	
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	Toilet Compartment Door	The compartment door is located in front of the water closet.	Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.	Not_Started	None	6/30/27	
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/27	
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/27	
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/27	
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/27	
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom in Activity Center	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/27	
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Distance from Door Edge to Nearest Fixture	The entrance door swings into the turning space within the restroom.	Reverse the door swing, or modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/27	
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Female	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/27

Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/27	
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Paper Towel	Dispenser Operation	The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.	Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center		Distance from Door Edge to Nearest Fixture	The entrance door swings into the turning space within the restroom.	Reverse the door swing, or modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center		Fixture Clear Floor Space	The entrance door swings into the clear floor space of a fixture.	Reverse the door swing, or modify the restroom so the door does not swing into the clear floor space required for a fixture.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	Male	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center		Toilet Compartment Length	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center		No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/27

Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Compartment Door Width	The clear opening width of the doorway to the compartment is less than required.	Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Toilet Compartment Door	The compartment door is located in front of the water closet.	Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Womens Restroom Next to Activity Center	Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	No Toilet Compartment Door	There is no door on the compartment designated to be accessible in the restroom.	Install a door with appropriate accessible door hardware on the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Restrooms	Mens Restroom Next to Activity Center	Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Community Center	Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	6/30/27

Golden Park - 8840 Golden Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Community Center		Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Community Center		Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space at the drinking fountain.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Concession Stand		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Concession Stand		Non-Accessible Controls	The faucet controls require tight grasping or pinching of the wrist to operate.	Provide fountain controls with controls that do not require tight grasping or pinching of the wrist to operate.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Concession Stand		Toe Clearance	The toe clearance is less than required.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Concession Stand		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Concession Stand		Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Concession Stand		Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Concession Stand		Fountain Depth	Drinking fountain does not provide a required fountain depth.	Install a drinking fountain the meets the required minimum depth.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Concession Stand		No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Outdoor Sports Areas	Baseball Field		Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Outdoor Sports Areas	Baseball Field	Home Concession Stand	Concessions Stand Counter Height	The height of the concession counter is greater than 34 inches.	Lower the concession counter to a height between 28 inches and 34 inches above the ground level .	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Outdoor Sports Areas	Baseball Field	Home Concession Stand	Protruding Object	The concession stand counter is a protruding object.	Make sure that the concession stand counter is not a protruding object.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Play Area	Small Play Area		Change In Level	There is a change in level to the play area surface.	Provide a smooth transition from the play area access point to the play area surface.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Play Area	Small Play Area	Play Table - Rubberized Surface	Route Width	The width of the route to the transfer platform/play equipment is not compliant.	Modify the width of the route to the transfer platform/play equipment.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Play Area	Small Play Area	Play Table - Rubberized Surface	Knee Clearance Height	The knee clearance at the play table is not compliant.	Provide a compliant table at the play area with sufficient knee clearance.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Play Area	Small Play Area	Elevated Equipment - Rubberized Surface	Means of Support	At least one means of support for transferring to the transfer platform is not provided at the steps.	Provide at least one means of support for transferring to assist when transferring.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Play Area	Small Play Area	Store Window - Rubberized Surface	Route Width	The width of the route to the transfer platform/play equipment is not compliant.	Modify the width of the route to the transfer platform/play equipment.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Play Area	Small Play Area	Tick-Tac-Toe - Rubberized Surface	Route Width	The width of the route to the transfer platform/play equipment is not compliant.	Modify the width of the route to the transfer platform/play equipment.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Play Area	Small Play Area	Music Box - Rubberized Surface	Route Width	The width of the route to the transfer platform/play equipment is not compliant.	Modify the width of the route to the transfer platform/play equipment.	Not_Started	None	6/30/27

Golden Park - 8840 Golden Avenue Downey, CA 90240	Play Area	Small Play Area	Swings - Sand	Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Play Area	Large Play Area		Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Play Area	Large Play Area		Change In Level	There is a change in level to the play area surface.	Provide a smooth transition from the play area access point to the play area surface.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Play Area	Large Play Area	Elevated Equipment - Sand	Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Play Area	Large Play Area	Store Window - Sand	Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Play Area	Large Play Area	Swings - Sand	Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Break/Conference Room	Media Room		Sink - Control Type	Sink controls needs twisting to operate.	Provide compliant controls for the sink in break/conference room.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Break/Conference Room	Media Room		Sink - Counter Height	Sink counter height does not meet the standards.	Provide compliant sink.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Break/Conference Room	Media Room		Toe Kick Not Removed	The toe kick for the sink in break/conference room is not removed.	Remove the toe kick for the sink.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Break/Conference Room	Media Room		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Break/Conference Room	Media Room		Cabinet Door Hardware	The cabinet door hardware is not accessible.	Provide compliant hardware for the cabinet door.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Break/Conference Room	Media Room		Break Room Sink - Bubbler	The sink bubbler controls are not accessible.	Provide compliant hardware and controls for the bubbler.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Break/Conference Room	Media Room		Supply Lines	Supply lines are not wrapped for the break/conference room sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Break/Conference Room	Media Room		Clear Floor Space Width	There is not enough clear floor space at the sink.	Provide enough clear floor space at the location.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Break/Conference Room	Media Room	Paper Towel	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Sinks	Sink in Multipurpose Room		Sink - Control Type	Twist controls are present on the sink.	Provide compliant controls for the sink.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Sinks	Sink in Multipurpose Room		Sink - Counter Height	Sink counter height is not compliant.	Provide compliant sink.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Sinks	Sink in Multipurpose Room		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Sinks	Sink in Multipurpose Room		Door Hardware	The cabinet door hardware is not accessible.	Provide compliant hardware for cabinet door.	Not_Started	None	6/30/27

Golden Park - 8840 Golden Avenue Downey, CA 90240	Sinks	Sink in Multipurpose Room		Toe Kick Not Removed	The toe kick for the sink is not removed.	Make sure there is no toe kick at the sink.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Sinks	Sink in Multipurpose Room		Clear Floor Space Width	There is not enough clear floor space at the sink.	Provide enough clear floor space at the location.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Sinks	Sink in Multipurpose Room		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Sinks	Sink in Multipurpose Room	Soap	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Sinks	Sink in Multipurpose Room	Paper Towel	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Picnic Areas	Picnic Tables Next to Play Area		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Picnic Areas	Picnic Tables Next to Play Area		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Picnic Areas	Picnic Shelter 1, 2, 3		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Picnic Areas	Picnic Shelter 1, 2, 3		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Reach Ranges	Park	Barbecue	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Reach Ranges	Picnic Shelters	Barbecue Grill	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Benches	Bench Next To Community Center		On Accessible Route	The bench is not on an accessible route.	Provide a compliant accessible route to the benches.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Benches	2nd Base Dugout		On Accessible Route	The bench is not on an accessible route.	Provide a compliant accessible route to the benches.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Benches	2nd Base Dugout		Clear Floor Space Slope	Clear floor space slope is not compliant for the bench.	Provide compliant clear floor space at the bench.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Benches	3rd Base Dugout		On Accessible Route	The bench is not on an accessible route.	Provide a compliant accessible route to the benches.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Kitchens	Kitchen	Window Counter	Height	Kitchen work surface height is not compliant.	Provide compliant work surface with recommended height for the kitchen.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Kitchens	Kitchen	Window Counter	Cabinet Hardware	Cabinet hardware is not operable with one hand and requires tight pinching, grasping or twisting of the wrist.	Provide compliant hardware for the kitchen cabinet.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Kitchens	Kitchen	Window Counter	Toe Kick/Cabinetry	Toe kick/cabinetry below work surface is not removable.	Make sure that toe kick/cabinetry below the work surface is removed or removable.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Kitchens	Kitchen	Storage - Both	Storage - Cabinet Hardware	Cabinet hardware is not operable with one hand and requires tight pinching, grasping or twisting of the wrist.	Provide compliant hardware for the kitchen cabinet.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Kitchens	Kitchen	Sink - Lever	Counter Height	Sink counter height does not meet the standards.	Provide compliant sink.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Kitchens	Kitchen	Sink - Lever	Knee Clearance	Sink knee clearance does not meet the standards.	Provide compliant sink.	Not_Started	None	6/30/27

Golden Park - 8840 Golden Avenue Downey, CA 90240	Kitchens	Kitchen	Sink - Lever	Toe Kick Not Removed	The toe kick for the sink in kitchen is not removed.	Remove the toe kick for the sink.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Kitchens	Kitchen	Sink - Lever	Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Kitchens	Kitchen	Sink - Lever	Cabinet Door Hardware	The cabinet door hardware is not accessible.	Provide compliant hardware for the cabinet door.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Kitchens	Kitchen	Sink - Lever	Supply Lines	Supply lines are not wrapped for the kitchen sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Kitchens	Kitchen	Paper Towel	Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Kitchens	Kitchen	Appliance - Oven	Controls Operation	Appliance control hardware is not operable with one hand and requires tight pinching, grasping or twisting of the wrist.	Provide compliant hardware for the kitchen appliance.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Kitchens	Kitchen	Appliance - Refrigerator/Freezer	Height to Center of Freezer Space	Height to center of freezer space is not compliant.	Provide compliant freezer within recommended height.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Kitchens	Kitchen	Appliance - Range/Cooktop	Controls Operation	Appliance control hardware is not operable with one hand and requires tight pinching, grasping or twisting of the wrist.	Provide compliant hardware for the kitchen appliance.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Kitchens	Kitchen	Appliance - Range/Cooktop	Exhaust Controls Height	Exhaust fan controls height is not at a compliant height.	Adjust the exhaust fan controls to the recommended value.	Not_Started	None	6/30/27
Golden Park - 8840 Golden Avenue Downey, CA 90240	Kitchens	Kitchen	Appliance - Range/Cooktop	Exhaust Controls Operation	Exhaust control hardware is not operable with one hand and requires tight pinching, grasping or twisting of the wrist.	Provide compliant hardware for the kitchen exhaust.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	North Entrance From Bellflower Boulevard	No Parking Lot Warning Sign	There is no warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot.	Post a sign in a conspicuous place to the entrance of the parking lot, or immediately adjacent to and visible from each accessible parking space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that clearly and conspicuously states the following: "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities will be towed away at owner's expense. Towed vehicles may be reclaimed at ____ or by telephoning ____." Fill in the blank spaces with appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	South Entrance From Bellflower Boulevard	Parking Lot Warning Sign Blanks Not Filled	There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.	Fill in the blank spaces which are required to furnish the point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.	In_Progress	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	2nd Accessible Space From Left	Outline is Faded, Damaged or Missing	The accessible parking space outline is faded, damaged, missing or otherwise not viewable.	Re-stripe the existing parking space marked as accessible to define the width of the space.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	2nd Accessible Space From Left	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	1st Accessible Space From Left	Outline is Faded, Damaged or Missing	The accessible parking space outline is faded, damaged, missing or otherwise not viewable.	Re-stripe the existing parking space marked as accessible to define the width of the space.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	1st Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27

Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	1st Accessible Space From Left	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	1st Accessible Space From Left	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	4th Accessible Space From Left	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	4th Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	4th Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	4th Accessible Space From Left	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	3rd Accessible Space From Left	Outline is Faded, Damaged or Missing	The accessible parking space outline is faded, damaged, missing or otherwise not viewable.	Re-stripe the existing parking space marked as accessible to define the width of the space.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	3rd Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	3rd Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	3rd Accessible Space From Left	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	3rd Accessible Space From Left	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	3rd Accessible Space From Left	Access Aisle is Faded or Damaged	The access aisle markings are faded, damaged, or otherwise not viewable.	Re-stripe the access aisle so as to discourage parking.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	3rd Accessible Space From Left	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Skate Park	3rd Accessible Space From Left	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Softball Fields	Warning Sign	Parking Lot Warning Sign Wording Incorrect	There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the signage does not contain the correct wording and/or the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.	Provide a compliant warning sign regarding unauthorized use of accessible parking spaces in the parking lot. Fill in the blank spaces with are required to furnish point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	6/30/27

Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Softball Fields	Next To Field 1, Right Accessible Space	Outline is Faded, Damaged or Missing	The accessible parking space outline is faded, damaged, missing or otherwise not viewable.	Re-stripe the existing parking space marked as accessible to define the width of the space.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Softball Fields	Next To Field 1, Right Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Softball Fields	Next To Field 1, Right Accessible Space	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Softball Fields	Next To Field 1, Right Accessible Space	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Softball Fields	Next To Field 1, Left Accessible Space	Outline is Faded, Damaged or Missing	The accessible parking space outline is faded, damaged, missing or otherwise not viewable.	Re-stripe the existing parking space marked as accessible to define the width of the space.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Softball Fields	Next To Field 1, Left Accessible Space	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Softball Fields	Next To Field 1, Left Accessible Space	Access Aisle is Faded or Damaged	The access aisle markings are faded, damaged, or otherwise not viewable.	Re-stripe the access aisle so as to discourage parking.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Softball Fields	Next To Field 1, Left Accessible Space	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Softball Fields	Next To Field 1, Left Accessible Space	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Softball Fields	Next To Field 1, Center Accessible Space	Outline is Faded, Damaged or Missing	The accessible parking space outline is faded, damaged, missing or otherwise not viewable.	Re-stripe the existing parking space marked as accessible to define the width of the space.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Softball Fields	Next To Field 1, Center Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Parking	Parking Lot Next To Softball Fields	Next To Field 1, Center Accessible Space	Must Travel Behind Parked Cars	The location of the accessible parking spaces requires individuals with disabilities to travel behind parked cars other than their own.	Stripe an access aisle at the head of the accessible parking spaces, install a wheel stop at the head of the accessible parking spaces and at the general parking spaces. Wheel stops shall be used to prevent vehicles from encroaching into access aisles or walkways, but shall not present additional encroachment into those areas.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Curb Ramps	Curb Ramp At The Accessible Spaces Next To Skate Park		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Curb Ramps	Curb Ramp At The Accessible Spaces Next To Skate Park		Curb Ramp Slope	The running slope is greater than allowed.	Provide a compliant curb ramp.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Curb Ramps	Curb Ramp At The Accessible Spaces Next To Skate Park		Appurtenances	Utilities, gratings or other appurtenances are located on the curb ramp.	Provide a compliant curb ramp free of appurtenances.	Not_Started	None	6/30/27

Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Curb Ramps	Curb Ramp At The Accessible Spaces Next To Skate Park	Top Landing	Top Landing Slope	The slope at the top landing is greater than allowed.	Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Path of Travel	Path Of Travel From The Accessible Spaces Next To Field 1	Access Aisle	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Path of Travel	Path Of Travel From The Accessible Spaces Next To Field 1	Access Aisle	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Path of Travel	Path Of Travel From Softball Field 1 To Softball Field4	Open Area	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Path of Travel	Path Of Travel From Tennis Center To Softball Fields	Change In Level	Change In Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Path of Travel	Path From Softball Field 1 To North Tennis Courts	Change In Level	Change In Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Path of Travel	Softball Fields 2 & 3 Spectators Area	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Path of Travel	Path Of Travel From South Tennis Court To Softball Field 1	Open Area	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Path of Travel	Path From Softball Field 1 To North Tennis Courts - Continued	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Path of Travel	Path From Softball Field 1 To North Tennis Courts - Continued	Exterior Walkway	Sidewalk Width	The width of the path of travel is insufficient.	Widen the primary path of travel to provide the correct width.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Path of Travel	Path From Softball Field 1 To North Tennis Courts - Continued	Change In Level	Change In Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Path of Travel	Path Of Travel From Restroom Building To Softball Fields 2 & 3	Open Area	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Path of Travel	Softball Field 1 Seating Area	Change In Level	Change In Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Path of Travel	Large Play Area Next To Restrooms	Change In Level	Change In Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Concessions Entrance	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/27

Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Concessions Entrance	Lever	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Concessions Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	In_Progress	None	6/30/27
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	North Tennis Courts Entrances	Lever	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	South Tennis Courts Side Entrances	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	South Tennis Courts Side Entrances	Lever	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Tennis Court Entrance	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Tennis Court Entrance	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Tennis Court Entrance	Lever	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Left Unisex Restroom Next To Skate Park	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Left Unisex Restroom Next To Skate Park	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Left Unisex Restroom Next To Tennis Courts	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Left Unisex Restroom Next To Tennis Courts	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Tennis Center East Entrance	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Tennis Center East Entrance	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Right Unisex Restroom Next To Tennis Courts	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/29

Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Right Unisex Restroom Next To Tennis Courts	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Right Unisex Restroom Next To Skate Park	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Door Between Equipment Rental & Tennis Center		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Door Between Equipment Rental & Tennis Center	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Doors	Equipment Rental Entrance	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Counters	Tennis Center Counter		Clear Floor Space Length	The clear floor space length at the counter is not compliant.	Provide compliant clear floor space at the counter.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Signage	Concessions Entrance		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Signage	Directional Signage From The Public Right Of Way		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Signage	Tennis Center Entrances		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Signage	Equipment Rental		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Public Telephones	Payphone Next To Tennis Center		Highest Operable Parts	The highest operable part of the public telephone exceeds allowed maximum reach range.	Contact the telephone company that owns the public telephone regarding the height of all the operating devices on the telephone.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Female	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/29

Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area		No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area		No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area		Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area		Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area		Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area		Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/29

Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	No Back Wall Grab Bar	There is no back grab bar at the toilet compartment.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Side Grab Bar Length	The length of the side grab bar is less than required.	Replace the side grab bar with a compliant grab bar.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Grab Bar Distance From Back Wall	The distance from the rear wall to the side grab bar is greater than allowed.	Remount the side grab bar so it meets the distance requirements from the back wall.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Play Area	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area	Urinal Rim Height	The height of the urinal rim in the restroom is greater than 17 inches above the finished floor.	Lower the urinal designated to be accessible in the restroom so that the rim height is not more than 17 inches above the finished floor.	Not_Started	None	6/30/29	

Independence Park - 12334 Bellflower Boulevard										
Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard										
Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard										
Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard										
Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard										
Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard										
Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area	Male	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard										
Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard										
Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard										
Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard										
Downey, CA 90240	Restrooms	Mens Restroom Next To Play Area	Paper Towel	Dispenser Operation	The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.	Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard										
Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Skate Park		No Door Privacy Lock and Occupied Indicator	The restroom door does not provide a compliant privacy lock with occupancy indicator.	Install a compliant privacy lock with occupancy indicator to the door.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard										
Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Skate Park	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard										
Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Skate Park	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard										
Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Skate Park	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/29	
Independence Park - 12334 Bellflower Boulevard										
Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Skate Park	Unisex	Unisex Restroom Signage	Signage does not include contrasting gender use symbols.	Provide compliant contrasting gender use unisex signage.	Not_Started	None	6/30/29	

Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Skate Park	Unisex	No Contrasting Finish	The signage does not have contrasting finish from the door.	Restroom door signage should have contrasting finish.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Skate Park		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Skate Park	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Tennis Courts		No Door Privacy Lock and Occupied Indicator	The restroom door does not provide a compliant privacy lock with occupancy indicator.	Install a compliant privacy lock with occupancy indicator to the door.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Tennis Courts	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Tennis Courts	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Tennis Courts	Unisex	Unisex Restroom Signage	Signage does not include contrasting gender use symbols.	Provide compliant contrasting gender use unisex signage.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Tennis Courts	Unisex	No Contrasting Finish	The signage does not have contrasting finish from the door.	Restroom door signage should have contrasting finish.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Tennis Courts		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Tennis Courts	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Tennis Courts		No Door Privacy Lock and Occupied Indicator	The restroom door does not provide a compliant privacy lock with occupancy indicator.	Install a compliant privacy lock with occupancy indicator to the door.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Tennis Courts		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Tennis Courts	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Tennis Courts	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Tennis Courts	Unisex	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/29

Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Tennis Courts	Unisex	Unisex Restroom Signage	Signage does not include contrasting gender use symbols.	Provide compliant contrasting gender use unisex signage.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Tennis Courts	Unisex	No Contrasting Finish	The signage does not have contrasting finish from the door.	Restroom door signage should have contrasting finish.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Tennis Courts		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Tennis Courts	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Tennis Courts	Blower	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Skate Park		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Skate Park		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Skate Park		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Tennis Courts		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Tennis Courts		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Right Unisex Restroom Next To Tennis Courts		Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Tennis Courts		Grab Bar Distance From Back Wall	The distance from the rear wall to the side grab bar is greater than allowed.	Remount the side grab bar so it meets the distance requirements from the back wall.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Skate Park		No Door Privacy Lock and Occupied Indicator	The restroom door does not provide a compliant privacy lock with occupancy indicator.	Install a compliant privacy lock with occupancy indicator to the door.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Skate Park	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Skate Park	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/29

Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Skate Park	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Skate Park	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Skate Park	Unisex	Unisex Restroom Signage	Signage does not include contrasting gender use symbols.	Provide compliant contrasting gender use unisex signage.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Skate Park	Unisex	No Contrasting Finish	The signage does not have contrasting finish from the door.	Restroom door signage should have contrasting finish.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Skate Park		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Restrooms	Left Unisex Restroom Next To Skate Park	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Skate Park		Protruding Object	The drinking fountain is a protruding object.	Make sure that the fountain is not a protruding object.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Skate Park		Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Skate Park		No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Restroom Building		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Restroom Building		Non-Accessible Controls	The faucet controls require tight grasping or pinching of the wrist to operate.	Provide fountain controls with controls that do not require tight grasping or pinching of the wrist to operate.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Restroom Building		Toe Clearance	The toe clearance is less than required.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Restroom Building		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Restroom Building		Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Restroom Building		Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	6/30/29

Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain On North Side Of Tennis Courts		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain On North Side Of Tennis Courts		Non-Accessible Controls	The faucet controls require tight grasping or pinching of the wrist to operate.	Provide fountain controls with controls that do not require tight grasping or pinching of the wrist to operate.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain On North Side Of Tennis Courts		Toe Clearance	The toe clearance is less than required.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain On North Side Of Tennis Courts		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain On North Side Of Tennis Courts		Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain On North Side Of Tennis Courts		Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Tennis Courts		Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Outdoor Sports Areas	Softball Field 3		Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Outdoor Sports Areas	Softball Field 1		Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Outdoor Sports Areas	Softball Field 1		Total Semi Ambulatory Seats	There are not enough semi ambulatory seats at the location with respect to the total number of seats available.	Provide compliant semi ambulatory seating at the location.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Outdoor Sports Areas	Softball Field 1	Concession Stand	Concessions Stand Counter Height	The height of the concession counter is greater than 34 inches.	Lower the concession counter to a height between 28 inches and 34 inches above the ground level .	In_Progress	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Outdoor Sports Areas	Softball Field 1	Concession Stand	Protruding Object	The concession stand counter is a protruding object.	Make sure that the concession stand counter is not a protruding object.	In_Progress	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Outdoor Sports Areas	Tennis Courts		Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Play Area	Small Play Area Next To Restrooms	Steering Wheel - Fibar	Point of Operation Height	The point of operation height for the play equipment is not compliant.	Provide compliant play equipment.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard Downey, CA 90240	Sinks	Hand Wash Station		Sink - Control Type	Twist controls are present on the sink.	Provide compliant controls for the sink.	Not_Started	None	6/30/29

Independence Park - 12334 Bellflower Boulevard	Downey, CA 90240	Sinks	Hand Wash Station		Sink - Counter Height	Sink counter height is not compliant.	Provide compliant sink.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard	Downey, CA 90240	Sinks	Hand Wash Station		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/29
Independence Park - 12334 Bellflower Boulevard	Downey, CA 90240	Sinks	Hand Wash Station		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/29
Independence Park - 12334 Bellflower Boulevard	Downey, CA 90240	Sinks	Hand Wash Station	Soap	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard	Downey, CA 90240	Sinks	Hand Wash Station	Paper Towel	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard	Downey, CA 90240	Picnic Areas	Picnic Table Next To Skate Park		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard	Downey, CA 90240	Picnic Areas	Picnic Table Next To Skate Park		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard	Downey, CA 90240	Picnic Areas	Picnic Tables Next To Restroom Building		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard	Downey, CA 90240	Picnic Areas	Picnic Tables Next To Restroom Building		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard	Downey, CA 90240	Picnic Areas	Picnic Tables Next To Pay Area		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard	Downey, CA 90240	Picnic Areas	Picnic Tables Next To Pay Area		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard	Downey, CA 90240	Reach Ranges	Park	Barbeque	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard	Downey, CA 90240	Benches	Benches Next To Skate Park		Clear Floor Space	No clear floor space provided at the bench.	Provide compliant clear floor space for the bench at one end.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard	Downey, CA 90240	Benches	Benches Next To Small Play Area		Clear Floor Space	No clear floor space provided at the bench.	Provide compliant clear floor space for the bench at one end.	Not_Started	None	6/30/29
Independence Park - 12334 Bellflower Boulevard	Downey, CA 90240	Benches	Benches Next To Small Play Area		On Accessible Route	The bench is not on an accessible route.	Provide a compliant accessible route to the benches.	Not_Started	None	6/30/29

Independence Park - 12334 Bellflower Boulevard										
Downey, CA 90240	Benches	Benches Next To Large Play Area			Clear Floor Space Slope	Clear floor space slope is not compliant for the bench.	Provide compliant clear floor space at the bench.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue										
Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 1st Accessible Space From Left	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29	
Parking Structure - 2nd Street and La Reina Avenue										
Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 1st Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/29	
Parking Structure - 2nd Street and La Reina Avenue										
Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 1st Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29	
Parking Structure - 2nd Street and La Reina Avenue										
Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 1st Accessible Space From Left	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/29	
Parking Structure - 2nd Street and La Reina Avenue										
Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 1st Accessible Space From Left	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/29	
Parking Structure - 2nd Street and La Reina Avenue										
Downey, CA 90240	Parking	Parking Structure	1st Floor, Southeast Corner Left Accessible Space	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29	
Parking Structure - 2nd Street and La Reina Avenue										
Downey, CA 90240	Parking	Parking Structure	1st Floor, Southeast Corner Left Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/29	
Parking Structure - 2nd Street and La Reina Avenue										
Downey, CA 90240	Parking	Parking Structure	1st Floor, Southeast Corner Left Accessible Space	Parking Space Vertical Clearance	The vertical clearance of the accessible parking space is less than required.	Provide sufficient vertical clearance at each accessible parking space.	Not_Started	None	6/30/29	
Parking Structure - 2nd Street and La Reina Avenue										
Downey, CA 90240	Parking	Parking Structure	1st Floor, Southeast Corner Left Accessible Space	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29	
Parking Structure - 2nd Street and La Reina Avenue										
Downey, CA 90240	Parking	Parking Structure	1st Floor, Southeast Corner Left Accessible Space	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/29	
Parking Structure - 2nd Street and La Reina Avenue										
Downey, CA 90240	Parking	Parking Structure	1st Floor, Southeast Corner Left Accessible Space	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/29	
Parking Structure - 2nd Street and La Reina Avenue										
Downey, CA 90240	Parking	Parking Structure	1st Floor, Southeast Corner Left Accessible Space	Access Aisle is Faded or Damaged	The access aisle markings are faded, damaged, or otherwise not viewable.	Re-stripe the access aisle so as to discourage parking.	Not_Started	None	6/30/29	
Parking Structure - 2nd Street and La Reina Avenue										
Downey, CA 90240	Parking	Parking Structure	1st Floor, West Wall, Right Accessible Space	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29	
Parking Structure - 2nd Street and La Reina Avenue										
Downey, CA 90240	Parking	Parking Structure	1st Floor, West Wall, Right Accessible Space	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29	

Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, West Wall, Right Accessible Space	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, Accessible Space Next to Elevator	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, Accessible Space Next to Elevator	Parking Space Vertical Clearance	The vertical clearance of the accessible parking space is less than required.	Provide sufficient vertical clearance at each accessible parking space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, Accessible Space Next to Elevator	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, Accessible Space Next to Elevator	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, Accessible Space Next to Elevator	Access Aisle Width	The access aisle does not meet the minimum required width.	Re-stripe the access aisle to meet the minimum required width and length for the space type.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, Accessible Space Next to Elevator	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, West Wall, Left Accessible Space	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, West Wall, Left Accessible Space	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, West Wall, Left Accessible Space	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, West Wall, Left Accessible Space	Access Aisle Width	The access aisle does not meet the minimum required width.	Re-stripe the access aisle to meet the minimum required width and length for the space type.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 2nd Accessible Space From Left	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 2nd Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 2nd Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 2nd Accessible Space From Left	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/29

Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 4th Accessible Space From Left	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 4th Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 4th Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 4th Accessible Space From Left	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 5th Accessible Space From Left	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 5th Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 5th Accessible Space From Left	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, Southeast Corner Right Accessible Space	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, Southeast Corner Right Accessible Space	Parking Space Vertical Clearance	The vertical clearance of the accessible parking space is less than required.	Provide sufficient vertical clearance at each accessible parking space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, Southeast Corner Right Accessible Space	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, Southeast Corner Right Accessible Space	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, Southeast Corner Right Accessible Space	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 3rd Accessible Space From Left	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 3rd Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 3rd Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/29

Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 3rd Accessible Space From Left	Parking Space Accessible Signage Height	The bottom edge of the wall-mounted signage designating accessible parking is not at the required height.	Remount the wall-mounted signage designating the accessible parking space so that it is installed at the required height. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Parking	Parking Structure	1st Floor, South Wall, 3rd Accessible Space From Left	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Path of Travel	Path Of Travel From The West Wall Accessible Spaces From The Public Right of Way	Access Aisle	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Path of Travel	Path of Travel to Elevator 1st Floor Entrance	Interior Corridor	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Path of Travel	Path Of Travel From The South Wall, 5th Accessible Space From Left to The Public Right of Way	Access Aisle	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Path of Travel	Path Of Travel From The Accessible Space Next to Elevator to The Public Right of Way	Access Aisle	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Path of Travel	Path Of Travel From The Accessible Space Next to Elevator to The Public Right of Way	Vehicular Traffic	Cross Walks and Detectable Warnings	There are no detectable warnings where the pedestrian route crosses vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Path of Travel	Path Of Travel From The Southwest Corner Accessible Spaces to The Public Right of Way	Access Aisle	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Path of Travel	Path Of Travel From The Southwest Corner Accessible Spaces to The Public Right of Way	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Path of Travel	Path Of Travel From The Southwest Corner Accessible Spaces to The Public Right of Way	Exterior Walkway	Sidewalk Width	The width of the path of travel is insufficient.	Widen the primary path of travel to provide the correct width.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Path of Travel	Path Of Travel From The South Wall, 1st Accessible Space From Left to The Public Right of Way	Access Aisle	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Path of Travel	Path Of Travel From The South Wall, 1st Accessible Space From Left to The Public Right of Way	Open Area	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Path of Travel	Path Of Travel From The South Wall, 3rd Accessible Space From Left to The Public Right of Way	Access Aisle	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Elevators	Elevator Next To East Entrance		Car Width	The elevator provides a center opening door to the elevator car. The width of the elevator car is less than required.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Elevators	Elevator Next To East Entrance		Elevator - Jamb Marking	Main floor is not indicated with a star.	Make sure that main floor is indicated with a star.	Not_Started	None	6/30/29

Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Elevators	Elevator Next To East Entrance		Jamb Marking	Elevator has no jamb marking.	Provide compliant jamb marking for the elevator.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Stairs	Stairs Next To Elevator	Run 4 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Stairs	Stairs Next To Elevator	Run 5 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Stairs	Stairs Next To Elevator	Run 6 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Stairs	Stairs Next To Elevator	Run 2 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Stairs	Stairs Next To Elevator	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Stairs	Stairs Next To Elevator	Run 1 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Signage	Stairs Next To Elevator	Run 4 Floor Level Landing	No Floor Level Signage	The stairs do not provide accessible signage stating the floor level and the upper and lower terminus of the stairway. The stairway provides access between two floor levels of the facility.	Install signage at the required height above the finished floor on the wall adjacent to the latch side of the entry doorway stating the floor level and the upper and lower terminus of the stairway. The sign shall provide raised Arabic numerals and raised Grade 2 Braille symbols and shall comply with the finish and contrast requirements set forth. Signage should be located where a person may approach within three inches of the sign without encountering protruding objects or standing within the swing of the door.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Signage	Stairs Next To Elevator	Run 6 Floor Level Landing	No Floor Level Signage	The stairs do not provide accessible signage stating the floor level and the upper and lower terminus of the stairway. The stairway provides access between two floor levels of the facility.	Install signage at the required height above the finished floor on the wall adjacent to the latch side of the entry doorway stating the floor level and the upper and lower terminus of the stairway. The sign shall provide raised Arabic numerals and raised Grade 2 Braille symbols and shall comply with the finish and contrast requirements set forth. Signage should be located where a person may approach within three inches of the sign without encountering protruding objects or standing within the swing of the door.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Signage	Stairs Next To Elevator	Run 2 Floor Level Landing	No Floor Level Signage	The stairs do not provide accessible signage stating the floor level and the upper and lower terminus of the stairway. The stairway provides access between two floor levels of the facility.	Install signage at the required height above the finished floor on the wall adjacent to the latch side of the entry doorway stating the floor level and the upper and lower terminus of the stairway. The sign shall provide raised Arabic numerals and raised Grade 2 Braille symbols and shall comply with the finish and contrast requirements set forth. Signage should be located where a person may approach within three inches of the sign without encountering protruding objects or standing within the swing of the door.	Not_Started	None	6/30/29
Parking Structure - 2nd Street and La Reina Avenue Downey, CA 90240	Signage	Directional Signage From The Public Right Of Way		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Curb Ramps	Curb Ramp next to Entrance next to System Manager		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Curb Ramps	Curb Ramp next to Entrance next to System Manager	Bottom Landing	Bottom Landing Slope	The slope at the bottom landing is greater than allowed.	Provide a compliant bottom landing that does not exceed the maximum slope requirements.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Curb Ramps	Curb Ramp next to Entrance next to System Manager	Bottom Landing	Bottom Landing Change in Level - Curb Ramps	The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.	Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Path of Travel	Path to Entrance next to Forensic Office	Exterior Walkway	Noncompliant Surface	The surface of the primary accessible path of travel is rough and uneven, providing a hazardous surface for individuals with mobility impairments and the general public.	Resurface the path of travel to provide a smooth, firm, stable and slip-resistant surface.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Path of Travel	Sidewalk to the Main Entrance	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Path of Travel	Sidewalk from Entrance to Police Parking Lot to Entrance next to Armory	Vehicular Traffic	Cross Walks and Detectable Warnings	There are no detectable warnings where the pedestrian route crosses vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Path of Travel	Womens Locker Room	Shower Curtain	Protruding Objects - Vertical Clearance	The vertical clearance height is less than required.	Provide recommended vertical clearance.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Path of Travel	Communications Unisex Restroom	Cabinet	Protruding Objects - Protrusion Limit	The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.	Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Path of Travel	Mens Restroom next to Gang Unit	Shelf	Protruding Objects - Protrusion Limit	The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.	Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Path of Travel	Briefing Room	Step	Stairs or Steps Obstruction	There is a step or curb on the path of travel preventing access.	Provide a ramp or other means of vertical access.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Entrance to Police Parking Lot	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Entrance to Police Parking Lot	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Entrance to Police Parking Lot	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Entrance to Police Parking Lot	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Intoxilizer	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Intoxilizer	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Fingerprint Room	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Fingerprint Room	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Lobby Womens Restroom	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Lobby Womens Restroom	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Lobby Womens Restroom	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Lobby Womens Restroom	Lever	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Womens Locker Room Restroom next to Break Room - 2nd Door		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Womens Locker Room Restroom next to Break Room - 2nd Door	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Womens Locker Room Restroom next to Break Room - 2nd Door	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Womens Locker Room Restroom next to Break Room - 2nd Door	Push / Pull	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Special Operations Sergeant	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Weight Room	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Weight Room	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Weight Room	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Weight Room		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Lobby Mens Restroom	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Lobby Mens Restroom	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Lobby Mens Restroom	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Lobby Mens Restroom	Lever	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Entrance next to Weight Room	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Entrance next to Weight Room		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Hallway next to Break Room	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Records Bureau Left File Room	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Records Bureau Left File Room	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Records Bureau Left File Room	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Records Bureau Left File Room	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Records Bureau Left File Room	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Records Bureau Left File Room	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Records Bureau Right File Room	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Records Bureau Right File Room	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Records Bureau Right File Room	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Records Bureau Right File Room	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Records Bureau Right File Room	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Records Bureau Right File Room	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Records Bureau Right File Room	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Special Operations	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Special Operations	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Special Operations	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Hallway in Main Lobby	Push Bar / Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Watch Commander	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Watch Commander	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Main Entrance	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Main Entrance	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Main Entrance	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Main Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Conference Room in Captain Field Operaions	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Conference Room in Captain Field Operaions	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Womens Locker Room Restroom next to Break Room - 1st Door		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Womens Locker Room Restroom next to Break Room - 1st Door	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Womens Locker Room Restroom next to Break Room - 1st Door	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Services Hallway next to Records	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Services Hallway next to Records	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Officer in Charge Technical Services Section	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Officer in Charge Technical Services Section	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Officer in Charge Technical Services Section	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Entrance next to Armory	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Entrance next to Armory	Push Bar / Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Conference Room next to Shift Sergeants, Shift Sergeants	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Conference Room next to Shift Sergeants, Shift Sergeants	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Conference Room next to Shift Sergeants, Shift Sergeants	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Amateur Radio Communications	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Amateur Radio Communications	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Womens Locker Room Restroom next to Records - 2nd Door	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Records Bureau	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Shift Sergeants next to Captains Office	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Shift Sergeants next to Captains Office	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Shift Sergeants next to Captains Office	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Shift Sergeants next to Captains Office	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Shift Sergeants next to Captains Office	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Services Hallway Unisex Restroom		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Services Hallway Unisex Restroom	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Store Room in File Room	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Womens Locker Room Restroom next to Records - 1st Door	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom next to Gang Unit	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Womens Restroom next to Gang Unit	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Briefing Room Entrance	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Briefing Room Entrance	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Briefing Room Entrance		Bottom Door Panel Height	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Communications	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Communications	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom next to Gang Unit	Pull Side	Latch Approach Clear Floor Space Width	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Mens Restroom next to Gang Unit	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Detectives next to Systems Manager	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Detectives next to Systems Manager	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Systems Manager	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Systems Manager	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Systems Manager	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Systems Manager	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Adult Padded Holding Cell		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Gang Unit next to Sergeants Office	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Gang Unit next to Sergeants Office	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Gang Unit next to Sergeants Office	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Gang Unit next to Sergeants Office	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Gang Unit next to Sergeants Office	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Workroom next to Sergeant Crimes - Property	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Workroom next to Sergeant Crimes - Property	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Workroom next to Sergeant Crimes - Property	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Detective Break Room	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Detective Break Room	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Detective Break Room	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Sergeant Crimes - Property	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Sergeant Crimes - Property	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Hi-Tech Crimes	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Hi-Tech Crimes	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Entrance next to System Manager	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Entrance next to System Manager	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Entrance next to System Manager	Push / Pull	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Entrance next to System Manager	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Supervisors Mens Locker Room	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Force Training Room	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Force Training Room	Push / Pull	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Booking Area Holding Cell		Doorway Opening Width	The clear opening width of the doorway is not compliant.	Provide a compliant doorway at the location.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Special Investigation Narcotics	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Special Investigation Narcotics	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Special Investigation Narcotics	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Search, Pre Booking		Doorway Opening Width	The clear opening width of the doorway is not compliant.	Provide a compliant doorway at the location.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Computer Forensics	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Computer Forensics	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Computer Forensics	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Computer Forensics	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Computer Forensics	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Sergeant Narcotics, Sergant Crimes, Lieutenant Investigation	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Sergeant Narcotics, Sergant Crimes, Lieutenant Investigation	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Sergeant Narcotics, Sergant Crimes, Lieutenant Investigation	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Right Briefing Room	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Gang Unit next to Detective Reception	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Gang Unit next to Detective Reception	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Gang Unit next to Detective Reception	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Left Briefing Room	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Mens Locker Room Restroom in Weight Room	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Mens Locker Room Restroom in Weight Room	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Mens Locker Room Restroom in Weight Room		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Forensic Unit	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Forensic Unit	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Forensic Unit	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Forensic Unit	Push / Pull	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Conference Room in Police Chiefs Office	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chief Secretary Office Break Room		Pocket Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and provide a compliant door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chief Secretary Office Break Room	Finger Pull - 1.5	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chief Secretary Office Break Room	Finger Pull - 1.5	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Neighborhood Watch Coordinator	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Administration Entrance	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Administration Entrance	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Administration Entrance	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Administrative Offices	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Administrative Offices	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Administrative Offices	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Interview Room next to Information Technology	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Interview Room next to Information Technology	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Interview Room next to Information Technology	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chiefs Office	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chiefs Office Patio Entrance	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chiefs Office Patio Entrance	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chiefs Office Patio Entrance	Push / Pull	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Entrance next to Forensic Office	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Entrance next to Forensic Office	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Entrance next to Forensic Office		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Special Enforcement Team	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Administration Conference Room	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Administration Conference Room	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Administration Conference Room	Lever	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Administration Conference Room	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chiefs Office Patio	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chiefs Office Patio	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chiefs Office Patio	Push / Pull	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chiefs Office Patio	Push / Pull	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chiefs Office Patio	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chiefs Office Patio		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Forensic Supervisor	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Information Technology	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Information Technology	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Information Technology	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Information Technology	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Dark Room, Forensic File Room	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Dark Room, Forensic File Room	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chief Secretary Office	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chief Secretary Office	Push / Pull	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chief Secretary Office	Push / Pull	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Doors	Police Chief Secretary Office	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Counters	Record Reception		Counter Height	The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.	Provide a portion of counter at the compliant height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Counters	Record Request Counter		Counter Height	The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.	Provide a portion of counter at the compliant height.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Counters	Main Lobby Reception	Counter Height	The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.	Provide a portion of counter at the compliant height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Counters	Detectives Reception	Counter Height	The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.	Provide a portion of counter at the compliant height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Counters	Booking Office	Counter Height	The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.	Provide a portion of counter at the compliant height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Main Lobby Doorbell	No Information Signage	There is no informational signage.	Install informational signage to each accessible element or room or location.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Hallway next to Break Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Shift Sergeants next to Captains Office	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Records Workroom	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Services Hallway next to Records	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Entrance next to Armory	No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Conference Room next to Shift Sergeants	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Amateur Radio Communications	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Records next to Records Request	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Intoxilizer	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Special Operations Sergeant	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Entrance next to Weight Room	No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Hallway in Main Lobby	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Main Entrance	No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Officer in Charge Technical Services Section	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Watch Commander	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Records Bureau	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Store Room in File Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Records Bureau File Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Weight Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Detective Break Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	DPOA Office	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Detectives Offices	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Supervisors Mens Locker Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Computer Forensics	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Gang Unit Sergeants Office	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Detectives Interview Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Sergeant Crimes - Property	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Gang Unit	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Briefing Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Entrance next to System Manager	No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Detectives Interview Room Panic Button	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Forensic Unit	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Force Training Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Captain Investigation	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Hi-Tech Crimes	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Administrative Offices	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Special Enforcement Team	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Neighborhood Watch Coordinator	Highest Tactile Character Height	Highest line of tactile characters are not at a compliant height.	Provide compliant signage at the location.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Police Chief Secretary Office Break Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Lieutenant Administration	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Information Technology	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Police Chiefs Office	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Police Chief Secretary Office	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Conference Room in Police Chiefs Office	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Police Chiefs Office Patio	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Administration Conference Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Administrative Sergeant	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Signage	Forensic Supervisor	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Public Telephones	Payphone in Lobby	Highest Operable Parts	The highest operable part of the public telephone exceeds allowed maximum reach range.	Contact the telephone company that owns the public telephone regarding the height of all the operating devices on the telephone.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Mens Restroom	Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Mens Restroom	Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Mens Restroom	Side Grab Bar Height	The height of the side grab bar is not at the correct height.	Remount the grab bar so it is at the correct height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Mens Restroom	Rear Grab Bar Length	The length of the rear grab bar is less than required.	Replace the rear grab bar with a compliant grab bar.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Mens Restroom	Rear Grab Bar Interferes	Rear grab bar interferes with the tank/flushometer.	Readjust the rear grab bar so that it does not interfere with the tank/flushometer.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Mens Restroom	Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Mens Restroom	Rear Grab Bar Height	The grab bar on the rear wall is not at the correct height.	Remount the rear grab bar in the compartment designated to be accessible so the height of the gripping surface is at the correct height.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Mens Restroom		Located Behind Front of Seat	The paper dispenser is located behind the front of toilet seat.	Provide a compliant dispenser mounted at 7" to 9" in front of the water closet.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Locker Room Restroom	Lavatory	Lavatory Surface Height	The height of the counter surface is greater than allowed.	Relocate or replace the lavatory to provide a maximum counter surface height of no greater than recommended.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Locker Room Restroom	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Locker Room Restroom	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Locker Room Restroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Locker Room Restroom	Female	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Locker Room Restroom	Female	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Locker Room Restroom		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Locker Room Restroom		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Locker Room Restroom	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Locker Room Restroom	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Locker Room Restroom		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Locker Room Restroom		Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Locker Room Restroom		Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Locker Room Restroom		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Locker Room Restroom		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Locker Room Restroom		Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Mens Restroom		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Mens Restroom	Lavatory	Lavatory Surface Height	The height of the counter surface is greater than allowed.	Relocate or replace the lavatory to provide a maximum counter surface height of no greater than recommended.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Mens Restroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Mens Restroom	Male	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Mens Restroom	Male	No Contrasting Finish	The signage does not have contrasting finish from the door.	Restroom door signage should have contrasting finish.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Mens Restroom		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Mens Restroom	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Mens Restroom	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom		Side Grab Bar Length	The length of the side grab bar is less than required.	Replace the side grab bar with a compliant grab bar.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom		Rear Grab Bar Length	The length of the rear grab bar is less than required.	Replace the rear grab bar with a compliant grab bar.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom		Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom		Located Behind Front of Seat	The paper dispenser is located behind the front of toilet seat.	Provide a compliant dispenser mounted at 7" to 9" in front of the water closet.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom		Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom		Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom		No Door Privacy Lock and Occupied Indicator	The restroom door does not provide a compliant privacy lock with occupancy indicator.	Install a compliant privacy lock with occupancy indicator to the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom	Lavatory	Lavatory Control Type	The faucet controls on the lavatory require tight grasping, pinching, or twisting of the wrist and are not accessible.	Install accessible faucet controls. Lever-operated, push-type, touch-type or electronically controlled mechanisms are acceptable elements. If self-closing valves are used the faucet shall remain open for at least 10 seconds.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom	Unisex	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Services Hallway Unisex Restroom	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Womens Restroom		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Womens Restroom	Lavatory	Lavatory Surface Height	The height of the counter surface is greater than allowed.	Relocate or replace the lavatory to provide a maximum counter surface height of no greater than recommended.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Womens Restroom	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Womens Restroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Womens Restroom	Female	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Womens Restroom	Female	No Contrasting Finish	The signage does not have contrasting finish from the door.	Restroom door signage should have contrasting finish.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Womens Restroom		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Womens Restroom	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Womens Restroom	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Womens Restroom		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Womens Restroom		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Womens Restroom		Side Grab Bar Height	The height of the side grab bar is not at the correct height.	Remount the grab bar so it is at the correct height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Womens Restroom		Rear Grab Bar Length	The length of the rear grab bar is less than required.	Replace the rear grab bar with a compliant grab bar.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Womens Restroom		Rear Grab Bar Interferes	Rear grab bar interferes with the tank/flushometer.	Readjust the rear grab bar so that it does not interfere with the tank/flushometer.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Womens Restroom		Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Lobby Womens Restroom		Located Behind Front of Seat	The paper dispenser is located behind the front of toilet seat.	Provide a compliant dispenser mounted at 7" to 9" in front of the water closet.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Communications Unisex Restroom		No Door Privacy Lock and Occupied Indicator	The restroom door does not provide a compliant privacy lock with occupancy indicator.	Install a compliant privacy lock with occupancy indicator to the door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Communications Unisex Restroom		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Communications Unisex Restroom	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Communications Unisex Restroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Communications Unisex Restroom	Unisex	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Communications Unisex Restroom	Unisex	No Contrasting Finish	The signage does not have contrasting finish from the door.	Restroom door signage should have contrasting finish.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Communications Unisex Restroom		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Communications Unisex Restroom	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Communications Unisex Restroom		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Communications Unisex Restroom		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Communications Unisex Restroom		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Communications Unisex Restroom		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Communications Unisex Restroom		Toilet Paper Dispenser Interferes with Grab Bar	The toilet paper dispenser interferes with the use of the grab bar.	Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Communications Unisex Restroom		Toilet Paper Dispenser Above Grab Bar	The toilet paper dispenser is located above the provided grab bar.	Remount the dispenser below the grab bar at 19" minimum.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Communications Unisex Restroom		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Gang Unit		Urinal Rim Height	The height of the urinal rim in the restroom is greater than 17 inches above the finished floor.	Lower the urinal designated to be accessible in the restroom so that the rim height is not more than 17 inches above the finished floor.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Gang Unit	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Gang Unit	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Gang Unit	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Gang Unit	Male	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Gang Unit		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Gang Unit	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Locker Room Restroom		Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Locker Room Restroom		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Locker Room Restroom		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Locker Room Restroom		Compartment Door Swings In	The door to the compartment swings inward into the minimum required compartment area.	Modify the swing of the door so that it does not swing into the minimum required compartment area.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Locker Room Restroom		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Locker Room Restroom		Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Locker Room Restroom		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Locker Room Restroom	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Locker Room Restroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Locker Room Restroom	Male	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Locker Room Restroom	Male	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Locker Room Restroom		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Locker Room Restroom		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Locker Room Restroom	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Locker Room Restroom	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Holding Cell	Lavatory	Pedestal	Pedestal sink does not allow a forward approach.	Provide compliant sink.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Holding Cell	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Holding Cell	Lavatory	Lavatory Clear Floor Space Width	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Holding Cell	Lavatory	Lavatory Clear Floor Space Length	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Padded Holding Cell		No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Padded Holding Cell		Toilet Clear Floor Space Length	There is not a minimum of 56 inches of clearance around the water closet measured perpendicular from the rear wall.	Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Padded Holding Cell		Toilet Clear Floor Space Width	There is not a minimum of 60 inches of clearance around the water closet measured perpendicular from the side wall.	Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Padded Holding Cell		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Padded Holding Cell		Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Padded Holding Cell		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Padded Holding Cell		Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit	Female	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit	Feminine Products	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Padded Holding Cell	Lavatory	Pedestal	Pedestal sink does not allow a forward approach.	Provide compliant sink.	Not_Started	None	6/30/29
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Padded Holding Cell	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/29

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Padded Holding Cell	Lavatory	Lavatory Clear Floor Space Width	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Padded Holding Cell	Lavatory	Lavatory Clear Floor Space Length	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit		No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit		No Back Wall Grab Bar	There is no back grab bar at the toilet compartment.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit		Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit		Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit		Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit		Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	6/30/30

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Womens Restroom next to Gang Unit	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Booking Area Unisex Restroom	No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Booking Area Unisex Restroom	Toilet Clear Floor Space Width	There is not a minimum of 60 inches of clearance around the water closet measured perpendicular from the side wall.	Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Booking Area Unisex Restroom	Grab Bar Distance From Back Wall	The distance from the rear wall to the side grab bar is greater than allowed.	Remount the side grab bar so it meets the distance requirements from the back wall.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Booking Area Unisex Restroom	Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Booking Area Unisex Restroom	Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Booking Area Unisex Restroom	Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Booking Area Unisex Restroom	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Gang Unit	No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Gang Unit	Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Gang Unit	No Back Wall Grab Bar	There is no back grab bar at the toilet compartment.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Gang Unit	Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Gang Unit	Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Gang Unit	Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Gang Unit	Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/30

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Mens Restroom next to Gang Unit		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Booking Area Unisex Restroom		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Booking Area Unisex Restroom	Lavatory	Pedestal	Pedestal sink does not allow a forward approach.	Provide compliant sink.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Booking Area Unisex Restroom	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Booking Area Unisex Restroom	Lavatory	Lavatory Clear Floor Space Width	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Booking Area Unisex Restroom	Lavatory	Lavatory Clear Floor Space Length	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Holding Cell		No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Holding Cell		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Holding Cell		Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Restrooms	Adult Holding Cell		Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain in Main Lobby		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain in Main Lobby		Spout Height for Standing Persons	The spout height for standing persons is not compliant.	Provide a compliant spout outlet height for standing persons.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain in Main Lobby		No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain In Break Room		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain In Break Room		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/30

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain In Break Room	No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Womens Locker Room	Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Womens Locker Room	Stream Height	The height of the water stream is less than required.	Insure that the spout directs the water flow to the required height and in a trajectory that is parallel or nearly parallel to the front of the drinking fountain.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Detectives Reception	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Detectives Reception	Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Locker Rooms	Womens Locker Room Restroom	No Accessible Lockers Available	No accessible lockers were found.	At least one locker or 5% of the lockers should be accessible.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Locker Rooms	Womens Locker Room Restroom	Accessible Benches	There are no accessible benches in the locker room.	Install compliant benches in the locker room.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Locker Rooms	Supervisors Mens Locker Room	No Accessible Lockers Available	No accessible lockers were found.	At least one locker or 5% of the lockers should be accessible.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Locker Rooms	Supervisors Mens Locker Room	Accessible Benches	There are no accessible benches in the locker room.	Install compliant benches in the locker room.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Locker Rooms	Mens Locker Room Restroom	No Accessible Lockers Available	No accessible lockers were found.	At least one locker or 5% of the lockers should be accessible.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Locker Rooms	Mens Locker Room Restroom	Accessible Benches	There are no accessible benches in the locker room.	Install compliant benches in the locker room.	Not_Started	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room next to Locker Rooms	Control Height	The side reach height of the controls on the vending machine is greater than the allowed maximum height.	Provide a compliant vending machine.	In_Progress	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room next to Locker Rooms	Control Height	The side reach height of the controls on the vending machine is greater than the allowed maximum height.	Provide a compliant vending machine.	In_Progress	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room next to Locker Rooms	Control Height	The side reach height of the controls on the vending machine is greater than the allowed maximum height.	Provide a compliant vending machine.	In_Progress	None	6/30/30
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room next to Locker Rooms	Sink - Counter Height	Sink counter height does not meet the standards.	Provide compliant sink.	Not_Started	None	6/30/32

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room next to Locker Rooms		Toe Kick Not Removed	The toe kick for the sink in break/conference room is not removed.	Remove the toe kick for the sink.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room next to Locker Rooms		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room next to Locker Rooms		Supply Lines	Supply lines are not wrapped for the break/conference room sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room next to Locker Rooms	Soap	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room next to Locker Rooms	Paper Towel	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Break Room next to Locker Rooms	Refrigerator	Reach Height	Appliance Reach Height in the break/conference room is not compliant.	Make sure that the specified appliance reach height is compliant.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Communications		Sink - Counter Height	Sink counter height does not meet the standards.	Provide compliant sink.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Communications		Toe Kick Not Removed	The toe kick for the sink in break/conference room is not removed.	Remove the toe kick for the sink.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Communications		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Communications		Clear Floor Space Width	There is not enough clear floor space at the sink.	Provide enough clear floor space at the location.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Communications		Supply Lines	Supply lines are not wrapped for the break/conference room sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Communications	Microwave	Reach Height	Appliance Reach Height in the break/conference room is not compliant.	Make sure that the specified appliance reach height is compliant.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Detective Break Room		Sink - Control Type	Sink controls needs twisting to operate.	Provide compliant controls for the sink in break/conference room.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Detective Break Room		Sink - Counter Height	Sink counter height does not meet the standards.	Provide compliant sink.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Detective Break Room		Toe Kick Not Removed	The toe kick for the sink in break/conference room is not removed.	Remove the toe kick for the sink.	Not_Started	None	6/30/32

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Detective Break Room		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Detective Break Room		Clear Floor Space Width	There is not enough clear floor space at the sink.	Provide enough clear floor space at the location.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Detective Break Room		Supply Lines	Supply lines are not wrapped for the break/conference room sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Detective Break Room	Soap	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Detective Break Room	Paper Towel	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Detective Break Room	Microwave	Reach Height	Appliance Reach Height in the break/conference room is not compliant.	Make sure that the specified appliance reach height is compliant.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Briefing Room		Tables - Knee Depth	The table knee depth does not meet required standards.	Provide compliant tables.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Administration Conference Room		Tables - Knee Clearance	The table knee clearance does not meet required standards.	Provide compliant tables.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Police Chief Secretary Office Break Room		Sink - Counter Height	Sink counter height does not meet the standards.	Provide compliant sink.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Police Chief Secretary Office Break Room		Toe Kick Not Removed	The toe kick for the sink in break/conference room is not removed.	Remove the toe kick for the sink.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Police Chief Secretary Office Break Room		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Police Chief Secretary Office Break Room		Cabinet Door Hardware	The cabinet door hardware is not accessible.	Provide compliant hardware for the cabinet door.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Police Chief Secretary Office Break Room		Clear Floor Space Length	There is not enough clear floor space at the sink.	Provide enough clear floor space at the location.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Police Chief Secretary Office Break Room		Supply Lines	Supply lines are not wrapped for the break/conference room sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Police Chief Secretary Office Break Room	Paper Towel	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/32

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Break/Conference Room	Police Chief Secretary Office Break Room	Microwave	Reach Height	Appliance Reach Height in the break/conference room is not compliant.	Make sure that the specified appliance reach height is compliant.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Sinks	Intoxilizer		Sink - Counter Height	Sink counter height is not compliant.	Provide compliant sink.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Sinks	Intoxilizer		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Sinks	Intoxilizer		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Sinks	Intoxilizer	Paper Towel	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Sinks	Booking Area		Sink - Counter Height	Sink counter height is not compliant.	Provide compliant sink.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Sinks	Booking Area		Sink - Knee Clearance	Sink knee clearance does not meet the standards.	Provide compliant sink.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Sinks	Booking Area		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Sinks	Booking Area		Door Hardware	The cabinet door hardware is not accessible.	Provide compliant hardware for cabinet door.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Sinks	Booking Area		Toe Kick Not Removed	The toe kick for the sink is not removed.	Make sure there is no toe kick at the sink.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Sinks	Booking Area		Clear Floor Space Width	There is not enough clear floor space at the sink.	Provide enough clear floor space at the location.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Sinks	Booking Area		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Sinks	Booking Area	Soap	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Sinks	Booking Area	Paper Towel	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Picnic Areas	Picnic Tables next to Police Parking Lot		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/32

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Lockers	Lockers next to Police Parking Lot	No Accessible Lockers Available	No accessible lockers were found.	At least one locker or 5% of the lockers should be accessible.	Not_Started	None	6/30/32	
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Accessible Showers	Womens Locker Room Restroom	Soap Dish Height	The soap dish is not mounted at a compliant height.	Relocated the soap dish on the same wall as the water controls at a compliant height.	Not_Started	None	6/30/32	
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Accessible Showers	Womens Locker Room Restroom	Seat Length	Shower seat length is not compliant.	Provide a compliant seat that extends the full length of the shower.	Not_Started	None	6/30/32	
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Accessible Showers	Womens Locker Room Restroom	Hand Held Unit Height	The hand-held sprayer unit is not mounted at the required height above the finished floor.	Provide a compliant hand-held sprayer unit with a hose.	Not_Started	None	6/30/32	
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Accessible Showers	Womens Locker Room Restroom	Hand Held Unit Hose Length	The length of the hose for the hand-held sprayer unit is not compliant.	Provide a compliant hand-held sprayer unit with a hose.	Not_Started	None	6/30/32	
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Accessible Showers	Booking Area Unisex Restroom	Accessible Showers	There are not enough accessible showers with respect to the total number of showers available.	Provide the required amount of compliant accessible showers.	Not_Started	None	6/30/32	
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Accessible Showers	Mens Locker Room Restroom	Soap Dish Height	The soap dish is not mounted at a compliant height.	Relocated the soap dish on the same wall as the water controls at a compliant height.	Not_Started	None	6/30/32	
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Accessible Showers	Mens Locker Room Restroom	Seat Length	Shower seat length is not compliant.	Provide a compliant seat that extends the full length of the shower.	Not_Started	None	6/30/32	
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Accessible Showers	Mens Locker Room Restroom	Seat Distance From Wall	The distance between the folding seat and the adjacent wall is greater than 1 1/2 inches.	Remount the folding seat at a height of 18 inches above the finished floor. Make certain that the distance between the folding seat and wall upon which it is hung is no greater than 1 1/2 inches and that it extends less than 6 inches from the mounting wall when folded.	Not_Started	None	6/30/32	
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Accessible Showers	Mens Locker Room Restroom	Seat Height	The folding seat in the accessible shower is not mounted at a compliant height above the finished floor.	Remount the folding seat to a compliant height above the finished floor.	Not_Started	None	6/30/32	
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Accessible Showers	Mens Locker Room Restroom	Hand Held Unit Height	The hand-held sprayer unit is not mounted at the required height above the finished floor.	Provide a compliant hand-held sprayer unit with a hose.	Not_Started	None	6/30/32	
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Accessible Showers	Mens Locker Room Restroom	Hand Held Unit Hose Length	The length of the hose for the hand-held sprayer unit is not compliant.	Provide a compliant hand-held sprayer unit with a hose.	Not_Started	None	6/30/32	
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Accessible Showers	Mens Locker Room Restroom	Water Valve Height	The water control valve is not mounted at a compliant height.	Remount the water control valve.	Not_Started	None	6/30/32	
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Reach Ranges	Parking Lot	Right Electric Vehicle Charging Station	Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Reach Ranges	Parking Lot	Right Electric Vehicle Charging Station	Element Highest Point of Operation	The highest point of operation for the element is not compliant.	Make sure that the highest point of operation is within the recommended value.	In_Progress	None	6/30/32

Police Department - 10911 Brookshire Avenue Downey, CA 90240	Reach Ranges	Parking Lot	Left Electric Vehicle Charging Station	Reach Depth	Element reach depth is not compliant.	Make sure that the element is within allowed reach range with recommended reach depth.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Reach Ranges	Parking Lot	Left Electric Vehicle Charging Station	Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space.	Not_Started	None	6/30/32
Police Department - 10911 Brookshire Avenue Downey, CA 90240	Reach Ranges	Parking Lot	Left Electric Vehicle Charging Station	Element Highest Point of Operation	The highest point of operation for the element is not compliant.	Make sure that the highest point of operation is within the recommended value.	In_Progress	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Parking	Visitors Parking Lot		No Accessible Parking Spaces Available	There are not enough accessible parking spaces marked in the parking lot and therefore does not meet the minimum number required.	Re-stripe any existing parking spaces marked accessible and create additional accessible parking spaces. Designate one parking space as "van-accessible".	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Parking	Visitors Parking Lot		No Parking Lot Warning Sign	There is no warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot.	Post a sign in a conspicuous place to the entrance of the parking lot, or immediately adjacent to and visible from each accessible parking space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that clearly and conspicuously states the following; "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities will be towed away at owner's expense. Towed vehicles may be reclaimed at ____ or by telephoning ____." Fill in the blank spaces with appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Path of Travel	Path Of Travel From Visitors Parking Lot To Public Works Building	Vehicular Traffic	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Path of Travel	Path Of Travel To The Main Entrance	Curb	Curb is on The Path of Travel	There is a curb on the designated path of travel.	Provide a compliant curb ramp.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Path of Travel	Path Of Travel From The Public Right Of Way		No Designated Accessible Route	There is no compliant accessible route from the public right of way to the accessible entrance of the facility.	Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Path of Travel	Reception	Cabinet	Protruding Objects - Vertical Clearance	The vertical clearance height is less than required.	Provide recommended vertical clearance.	In_Progress	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Doors	Secretarys Office		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Doors	Secretarys Office		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Doors	Secretarys Office	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/32

Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Doors	Main Entrance		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Doors	Main Entrance		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Doors	Main Entrance	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Doors	Main Entrance	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Doors	Main Entrance	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Doors	Main Entrance	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Doors	Main Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Doors	Superintendents Office		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Doors	Superintendents Office	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Doors	Mens Restroom In Breakroom		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Doors	Mens Restroom In Breakroom		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Doors	Mens Restroom In Breakroom		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/32

Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240										Doors	Mens Restroom In Breakroom	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240										Doors	Mens Restroom In Breakroom	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240										Doors	Mens Restroom In Breakroom		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240										Doors	Breakroom		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240										Doors	Breakroom		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240										Doors	Breakroom		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240										Doors	Breakroom	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240										Doors	Breakroom	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240										Doors	Breakroom	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240										Doors	Womens Restroom Next To Reception		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240										Doors	Womens Restroom Next To Reception		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240										Doors	Womens Restroom Next To Reception	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/32

Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Doors	Womens Restroom Next To Reception	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Doors	Breakroom Exterior Entrance		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Doors	Breakroom Exterior Entrance		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Doors	Breakroom Exterior Entrance	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Doors	Breakroom Exterior Entrance	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Doors	Breakroom Exterior Entrance	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Doors	Breakroom Exterior Entrance	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Doors	Breakroom Exterior Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Counters	Reception Counter		Counter Height	The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.	Provide a portion of counter at the compliant height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Signage	Superintendents Office, Secretarys Office, Breakroom		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Signage	Main Entrance		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Signage	Breakroom Exterior Entrance		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/32

Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception	Toilet Clear Floor Space Width	There is not a minimum of 60 inches of clearance around the water closet measured perpendicular from the side wall.	Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception	No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception	Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception	Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception	Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception	Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom In Breakroom	Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom In Breakroom	Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom In Breakroom	Toilet Compartment Length	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom In Breakroom	Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom In Breakroom	No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/32

Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Restrooms	Mens Restroom In Breakroom		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Restrooms	Mens Restroom In Breakroom		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Restrooms	Mens Restroom In Breakroom		Compartment Door Width	The clear opening width of the doorway to the compartment is less than required.	Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Restrooms	Mens Restroom In Breakroom		Toilet Compartment Door	The compartment door is located in front of the water closet.	Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Restrooms	Mens Restroom In Breakroom		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Restrooms	Mens Restroom In Breakroom		Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Restrooms	Mens Restroom In Breakroom		Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Restrooms	Mens Restroom In Breakroom		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Restrooms	Mens Restroom In Breakroom		Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Restrooms	Mens Restroom In Breakroom		Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Restrooms	Mens Restroom In Breakroom		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard									
Downey, CA 90240	Restrooms	Womens Restroom Next To Reception		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/32

Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception	Lavatory	Lavatory Type	The lavatory is in an enclosed cabinet, thereby preventing an accessible forward approach.	Lavatories in restrooms must provide clear floor space in front of the lavatory for an accessible forward approach and shall provide the minimum required primary age group knee and toe clearances. If sufficient clear floor space and compliant clearances can not be provided, remove the lavatory cabinet and replace with an accessible wall-mounted lavatory unit.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception	Lavatory	Lavatory Clear Floor Space Width	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception	Lavatory	Lavatory Clear Floor Space Length	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception	Female	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Womens Restroom Next To Reception		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom In Breakroom		Urinal Rim Height	The height of the urinal rim in the restroom is greater than 17 inches above the finished floor.	Lower the urinal designated to be accessible in the restroom so that the rim height is not more than 17 inches above the finished floor.	Not_Started	None	6/30/32

Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom In Breakroom		Urinal Flush Control Height	The height of the urinal flush control in the restroom is greater than the required maximum height.	Lower the flush control valve on the urinal to a height not greater than the required maximum height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom In Breakroom		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom In Breakroom	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom In Breakroom	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom In Breakroom	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom In Breakroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom In Breakroom	Male	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom In Breakroom		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Restrooms	Mens Restroom In Breakroom	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Emergency Warning Systems	Visual Alarms		Emergency Warning System	There are no visual warning devices at the facility.	Install visual warning devices integrated with the facility's alarm system in all common areas such as hallways, classrooms and general use rooms, and in accessible restrooms and other accessible rooms.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Break/Conferenc e Room	Superintendents Office		Tables - Knee Depth	The table knee depth does not meet required standards.	Provide compliant tables.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Break/Conferenc e Room	Break Room		Control Height	The side reach height of the controls on the vending machine is greater than the allowed maximum height.	Provide a compliant vending machine.	In_Progress	None	6/30/32

Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Break/Conference Room	Break Room		Control Height	The side reach height of the controls on the vending machine is greater than the allowed maximum height.	Provide a compliant vending machine.	In_Progress	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Break/Conference Room	Break Room		Sink - Counter Height	Sink counter height does not meet the standards.	Provide compliant sink.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Break/Conference Room	Break Room		Toe Kick Not Removed	The toe kick for the sink in break/conference room is not removed.	Remove the toe kick for the sink.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Break/Conference Room	Break Room		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Break/Conference Room	Break Room		Cabinet Door Hardware	The cabinet door hardware is not accessible.	Provide compliant hardware for the cabinet door.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Break/Conference Room	Break Room		Supply Lines	Supply lines are not wrapped for the break/conference room sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Break/Conference Room	Break Room	Paper Towel	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/32
Public Works Maintenance Yard - 12324 Bellflower Boulevard Downey, CA 90240	Break/Conference Room	Break Room	Soap	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Parking	Parking Lot		No Accessible Parking Spaces Available	There are not enough accessible parking spaces marked in the parking lot and therefore does not meet the minimum number required.	Re-stripe any existing parking spaces marked accessible and create additional accessible parking spaces. Designate one parking space as "van-accessible". Post a sign in a conspicuous place to the entrance of the parking lot, or immediately adjacent to and visible from each accessible parking space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that clearly and conspicuously states the following; "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities will be towed away at owner's expense. Towed vehicles may be reclaimed at ____ or by telephoning ____." Fill in the blank spaces with appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Parking	Parking Lot		No Parking Lot Warning Sign	There is no warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot.		Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Path of Travel	Building Perimeter Walkway	Fire Extinguisher	Protruding Objects - Protrusion Limit	The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.	Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.	In_Progress	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Path of Travel	Building Perimeter Walkway	Ash Tray	Protruding Objects - Protrusion Limit	The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.	Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.	In_Progress	None	6/30/32

Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Path of Travel	Path Of Travel From The Public Right Of Way		No Designated Accessible Route	There is no compliant accessible route from the public right of way to the accessible entrance of the facility.	Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Path of Travel	Office Next To Equipment Room	Mailbox	Protruding Objects - Protrusion Limit	The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.	Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.	In_Progress	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Office Next To Equipment Room		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Office Next To Equipment Room	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Office Next To Equipment Room	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Office Next To Equipment Room	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Office Next To Equipment Room	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Office Next To Equipment Room		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Break Room	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Break Room	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Break Room		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Left Office Next To Break Room		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Left Office Next To Break Room	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Left Office Next To Break Room	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Womens Restroom In Main Office		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/32

Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Womens Restroom In Main Office	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Womens Restroom In Main Office	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Womens Restroom In Main Office	Single Knob	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Right Office Next To Break Room		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Right Office Next To Break Room		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Mens Restroom Next To Main Entrance - Shower		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Mens Restroom Next To Main Entrance - Shower		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Mens Restroom Next To Main Entrance - Shower	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Mens Restroom Next To Main Entrance - Shower	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Mens Restroom Next To Main Entrance - Shower	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Mens Restroom Next To Main Entrance - Shower	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Mens Restroom Next To Main Entrance - Shower	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Mens Restroom Next To Main Entrance - Shower		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Main Entrance		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Main Entrance		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/32

Public Works Utility Yard - 9252 Stewart and Gray Road									
Downey, CA 90240	Doors	Main Entrance		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road									
Downey, CA 90240	Doors	Main Entrance	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road									
Downey, CA 90240	Doors	Main Entrance	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road									
Downey, CA 90240	Doors	Main Entrance	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road									
Downey, CA 90240	Doors	Main Entrance	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road									
Downey, CA 90240	Doors	Main Entrance	Single Knob	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road									
Downey, CA 90240	Doors	Main Entrance	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road									
Downey, CA 90240	Doors	Main Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road									
Downey, CA 90240	Doors	Offices Next To Break Room		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road									
Downey, CA 90240	Doors	Offices Next To Break Room	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road									
Downey, CA 90240	Doors	Offices Next To Break Room	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road									
Downey, CA 90240	Doors	Offices Next To Break Room	Single Knob	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road									
Downey, CA 90240	Doors	Offices Next To Break Room		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road									
Downey, CA 90240	Doors	Office Next To Main Entrance		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road									
Downey, CA 90240	Doors	Office Next To Main Entrance		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/32

Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Office Next To Main Entrance	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Office Next To Main Entrance	Single Knob	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Mens Restroom Next To Main Entrance		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Mens Restroom Next To Main Entrance	Push Side	Latch Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Mens Restroom Next To Main Entrance	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Mens Restroom Next To Main Entrance	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Mens Restroom Next To Main Entrance	Single Knob	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Mens Restroom Next To Main Entrance	Single Knob	Door Lock	The door lock requires tight grasping, pinching, or twisting of the wrist to operate.	Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Mens Restroom Next To Main Entrance	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Doors	Mens Restroom Next To Main Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Signage	Directional Signage From The Public Right Of Way		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Signage	Main Entrance		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Signage	Office Next To Main Entrance		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Signage	Office Next To Equipment Room		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Signage	Offices Next To Break Room		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/32

Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Signage	Break Room	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/32	
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/32	
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/32	
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	Toilet Clear Floor Space Width	There is not a minimum of 60 inches of clearance around the water closet measured perpendicular from the side wall.	Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.	Not_Started	None	6/30/32	
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/32	
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/32	
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	Shelf Height	The shelf is mounted at an incorrect height.	Mount the shelf at the recommended height.	Not_Started	None	6/30/32	
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	6/30/32	
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	6/30/32	
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/32	
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/32	
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance	Urinal Flush Control Height	The height of the urinal flush control in the restroom is greater than the required maximum height.	Lower the flush control valve on the urinal to a height not greater than the required maximum height.	Not_Started	None	6/30/32	
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance	Width Between Urinal Shields	The shields extend greater than 24" in front of the urinal. The width between the shields is less than required.	Modify or replace the urinal shields in the restroom to provide the required clearance between the shields for the urinal designated as accessible.	Not_Started	None	6/30/32	
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance	Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/32	
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/32

Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance	Male	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/32
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		Shelf Height	The shelf is mounted at an incorrect height.	Mount the shelf at the recommended height.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		Compartment Door Width	The clear opening width of the doorway to the compartment is less than required.	Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.	Not_Started	None	6/30/35

Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		Toilet Compartment Door	The compartment door is located in front of the water closet.	Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		Compartment Door Handle Height	The compartment door hardware is not at a compliant height.	Remove and relocate the door hardware.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		Toilet Distance to Wall on Wide side	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Mens Restroom Next To Main Entrance		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office		Distance from Door Edge to Nearest Fixture	The entrance door swings into the turning space within the restroom.	Reverse the door swing, or modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	Lavatory	Lavatory Control Type	The faucet controls on the lavatory require tight grasping, pinching, or twisting of the wrist and are not accessible.	Install accessible faucet controls. Lever-operated, push-type, touch-type or electronically controlled mechanisms are acceptable elements. If self-closing valves are used the faucet shall remain open for at least 10 seconds.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	Lavatory	Lavatory Clear Floor Space Length	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/35

Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	Female	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Restrooms	Womens Restroom In Main Office	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Vending Machines		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Vending Machines		Toe Clearance	The toe clearance is less than required.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Vending Machines		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Vending Machines		Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Vending Machines		Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Main Entrance		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Main Entrance		Toe Clearance	The toe clearance is less than required.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Main Entrance		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Main Entrance		Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Main Entrance		Stream Height	The height of the water stream is less than required.	Insure that the spout directs the water flow to the required height and in a trajectory that is parallel or nearly parallel to the front of the drinking fountain.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Main Entrance		Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	6/30/35

Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Locker Rooms	Mens Restroom Next To Main Entrance		No Accessible Lockers Available	No accessible lockers were found.	At least one locker or 5% of the lockers should be accessible.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Locker Rooms	Mens Restroom Next To Main Entrance		Bench Not Attached to Wall	The bench is not fixed to the wall along the longer dimension.	Install a compliant bench in the locker room. Provide sufficient clear floor space alongside the bench to allow a person using a wheelchair to transfer on to the bench.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Break/Conference Room	Break Room		Tables - Knee Clearance	The table knee clearance does not meet required standards.	Provide compliant tables.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Break/Conference Room	Break Room	Paper Towel	Break Room	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Break/Conference Room	Break Room	Refrigerator	Reach Height	Appliance Reach Height in the break/conference room is not compliant.	Make sure that the specified appliance reach height is compliant.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Break/Conference Room	Office Next To Main Entrance		Tables - Knee Clearance	The table knee clearance does not meet required standards.	Provide compliant tables.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Picnic Areas	Picnic Tables Next To Break Room		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Lockers	Mens Restroom Next To Main Entrance		No Accessible Lockers Available	No accessible lockers were found.	At least one locker or 5% of the lockers should be accessible.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Accessible Showers	Mens Restroom Next To Main Entrance		Accessible Showers	There are not enough accessible showers with respect to the total number of showers available.	Provide the required amount of compliant accessible showers.	Not_Started	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Reach Ranges	Yard		Control Height	The side reach height of the controls on the vending machine is greater than the allowed maximum height.	Contact the owner of the vending machines to obtain accessible vending machines.	In_Progress	None	6/30/35
Public Works Utility Yard - 9252 Stewart and Gray Road Downey, CA 90240	Reach Ranges	Yard		Control Height	The side reach height of the controls on the vending machine is greater than the allowed maximum height.	Contact the owner of the vending machines to obtain accessible vending machines.	In_Progress	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot		Required Minimum Van Accessible Spaces	There is none or not enough designated van accessible parking spaces provided.	Re-stripe the existing parking space and create additional accessible van accessible parking spaces.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	8th Accessible Space From Left	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	8th Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	8th Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/35

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	2nd Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	2nd Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	7th Accessible Space From Left	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	7th Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	7th Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	7th Accessible Space From Left	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	7th Accessible Space From Left	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	7th Accessible Space From Left	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	6th Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	6th Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	1st Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	1st Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	1st Accessible Space From Left	Access Aisle Width	The access aisle does not meet the minimum required width.	Re-stripe the access aisle to meet the minimum required width and length for the space type.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	1st Accessible Space From Left	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	1st Accessible Space From Left	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	6/30/35

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	1st Accessible Space From Left	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	4th Accessible Space From Left	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	4th Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	4th Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	3rd Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	3rd Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	3rd Accessible Space From Left	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	3rd Accessible Space From Left	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	5th Accessible Space From Left	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	5th Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	5th Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	5th Accessible Space From Left	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	5th Accessible Space From Left	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Parking	Parking Lot	5th Accessible Space From Left	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Curb Ramps	4th Curb Ramp from the Left next to Accessible Spaces		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/35

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Curb Ramps	4th Curb Ramp from the Left next to Accessible Spaces	Bottom Landing	Bottom Landing Slope	The slope at the bottom landing is greater than allowed.	Provide a compliant bottom landing that does not exceed the maximum slope requirements.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Curb Ramps	Left Curb Ramp next to Roundabout		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Curb Ramps	Left Curb Ramp next to Roundabout	Bottom Landing	Bottom Landing Change in Level	The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.	Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Curb Ramps	3rd Curb Ramp from the Left next to Accessible Spaces		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Curb Ramps	3rd Curb Ramp from the Left next to Accessible Spaces	Bottom Landing	Bottom Landing Slope	The slope at the bottom landing is greater than allowed.	Provide a compliant bottom landing that does not exceed the maximum slope requirements.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Curb Ramps	2nd Curb Ramp from the Left next to Accessible Spaces		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Curb Ramps	2nd Curb Ramp from the Left next to Accessible Spaces	Bottom Landing	Bottom Landing Slope	The slope at the bottom landing is greater than allowed.	Provide a compliant bottom landing that does not exceed the maximum slope requirements.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Curb Ramps	1st Curb Ramp from the Left next to Accessible Spaces		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Curb Ramps	1st Curb Ramp from the Left next to Accessible Spaces	Bottom Landing	Bottom Landing Slope	The slope at the bottom landing is greater than allowed.	Provide a compliant bottom landing that does not exceed the maximum slope requirements.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Path of Travel	Path to Putting Practice	Exterior Walkway	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Path of Travel	Sidewalk around Roundabout	Vehicular Traffic	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Path of Travel	Sidewalk around Roundabout	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Path of Travel	Sidewalk next to Main Entrance Ramp	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Path of Travel	Path of Travel from the Public Right of Way		No Designated Accessible Route	There is no compliant accessible route from the public right of way to the accessible entrance of the facility.	Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Path of Travel	Path to 1st Hole	Exterior Walkway	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/35

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Path of Travel	Path to 1st Hole	Curb	Curb is on The Path of Travel	There is a curb on the designated path of travel.	Provide a compliant curb ramp.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Path of Travel	Path to Range Ball Dispenser	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp next to Driving Range	Run 1	Ramp Run Edge Protection	The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.	Install compliant edge protection on each side of the ramp run.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp next to Driving Range	Run 1	Ramp Run Slope	The slope of the ramp is greater than the allowed slope.	Modify the run of the ramp to provide the required slope and cross slope.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp next to Driving Range	Run 1 Intermediate Landing	Landing Length	The ramp changes direction at this landing. The length of the landing is less than the required minimum length.	Modify or replace the landing to meet the minimum required width and length.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp next to Driving Range	Run 1 Left Handrail	Handrail Bottom Extension	There is not enough extension beyond the top or bottom of the ramp.	The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp next to Driving Range	Run 1 Right Handrail	Handrail Bottom Extension	There is not enough extension beyond the top or bottom of the ramp.	The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp next to Driving Range	Run 1 Right Handrail	Handrail Top Extension	There is not enough extension beyond the top or bottom of the rail.	The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp next to Driving Range	Run 1 Right Handrail	Handrail Height	The height of the handrails on the ramp is not within the required range above the surface of the ramp.	Modify or replace the handrails on the ramp to provide a gripping surface height within the required range above the ramp surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp next to Driving Range	Run 2	Ramp Run Edge Protection	The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.	Install compliant edge protection on each side of the ramp run.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp next to Driving Range	Run 2	Ramp Run Slope	The slope of the ramp is greater than the allowed slope.	Modify the run of the ramp to provide the required slope and cross slope.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp next to Driving Range	Run 2 Left Handrail	Handrail Top Extension	There is not enough extension beyond the top or bottom of the rail.	The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp next to Driving Range	Run 2 Left Handrail	Handrail Height	The height of the handrails on the ramp is not within the required range above the surface of the ramp.	Modify or replace the handrails on the ramp to provide a gripping surface height within the required range above the ramp surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp next to Driving Range	Run 2 Right Handrail	Handrail Bottom Extension	There is not enough extension beyond the top or bottom of the ramp.	The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp next to Driving Range	Run 2 Right Handrail	Handrail Top Extension	There is not enough extension beyond the top or bottom of the rail.	The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.	Not_Started	None	6/30/35

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp next to Driving Range	Run 2 Right Handrail	Handrail Height	The height of the handrails on the ramp is not within the required range above the surface of the ramp.	Modify or replace the handrails on the ramp to provide a gripping surface height within the required range above the ramp surface.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp to the Main Entrance	Run 1 Bottom Landing	Landing Width	The width of the landing is less than required.	Modify or replace the landing on the ramp to provide the required length in the direction of the run of the ramp and required inches in width.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp to the Main Entrance	Run 1 Right Handrail	Handrail Near Abrasive Wall	The surface of the wall adjacent to the handrail is abrasive.	Modify the surface of the wall adjacent to the handrail so that the surface is smooth and nonabrasive.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp to the Main Entrance	Run 1 Left Handrail	Handrail Near Abrasive Wall	The surface of the wall adjacent to the handrail is abrasive.	Modify the surface of the wall adjacent to the handrail so that the surface is smooth and nonabrasive.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp to the Main Entrance	Run 2 Top Landing	Landing Width	The width of the landing is less than required.	Modify or replace the landing on the ramp to provide the required length in the direction of the run of the ramp and required inches in width.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp to the Main Entrance	Run 2 Left Handrail	Handrail Near Abrasive Wall	The surface of the wall adjacent to the handrail is abrasive.	Modify the surface of the wall adjacent to the handrail so that the surface is smooth and nonabrasive.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp to the Main Entrance	Run 2 Right Handrail	Handrail Near Abrasive Wall	The surface of the wall adjacent to the handrail is abrasive.	Modify the surface of the wall adjacent to the handrail so that the surface is smooth and nonabrasive.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp in Service Hallway next to Rio Hondo A	Run 1	Ramp Run Slope	The slope of the ramp is greater than the allowed slope.	Modify the run of the ramp to provide the required slope and cross slope.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp in Service Hallway next to Rio Hondo A	Run 1 Top Landing	Top Landing Length	The length of the top landing does not meet the required minimum length.	Modify or replace the top landing to provide the required minimum length and width.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp in Service Hallway next to Rio Hondo A	Run 1 Top Landing	Landing Edge to Door Clearance - Side Approach	The distance between the latch side of the door and the edge of the landing does not meet the required minimum distance.	Modify or replace the top landing on the ramp to provide a top landing with a level surface and provides the required minimum distance from the latch side of the door the edge of the landing.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Ramps	Ramp in Service Hallway next to Rio Hondo A	Run 1 Bottom Landing	Bottom Landing Length	The length of the bottom landing does not meet the required minimum length.	Modify or replace the bottom landing to provide the required minimum length and width.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Elevators	Elevator		Evacuation Signage	The Elevator does not have compliant Title 19 signage.	Provide compliant Evacuation signage.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Elevators	Elevator		Emergency System	An emergency communication system is provided, though the controls and emergency equipment are not identified by accessible symbols.	Contact a certified elevator provider to perform all renovation required.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Elevators	Elevator		Elevator - Jamb Marking	Braille is not located immediately below the raised letters.	Make sure that braille is located immediately below the raised letters.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Elevators	Elevator		Elevator - Jamb Marking	Braille is not located immediately below the raised letters.	Make sure that braille is located immediately below the raised letters.	Not_Started	None	6/30/35

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Elevators	Elevator		Elevator - Jamb Marking	Braille is not located immediately below the raised letters.	Make sure that braille is located immediately below the raised letters.	Not_Started	None	6/30/35
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Elevators	Elevator		Highest Tactile Character Height Above Finish Floor	The highest tactile character height above the finish floor is not compliant.	Provide compliant jamb marking for the elevator.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Restaurant	Run 2	Risers Striping Distance From Nosing	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Restaurant	Run 2 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Restaurant	Run 2 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Restaurant	Run 2 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Restaurant	Run 2 Right Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Restaurant	Run 2 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Restaurant	Run 1	Risers Striping Distance From Nosing	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Restaurant	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Restaurant	Run 1 Left Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Restaurant	Run 1 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Main Entrance	Run 1	No Riser Striping	There is no detectable striping on the stairways.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Main Entrance	Run 1 Middle Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Main Entrance	Run 1 Middle Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/37

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Main Entrance	Run 1 Middle Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Main Entrance	Run 1 Left Handrail	Handrail Near Wall	The surface texture of the wall adjacent to the handrail is sharp and abrasive.	Modify the surface texture on the wall adjacent to the handrail so that the surface is smooth.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Main Entrance	Run 1 Left Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Main Entrance	Run 1 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Main Entrance	Run 1 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Main Entrance	Run 1 Right Handrail	Handrail Near Wall	The surface texture of the wall adjacent to the handrail is sharp and abrasive.	Modify the surface texture on the wall adjacent to the handrail so that the surface is smooth.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Main Entrance	Run 1 Right Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Main Entrance	Run 1 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Main Entrance	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Administration	Run 1	Risers Striping Distance From Nosing	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Hackers Bar & Grill Patio	Run 1	No Riser Striping	There is no detectable striping on the stairways.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Hackers Bar & Grill Patio	Run 1 Left Handrail	Handrail Near Wall	The surface texture of the wall adjacent to the handrail is sharp and abrasive.	Modify the surface texture on the wall adjacent to the handrail so that the surface is smooth.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Hackers Bar & Grill Patio	Run 1 Right Handrail	Handrail Near Wall	The surface texture of the wall adjacent to the handrail is sharp and abrasive.	Modify the surface texture on the wall adjacent to the handrail so that the surface is smooth.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs to Hackers Bar & Grill Patio	Run 1 Right Handrail	Handrail Distance From Wall	The distance between the handrail and the wall on the stairway is less than required.	Remount the handrails on the stairway so that the distance from the handrail to the adjacent wall is compliant.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Hackers Bar	Run 1	No Handrail on One Side	There is no handrail provided on one side of the stairway.	Provide compliant handrails on the stairway.	Not_Started	None	6/30/37

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Hackers Bar	Run 1	Risers Striping Distance From Nosing	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Hackers Bar	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Golf Shop	Run 2 Right Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Golf Shop	Run 2 Right Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Golf Shop	Run 2 Right Handrail	Handrail Extension Length	The handrail extension is not the required length.	Install a compliant extension to the handrail.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Golf Shop	Run 2 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Golf Shop	Run 2 Left Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Golf Shop	Run 2 Left Handrail	Handrail Bottom Extension	The bottom handrail does not extend the depth of one stair tread beyond the bottom step.	Provide a compliant handrail extension.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Golf Shop	Run 2 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Golf Shop	Run 1	Risers Striping Distance From Nosing	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Golf Shop	Run 1 Intermediate Landing	Landing Upper Approach Stripe	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Golf Shop	Run 1 Bottom Landing	Landing Upper Approach Stripe	The width of the striping is not compliant, does not contrast, or is too far from the nosing.	Affix compliant contrasting striping to the upper approach and each tread that is the correct width and distance from the nosing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Golf Shop	Run 1 Right Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Golf Shop	Run 1 Right Handrail	Handrail Extension Length	The top handrail extension is not the required length beyond the top riser.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Golf Shop	Run 1 Right Handrail	Handrail Extension not Parallel	The top handrail extension of the stairway is not parallel with the floor surface at the top landing.	Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.	Not_Started	None	6/30/37

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Golf Shop	Run 1 Right Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Golf Shop	Run 1 Left Handrail	No Bottom Handrail Extension	There are no bottom handrail extensions provided.	Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Stairs	Stairs next to Golf Shop	Run 1 Left Handrail	Handrail Height	The handrails are not mounted at the required height.	Provide handrails on the stairway at the required height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Main Entrance	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Main Entrance	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Main Entrance	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Rio Hondo A Entrance, Rio Hondo B Entrance, Rio Hondo C Entrance	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Kitchen Womens Restroom - 2nd Door	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Lobby Mens Restroom - 2nd Door	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Lobby Mens Restroom - 2nd Door		Door Threshold	The height of the threshold at the entrance door is greater than allowed for a vertical rise.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Kitchen Entrance	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Kitchen Entrance	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Kitchen Entrance	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Kitchen Mens Restroom - 1st Door	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Kitchen Mens Restroom - 1st Door	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Kitchen Womens Restroom - 1st Door	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Kitchen Womens Restroom - 1st Door	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Administration	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Service Hallway next to Rio Hondo A	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Kitchen	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Kitchen	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Kitchen	Push / Pull	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Entrance next to Rio Hondo C	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Entrance next to Rio Hondo C	Push Bar Only	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Entrance next to Rio Hondo C	Push Bar Only	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Lobby Womens Restroom - 1st Door	Pull Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Lobby Womens Restroom - 1st Door	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Lobby Womens Restroom - 1st Door		Door Threshold	The height of the threshold at the entrance door is greater than allowed for a vertical rise.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Kitchen Restroom Hallway	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Lobby Mens Restroom - 1st Door	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Lobby Mens Restroom - 1st Door		Door Threshold	The height of the threshold at the entrance door is greater than allowed for a vertical rise.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Kitchen Mens Restroom - 2nd Door	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Brides Room	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Brides Room	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Brides Room		Door Threshold	The height of the threshold at the entrance door is greater than allowed for a vertical rise.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Executive Meeting Room	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Catering Manager, Catering Director	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Catering Manager, Catering Director	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Hackers Bar & Grill Patio	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Hackers Bar & Grill Patio	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Hackers Bar & Grill		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Hackers Bar & Grill	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Hackers Bar & Grill	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Administration in Bar & Grill	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Administration in Bar & Grill	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Golf Shop Office	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Golf Shop Office	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Golf Shop Entrance	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Golf Shop	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Mens Restroom next to Golf Shop	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Snack Bar	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Snack Bar	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Womens Restroom next to Golf Shop	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Womens Restroom next to Golf Shop	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Womens Restroom next to Tee 15	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Womens Restroom next to Tee 15	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Womens Restroom next to Tee 15	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Mens Restroom next to Tee 15	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Mens Restroom next to Tee 15	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Mens Restroom next to Tee 15	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Doors	Mens Restroom next to Tee 15	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Counters	Snack Bar		Protruding Object	The counter is a protruding object.	Adjust the counter so that it is no longer a protruding object.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Rio Hondo A, Rio Hondo B, Rio Hondo C		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Main Entrance		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Brides Room		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Entrance next to Rio Hondo C		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Kitchen Entrance		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Kitchen Restroom Hallway		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Service Hallway next to Rio Hondo A		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Kitchen		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Hackers Bar & Grill Patio		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Hackers Bar & Grill		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Executive Meeting Room		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Administration in Bar & Grill		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Catering Manager, Catering Director		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Snack Bar		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Golf Shop Office		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Golf Shop		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Entrance next to Snack Bar		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Signage	Golf Shop Entrance		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Kitchen Mens Restroom		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Kitchen Mens Restroom	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Kitchen Mens Restroom	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Kitchen Mens Restroom	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Kitchen Mens Restroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Kitchen Mens Restroom	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Kitchen Mens Restroom		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Kitchen Mens Restroom		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Womens Restroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Kitchen Womens Restroom	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/37

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Kitchen Womens Restroom	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Kitchen Womens Restroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Kitchen Womens Restroom	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Mens Restroom		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Mens Restroom		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Mens Restroom		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Mens Restroom		Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Mens Restroom		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Mens Restroom		Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Mens Restroom		Located Behind Front of Seat	The paper dispenser is located behind the front of toilet seat.	Provide a compliant dispenser mounted at 7" to 9" in front of the water closet.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Mens Restroom		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Womens Restroom - Left Standard		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Womens Restroom - Left Standard		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Womens Restroom - Left Standard		Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Womens Restroom - Left Standard		Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/37

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Womens Restroom - Left Standard		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Womens Restroom - Left Standard		Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Womens Restroom - Left Standard		Located Behind Front of Seat	The paper dispenser is located behind the front of toilet seat.	Provide a compliant dispenser mounted at 7" to 9" in front of the water closet.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Womens Restroom - Left Standard		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Mens Restroom	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Mens Restroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Mens Restroom	Male	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Kitchen Womens Restroom		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Kitchen Womens Restroom		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Womens Restroom - Right Standard		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Womens Restroom - Right Standard		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Womens Restroom - Right Standard		Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Womens Restroom - Right Standard		Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Womens Restroom - Right Standard		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Womens Restroom - Right Standard		Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/37

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Lobby Womens Restroom - Right Standard		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Golf Shop		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Golf Shop		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Golf Shop		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Golf Shop		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Golf Shop		Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Golf Shop	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Golf Shop	Male	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Golf Shop	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Golf Shop	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Golf Shop	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Golf Shop		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Golf Shop		Coat Hook Height	The coat hook is not mounted at the correct height.	Mount the coat hook at the recommended height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Golf Shop		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Golf Shop		Toilet Compartment Door	The compartment door is located in front of the water closet.	Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.	Not_Started	None	6/30/37

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Golf Shop	Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Golf Shop	Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Golf Shop	Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Golf Shop	Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Golf Shop	Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Golf Shop	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Golf Shop	Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Tee 15	Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Tee 15	Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Tee 15	Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Tee 15	Toilet Paper Dispenser Interferes with Grab Bar	The toilet paper dispenser interferes with the use of the grab bar.	Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Tee 15	Toilet Paper Dispenser Above Grab Bar	The toilet paper dispenser is located above the provided grab bar.	Remount the dispenser below the grab bar at 19" minimum.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Tee 15	Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Tee 15	Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Tee 15	Urinal Flush Control Height	The height of the urinal flush control in the restroom is greater than the required maximum height.	Lower the flush control valve on the urinal to a height not greater than the required maximum height.	Not_Started	None	6/30/37

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Tee 15		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Tee 15	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Tee 15	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Tee 15	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Tee 15	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Tee 15		Mirror Bottom Edge Height	The bottom edge of the reflective surface of the mirror is not at the correct height.	Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Tee 15	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Tee 15	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Tee 15	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Tee 15	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Womens Restroom next to Tee 15	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Tee 15		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Tee 15		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Tee 15		Seat Cover Dispenser	Seat cover dispenser interferes with use of grab bar.	Move the seat cover dispenser so it does not interfere with the use of the grab bars.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Tee 15		Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/37

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Tee 15	Toilet Paper Dispenser Interferes with Grab Bar	The toilet paper dispenser interferes with the use of the grab bar.	Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Tee 15	Toilet Paper Dispenser Above Grab Bar	The toilet paper dispenser is located above the provided grab bar.	Remount the dispenser below the grab bar at 19" minimum.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Tee 15	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Restrooms	Mens Restroom next to Tee 15	Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Drinking Fountains	Drinking Fountain next to 6th Hole	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Drinking Fountains	Drinking Fountain next to 6th Hole	Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Drinking Fountains	Drinking Fountain next to 6th Hole	Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Drinking Fountains	Drinking Fountain next to 6th Hole	No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Drinking Fountains	Drinking Fountain next to 16th Hole	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Drinking Fountains	Drinking Fountain next to 16th Hole	Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Drinking Fountains	Drinking Fountain next to 16th Hole	No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Snack Bar	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Snack Bar	Protruding Object	The drinking fountain is a protruding object.	Make sure that the fountain is not a protruding object.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Snack Bar	No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Tee 15 Restrooms	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/37

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Tee 15 Restrooms		Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Tee 15 Restrooms		No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Drinking Fountains	Drinking Fountain next to Tee 15 Restrooms		Toe Clearance	The toe clearance is less than required.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Food Service	Hackers Bar & Grill		Minimum Required Seating	There is less than the required percentage of accessible tables/seating provided.	Provide the minimum required percentage of the total seating capacity with accessible seating.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Food Service	Hackers Bar & Grill	Table	Table Knee Depth	The knee space at the table is less than required.	Modify or replace one or more of the tables in the food service area to meet the required minimum accessible seating.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Food Service	Hackers Bar & Grill	Bar Seating	Table Knee Depth	The knee space at the table is less than required.	Modify or replace one or more of the tables in the food service area to meet the required minimum accessible seating.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Break/Conference Room	Executive Meeting Room		Tables - Knee Depth	The table knee depth does not meet required standards.	Provide compliant tables.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Sinks	Kitchen		Sink - Counter Height	Sink counter height is not compliant.	Provide compliant sink.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Sinks	Kitchen		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Sinks	Kitchen		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Sinks	Kitchen	Soap	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Sinks	Snack Bar		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Sinks	Snack Bar		Clear Floor Space Width	There is not enough clear floor space at the sink.	Provide enough clear floor space at the location.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Sinks	Snack Bar		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Sinks	Snack Bar	Soap	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37

Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Sinks	Snack Bar	Paper Towel	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Lockers	Kitchen Mens Restroom		No Accessible Lockers Available	No accessible lockers were found.	At least one locker or 5% of the lockers should be accessible.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Lockers	Kitchen Womens Restroom		No Accessible Lockers Available	No accessible lockers were found.	At least one locker or 5% of the lockers should be accessible.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Lockers	Womens Restroom next to Golf Shop		No Accessible Lockers Available	No accessible lockers were found.	At least one locker or 5% of the lockers should be accessible.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Lockers	Mens Restroom next to Golf Shop		No Accessible Lockers Available	No accessible lockers were found.	At least one locker or 5% of the lockers should be accessible.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Reach Ranges	Driving Range		Control Height	The side reach height of the controls on the vending machine is greater than the allowed maximum height.	Contact the owner of the vending machines to obtain accessible vending machines.	In_Progress	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Reach Ranges	Golf Course	Ball Washing Station	Cannot be Operated with one hand	Element controls are non accessible.	Provide compliant controls for the element.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Reach Ranges	Golf Course	Ball Washing Station	Element Highest Point of Operation	The highest point of operation for the element is not compliant.	Make sure that the highest point of operation is within the recommended value.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Benches	Bench next to 1st Hole		On Accessible Route	The bench is not on an accessible route.	Provide a compliant accessible route to the benches.	Not_Started	None	6/30/37
Rio Hondo Golf Course - 10627 Old River School Road Downey, CA 90240	Benches	Bench next to 1st Hole		Clear Floor Space	No clear floor space provided at the bench.	Provide compliant clear floor space for the bench at one end.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Warning Sign At Accessible Spaces Next To Play Area	Parking Lot Warning Sign Wording Incorrect	There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the signage does not contain the correct wording and/or the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.	Provide a compliant warning sign regarding unauthorized use of accessible parking spaces in the parking lot. Fill in the blank spaces with are required to furnish point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Next To Play Area, 1st Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Next To Play Area, 1st Accessible Space From Left	Vehicle Encroaches Into Path of Travel	There is no device at the head of the accessible parking space to prevent vehicles from encroaching into accessible aisles or walkways.	Install a wheel stop at the head of the accessible parking space.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Next To Play Area, 1st Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Next To Play Area, 1st Accessible Space From Left	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Next To Play Area, 1st Accessible Space From Left	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Next To Play Area, 3rd Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37

Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Next To Play Area, 3rd Accessible Space From Left	Must Travel Behind Parked Cars	The location of the accessible parking spaces requires individuals with disabilities to travel behind parked cars other than their own.	Stripe an access aisle at the head of the accessible parking spaces, install a wheel stop at the head of the accessible parking spaces and at the general parking spaces. Wheel stops shall be used to prevent vehicles from encroaching into access aisles or walkways, but shall not present additional encroachment into those areas.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Next To Play Area, 3rd Accessible Space From Left	Access Aisle Width	The access aisle does not meet the minimum required width.	Re-stripe the access aisle to meet the minimum required width and length for the space type.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Next To Play Area, 3rd Accessible Space From Left	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Next To Play Area, 3rd Accessible Space From Left	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Next To Play Area, 4th Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Next To Play Area, 4th Accessible Space From Left	Must Travel Behind Parked Cars	The location of the accessible parking spaces requires individuals with disabilities to travel behind parked cars other than their own.	Stripe an access aisle at the head of the accessible parking spaces, install a wheel stop at the head of the accessible parking spaces and at the general parking spaces. Wheel stops shall be used to prevent vehicles from encroaching into access aisles or walkways, but shall not present additional encroachment into those areas.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Next To Play Area, 2nd Accessible Space From Left	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Next To Play Area, 2nd Accessible Space From Left	Vehicle Encroaches Into Path of Travel	There is no device at the head of the accessible parking space to prevent vehicles from encroaching into accessible aisles or walkways.	Install a wheel stop at the head of the accessible parking space.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Next To Play Area, 2nd Accessible Space From Left	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Accessible Space Next To Southeast Softball Field	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Accessible Space Next To Southeast Softball Field	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	South Parking Lot	Accessible Space Next To Southeast Softball Field	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	North Parking Lot		Less Than Minimum Required Parking Spaces	There are not enough accessible parking spaces marked in the parking lot and therefore does not meet the minimum number required.	Re-stripe any existing parking spaces marked accessible and create additional accessible parking spaces. Designate one parking space as "van-accessible".	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	North Parking Lot	Warning Sign	Parking Lot Warning Sign Wording Incorrect	There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the signage does not contain the correct wording and/or the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.	Provide a compliant warning sign regarding unauthorized use of accessible parking spaces in the parking lot. Fill in the blank spaces with are required to furnish point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	North Parking Lot	Right Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	North Parking Lot	Left Accessible Space	Parking Space Width	The accessible parking space does not meet the minimum requirements for width.	Re-stripe the accessible parking space.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	North Parking Lot	Left Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Parking	North Parking Lot	Left Accessible Space	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Curb Ramps	Curb Ramp At The Accessible Space Next To The Southeast Softball Field	Top Landing	Top Landing Slope	The slope at the top landing is greater than allowed.	Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.	Not_Started	None	6/30/37

Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Curb Ramps	Curb Ramp At The Accessible Space Next To The Southeast Softball Field	Top Landing	Top Landing Change in Level	The transition from the top of the curb ramp to the walk, gutter, or street is abrupt.	Patch the transition area at the top of the curb ramp so that the transition is flush and free of abrupt changes.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Curb Ramps	Curb Ramp At The Accessible Spaces Next To Play Area		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Curb Ramps	Curb Ramp At The Accessible Spaces Next To Play Area		Side Flare Slope	The slope of the curb ramp side flare is greater than allowed.	Provide curb ramp side flares with a compliant slope.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Curb Ramps	Curb Ramp At The Accessible Spaces Next To Play Area	Top Landing	Top Landing Slope	The slope at the top landing is greater than allowed.	Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Curb Ramps	Curb Ramp At The Accessible Spaces Next To Play Area	Bottom Landing	Bottom Landing Change in Level - Curb Ramps	The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.	Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Curb Ramps	Curb Ramp At The North Parking Lot Accessible Spaces	Top Landing	Top Landing Slope	The slope at the top landing is greater than allowed.	Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Curb Ramps	Curb Ramp At The North Parking Lot Accessible Spaces	Top Landing	Top Landing Change in Level	The transition from the top of the curb ramp to the walk, gutter, or street is abrupt.	Patch the transition area at the top of the curb ramp so that the transition is flush and free of abrupt changes.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Curb Ramps	Curb Ramp From The Public Right Of Way At Newville Avenue	Top Landing	Top Landing Slope	The slope at the top landing is greater than allowed.	Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Curb Ramps	Curb Ramp From The Public Right Of Way At Newville Avenue	Bottom Landing	Bottom Landing Change in Level	The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.	Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path Of Travel From Recreation Center To Northwest Baseball Field	Open Area	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path From The Accessible Space Next To The Southeast Softball Field	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Dog Park - Small Dogs	Open Area	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Southeast Softball Field Path To Drinking Fountain	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Southeast Softball Field Path To Drinking Fountain	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Southeast Softball Field Path To Drinking Fountain	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path To Dog Pak	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Southeast Softball Field 3rd Base Dugout	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Southeast Softball Field 3rd Base Dugout	Exterior Walkway	Sidewalk Width	The width of the path of travel is insufficient.	Widen the primary path of travel to provide the correct width.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Southeast Softball Field 3rd Base Dugout	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path Of Travel To Covered Picnic Area Next To Dog Park - Large Dogs	Open Area	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Southeast Softball Field 1st Base Dugout	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37

Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Southeast Softball Field 1st Base Dugout	Exterior Walkway	Sidewalk Width	The width of the path of travel is insufficient.	Widen the primary path of travel to provide the correct width.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Southeast Softball Field 1st Base Dugout	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path Of Travel To Designated Smoking Area	Open Area	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Southeast Softball Field	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Southeast Softball Field	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path Of Travel To Covered Picnic Area Next To Dog Park - Small Dogs	Open Area	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path Of Travel From Covered Picnic Area Next To Dog Park - Large Dogs To San Gabriel River Trail	Open Area	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path Of Travel From The North Parking Lot Accessible Spaces	Open Area	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Northwest Softball Field	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path Of Travel From North Parking Lot To Northwest Softball Field	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path Of Travel From North Parking Lot To Northwest Softball Field	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path Of Travel From The Public Right Of Way At Ardine Street	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Covered Picnic Areas	Structural Supports	Protruding Objects - Vertical Clearance	The vertical clearance height is less than required.	Provide recommended vertical clearance.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path Of Travel From The Public Right Of Way At Pico Vista Road		No Designated Accessible Route	There is no compliant accessible route from the public right of way to the accessible entrance of the facility.	Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Sidewalk Between Play Areas Play Area Southeast To Northwest	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Sidewalk Between Play Areas Play Area Southeast To Northwest	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path From Play Areas To Restrooms Next To Recreation Center	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path From Play Areas To Restrooms Next To Recreation Center	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path Of Travel From Recreation Center To Play Areas	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Sidewalk Around Play Areas	Drop Off	Drop Off Hazard	There is no edge protection at the drop off.	Install edge protection on the walking surface at the required minimum height.	Not_Started	None	6/30/37

Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Sidewalk Around Play Areas	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Sidewalk Around Play Areas	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Sidewalk Around Play Areas	Exterior Walkway	Opening	Walking surface has an opening that is not compliant.	Make sure that the walking surface opening does not allow passage of a sphere more than ½ inch in diameter.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Sidewalk Around Play Areas	Concrete Upheaval	Change in Level - Beveled	There is a change in elevation greater than recommended value.	Bevel the area or resurface the area to provide a smooth and level path of travel.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Sidewalk Around Play Areas	Change In Level	Change in Level - Beveled	There is a change in elevation greater than recommended value.	Bevel the area or resurface the area to provide a smooth and level path of travel.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path Of Travel From The Accessible Spaces Next To Recreation Center	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path Of Travel From The Accessible Spaces Next To Recreation Center	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path Of Travel From The Public Right Of Way At Newville Avenue	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Sidewalk Between Play Areas Play Area Southwest To Northeast	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Sidewalk Between Play Areas Play Area Southwest To Northeast	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Path of Travel	Path Of Travel From Southeast Softball Field To Large Covered Picnic Area	Open Area	Noncompliant Surface	The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.	Provide an accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Small Dogs 2nd Gate	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Small Dogs 2nd Gate	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Small Dogs 2nd Gate	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Small Dogs 2nd Gate	Pull Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Small Dogs 2nd Gate	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Small Dogs 2nd Gate	Lever	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Large Dog 1st Gate	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Large Dog 1st Gate	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Large Dog 1st Gate	Lever	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/37

Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Large Dog 2nd Gate	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Large Dog 2nd Gate	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Large Dog 2nd Gate	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Large Dog 2nd Gate	Pull Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Large Dog 2nd Gate	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Small Dogs 1st Gate	Push Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Small Dogs 1st Gate	Push Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the push side of the door .	Provide the recommended clear floor space on the push side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Small Dogs 1st Gate	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Small Dogs 1st Gate	Pull Side	Front Approach Clear Floor Space Width	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Small Dogs 1st Gate	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Dog Park - Small Dogs 1st Gate	Lever	Bottom Door Panel	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Southeast Softball Field 3rd Base Dugout Entrance		Open Doorway Height	The vertical clearance height of the open doorway is not compliant.	Provide a compliant open doorway at the location.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Northwest Softball Field 3rd Base Dugout		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Northwest Softball Field 1st Base Dugout		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Office East Entrance	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Office East Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Activity Room West Entrance		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Activity Room West Entrance	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Activity Room West Entrance	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Activity Room West Entrance	Single Knob	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37

Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Activity Room West Entrance	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Activity Room West Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed for a vertical rise.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Office West Entrance	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Office West Entrance	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Office West Entrance	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Activity Room North Entrance		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Activity Room North Entrance	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Activity Room North Entrance	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Activity Room North Entrance	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Activity Room North Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Mens Restroom Next To Recreation Center		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Mens Restroom Next To Recreation Center	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Mens Restroom Next To Recreation Center	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Womens Restroom Next To Recreation Center		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Womens Restroom Next To Recreation Center	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Womens Restroom Next To Recreation Center	Lever	Height	Door hardware is not mounted at the correct height.	Mount the door hardware at the recommended height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Mens Restroom Next To Northwest Softball Field		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Mens Restroom Next To Northwest Softball Field		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Mens Restroom Next To Northwest Softball Field	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Mens Restroom Next To Northwest Softball Field		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Womens Restroom Next To Northwest Softball Field		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/37

Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Womens Restroom Next To Northwest Softball Field		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Womens Restroom Next To Northwest Softball Field	Push Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Womens Restroom Next To Northwest Softball Field	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Womens Restroom Next To Northwest Softball Field	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Doors	Womens Restroom Next To Northwest Softball Field		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Counters	Office		Counter Height	The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.	Provide a portion of counter at the compliant height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Signage	Directional Signage From The Public Right Of Way At Ardine Street		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Signage	Directional Signage From The Public Right Of Way At Newville Avenue		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Signage	Activity Room North Entrance		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Signage	Office West Entrance		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Signage	Activity Room West Entrance		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Signage	Office East Entrance		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Signage	Northwest Softball Field Concessions Stand		No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Public Telephones	Payphone Next To Recreation Center		Highest Operable Parts	The highest operable part of the public telephone exceeds allowed maximum reach range.	Contact the telephone company that owns the public telephone regarding the height of all the operating devices on the telephone.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field	Female	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/37

Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field	Paper Towel	Dispenser Operation	The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.	Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field		No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field		No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field		Compartment Door Swings In	The door to the compartment swings inward into the minimum required compartment area.	Modify the swing of the door so that it does not swing into the minimum required compartment area.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field		Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field		Compartment Door Handle Height	The compartment door hardware is not at a compliant height.	Remove and relocate the door hardware.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field		Compartment Door Width	The clear opening width of the doorway to the compartment is less than required.	Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field		Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Northwest Softball Field		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Recreation Center		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Recreation Center		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Recreation Center		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/37

Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Recreation Center	Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Recreation Center	Toilet Paper Dispenser Interferes with Grab Bar	The toilet paper dispenser interferes with the use of the grab bar.	Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Recreation Center	Toilet Paper Dispenser Above Grab Bar	The toilet paper dispenser is located above the provided grab bar.	Remount the dispenser below the grab bar at 19" minimum.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	No Grab Bars	There are no grab bars.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Compartment Door Handle Height	The compartment door hardware is not at a compliant height.	Remove and relocate the door hardware.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Compartment Door Width	The clear opening width of the doorway to the compartment is less than required.	Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Recreation Center	Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Recreation Center	Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Recreation Center	Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Recreation Center	Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Recreation Center	Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/37

Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Recreation Center		Toilet Paper Dispenser Interferes with Grab Bar	The toilet paper dispenser interferes with the use of the grab bar.	Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Recreation Center		Toilet Paper Dispenser Above Grab Bar	The toilet paper dispenser is located above the provided grab bar.	Remount the dispenser below the grab bar at 19" minimum.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Recreation Center		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field		Circular Turning Space Diameter	There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.	Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field		Urinal Rim Height	The height of the urinal rim in the restroom is greater than 17 inches above the finished floor.	Lower the urinal designated to be accessible in the restroom so that the rim height is not more than 17 inches above the finished floor.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Male	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Northwest Softball Field	Paper Towel	Dispenser Operation	The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.	Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Recreation Center	Lavatory	Lavatory Surface Height	The height of the counter surface is greater than allowed.	Relocate or replace the lavatory to provide a maximum counter surface height of no greater than recommended.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Recreation Center	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Recreation Center	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Recreation Center	Male	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Recreation Center	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Recreation Center	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Mens Restroom Next To Recreation Center	Paper Towel	Dispenser Operation	The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.	Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.	Not_Started	None	6/30/37

Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Recreation Center	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Recreation Center	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Recreation Center	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Recreation Center	Female	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Recreation Center	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Recreation Center	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Restrooms	Womens Restroom Next To Recreation Center	Paper Towel	Dispenser Operation	The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.	Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain In Dog Park - Large Dog		Drinking Fountain	The drinking fountain is not on accessible route.	Make sure the drinking fountain is on an accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain In Dog Park - Large Dog		Stream Height	The height of the water stream is less than required.	Insure that the spout directs the water flow to the required height and in a trajectory that is parallel or nearly parallel to the front of the drinking fountain.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain In Dog Park - Large Dog		Clear Floor Space Length	There is insufficient clear floor space in front of the drinking fountain.	Provide the required clear floor space that is on a primary path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain In Dog Park - Small Dogs		Drinking Fountain	The drinking fountain is not on accessible route.	Make sure the drinking fountain is on an accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain In Dog Park - Small Dogs		Stream Height	The height of the water stream is less than required.	Insure that the spout directs the water flow to the required height and in a trajectory that is parallel or nearly parallel to the front of the drinking fountain.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain In Dog Park - Small Dogs		Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain In Dog Park - Small Dogs		Clear Floor Space Length	There is insufficient clear floor space in front of the drinking fountain.	Provide the required clear floor space that is on a primary path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Southeast Softball Field		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Southeast Softball Field		Protruding Object	The drinking fountain is a protruding object.	Make sure that the fountain is not a protruding object.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Southeast Softball Field		No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Northwest Softball Field		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Northwest Softball Field		Non-Accessible Controls	The faucet controls require tight grasping or pinching of the wrist to operate.	Provide fountain controls with controls that do not require tight grasping or pinching of the wrist to operate.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Northwest Softball Field		Toe Clearance	The toe clearance is less than required.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/37

Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Northwest Softball Field		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Northwest Softball Field		Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Northwest Softball Field		Spout Distance to Front	The distance from the front edge of the unit (including bumpers) to the spout location, is greater than the allowed maximum distance.	Make sure that the distance from the front of the fountain to the flow of the water is not greater than the allowed maximum distance.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Northwest Softball Field		Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Northwest Softball Field		Clear Floor Space Width	There is insufficient clear floor space in front of the drinking fountain.	Provide the required clear floor space that is on a primary path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Northwest Softball Field		Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space at the drinking fountain.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Basketball Court		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Basketball Court		Non-Accessible Controls	The faucet controls require tight grasping or pinching of the wrist to operate.	Provide fountain controls with controls that do not require tight grasping or pinching of the wrist to operate.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Basketball Court		Toe Clearance	The toe clearance is less than required.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Basketball Court		Drinking Fountain	The drinking fountain is not on accessible route.	Make sure the drinking fountain is on an accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Basketball Court		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Basketball Court		Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Basketball Court		Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Basketball Court		Clear Floor Space Length	There is insufficient clear floor space in front of the drinking fountain.	Provide the required clear floor space that is on a primary path of travel.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Outdoor Sports Areas	Southeast Softball Field		Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Outdoor Sports Areas	Northwest Softball Field		Less Than Minimum Required Accessible Seats	There are not enough accessible seats at the location with respect to the total number of seats available.	Provide compliant accessible seating at the location.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Outdoor Sports Areas	Northwest Softball Field	Concession Stand	Concessions Stand Counter Height	The height of the concession counter is greater than 34 inches.	Lower the concession counter to a height between 28 inches and 34 inches above the ground level .	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Outdoor Sports Areas	Northwest Softball Field	Concession Stand	Protruding Object	The concession stand counter is a protruding object.	Make sure that the concession stand counter is not a protruding object.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Play Area	Small Play Area		Path of Travel Slope	The path of travel slope is greater than allowed.	Provide a path of travel with a compliant slope.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Play Area	Small Play Area		Change In Level	There is a change in level to the play area surface.	Provide a smooth transition from the play area access point to the play area surface.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Play Area	Large Play Area		Change In Level	There is a change in level to the play area surface.	Provide a smooth transition from the play area access point to the play area surface.	Not_Started	None	6/30/37

Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Play Area	Large Play Area	Elevated Equipment - Fibar	Platform Height	The transfer platform height is not compliant.	Provide compliant platform with recommended value at the transfer point.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Sinks	Sink In Activity Room		Sink - Counter Height	Sink counter height is not compliant.	Provide compliant sink.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Sinks	Sink In Activity Room		Sink - Knee Clearance	Sink knee clearance does not meet the standards.	Provide compliant sink.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Sinks	Sink In Activity Room		Toe Clearance	There is not enough toe clearance at the sink.	Provide minimum required toe clearance.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Sinks	Sink In Activity Room		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Sinks	Sink In Activity Room		Door Hardware	The cabinet door hardware is not accessible.	Provide compliant hardware for cabinet door.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Sinks	Sink In Activity Room		Toe Kick Not Removed	The toe kick for the sink is not removed.	Make sure there is no toe kick at the sink.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Sinks	Sink In Activity Room		Clear Floor Space Width	There is not enough clear floor space at the sink.	Provide enough clear floor space at the location.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Sinks	Sink In Activity Room		Sink - Bubbler	The sink bubbler controls are not accessible.	Provide compliant hardware and controls for the bubbler.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Sinks	Sink In Activity Room		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Sinks	Sink In Activity Room	Soap	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Sinks	Sink In Activity Room	Paper Towel	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height. Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Sinks	Sink In Activity Room	Paper Towel	Sink	The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.	Relocate the dispenser to the correct height. Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Picnic Areas	Covered Picnic Area Next To Dog Park - Small Dogs		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Picnic Areas	Covered Picnic Area Next To Dog Park - Small Dogs		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Picnic Areas	Covered Picnic Area Next To Dog Park - Large Dogs		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Picnic Areas	Covered Picnic Area Next To Dog Park - Large Dogs		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Picnic Areas	Covered Picnic Area		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Picnic Areas	Covered Picnic Area		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Picnic Areas	Large Covered Picnic Area		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/37

Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Picnic Areas	Large Covered Picnic Area		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Reach Ranges	Covered Picnic Area Next To Dog Park - Large Dogs	Barbeque	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Reach Ranges	Covered Picnic Area Next To Dog Park - Large Dogs	Trash Receptacle	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Reach Ranges	Covered Picnic Area Next To Dog Park - Small Dogs	Barbeque	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Reach Ranges	Dog Park - Large Dog	Pet Waste Bag Dispenser	Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Reach Ranges	Dog Park - Large Dog	Pet Waste Bag Dispenser	Element Highest Point of Operation	The highest point of operation for the element is not compliant.	Make sure that the highest point of operation is within the recommended value.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Reach Ranges	Dog Park - Large Dog	Trash Receptacle	Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Reach Ranges	Dog Park - Large Dog	Hand Sanitizer	Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Reach Ranges	Dog Park - Small Dogs	Pet Waste Bag Dispenser	Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Reach Ranges	Dog Park - Small Dogs	Pet Waste Bag Dispenser	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Reach Ranges	Dog Park - Small Dogs	Pet Waste Bag Dispenser	Element Highest Point of Operation	The highest point of operation for the element is not compliant.	Make sure that the highest point of operation is within the recommended value.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Reach Ranges	Dog Park - Small Dogs	Hand Sanitizer	Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Reach Ranges	Dog Park - Small Dogs	Trash Receptacle	Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Reach Ranges	Designated Smoking Area Next To Dog Park	Ash Tray	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Reach Ranges	Covered Picnic Area	Barbeque	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Reach Ranges	Large Covered Picnic Area	Barbeque	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Benches	Benches In Dog Park - Small Dogs		On Accessible Route	The bench is not on an accessible route.	Provide a compliant accessible route to the benches.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Benches	Benches In Dog Park - Small Dogs		Clear Floor Space	No clear floor space provided at the bench.	Provide compliant clear floor space for the bench at one end.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Benches	Southeast Softball Field 1st Base Dugout Bench		Clear Floor Space Slope	Clear floor space slope is not compliant for the bench.	Provide compliant clear floor space at the bench.	Not_Started	None	6/30/37
Rio San Gabriel Park - 9612 Ardine Street Downey, CA 90240	Benches	Benches Next To Play Areas		Clear Floor Space	No clear floor space provided at the bench.	Provide compliant clear floor space for the bench at one end.	Not_Started	None	6/30/37
Temple Park - 7132 Cole Street Downey, CA 90240	Path of Travel	Sidewalk Around Play Area	Exterior Walkway	Sidewalk Width	The width of the path of travel is insufficient.	Widen the primary path of travel to provide the correct width.	Not_Started	None	6/30/37

Temple Park - 7132 Cole Street Downey, CA 90240	Path of Travel	Sidewalk Around Swings	Exterior Walkway	Sidewalk Width	The width of the path of travel is insufficient.	Widen the primary path of travel to provide the correct width.	Not_Started	None	6/30/37
Temple Park - 7132 Cole Street Downey, CA 90240	Path of Travel	Path Of Travel From The Public Right Of Way	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Temple Park - 7132 Cole Street Downey, CA 90240	Signage	Directional Signage From The Public Right Of Way	No Directional or Information Signage	No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/37
Temple Park - 7132 Cole Street Downey, CA 90240	Play Area	Play Area		Path of Travel Slope	The path of travel slope is greater than allowed.	Provide a path of travel with a compliant slope.	Not_Started	None	6/30/37
Temple Park - 7132 Cole Street Downey, CA 90240	Play Area	Play Area	Elevated Equipment - Fibar	Platform Height	The transfer platform height is not compliant.	Provide compliant platform with recommended value at the transfer point.	Not_Started	None	6/30/37
Temple Park - 7132 Cole Street Downey, CA 90240	Play Area	Play Area	Elevated Equipment - Fibar	Transfer Platform	The transfer platform is not located on shortest route from the play areas accessible point of access.	The transfer platform shall be located on the shortest route from the play areas accessible point of access.	Not_Started	None	6/30/37
Temple Park - 7132 Cole Street Downey, CA 90240	Play Area	Swings		Path of Travel Slope	The path of travel slope is greater than allowed.	Provide a path of travel with a compliant slope.	Not_Started	None	6/30/37
Temple Park - 7132 Cole Street Downey, CA 90240	Play Area	Swings	Swings - Fibar	Vertical Clearance Height	The vertical clearance height on route to the transfer platform/play equipment is not compliant.	Provide compliant vertical clearance.	Not_Started	None	6/30/37
Temple Park - 7132 Cole Street Downey, CA 90240	Picnic Areas	Picnic Tables		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/37
Temple Park - 7132 Cole Street Downey, CA 90240	Picnic Areas	Picnic Tables		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/37
Temple Park - 7132 Cole Street Downey, CA 90240	Reach Ranges	Park	Barbeque	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Passenger Loading Zones	Passenger Loading Zone Next To Main Buiding		Curbs Between Access Aisle and Vehicle Pull-up Space	There are curbs between the access aisle and the vehicle pull-up space.	Remove curbs or install compliant curb ramp to provide accessible path of travel from the vehicle pull-up space and the access aisle.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Passenger Loading Zones	Passenger Loading Zone Next To Main Buiding		No Access Aisle	There is no required striped access aisle adjacent to the passenger loading zone.	the passenger loading zone shall provide immediate access to an adjacent curb ramp or primary path of travel.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Passenger Loading Zones	Passenger Loading Zone Next To Main Buiding		No Sign	Passenger loading zone has no sign.	Mark the passenger loading zone with ISA symbol of accessibility.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Curb Ramps	2nd Curb Ramp From The Bus Stops To Main Entrance		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Curb Ramps	2nd Curb Ramp From The Bus Stops To Main Entrance	Top Landing	Top Landing Slope	The slope at the top landing is greater than allowed.	Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Curb Ramps	2nd Curb Ramp From The Bus Stops To Main Entrance	Bottom Landing	Bottom Landing Slope	The slope at the bottom landing is greater than allowed.	Provide a compliant bottom landing that does not exceed the maximum slope requirements.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Curb Ramps	1st Curb Ramp From The Bus Stops To Main Entrance		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/37

Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Path of Travel	Sidewalk From Passenger Loading Zone To Main Entrance	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Path of Travel	Sidewalk From Downey Avenue	Bus Stop Platform	Detectable Warning Domes Direction	Detectable warning domes are not aligned in the direction of travel.	Provide compliant detectable warnings with domes aligned in the direction of travel.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Path of Travel	Sidewalk From Downey Avenue	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Path of Travel	Sidewalk From Downey Avenue	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Path of Travel	Sidewalk Next To Passenger Loading Zone	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Path of Travel	Sidewalk From Bus Stop To Main Building	Vehicular Traffic	Cross Walks and Detectable Warnings	There are no detectable warnings where the pedestrian route crosses vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Path of Travel	Sidewalk From Bus Stop To Main Building	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Path of Travel	Lobby	Floor Mat	Mat or Runner	The mats or carpet runners do not adhere to the underlying floor surface and slip, thereby creating a hazardous path of travel.	Securely fasten the mats or carpet runners or replace with a mat or carpet runner that grips to the underlying floor surface to provide a firm, stable, continuous and relatively smooth path of travel surface. Mats or carpet runners along the primary path of travel shall provide beveled edges on all sides to prevent roll over.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Doors	Main Entrance	Push Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the push side of the door.	Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Doors	Main Entrance	Push Side	Floor Mat	An unstable floor mat is provided at the door landing.	Provide a compliant floor mat for the door.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Doors	Main Entrance	Pull Side	Floor Surface Slope	There is no level landing at this door.	Provide a level landing.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Doors	Main Entrance	Push Bar / D Handle	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Doors	Unisex Restroom	Lever	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Doors	Unisex Restroom		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue Downey, CA 90240	Signage	Directional Signage From The Public Right Of Way		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/37

Transportation Depot Center - 8150 Nance Avenue									
Downey, CA 90240	Signage	Main Entrance		No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue									
Downey, CA 90240	Restrooms	Unisex Restroom		No Door Privacy Lock and Occupied Indicator	The restroom door does not provide a compliant privacy lock with occupancy indicator.	Install a compliant privacy lock with occupancy indicator to the door.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue									
Downey, CA 90240	Restrooms	Unisex Restroom	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue									
Downey, CA 90240	Restrooms	Unisex Restroom	Unisex	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue									
Downey, CA 90240	Restrooms	Unisex Restroom	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue									
Downey, CA 90240	Restrooms	Unisex Restroom	Blower	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue									
Downey, CA 90240	Restrooms	Unisex Restroom		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue									
Downey, CA 90240	Restrooms	Unisex Restroom		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue									
Downey, CA 90240	Restrooms	Unisex Restroom		Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue									
Downey, CA 90240	Restrooms	Unisex Restroom		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/37
Transportation Depot Center - 8150 Nance Avenue									
Downey, CA 90240	Reach Ranges	Lobby	Bus Route Maps	Element Highest Point of Operation	The highest point of operation for the element is not compliant. There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the signage does not contain the correct wording and/or the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.	Make sure that the highest point of operation is within the recommended value. Provide a compliant warning sign regarding unauthorized use of accessible parking spaces in the parking lot. Fill in the blank spaces with are required to furnish point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road									
Downey, CA 90240	Parking	Parking Lot	Warning Sign	Parking Lot Warning Sign Wording Incorrect			Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road									
Downey, CA 90240	Parking	Parking Lot	Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road									
Downey, CA 90240	Parking	Parking Lot	Accessible Space	No Van Accessible Signage	There is no additional signage marked "van accessible" at the van accessible parking space.	Van accessible parking spaces shall provide additional signage that states "van accessible" .	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road									
Downey, CA 90240	Parking	Parking Lot	Accessible Space	Access Aisle Width	The access aisle does not meet the minimum required width.	Re-stripe the access aisle to meet the minimum required width and length for the space type.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road									
Downey, CA 90240	Parking	Parking Lot	Accessible Space	Access Aisle Striping	The hatched lines are striped greater than 36" on center or are not painted a contrasting color.	Re-stripe the hatched lines in a contrasting color up to 36" on center.	Not_Started	None	6/30/37

Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Parking	Parking Lot	Accessible Space	Access Aisle Does Not Say "No Parking"	The access aisle does not contain the wording "No Parking" painted on surface within the access aisle in white letters.	Paint "NO PARKING" in 12 inch white letters.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Path of Travel	Park Path - Parking Lot To Hannon Street	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Path of Travel	Path From Finevale Drive To Park Path	Vegetation	Protruding Objects - Vertical Clearance	The vertical clearance height is less than required.	Provide recommended vertical clearance.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Path of Travel	Path Of Travel From The Public Right Of Way At Finevale Drive	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Path of Travel	Path Of Travel From The Public Right Of Way At Finevale Drive	Concrete Upheaval	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Path of Travel	Path Of Travel From The Public Right Of Way At Cleargrove Drive	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Path of Travel	Path Of Travel From The Public Right Of Way At Cleargrove Drive	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Path of Travel	Path Of Travel From The Public Right Of Way At Shady Oak Drive	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Path of Travel	Path Of Travel From The Public Right Of Way At Coolgrove Drive	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Path of Travel	Path Of Travel From The Public Right Of Way At Bairnsdale Street	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Path of Travel	East Covered Picnic Tables	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Path of Travel	Path From Cleargrove Drive To Park Path	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Path of Travel	Drinking Fountain Next To Play Areas	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Path of Travel	Path Of Travel From Rio Hondo River Bike Trail To Park Path	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Path of Travel	Path Of Travel From Rio Hondo River Bike Trail To Park Path	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Path of Travel	Park Path - Bairnsdale Street To Hannon Street	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Path of Travel	Path Of Travel From The Accessible Space	Access Aisle	Cross Walks and Detectable Warnings	There are no detectable warnings where the pedestrian route crosses vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Signage	Directional Signage From The Public Right Of Way		No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Play Areas		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Play Areas		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Play Areas		Spout Distance to Front	The distance from the front edge of the unit (including bumpers) to the spout location, is greater than the allowed maximum distance.	Make sure that the distance from the front of the fountain to the flow of the water is not greater than the allowed maximum distance.	Not_Started	None	6/30/37

Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Play Areas		Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Play Area	Bucket Swings		Change In Level	There is a change in level to the play area surface.	Provide a smooth transition from the play area access point to the play area surface.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Play Area	Swings		Change In Level	There is a change in level to the play area surface.	Provide a smooth transition from the play area access point to the play area surface.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Play Area	Play Area		Change In Level	There is a change in level to the play area surface.	Provide a smooth transition from the play area access point to the play area surface.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Picnic Areas	West Covered Picnic Table		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Picnic Areas	West Covered Picnic Table		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Picnic Areas	East Covered Picnic Tables		Clear Floor Space Length	The length of the clear floor space at the table is not compliant.	Provide compliant clear floor space at the table.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Picnic Areas	Picnic Tables		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Reach Ranges	Park	Pet Waste Bag Dispenser	Element Highest Point of Operation	The highest point of operation for the element is not compliant.	Make sure that the highest point of operation is within the recommended value.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Reach Ranges	Park	Pet Waste Bad Dispenser	Element Highest Point of Operation	The highest point of operation for the element is not compliant.	Make sure that the highest point of operation is within the recommended value.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Reach Ranges	Park	Barbeque	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Reach Ranges	Park	Trash Receptacle	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	6/30/37
Treasure Island Park - 9300 Bluff Road Downey, CA 90240	Benches	Bench Next To Rio Hondo River Bike Trail		Clear Floor Space Slope	Clear floor space slope is not compliant for the bench.	Provide compliant clear floor space at the bench.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	South Parking Lot	Warning Sign	Parking Lot Warning Sign Not Visible	The is no warning signage posted that is at the entrance or visible from each accessible parking space.	Post a sign in a conspicuous place to the entrance of the parking lot, or immediately adjacent to and visible from each accessible parking space. The warning sign shall measure at least 17 inches by 22 inches in size and consist of lettering at least 1 inch in height that clearly and conspicuously states the following; "Unauthorized vehicles parked in designated accessible spaces not displaying distinguishing placards or license plates issued for persons with disabilities will be towed away at owner's expense. Towed vehicles may be reclaimed at ____ or by telephoning ____." Fill in the blank spaces with appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	South Parking Lot	Warning Sign	Parking Lot Warning Sign Wording Incorrect	There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the signage does not contain the correct wording and/or the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.	Provide a compliant warning sign regarding unauthorized use of accessible parking spaces in the parking lot. Fill in the blank spaces with are required to furnish point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	South Parking Lot	Next to Pond, Left Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	South Parking Lot	Next to Pond, Left Accessible Space	Must Travel Behind Parked Cars	The location of the accessible parking spaces requires individuals with disabilities to travel behind parked cars other than their own.	Stripe an access aisle at the head of the accessible parking spaces, install a wheel stop at the head of the accessible parking spaces and at the general parking spaces. Wheel stops shall be used to prevent vehicles from encroaching into access aisles or walkways, but shall not present additional encroachment into those areas.	Not_Started	None	6/30/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	South Parking Lot	Next to Pond, Left Accessible Space	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	South Parking Lot	Next to Pond, Center Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	South Parking Lot	Next to Pond, Center Accessible Space	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	South Parking Lot	Next to Pond, Right Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	South Parking Lot	Next to Pond, Right Accessible Space	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	North Parking Lot	Warning Sign	Parking Lot Warning Sign Wording Incorrect	There is warning signage posted regarding unauthorized use of accessible parking spaces in the parking lot, though the signage does not contain the correct wording and/or the blank spaces which should furnish the point of contact and telephone number for reclaiming towed vehicles have been left blank.	Provide a compliant warning sign regarding unauthorized use of accessible parking spaces in the parking lot. Fill in the blank spaces with are required to furnish point of contact and telephone number for reclaiming towed vehicles with the appropriate information as a permanent part of the sign and maintain the currency of the information.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	North Parking Lot	Next to Park Building, Right Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	North Parking Lot	Next to Park Building, Right Accessible Space	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	North Parking Lot	Next to Park Building, Right Accessible Space	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	North Parking Lot	Next to Park Building, Left Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	North Parking Lot	Next to Park Building, Left Accessible Space	Must Travel Behind Parked Cars	The location of the accessible parking spaces requires individuals with disabilities to travel behind parked cars other than their own.	Stripe an access aisle at the head of the accessible parking spaces, install a wheel stop at the head of the accessible parking spaces and at the general parking spaces. Wheel stops shall be used to prevent vehicles from encroaching into access aisles or walkways, but shall not present additional encroachment into those areas.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	North Parking Lot	Next to Park Building, Left Accessible Space	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	North Parking Lot	Next to Park Building, Left Accessible Space	Access Aisle Slope	The access aisle exceeds maximum slope.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	North Parking Lot	Next to Park Building, Center Accessible Space	Parking Space Slope	The surface of the accessible parking space has a slope greater than allowed.	Pave the parking lot to provide a level surface.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Parking	North Parking Lot	Next to Park Building, Center Accessible Space	Parking Space Length	The accessible parking space provided in the parking lot does not meet the minimum requirement for length.	Re-stripe the accessible parking space.	Not_Started	None	6/30/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Curb Ramps	Curb Ramp At North Parking Lot Accessible Spaces		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Curb Ramps	Curb Ramp At North Parking Lot Accessible Spaces		Side Flare Slope	The slope of the curb ramp side flare is greater than allowed.	Provide curb ramp side flares with a compliant slope.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Curb Ramps	Curb Ramp At North Parking Lot Accessible Spaces	Bottom Landing	Bottom Landing Slope	The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.	Ensure the bottom landing slope is compliant and provides a smooth transition.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Curb Ramps	Curb Ramp At North Parking Lot Accessible Spaces	Top Landing	Top Landing Slope	The slope at the top landing is greater than allowed.	Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Curb Ramps	Right Curb Ramp at South Parking Lot Accessible Spaces		Projects into Traffic	The curb ramp projects into vehicular traffic lanes, parking spaces, or parking access aisles.	Provide a compliant curb ramp.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Curb Ramps	Right Curb Ramp at South Parking Lot Accessible Spaces		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Curb Ramps	Right Curb Ramp at South Parking Lot Accessible Spaces		Curb Ramp Slope	The running slope is greater than allowed.	Provide a compliant curb ramp.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Curb Ramps	Right Curb Ramp at South Parking Lot Accessible Spaces	Bottom Landing	Bottom Landing Slope	The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.	Ensure the bottom landing slope is compliant and provides a smooth transition.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Curb Ramps	Left Curb Ramp at South Parking Lot Accessible Spaces		Projects into Traffic	The curb ramp projects into vehicular traffic lanes, parking spaces, or parking access aisles.	Provide a compliant curb ramp.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Curb Ramps	Left Curb Ramp at South Parking Lot Accessible Spaces		No Detectable Warnings	The curb ramp does not provide a detectable warning surface which includes truncated domes.	Provide compliant detectable warnings to surface.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Curb Ramps	Left Curb Ramp at South Parking Lot Accessible Spaces	Top Landing	Top Landing Change in Level	The transition from the top of the curb ramp to the walk, gutter, or street is abrupt.	Patch the transition area at the top of the curb ramp so that the transition is flush and free of abrupt changes.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Curb Ramps	Left Curb Ramp at South Parking Lot Accessible Spaces	Bottom Landing	Bottom Landing Slope	The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.	Ensure the bottom landing slope is compliant and provides a smooth transition.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Sidewalk Around Play Area	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Sidewalk Around Play Area	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Sidewalk Around Play Area	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Sidewalk Around Play Area	Change In Level	Change in Level - Beveled	There is a change in elevation greater than recommended value.	Bevel the area or resurface the area to provide a smooth and level path of travel.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Park Path From Park Building to Picnic Shelter #1 - Continued	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Park Path From Park Building to Picnic Shelter #1 - Continued	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From The North Parking Lot Accessible Spaces	Access Aisle	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From The North Parking Lot Accessible Spaces	Vehicular Traffic	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From The North Parking Lot Accessible Spaces	Access Aisle	No Detectable Warnings	The pedestrian route adjoins vehicular traffic.	Provide detectable warnings.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Restrooms to Play Area	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Park Path From Park Building to Picnic Shelter #1	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Park Path From Park Building to Picnic Shelter #1	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Park Path From Park Building to Picnic Shelter #1	Change In Level	Change in Level - Beveled	There is a change in elevation greater than recommended value.	Bevel the area or resurface the area to provide a smooth and level path of travel.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	South Pond Loop - From Park Building to San Gabriel River Trail	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	South Pond Loop - From Park Building to San Gabriel River Trail	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	South Pond Loop - From Park Building to San Gabriel River Trail	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Public Right of Way To Picnic Shelter #1	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Public Right of Way To Picnic Shelter #1	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Public Right of Way To Picnic Shelter #1	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From The Public Right Of Way Next to North Parking Lot	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From The Public Right Of Way Next to North Parking Lot	Change In Level	Change in Level - Beveled	There is a change in elevation greater than recommended value.	Bevel the area or resurface the area to provide a smooth and level path of travel.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Park Path West Side of North Pond	Pond	Drop Off Hazard	There is no edge protection at the drop off.	Install edge protection on the walking surface at the required minimum height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Park Path West Side of North Pond	Open Area	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Picnic Shelter #2 To Park Building	Pond	Drop Off Hazard	There is no edge protection at the drop off.	Install edge protection on the walking surface at the required minimum height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Picnic Shelter #2 To Park Building	Pond	Drop Off Hazard	There is no edge protection at the drop off.	Install edge protection on the walking surface at the required minimum height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Picnic Shelter #2 To Park Building	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Picnic Shelter #2 To Park Building	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Picnic Shelter #2 To Park Building	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Picnic Shelter #2 To Park Building	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Picnic Shelter #2 To Park Building	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Park Path South Pond Loop	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Park Path South Pond Loop	Exterior Walkway	Sidewalk Width	The width of the path of travel is insufficient.	Widen the primary path of travel to provide the correct width.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Park Path From Picknic Shelter #2 to Restroom Building	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Park Path From Picnic Shelter #2 to Restroom Building	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Park Building To Eastside of North Pond	Pond	Drop Off Hazard	There is no edge protection at the drop off.	Install edge protection on the walking surface at the required minimum height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Park Building To Eastside of North Pond	Tree	Protruding Objects - Vertical Clearance	The vertical clearance height is less than required.	Provide recommended vertical clearance.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Park Building To Eastside of North Pond	Exterior Walkway	Walking Surface Slope	There are slopes greater than allowed maximum slope on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Park Building To Eastside of North Pond	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Path Of Travel From Park Building To Eastside of North Pond	Change In Level	Change in Level - Beveled	There is a change in elevation greater than recommended value.	Bevel the area or resurface the area to provide a smooth and level path of travel.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	South Pond Loop - From San Gabriel River Trail to Picnic Shelter #2	Exterior Walkway	Walking Surface Cross Slope	There are cross slopes greater than allowed on the primary path of travel.	Provide a compliant path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	South Pond Loop - From San Gabriel River Trail to Picnic Shelter #2	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	South Pond Loop - From San Gabriel River Trail to Picnic Shelter #2	Change In Level	Change in Level	There is a change in elevation greater than recommended value.	Ensure that the change in elevation is within the recommended value.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Mens Restroom In Park Building	Interior Corridor	Clear Width - Walking Surfaces	The width of the path of travel is insufficient.	Widen the primary path of travel to provide the correct width.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Path of Travel	Room Next to Kitchen	Shelf	Protruding Objects - Protrusion Limit	The leading edge of the wall-mounted item is more than 4 inches from the wall. The item is greater than 27 inches, and less than 80 inches from the floor and protrudes into the primary path of travel.	Install side extensions, modify, relocate, or lower the item so that the leading edge protrudes less than 4 inches from the wall, is less than 27 inches from the floor, or more than 80 inches from the floor.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Stairs	Stairs Next To Pond	Run 1	No Handrails	There are no handrails provided on the stairway.	Provide compliant handrails.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Stairs	Stairs Next To Pond	Run 1	Risers Height	The height of the risers are not uniform.	Modify or replace the stairs to provide uniform riser height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Stairs	Stairs Next To Pond	Run 1	No Riser Striping	There is no detectable striping on each tread of the exterior stairway.	Affix detectable contrasting striping to each tread of the stairway that clearly contrasts in color from the tread and is at least 2 inches in width placed no more than 1 inch from the tread nose or landing.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Entrance Next to Restrooms	Push / Pull	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Entrance Next to Restrooms	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Womens Restroom In Park Building		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Womens Restroom In Park Building		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Womens Restroom In Park Building		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Womens Restroom In Park Building		Bottom Door Panel Height	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Womens Restroom In Park Building	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Mens Restroom In Park Building		Door Closer Vertical Clearance	The door closing device limits the required headroom clearance.	Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Mens Restroom In Park Building		Door Opening Width	The clear opening width of the door is less than required.	Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Mens Restroom In Park Building		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Mens Restroom In Park Building	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Mens Restroom In Park Building		Bottom Door Panel Height	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Mens Restroom In Park Building	Push / Pull	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Main Office		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Main Office		Bottom Door Panel Height	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Main Office	Lever	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Kitchen Door		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Kitchen Door		Bottom Door Panel Height	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Room Next to Kitchen Exterior Entrance	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Room Next to Kitchen Exterior Entrance	Single Knob	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Room Next to Kitchen Exterior Entrance	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Room Next to Kitchen Exterior Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Arts & Crafts Room		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Arts & Crafts Room	Pull Side	Front Approach Clear Floor Space Length	There is not enough clear floor space provided at the pull side of the door.	Provide the recommended clear floor space on the pull side of the door.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Arts & Crafts Room		Bottom Door Panel Height	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Main Activity Room East Entrance		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Main Activity Room East Entrance	Push Bar / Thumb Latch	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Main Activity Room East Entrance	Push Bar / Thumb Latch	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Hallway Entrance Next to Restrooms		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Hallway Entrance Next to Restrooms	Pull Side	Front Approach Latch Side Clearance	There is less than the required latch side clearance on the pull side of the door.	Provide required latch side clearance on the pull side of the door.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Hallway Entrance Next to Restrooms	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Hallway Entrance Next to Restrooms	Single Knob	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Room Next to Arts & Crafts Room		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Room Next to Arts & Crafts Room		Bottom Door Panel Height	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Door Behind Main Activity Room Counter		Door Opening Height	The vertical clearance height of the door is less than required.	Upon major renovation of the area, consult a design professional to determine the feasibility of extending the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Door Behind Main Activity Room Counter	Single Knob	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Main Activity Room West Entrance		Door Opening Height	The vertical clearance height of the door is less than required.	Extend the height of the doorway to provide the required clearance height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Main Activity Room West Entrance	Push Bar / Thumb Latch	Non-Accessible Hardware	The door opening hardware is not accessible.	Provide accessible hardware on the door.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Main Activity Room West Entrance	Push Bar / Thumb Latch	Door Opening Pressure	The door opening force for this door is greater than allowed.	Adjust the closer on the door to meet the door opening force requirements.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Main Activity Room West Entrance	Push Bar / Thumb Latch	Door Hardware	Has a door stop.	Remove the door stop.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Main Activity Room West Entrance		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Room Next to Kitchen		Bottom Door Panel Height	The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.	Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Doors	Mens Restroom Next to Play Area		Door Threshold	The height of the threshold at the entrance door is greater than allowed.	Modify or replace the threshold to provide the recommended height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Counters	Kitchen		Counter Height	The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.	Provide a portion of counter at the compliant height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Counters	Main Activity Room Counter Next to Fireplace		Counter Height	The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.	Provide a portion of counter at the compliant height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Counters	Main Activity Room Counter		Counter Height	The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.	Provide a portion of counter at the compliant height.	Not_Started	None	6/30/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Signage	Directional Signage From The Public Right Of Way	No Directional or Information Signage	There is no directional signage.	Install directional signage to each accessible element or room.	Not_Started	None	6/30/37	
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Signage	Room Next to Arts & Crafts Room	No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/37	
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Signage	Arts & Crafts Room	No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/37	
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Signage	Main Office	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37	
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Signage	Room Next to Kitchen	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37	
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Signage	Main Activity Room West Entrance	No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/37	
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Signage	Kitchen Door	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37	
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Signage	Main Activity Room East Entrance	No Accessible Element/Entrance Signage	There is no room signage.	Install accessible room signage.	Not_Started	None	6/30/37	
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Signage	Door Behind Main Activity Room Counter	No Room Identification	There is no room identification signage.	Install room identification signage.	Not_Started	None	6/30/37	
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Urinal Rim Height	The height of the urinal rim in the restroom is greater than 17 inches above the finished floor.	Lower the urinal designated to be accessible in the restroom so that the rim height is not more than 17 inches above the finished floor.	Not_Started	None	6/30/37	
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Urinal Clear Floor Space Width	There is less than the required clear floor space provided in front of the urinal in the restroom to allow an accessible forward approach.	Provide the required minimum clear floor space in front of the urinal designated to be accessible in the restroom, for a forward approach.	Not_Started	None	6/30/37	
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Lavatory	Lavatory Clear Floor Space Length	There is not sufficient clear floor space provided to allow an accessible forward approach.	Relocate the lavatory to provide clear floor space.	Not_Started	None	6/30/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Male	Door Signage Height	The gender use signage on the entrance door is not mounted at the required height.	Post gender use signage on the center of the door at the required height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Paper Towel	Dispenser Operation	The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.	Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		No Toilet Paper Dispenser	There is no toilet paper dispenser provided on the narrow side wall.	Install a compliant toilet paper dispenser.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		No Back Wall Grab Bar	There is no back grab bar at the toilet compartment.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		Compartment Door Width	The clear opening width of the doorway to the compartment is less than required.	Widen the doorway to provide a compliant clear opening width when the door is open 90 degrees.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		Toilet Compartment Door	The compartment door is located in front of the water closet.	Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		Side Grab Bar Length	The length of the side grab bar is less than required.	Replace the side grab bar with a compliant grab bar.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		Side Grab Bar Height	The height of the side grab bar is not at the correct height.	Remount the grab bar so it is at the correct height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building		Distance from Door Edge to Nearest Fixture	The entrance door swings into the turning space within the restroom.	Reverse the door swing, or modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building	Paper Towel	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building	Paper Towel	Dispenser Operation	The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.	Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom In Park Building	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	6/30/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	No Back Wall Grab Bar	There is no back grab bar at the toilet compartment.	Install the required grab bars in the toilet compartment.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Compartment Door	Door does not close automatically.	Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Compartment Door Latch	The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.	Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Door Handle	The inside handle is not located near the latch.	Adjust the inside handle so that it is located near the latch.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Distance from Front Edge of Toilet to Front of Grab Bar	The distance from the front edge of the toilet to the front edge of the side grab bar is insufficient.	Install or relocate the side grab bar so that the distance from the front edge of the toilet to the front edge of the side grab bar meets the required minimum distance.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Toilet Paper Dispenser Above Grab Bar	The toilet paper dispenser is located above the provided grab bar.	Remount the dispenser below the grab bar at 19" minimum.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building	Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	6/30/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom In Park Building		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area		Urinal Rim Height	The height of the urinal rim in the restroom is greater than 17 inches above the finished floor.	Lower the urinal designated to be accessible in the restroom so that the rim height is not more than 17 inches above the finished floor.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area		Urinal Flush Control Height	The height of the urinal flush control in the restroom is greater than the required maximum height.	Lower the flush control valve on the urinal to a height not greater than the required maximum height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Lavatory	Lavatory Apron Height	The apron height under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required apron height.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	6/30/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Male	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Blower	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area		Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area		Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	12/31/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Compartment Door Handle	The door to the compartment does not have an accessible handle on both sides.	Provide an accessible handle mounted on the door of the compartment near the latch.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Toilet Compartment Door	The compartment door is located in front of the water closet.	Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Rear Grab Bar Length	The length of the rear grab bar is less than required.	Replace the rear grab bar with a compliant grab bar.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Toilet Paper Dispenser Interferes with Grab Bar	The toilet paper dispenser interferes with the use of the grab bar.	Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Toilet Paper Dispenser Above Grab Bar	The toilet paper dispenser is located above the provided grab bar.	Remount the dispenser below the grab bar at 19" minimum.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Mens Restroom Next to Play Area	Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area	Seat Cover Dispenser Behind Toilet	The location of the seat cover dispenser does not provide sufficient clear floor space.	Relocate the seat cover dispenser so it provides sufficient clear floor space and does not interfere with the use of a grab bar. Make certain that the height of all operable parts of the seat cover dispenser is within reach range above the finished floor.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area	Toilet Compartment Width	There is insufficient clear floor space in the compartment.	Modify or replace the compartment to provide adequate clear floor space.	Not_Started	None	12/31/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area		Seat Cover Dispenser Height	The height of the operable parts of the seat cover dispenser is greater than the allowed maximum height.	Lower the seat cover dispenser so the height of all operable parts meets the required accessible height. Make certain that the location of the seat cover dispenser does not interfere with the use of a grab bar.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area		Toilet Compartment Door	The compartment door is located in front of the water closet.	Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area		Distance from Back Wall to Front of Grab Bar	The distance from the back wall to the front of the grab bar is less than required.	Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area		Rear Grab Bar Length	The length of the rear grab bar is less than required.	Replace the rear grab bar with a compliant grab bar.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area		Rear Grab Bar Location	Rear grab bar location is not compliant.	Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area		Toilet Paper Dispenser Distance From Seat	The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.	Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area		Toilet Paper Dispenser Interferes with Grab Bar	The toilet paper dispenser interferes with the use of the grab bar.	Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area		Toilet Paper Dispenser Above Grab Bar	The toilet paper dispenser is located above the provided grab bar.	Remount the dispenser below the grab bar at 19" minimum.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area		Toilet Distance From Wall	The distance from the center of the toilet to the nearest side wall does not meet the required distance.	Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area		Toilet Seat Height	The height of the toilet seat is not at the required height.	Adjust or modify the toilet so the seat height is at the required accessible height.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area		Toilet Flush Control not on Wide Side	The flush control on the toilet is not on the wide (approach) side of the toilet.	Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be hand-operated or automatic mechanisms.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area		Toilet Minimum Distance From Any fixture	The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.	Locate the toilet in a space which provides the required clearances.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area		Toilet Clear Floor Space	There is less than the required minimum space in front of the toilet.	Create the required minimum clear space in front of the toilet.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area	Lavatory	Lavatory Knee Clearance	The knee clearance space under the lavatory is less than the required minimum height.	Raise or replace the lavatory to provide the minimum required knee clearance.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area	Lavatory	Lavatory Distance From Wall/Fixture	The lavatory does not meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall, partition or fixture.	Replace or remount lavatory to meet the minimum required distance to the center line of the fixture, when located adjacent to a side wall or partition.	Not_Started	None	12/31/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area	Lavatory	Lavatory Pipes Not Wrapped	The pipes under the lavatory do not provide protection against contact.	Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.	In_Progress	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area	Lavatory	Lavatory - Supply Lines not wrapped	Supply lines are not wrapped at the lavatory.	Wrap the supply lines around lavatory according to compliance.	In_Progress	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area	Female	No Door Signage	There is no gender use signage on the entrance door.	Post gender use signage on the center of the door at the required height.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area		No Wall Signage	There is no signage indicating accessibility on the latch side of the entry door of the restroom.	Provide compliant signage on latch side of door.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area	Soap	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Restrooms	Womens Restroom Next to Play Area	Blower	Dispenser Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Park Building		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Park Building		Non-Accessible Controls	The faucet controls require tight grasping or pinching of the wrist to operate.	Provide fountain controls with controls that do not require tight grasping or pinching of the wrist to operate.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Park Building		Toe Clearance	The toe clearance is less than required.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Park Building		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Park Building		Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Park Building		Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Restroom Building		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Restroom Building		Non-Accessible Controls	The faucet controls require tight grasping or pinching of the wrist to operate.	Provide fountain controls with controls that do not require tight grasping or pinching of the wrist to operate.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Restroom Building		Toe Clearance	The toe clearance is less than required.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Restroom Building	Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Restroom Building	Spout Distance to Front	The distance from the front edge of the unit (including bumpers) to the spout location, is greater than the allowed maximum distance.	Make sure that the distance from the front of the fountain to the flow of the water is not greater than the allowed maximum distance.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Restroom Building	Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To North Pond	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To North Pond	Non-Accessible Controls	The faucet controls require tight grasping or pinching of the wrist to operate.	Provide fountain controls with controls that do not require tight grasping or pinching of the wrist to operate.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To North Pond	Toe Clearance	The toe clearance is less than required.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To North Pond	Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To North Pond	Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To North Pond	Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space at the drinking fountain.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Picnic Shelter #2	Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Picnic Shelter #2	Non-Accessible Controls	The faucet controls require tight grasping or pinching of the wrist to operate.	Provide fountain controls with controls that do not require tight grasping or pinching of the wrist to operate.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Picnic Shelter #2	Toe Clearance	The toe clearance is less than required.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Picnic Shelter #2	Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Picnic Shelter #2	Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Picnic Shelter #2	Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	12/31/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Picnic Shelter #2		Clear Floor Space Width	There is insufficient clear floor space in front of the drinking fountain.	Provide the required clear floor space that is on a primary path of travel.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Picnic Shelter #1		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Picnic Shelter #1		Toe Clearance	The toe clearance is less than required.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Picnic Shelter #1		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Picnic Shelter #1		Stream Height	The height of the water stream is less than required.	Insure that the spout directs the water flow to the required height and in a trajectory that is parallel or nearly parallel to the front of the drinking fountain.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Picnic Shelter #1		Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space at the drinking fountain.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Picnic Shelter #1		Control Missing/Broken	The drinking fountain control is either missing or broken.	Provide compliant control for the drinking fountain.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Picnic Shelter #1		No Detectable Warnings	The drinking fountain is not set entirely in an alcove.	If the drinking fountain is not set in an alcove it shall provide a side rail or wing wall next to each side of the fountain to prevent it from protruding into the primary path of travel.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Kitchen		Fountain Type	The provided drinking fountain is not a Hi-Low fountain.	Replace the drinking fountain with a compliant Hi-Low fountain.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Kitchen		Knee Clearance	There is less than the required minimum knee clearance height.	Provide a fountain with the required knee and toe clearances.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Kitchen		Spout Height	The spout outlet height is greater than required.	Provide a spout outlet that does not exceed the required height.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Kitchen		Stream Trajectory	The water flow trajectory is not parallel to the front of the drinking fountain.	Provide a water flow trajectory that is parallel to the front of the drinking fountain.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Drinking Fountains	Drinking Fountain Next To Kitchen		Fountain Depth	Drinking fountain does not provide a required fountain depth.	Install a drinking fountain the meets the required minimum depth.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Play Area	Play Area	North Elevated Equipment - Rubberized Surface	Means of Support	At least one means of support for transferring to the transfer platform is not provided at the steps.	Provide at least one means of support for transferring to assist when transferring.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Play Area	Play Area	Jeep - Sand	Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	12/31/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Play Area	Play Area	Tick-Tac-Toe - Rubberized Surface	Route Width	The width of the route to the transfer platform/play equipment is not compliant.	Modify the width of the route to the transfer platform/play equipment.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Play Area	Play Area	Tick-Tac-Toe - Rubberized Surface	Vertical Clearance Height	The vertical clearance height on route to the transfer platform/play equipment is not compliant.	Provide compliant vertical clearance.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Play Area	Play Area	Swings - Sand	Surface Type	The surface beneath the play area is non-accessible to individuals with mobility impairments.	The play area should be made an accessible play area for the facility. Provide a maneuvering space with an accessible resilient surface beneath the play components and adjacent to the play components where technically feasible.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Play Area	Play Area	South Tick-Tac-Toe - Rubberized Surface	Route Width	The width of the route to the transfer platform/play equipment is not compliant.	Modify the width of the route to the transfer platform/play equipment.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Sinks	Sink In Arts & Crafts Room		Sink - Control Type	Twist controls are present on the sink.	Provide compliant controls for the sink.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Sinks	Sink In Arts & Crafts Room		Sink - Counter Height	Sink counter height is not compliant.	Provide compliant sink.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Sinks	Sink In Arts & Crafts Room		Sink - Knee Clearance	Sink knee clearance does not meet the standards.	Provide compliant sink.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Sinks	Sink In Arts & Crafts Room		Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Sinks	Sink In Arts & Crafts Room		Door Hardware	The cabinet door hardware is not accessible.	Provide compliant hardware for cabinet door.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Sinks	Sink In Arts & Crafts Room		Toe Kick Not Removed	The toe kick for the sink is not removed.	Make sure there is no toe kick at the sink.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Sinks	Sink In Arts & Crafts Room		Supply Lines	Supply lines are not wrapped for the sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Sinks	Sink In Arts & Crafts Room	Soap	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Sinks	Sink In Arts & Crafts Room	Paper Towel	Sink	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Picnic Areas	Picnic Shelter #3		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Picnic Areas	Picnic Shelter #3		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	12/31/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Picnic Areas	Picnic Shelter #2		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Picnic Areas	Picnic Shelter #2		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Picnic Areas	Picnic Shelter #1		Not on Accessible Route	There is no accessible route to the picnic tables.	Provide an accessible route to the picnic tables.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Picnic Areas	Picnic Shelter #1		At least 5% not Accessible	At least 5% of the provided tables are not accessible.	Provide enough compliant Accessible Tables (At least 5% of the total Tables).	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Reach Ranges	Park	Barbecue	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Reach Ranges	Park	Pet Waste Bag Dispenser	Reach Depth	Element reach depth is not compliant.	Make sure that the element is within allowed reach range with recommended reach depth.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Reach Ranges	Park	Pet Waste Bag Dispenser	Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Reach Ranges	Park	Pet Waste Bag Dispenser	Element Highest Point of Operation	The highest point of operation for the element is not compliant.	Make sure that the highest point of operation is within the recommended value.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Reach Ranges	Park	Pet Waste Bag Dispenser	Reach Depth	Element reach depth is not compliant.	Make sure that the element is within allowed reach range with recommended reach depth.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Reach Ranges	Park	Pet Waste Bag Dispenser	Clear Floor Space Slope	The clear floor space slope is not compliant.	Provide compliant clear floor space.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Reach Ranges	Park	Pet Waste Bag Dispenser	Element Highest Point of Operation	The highest point of operation for the element is not compliant.	Make sure that the highest point of operation is within the recommended value.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Reach Ranges	Park	Barbecue	Element on Accessible Route	The element is not located on the accessible route.	The element must be located on the accessible route.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Reach Ranges	Park	Pet Waste Bag Dispenser	Element Highest Point of Operation	The highest point of operation for the element is not compliant.	Make sure that the highest point of operation is within the recommended value.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Reach Ranges	Room Next to Kitchen	Paper Towel Dispenser	Reach Ranges	This element is a protruding object.	Make sure that the element is not a protruding object.	In_Progress	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Reach Ranges	Room Next to Kitchen	Paper Towel Dispenser	Element Highest Point of Operation	The highest point of operation for the element is not compliant.	Make sure that the highest point of operation is within the recommended value.	In_Progress	None	12/31/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Benches	Benches Next To Park Path		Clear Floor Space	No clear floor space provided at the bench.	Provide compliant clear floor space for the bench at one end.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen		U Shaped - Clearance	There is not enough clearance between opposing cabinets, counters, appliances or walls in the kitchen.	Provide recommended clearance between all opposing items.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Work Surface	Height	Kitchen work surface height is not compliant.	Provide compliant work surface with recommended height for the kitchen.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Work Surface	Knee Clearance Height	There is not enough knee clearance height for the work surface.	Provide compliant work surface with recommended knee clearance height.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Work Surface	Cabinet Hardware	Cabinet hardware is not operable with one hand and requires tight pinching, grasping or twisting of the wrist.	Provide compliant hardware for the kitchen cabinet.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Work Surface	Toe Kick/Cabinetry	Toe kick/cabinetry below work surface is not removable.	Make sure that toe kick/cabinetry below the work surface is removed or removable.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Storage - Both	Storage - Cabinet Hardware	Cabinet hardware is not operable with one hand and requires tight pinching, grasping or twisting of the wrist.	Provide compliant hardware for the kitchen cabinet.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Sink - Lever	Counter Height	Sink counter height does not meet the standards.	Provide compliant sink.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Sink - Lever	Toe Kick Not Removed	The toe kick for the sink in kitchen is not removed.	Remove the toe kick for the sink.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Sink - Lever	Pipes not Wrapped	The pipes are not wrapped for the sink.	Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.	In_Progress	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Sink - Lever	Cabinet Door Hardware	The cabinet door hardware is not accessible.	Provide compliant hardware for the cabinet door.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Sink - Lever	Toe Clearance	There is not enough toe clearance at the kitchen sink.	Provide minimum required toe clearance.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Sink - Lever	Supply Lines	Supply lines are not wrapped for the kitchen sink.	Make sure that the supply lines are fully wrapped and insulated for the sink.	In_Progress	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Sink - Lever	Knee Clearance	Sink knee clearance does not meet the standards.	Provide compliant sink.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Paper Towel	Height	The height of the controls and operating mechanisms for the dispenser is not at the correct height.	Relocate the dispenser to the correct height.	Not_Started	None	12/31/37

Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Refrigerator - Refrigerator/Freezer	Height to Center of Freezer Space	Height to center of freezer space is not compliant.	Provide compliant freezer within recommended height.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Oven - Oven	Controls Operation	Appliance control hardware is not operable with one hand and requires tight pinching, grasping or twisting of the wrist.	Provide compliant hardware for the kitchen appliance.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Oven - Oven	Oven Work Surface - Bottom Hinged Door	Work surface is not provided adjacent to one side of the oven door.	Provide compliant work surface adjacent to on side of the oven door.	Not_Started	None	12/31/37
Wilderness Park - 10999 Little Lake Road Downey, CA 90240	Kitchens	Kitchen	Range/Cooktop - Range/Cooktop	Controls Operation	Appliance control hardware is not operable with one hand and requires tight pinching, grasping or twisting of the wrist.	Provide compliant hardware for the kitchen appliance.	Not_Started	None	Projected Completion Date