
Accessibility Survey

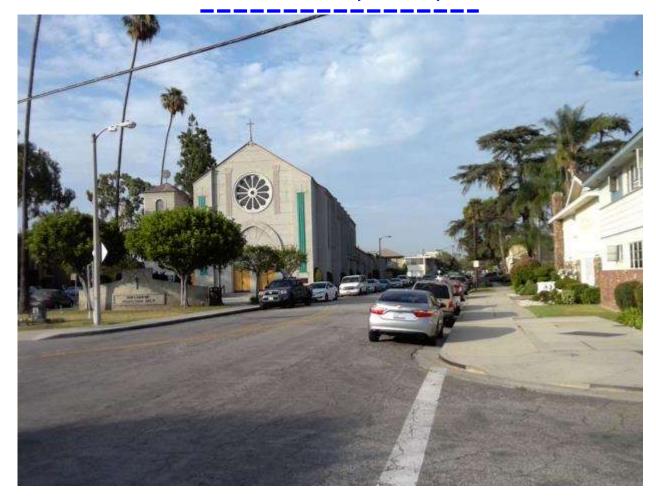

City of Downey New Street - 6th Street to 2nd Street

6th Street to 2nd Street Downey, CA 90242

Date of Inspection 7/19/2017

Prepared By

Disability Access Consultants

(800) 743-7067

East Side

Change in Level South of 3rd Street @ 33.942098286438, -118.132724761963

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 2.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302 Notes: Surface is Rough And Uneven

Progress

Record Number	471870	Resolution	None
Progress	Not_Started	Priority	One

Actual Date Projected Date 06/30/2018

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

West Side

Change in Level North of 4th Street @ 33.943698166225, -118.131551295519

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302 Notes: Surface is Rough And Uneven

Progress

Record Number471809ResolutionNoneProgressNot_StartedPriorityOne

Actual Date Projected Date 06/30/2018

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

West Side

Change in Level North of 4th Street @ 33.943698166225, -118.131551295519

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302 Notes: Surface is Rough And Uneven

Progress

Record Number471822ResolutionNoneProgressNot_StartedPriorityOne

Actual Date Projected Date 06/30/2018

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

West Side

Change in Level North of 4th Street @ 33.943827223367, -118.131438642740

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 2.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302 Notes: Surface is Rough And Uneven

Progress

Record Number471819ResolutionNoneProgressNot_StartedPriorityOneActual DateProjected Date06/30/2018

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

East Side

Change in Level South of 3rd Street @ 33.942098286438, -118.132724761963

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	471869	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

West Side

Change in Level North of 3rd Street @ 33.942636775064, -118.132459223270

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	471801	Resolution	None
Progress	Not_Started	Priority	Two

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

West Side

Change in Level North of 3rd Street @ 33.943055102720, -118.132117241621

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

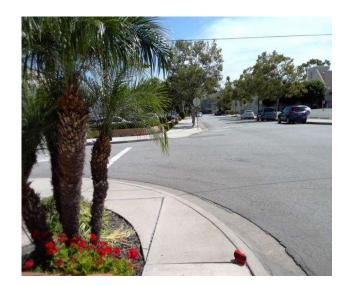

Code Reference ADA 206, 302

Progress

Record Number471802ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2021Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

West Side

Change in Level North of 3rd Street @ 33.943055102720, -118.132117241621

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

 Record Number
 471810
 Resolution
 None

 Progress
 Not_Started
 Priority
 Two

 Actual Date
 Projected Date
 06/30/30

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

West Side

Change in Level North of 4th Street @ 33.943308768489, -118.131905347109

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	471812	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

West Side

Change in Level North of 4th Street @ 33.943504580145, -118.131725639105

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

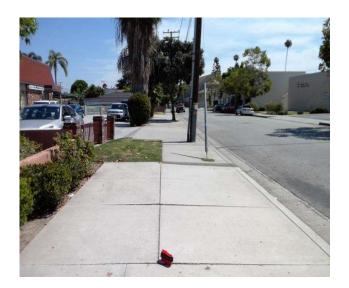

Code Reference ADA 206, 302

Progress

Record Number	471813	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

West Side

Change in Level North of 4th Street @ 33.943513480664, -118.131720274687

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number471817ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2021

Actual Cost \$0.00 Contractor

No Comments

Assignment None **New Value** 0

Designated Staff

Comments

West Side

Change in Level North of 4th Street @ 33.943536844522, -118.131708204746

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302 Notes: Surface is Rough And Uneven

Progress

Record Number471804ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

West Side

Change in Level North of 4th Street @ 33.943906215142, -118.131352812052

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	471811	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

West Side

Change in Level North of 5th Street @ 33.944888599685, -118.130623251200

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.25 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	471807	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

West Side

Change in Level North of 5th Street @ 33.945041018468, -118.130489140749

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	471816	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

West Side

Change in Level North of 5th Street @ 33.945041018468, -118.130489140749

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.25 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	471821	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	

Assignment None **New Value** 0

No Comments

Designated Staff

Comments

West Side

Change in Level North of 5th Street @ 33.945072169718, -118.130463659763

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	471805	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

West Side

Change in Level North of 5th Street @ 33.945072169718, -118.130463659763

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302 Notes: Surface is Rough And Uneven

Progress

Record Number	471815	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Ducineted Date	06/20/2

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

West Side

Change in Level North of 4th Street @ 33.943385535612, -118.131831586361

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number471820ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date12/31/2022

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Northeast Corner of 2nd Street @ 33.941481913045, -118.133229017258

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number	471845	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Northeast Corner of 2nd Street @ 33.941481913045, -118.133229017258

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 8.90 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number	471846	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner of 2nd Street @ 33.941481913045, -118.133229017258

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 4.10 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Record Number	471847	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner of 2nd Street @ 33.941481913045, -118.133229017258

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 44.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number	471848	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 **Contractor**

Comments No Comments

Assignment None New Value 0

Northeast Corner of 3rd Street @ 33.942301888943, -118.132535666227

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number	471850	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Northeast Corner of 3rd Street @ 33.942301888943, -118.132535666227

Curb Ramp : Parallel Curb Ramp Left Side Slope

Finding

The running slope is greater than allowed.

On-Site Finding 10.50 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.2,CA 11B-406

Record Number	471851	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Northeast Corner of 3rd Street @ 33.942301888943, -118.132535666227

Curb Ramp : Parallel Curb Ramp Left Side Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.70 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.3,CA 11B-406.5.7

Record Number	471852	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Northeast Corner of 3rd Street @ 33.942301888943, -118.132535666227

Curb Ramp : Parallel Curb Ramp Right Side Slope

Finding

The running slope is greater than allowed.

On-Site Finding 9.90 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.2,CA 11B-406

Record Number	471853	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner of 3rd Street @ 33.942301888943, -118.132535666227

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Slope

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 3.30 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 402, 406.4, 406.2, 403.3, 406.1, CA 11B-406.5.3

Progress

Record Number	471854	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner of 3rd Street @ 33.942301888943, -118.132535666227

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.90 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3 **Code Reference**

Progress

Record Number	471855	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None

New Value

Northeast Corner of 4th Street @ 33.943127419793, -118.131840974092

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number	471842	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Northeast Corner of 4th Street @ 33.943127419793, -118.131840974092

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 10.70 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

Record Number	471843	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner of 4th Street @ 33.943127419793, -118.131840974092

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 36.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number	471844	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Northeast Corner of 5th Street @ 33.944157653262, -118.130926340818

Curb Ramp : Parallel Curb Ramp Left Side Slope

Finding

The running slope is greater than allowed.

On-Site Finding 9.00 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.2,CA 11B-406

Record Number	471782	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner of 5th Street @ 33.944157653262, -118.130926340818

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 12.60 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Record Number	471783	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner of 5th Street @ 33.944157653262, -118.130926340818

Slope - Parallel Curb Ramp

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.00 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions : Top Landing Right Side

Code Reference ADA 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	471784	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

None

Northeast Corner of 5th Street @ 33.944157653262, -118.130926340818

Length - Parallel Curb Ramp

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 42.50 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Right Side Clear

Code Reference ADA 406.4,CA 11B-406.5.3

Progress

Record Number	471785	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Northwest Corner of 2nd Street @ 33.941569807719, -118.133356422186

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Record Number	471838	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Northwest Corner of 2nd Street @ 33.941569807719, -118.133356422186

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 11.00 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

Record Number	471839	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Northwest Corner of 2nd Street @ 33.941569807719, -118.133356422186

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 6.20 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

Record Number	471840	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None New Value

Northwest Corner of 2nd Street @ 33.941569807719, -118.133356422186

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Record Number	471841	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Northwest Corner of 3rd Street @ 33.942380882133, -118.132699280977

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number	471889	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Northwest Corner of 3rd Street @ 33.942380882133, -118.132699280977

Curb Ramp : Parallel Curb Ramp Left Side Slope

Finding

The running slope is greater than allowed.

On-Site Finding 8.50 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.2,CA 11B-406

Progress

Record Number	471890	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 **Contractor**

Comments No Comments

Assignment None New Value

Northwest Corner of 3rd Street @ 33.942380882133, -118.132699280977

Curb Ramp : Parallel Curb Ramp Right Side Width

Finding

The width of the curb ramp is less than required.

On-Site Finding 36.00 inches

Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1,CA 11B-406.5.2,CA 11B-406

Progress

Record Number	471891	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Northwest Corner of 3rd Street @ 33.942380882133, -118.132699280977

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.00 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	471892	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

New Street - 6th Street to 2nd Street

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

Northwest Corner of 3rd Street @ 33.942380882133, -118.132699280977

Top Landing

Curb Ramp , Landings And Transitions $\,:\,$ Top Landing Right Side Change in Level

Finding

The transition from the top of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.87 inches

Recommendation

Patch the transition area at the top of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$155



Code Reference ADA 303.1

Progress

Record Number471893ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Northwest Corner of 4th Street @ 33.943210862492, -118.131989836693

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Record Number	471897	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Northwest Corner of 4th Street @ 33.943210862492, -118.131989836693

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 8.80 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number	471898	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Northwest Corner of 4th Street @ 33.943210862492, -118.131989836693

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 14.20 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

Record Number	471899	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value

Northwest Corner of 4th Street @ 33.943210862492, -118.131989836693

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 17.30 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

Record Number471900ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Northwest Corner of 4th Street @ 33.943210862492, -118.131989836693

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	471901	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

None

Northwest Corner of 5th Street @ 33.944218843843, -118.131088614464

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 37.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number	471849	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Southeast Corner of 3rd Street @ 33.942182842729, -118.132642954588

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Record Number	471883	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Southeast Corner of 3rd Street @ 33.942182842729, -118.132642954588

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 11.00 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number	471884	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value

Southeast Corner of 3rd Street @ 33.942182842729, -118.132642954588

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 11.50 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Record Number	471885	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Southeast Corner of 3rd Street @ 33.942182842729, -118.132642954588

Curb Ramp - Clear Space

Bottom Landing

Finding

There is less than the required clear space.

On-Site Finding 40.00 inches

Recommendation

Provide sufficient clear space at the bottom of the curb ramp that does not accumulate water.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$255



Curb Ramp , Landings and Transitions : Bottom Landing Of Diagonal

Code Reference ADA 406, 406.6, 406.1, 405.10

Progress

Record Number	471886	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Southeast Corner of 3rd Street @ 33.942182842729, -118.132642954588

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 6.80 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

Record Number471887ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Southeast Corner of 3rd Street @ 33.942182842729, -118.132642954588

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.10 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	471888	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

None

Southeast Corner of 5th Street @ 33.944045284991, -118.131052404642

Slope - Parallel Curb Ramp

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.40 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions : Top Landing Right Side

Code Reference ADA 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	471896	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Southeast Corner of 6th Street @ 33.945073282263, -118.130267858505

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number	471786	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Comments	No Comments		
Assignment	None	New Value	0

Southeast Corner of 6th Street @ 33.945073282263, -118.130267858505

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 15.60 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Record Number	471787	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Southeast Corner of 6th Street @ 33.945073282263, -118.130267858505

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.10 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3,CA 11B-406.5.7

Record Number	471788	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Southeast Corner of 6th Street @ 33.945073282263, -118.130267858505

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 18.10 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

Record Number	471789	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Southeast Corner of 6th Street @ 33.945073282263, -118.130267858505

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 9.60 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

Record Number	471790	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Commonto	No Commonto		

Comments No Comments

Assignment None New Value 0

Southeast Corner of 6th Street @ 33.945073282263, -118.130267858505

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.00 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Record Number	471791	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Southeast Corner of 6th Street @ 33.945073282263, -118.130267858505

Top Landing

Curb Ramp , Landings and Transitions $\,:\,$ Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 24.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number	471792	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Southwest Corner of 3rd Street @ 33.942251822798, -118.132795840502

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number	471894	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Southwest Corner of 3rd Street @ 33.942251822798, -118.132795840502

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 11.80 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

Record Number	471895	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value

Southwest Corner of 5th Street @ 33.944045284991, -118.131052404642

Curb Ramp : Parallel Curb Ramp Left Side Width

Finding

The width of the curb ramp is less than required.

On-Site Finding 44.00 inches

Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1,CA 11B-406.5.2,CA 11B-406

Progress

471779	Resolution	None
Not_Started	Priority	Seven
	Projected Date	06/30/2032
\$0.00	Contractor	
	Not_Started	Not_Started

Comments No Comments

Assignment None New Value 0

Southwest Corner of 5th Street @ 33.944045284991, -118.131052404642

Curb Ramp : Parallel Curb Ramp Right Side Width

Finding

The width of the curb ramp is less than required.

On-Site Finding 41.00 inches

Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1,CA 11B-406.5.2,CA 11B-406

Progress

Record Number	471780	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Southwest Corner of 5th Street @ 33.944045284991, -118.131052404642

Slope - Parallel Curb Ramp

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.90 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions : Top Landing Right Side

Code Reference ADA 406.4, 403.3, 406.1,CA 11B-406.5.3

Record Number	471781	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

New Street - 6th Street to 2nd Street

Sidewalks - Exterior : Sidewalks

East Side

4th Street East Crossing @ 33.943064003286, -118.131906688213

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 6.30 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

Record Number471878ResolutionNoneProgressNot_StartedPrioritySeven

Actual Date Projected Date 06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks

East Side

5th Street East Crossing @ 33.944090899851, -118.131004124880

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 8.00 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

Record Number	471871	Resolution	None
Progress	Not_Started	Priority	Seven

Actual Date Projected Date 06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Curb Southeast Corner of 4th Street @ 33.942999474161, -118.131953626871

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

Finding

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



Code Reference ADA 402, 303, 406, 403.4, 303.4

Progress

Record Number	471868	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

East Side

Driveway South of 3rd Street @ 33.941788987712, -118.132972866297

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number471881ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

East Side

Driveway South of 3rd Street @ 33.941892458274, -118.132893741131

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	471874	Resolution	None
Progress	Not_Started	Priority	Seven

Actual Date Projected Date 06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

East Side

Driveway South of 3rd Street @ 33.942017067817, -118.132805228233

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	471882	Resolution	None
Progress	Not_Started	Priority	Seven

Actual Date Projected Date 06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

East Side

Driveway South of 4th Street @ 33.942415372095, -118.132479339838

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	471872	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of 4th Street @ 33.942415372095, -118.132479339838

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 13.60 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471873	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

East Side

Driveway South of 4th Street @ 33.942810336788, -118.132136017084

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found


Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings

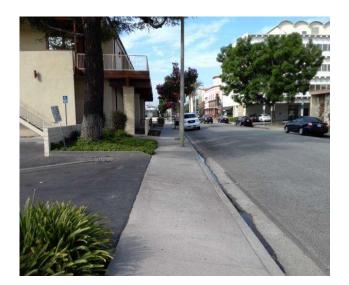

Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number471876ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of 4th Street @ 33.942810336788, -118.132136017084

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 13.90 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471877	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

East Side

Driveway South of 5th Street @ 33.943609161185, -118.131434619427

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	471875	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

East Side

Driveway South of 6th Street @ 33.944224406621, -118.130896836519

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	471879	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

East Side

Driveway South of 6th Street @ 33.944224406621, -118.130896836519

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 13.30 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471880	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

East Side

Sidewalk South of 5th Street @ 33.943274278889, -118.131749778986

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 42.00 inches for 4.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-403.5.1

Progress

Record Number	471866	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

East Side

Sidewalk South of 5th Street @ 33.943337695239, -118.131680041552

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 42.00 inches for 4.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-403.5.1

Progress

Record Number	471867	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

East Side

Sidewalk South of 5th Street @ 33.943393323577, -118.131633102894

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 42.00 inches for 4.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-403.5.1

Progress

Record Number	471861	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

East Side

Sidewalk South of 5th Street @ 33.943472315755, -118.131576776505

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 42.00 inches for 4.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



0

Code Reference ADA 206, 302,CA 11B-403.5.1

Progress

Record Number	471864	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

New Value

Actual Cost \$0.00 Contractor

None

Comments No Comments

Designated Staff

Assignment

East Side

Sidewalk South of 5th Street @ 33.943541294780, -118.131507039070

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 42.00 inches for 4.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-403.5.1

Progress

Record Number	471860	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

East Side

Sidewalk South of 5th Street @ 33.943721530032, -118.131344765425

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 42.00 inches for 4.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-403.5.1

Progress

Record Number	471859	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South of 5th Street @ 33.943783833488, -118.131295144558

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 42.00 inches for 4.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-403.5.1

Progress

Record Number	471862	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

East Side

Sidewalk South of 5th Street @ 33.943892864425, -118.131186515093

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 42.00 inches for 4.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-403.5.1

Progress

Record Number	471857	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

East Side

Sidewalk South of 5th Street @ 33.943940704486, -118.131142258644

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 42.00 inches for 4.00 feet


Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260

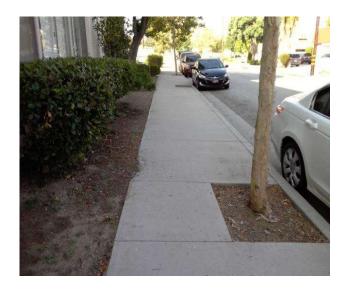

Code Reference ADA 206, 302,CA 11B-403.5.1

Progress

Record Number	471858	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of 5th Street @ 33.944038609643, -118.131075203419

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.80 percent for 166.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471863	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of 6th Street @ 33.945073282263, -118.130267858505

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.30 percent for 320.00 feet


Recommendation

Repave the sidewalk surface with the recommended cross slope.

Up to 2.08 percent Recommendation

Costing Info (Estimated)

Repave surface \$1,092

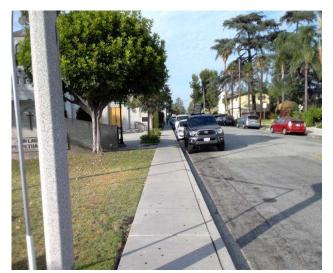

0

Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471865	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Actual Cost \$0.00

No Comments

Assignment New Value None

Designated Staff

Comments

East Side @ 33.945055481550, -118.130301386118

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

Record Number	471856	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

West Side

4th Street West Crossing @ 33.943137432921, -118.132046163082

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 6.00 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

Record Number	471837	Resolution	None
Progress	Not_Started	Priority	Seven

Actual Date Projected Date 06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks

West Side

5th Street West Crossing @ 33.944152090480, -118.131134212017

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 6.60 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

Record Number	471836	Resolution	None
Progress	Not_Started	Priority	Seven

Actual Date Projected Date 06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Curb Southwest Corner of 4th Street @ 33.943082916986, -118.132099807262

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

Finding

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



Code Reference ADA 402, 303, 406, 403.4, 303.4

Progress

Record Number	471818	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

West Side

Driveway North of 2nd Street @ 33.941773411487, -118.133198171854

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found


Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings

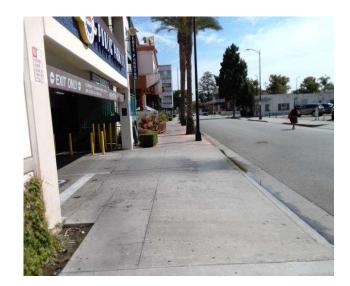

Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	471828	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

West Side

Driveway North of 2nd Street @ 33.941773411487, -118.133198171854

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 4.20 percent


Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

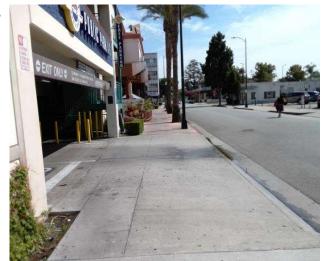

Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471829	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

West Side

Driveway North of 3rd Street @ 33.942553331802, -118.132528960705

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	471826	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

West Side

Driveway North of 3rd Street @ 33.942553331802, -118.132528960705

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 12.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



0

Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471827	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

No Comments

Assignment None New Value

Designated Staff

Comments

West Side

Driveway North of 3rd Street @ 33.942694629011, -118.132410943508

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings

atio



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Comments

Record Number471823ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Actual Cost \$0.00 Contracto

No Comments

Assignment None **New Value** 0

West Side

Driveway North of 3rd Street @ 33.942694629011, -118.132410943508

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 13.30 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471824	Resolution	None
Progress	Not_Started	Priority	Seven
Astual Data		Ducinated Data	06/20/202

Actual Date Projected Date 06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

West Side

Driveway North of 4th Street @ 33.943385535612, -118.131831586361

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 4.20 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471825	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

West Side

Driveway North of 4th Street @ 33.943612498876, -118.131630420685

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	471834	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

West Side

Driveway North of 4th Street @ 33.943612498876, -118.131630420685

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 6.60 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471835	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of 4th Street @ 33.943776045558, -118.131478875875

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	471832	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

\$0.00 Contractor **Actual Cost**

Comments No Comments

Assignment **New Value** 0 None

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of 4th Street @ 33.943776045558, -118.131478875875

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 6.50 percent


Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

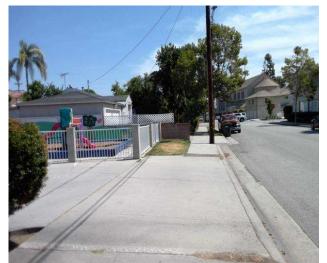

Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471833	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of 5th Street @ 33.944571523240, -118.130839169025

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found


Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190 warnings

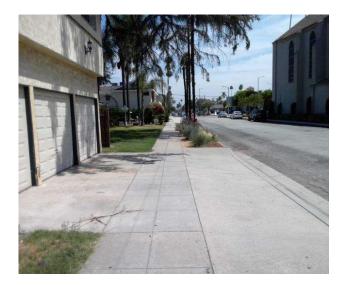

Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	471830	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of 5th Street @ 33.944571523240, -118.130839169025

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471831	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

West Side

Guy Wire North of 4th Street @ 33.943536844522, -118.131708204746

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 65.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Progress

Record Number	471800	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

West Side

Sidewalk North of 3rd Street @ 33.942636775064, -118.132459223270

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.80 percent for 202.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471797	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

West Side

Sidewalk North of 4th Street @ 33.943308768489, -118.131905347109

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.70 percent for 33.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471798	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

New Street - 6th Street to 2nd Street

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of 4th Street @ 33.943513480664, -118.131720274687

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 6.00 percent for 35.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471796	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

West Side

Sidewalk North of 4th Street @ 33.943827223367, -118.131438642740

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 8.80 percent for 110.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471793	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

West Side

Sidewalk North of 5th Street @ 33.944238869841, -118.131077885628

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.70 percent for 91.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471799	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

West Side

Sidewalk North of 5th Street @ 33.944622700571, -118.130812346935

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.60 percent for 243.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	471794	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

No Comments

Assignment None New Value 0

Designated Staff

Comments

Sidewalks - Exterior : Sidewalks

West Side

Sidewalk North of 5th Street @ 33.944622700571, -118.130812346935

Sidewalks : Opening

Finding

Ground surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the surface opening does not allow passage of a sphere more than ½ inch in diameter.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 302

Progress

Record Number471795ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

West Side

Sign North of 3rd Street @ 33.942405358882, -118.132667094469

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 40.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1,CA 11B-403.5

Progress

Record Number	471808	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

West Side

Sign North of 3rd Street @ 33.942675715225, -118.132435083389

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 38.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1,CA 11B-403.5

Progress

Record Number	471814	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

West Side

Sign North of 3rd Street @ 33.942958309004, -118.132185637951

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 38.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1,CA 11B-403.5

Progress

Record Number	471806	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

West Side

Utility Pole North of 4th Street @ 33.943569108887, -118.131654560566

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 45.50 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1,CA 11B-403.5

Progress

Record Number	471803	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0



New Street - 6th Street to 2nd Street

6th Street to 2nd Street Downey, CA 90242

Date of Inspection 7/19/2017

*Estimated Facility Total: \$101,678

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using

