

## Accessibility Survey

---



### City of Downey

### Dunrobin Avenue - Foster Road to Washburn Road

Dunrobin Avenue - Foster Road to Washburn Road  
Downey, CA 90424

Date of Inspection  
12/6/2016

Prepared By

**Disability Access Consultants**

(800) 743-7067

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks , Change in Level**

---

**East Side**

**Change In Level South Of Angell Street @ 33.910265779433, -118.120931088924**

Sidewalks , Change in Level : Change in Level Non Beveled

**Finding**

There is a change in elevation greater than recommended value.

**On-Site Finding** 2.50 inches

**Recommendation**

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)**

Remove tripping hazards \$198



**Code Reference** ADA 206, 302

**Progress**

---

<b>Record Number</b>	316843	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	One
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2018
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks , Change in Level**

---

**West Side**

**Change In Level North Of Foster Road @ 33.910528446835, -118.121121525764**

Sidewalks , Change in Level : Change in Level Non Beveled

**Finding**

There is a change in elevation greater than recommended value.

**On-Site Finding** 1.37 inches

**Recommendation**

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)**

Remove tripping hazards \$198



**Code Reference** ADA 206, 302

**Progress**

---

<b>Record Number</b>	315693	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	One
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2018
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks , Change in Level**

---

**East Side**

**Change In Level South Of Angell Street @ 33.911572430454, -118.120941817760**

Sidewalks , Change in Level : Change in Level Non Beveled

**Finding**

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.62 inches

**Recommendation**

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)**

Remove tripping hazards \$198



**Code Reference** ADA 206, 302

**Progress**

---

<b>Record Number</b>	316841	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Two
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2021
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks , Change in Level**

---

**East Side**

**Change In Level South Of Washburn Road @ 33.924157102913, -118.121826359**

Sidewalks , Change in Level : Change in Level Non Beveled

**Finding**

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.50 inches

**Recommendation**

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)**

Remove tripping hazards \$198



**Code Reference** ADA 206, 302

**Progress**

---

<b>Record Number</b>	315745	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Two
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2021
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks , Change in Level**

---

**West Side**

**Change In Level North Of Adoree Street @ 33.914802243353, -118.121121525764**

Sidewalks , Change in Level : Change in Level Non Beveled

**Finding**

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.50 inches

**Recommendation**

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)**

Remove tripping hazards \$198



**Code Reference** ADA 206, 302

**Progress**

---

<b>Record Number</b>	315687	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Two
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2021
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Change in Level

---

#### West Side

**Change In Level North Of Imperial Highway @ 33.917620160681, - 118.121129572392**

Sidewalks , Change in Level : Change in Level Non Beveled

#### Finding

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.50 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### Costing Info (Estimated)

Remove tripping hazards \$198



**Code Reference** ADA 206, 302

#### Progress

---

<b>Record Number</b>	315688	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Two
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2021
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks , Change in Level**

---

**West Side**

**Change In Level North Of Spry Street @ 33.921323821813, -118.121145665646**

Sidewalks , Change in Level : Change in Level Non Beveled

**Finding**

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.62 inches

**Recommendation**

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)**

Remove tripping hazards \$198



**Code Reference** ADA 206, 302

**Progress**

---

<b>Record Number</b>	315691	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Two
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2021
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			



## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Change in Level

---

#### East Side

#### Change In Level South Of Imperial Highway @ 33.916206761979, - 118.120955228806

Sidewalks , Change in Level : Change in Level Non Beveled

#### Finding

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.37 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### Costing Info (Estimated)

Remove tripping hazards \$198



**Code Reference** ADA 206, 302

#### Progress

---

<b>Record Number</b>	316840	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Three
<b>Actual Date</b>		<b>Projected Date</b>	12/31/2022
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings And Transitions**

---

**Northeast Corner Of Adoree Street @ 33.914185672398, -  
118.120928406715**

**Bottom Landing**

**Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** 0.75 inches

**Recommendation**

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

**Costing Info (Estimated)**

Patch lip at curb ramp \$255

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level



**Code Reference** ADA 302, 303, 406.2, 303.1

**Progress**

---

<b>Record Number</b>	316876	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Northeast Corner Of Adoree Street @ 33.914185672398, - 118.120928406715**

**Top Landing**

Curb Ramp , Landings and Transitions : Top Landing Slope

**Finding**

The slope at the top landing is greater than allowed.

**On-Site Finding** 2.80 percent

**Recommendation**

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)**

Provide compliant landing \$1,260



**Code Reference** ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

**Progress**

---

<b>Record Number</b>	316877	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

**Northeast Corner Of Adoree Street @ 33.914185672398, - 118.120928406715**

**Top Landing**

**Finding**

There is not enough top landing clear length.

**On-Site Finding** 47.00 inches

**Recommendation**

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

**Costing Info (Estimated)**

Provide compliant landing \$240

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings



**Code Reference** ADA 406, 406.4,CA 11B-406.5.3

**Progress**

<b>Record Number</b>	316878	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northeast Corner Of Adoree Street @ 33.914185672398, - 118.120928406715**

Curb Ramp : No Detectable Warnings

**Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

**Recommendation**

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

**Costing Info (Estimated)**

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

**Progress**

<b>Record Number</b>	326317	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northeast Corner Of Adoree Street @ 33.914185672398, - 118.120928406715**

Curb Ramp : Curb Ramp Slope

**Finding**

The running slope is greater than allowed.

**On-Site Finding** 12.80 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

**Progress**

<b>Record Number</b>	326318	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northeast Corner Of Adoree Street @ 33.914185672398, - 118.120928406715**

Curb Ramp : Side Flare Slope

**Finding**

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 14.70 percent

**Recommendation**

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)**

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3,CA 11B-406.2.2

**Progress**

<b>Record Number</b>	326319	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northeast Corner Of Angell Street @ 33.912954743032, - 118.120936453342**

Curb Ramp : No Detectable Warnings

**Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

**Recommendation**

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

**Costing Info (Estimated)**

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

**Progress**

<b>Record Number</b>	316865	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			



**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northeast Corner Of Angell Street @ 33.912954743032, - 118.120936453342**

Curb Ramp : Curb Ramp Slope

**Finding**

The running slope is greater than allowed.

**On-Site Finding** 8.80 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

**Progress**

<b>Record Number</b>	316866	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Curb Ramps - Exterior : Curb Ramp

**Northeast Corner Of Angell Street @ 33.912954743032, -  
118.120936453342**

Curb Ramp : Curb Ramp - Cross Slope

#### Finding

The cross slope is greater than allowed.

**On-Site Finding** 2.60 percent

#### Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

#### Costing Info (Estimated)

Install curb ramp \$1,300



**Code Reference** ADA 402, 406.1, 405.3, CA 11B-406.5.7

#### Progress

<b>Record Number</b>	316867	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Curb Ramps - Exterior : Curb Ramp

#### Northeast Corner Of Angell Street @ 33.912954743032, - 118.120936453342

Curb Ramp : Side Flare Slope

#### Finding

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 11.70 percent

#### Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

#### Costing Info (Estimated)

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3, CA 11B-406.2.2

### Progress

<b>Record Number</b>	316868	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Curb Ramps - Exterior : Curb Ramp

---

#### Northeast Corner Of Foster Road

Curb Ramp : Detectable Warnings Depth

#### Finding

Depth of detectable warnings is not compliant.

**On-Site Finding** 35.00 inches

#### Recommendation

Provide compliant detectable warnings.

Recommendation At least 36.00 inches

#### Costing Info (Estimated)

Install compliant detectable warnings \$190



**Code Reference** CA 11B-705.1.2.2, ADA 705.1.2.2

#### Progress

---

<b>Record Number</b>	316869	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Curb Ramps - Exterior : Curb Ramp

---

#### Northeast Corner Of Foster Road

Curb Ramp : Detectable Warning Domes Direction

#### Finding

Detectable warning domes are not aligned in the direction of travel.

**On-Site Finding** Not Compliant

#### Recommendation

Provide compliant detectable warnings with domes aligned in the direction of travel.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install compliant detectable warnings \$190



#### Code Reference

#### Progress

---

<b>Record Number</b>	316870	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Northeast Corner Of Foster Road @ 33.909891810888, - 118.120925724506**

**Bottom Landing**

Curb Ramp , Landings and Transitions : Bottom Landing Slope

**Finding**

The slope at the bottom landing is greater than allowed.

**On-Site Finding** 4.40 percent

**Recommendation**

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)**

Provide compliant landing \$240



**Code Reference** ADA 402, 406.4, 406.2, 403.3, 406.1, CA 11B-406.5.3

**Progress**

---

<b>Record Number</b>	316871	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northeast Corner Of Spry Street @ 33.920807455640, - 118.120947182179**

Curb Ramp : No Detectable Warnings

**Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

**Recommendation**

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

**Costing Info (Estimated)**

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

**Progress**

<b>Record Number</b>	315737	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northeast Corner Of Spry Street @ 33.920807455640, - 118.120947182179**

Curb Ramp : Curb Ramp Slope

**Finding**

The running slope is greater than allowed.

**On-Site Finding** 10.50 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

**Progress**

<b>Record Number</b>	315738	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			



**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northeast Corner Of Spry Street @ 33.920807455640, - 118.120947182179**

Curb Ramp : Side Flare Slope

**Finding**

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 10.50 percent

**Recommendation**

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)**

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3,CA 11B-406.2.2

**Progress**

<b>Record Number</b>	315739	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northeast Corner Of Spry Street @ 33.920807455640, - 118.120947182179**

**Bottom Landing**

Curb Ramp : Bottom Landing Slope

**Finding**

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

**On-Site Finding** 9.10 percent

**Recommendation**

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)**

Repave landing \$1,260



**Code Reference** ADA 406, 406.2, CA 11B-406.5.8

**Progress**

<b>Record Number</b>	315740	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings And Transitions**

---

**Northeast Corner Of Spry Street @ 33.920807455640, - 118.120947182179**

**Bottom Landing**

**Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** 0.62 inches

**Recommendation**

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

**Costing Info (Estimated)**

Patch lip at curb ramp \$255

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level



**Code Reference** ADA 302, 303, 406.2, 303.1

**Progress**

---

<b>Record Number</b>	315741	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Northeast Corner Of Spry Street @ 33.920807455640, - 118.120947182179**

**Top Landing**

Curb Ramp , Landings and Transitions : Top Landing Slope

**Finding**

The slope at the top landing is greater than allowed.

**On-Site Finding** 3.40 percent

**Recommendation**

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)**

Provide compliant landing \$1,260



**Code Reference** ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

**Progress**

---

<b>Record Number</b>	315742	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northwest Corner Of Adoree Street @ 33.914154509848, - 118.121116161346**

Curb Ramp : No Detectable Warnings

**Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

**Recommendation**

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

**Costing Info (Estimated)**

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

**Progress**

<b>Record Number</b>	315752	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northwest Corner Of Adoree Street @ 33.914154509848, - 118.121116161346**

Curb Ramp : Curb Ramp Slope

**Finding**

The running slope is greater than allowed.

**On-Site Finding** 10.00 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

**Progress**

<b>Record Number</b>	315753	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northwest Corner Of Adoree Street @ 33.914154509848, - 118.121116161346**

Curb Ramp : Side Flare Slope

**Finding**

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 12.30 percent

**Recommendation**

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)**

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3,CA 11B-406.2.2

**Progress**

<b>Record Number</b>	315754	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Northwest Corner Of Adoree Street @ 33.914154509848, -  
118.121116161346**

**Bottom Landing**

**Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** Not Beveled

**Recommendation**

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

**Costing Info (Estimated)**

Patch lip at curb ramp \$255

Curb Ramp , Landings and Transitions : Bottom Landing Change in Level - Curb Ramps



**Code Reference** ADA 302, 406.2

**Progress**

---

<b>Record Number</b>	315755	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			



**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northwest Corner Of Angell Street @ 33.912896868881, - 118.121132254601**

Curb Ramp : No Detectable Warnings

**Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

**Recommendation**

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

**Costing Info (Estimated)**

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

**Progress**

<b>Record Number</b>	315756	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northwest Corner Of Angell Street @ 33.912896868881, - 118.121132254601**

Curb Ramp : Curb Ramp Slope

**Finding**

The running slope is greater than allowed.

**On-Site Finding** 9.40 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

**Progress**

<b>Record Number</b>	315757	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northwest Corner Of Angell Street @ 33.912896868881, - 118.121132254601**

Curb Ramp : Side Flare Slope

**Finding**

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 11.00 percent

**Recommendation**

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)**

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3,CA 11B-406.2.2

**Progress**

<b>Record Number</b>	315758	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings And Transitions**

---

**Northwest Corner Of Angell Street @ 33.912896868881, - 118.121132254601**

**Bottom Landing**

**Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** 0.62 inches

**Recommendation**

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

**Costing Info (Estimated)**

Patch lip at curb ramp \$255

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level



**Code Reference** ADA 302, 303, 406.2, 303.1

**Progress**

---

<b>Record Number</b>	315759	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northwest Corner Of Spry Street @ 33.920633849069, - 118.121148347855**

Curb Ramp : No Detectable Warnings

**Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

**Recommendation**

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

**Costing Info (Estimated)**

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

**Progress**

<b>Record Number</b>	315704	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northwest Corner Of Spry Street @ 33.920633849069, - 118.121148347855**

Curb Ramp : Curb Ramp Slope

**Finding**

The running slope is greater than allowed.

**On-Site Finding** 12.60 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

**Progress**

<b>Record Number</b>	315705	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northwest Corner Of Spry Street @ 33.920633849069, - 118.121148347855**

Curb Ramp : Side Flare Slope

**Finding**

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 12.90 percent

**Recommendation**

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)**

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3,CA 11B-406.2.2

**Progress**

<b>Record Number</b>	315706	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Northwest Corner Of Spry Street @ 33.920633849069, - 118.121148347855**

**Bottom Landing**

Curb Ramp : Bottom Landing Slope

**Finding**

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

**On-Site Finding** 9.20 percent

**Recommendation**

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)**

Repave landing \$1,260



**Code Reference** ADA 406, 406.2, CA 11B-406.5.8

**Progress**

<b>Record Number</b>	315707	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			



**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings And Transitions**

---

**Northwest Corner Of Spry Street @ 33.920633849069, -  
118.121148347855**

**Bottom Landing**

**Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** 0.62 inches

**Recommendation**

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

**Costing Info (Estimated)**

Patch lip at curb ramp \$255

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level



**Code Reference** ADA 302, 303, 406.2, 303.1

**Progress**

---

<b>Record Number</b>	315708	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southeast Corner Of Adoree Street @ 33.914036537237, - 118.120928406715**

Curb Ramp : No Detectable Warnings

**Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

**Recommendation**

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

**Costing Info (Estimated)**

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

**Progress**

<b>Record Number</b>	316859	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southeast Corner Of Adoree Street @ 33.914036537237, - 118.120928406715**

Curb Ramp : Curb Ramp Slope

**Finding**

The running slope is greater than allowed.

**On-Site Finding** 10.70 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

**Progress**

<b>Record Number</b>	316860	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Curb Ramps - Exterior : Curb Ramp

#### **Southeast Corner Of Adoree Street @ 33.914036537237, - 118.120928406715**

Curb Ramp : Side Flare Slope

#### **Finding**

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 10.60 percent

#### **Recommendation**

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

#### **Costing Info (Estimated)**

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3,CA 11B-406.2.2

### **Progress**

<b>Record Number</b>	316861	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southeast Corner Of Adoree Street @ 33.914036537237, - 118.120928406715**

**Bottom Landing**

Curb Ramp : Bottom Landing Slope

**Finding**

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

**On-Site Finding** 9.80 percent

**Recommendation**

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)**

Repave landing \$1,260



**Code Reference** ADA 406, 406.2, CA 11B-406.5.8

**Progress**

<b>Record Number</b>	316862	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Southeast Corner Of Adoree Street @ 33.914036537237, - 118.120928406715**

**Bottom Landing**

**Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** Not Beveled

**Recommendation**

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

**Costing Info (Estimated)**

Patch lip at curb ramp \$255

Curb Ramp , Landings and Transitions : Bottom Landing Change in Level - Curb Ramps



**Code Reference** ADA 302, 406.2

**Progress**

---

<b>Record Number</b>	316863	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Southeast Corner Of Adoree Street @ 33.914036537237, - 118.120928406715**

**Top Landing**

Curb Ramp , Landings and Transitions : Top Landing Slope

**Finding**

The slope at the top landing is greater than allowed.

**On-Site Finding** 3.10 percent

**Recommendation**

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)**

Provide compliant landing \$1,260



**Code Reference** ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

**Progress**

---

<b>Record Number</b>	316864	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southeast Corner Of Angell Street @ 33.912790024191, - 118.120923042297**

Curb Ramp : No Detectable Warnings

**Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

**Recommendation**

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

**Costing Info (Estimated)**

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

**Progress**

<b>Record Number</b>	316853	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			



**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southeast Corner Of Angell Street @ 33.912790024191, - 118.120923042297**

Curb Ramp : Curb Ramp Slope

**Finding**

The running slope is greater than allowed.

**On-Site Finding** 13.10 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

**Progress**

<b>Record Number</b>	316854	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southeast Corner Of Angell Street @ 33.912790024191, - 118.120923042297**

Curb Ramp : Side Flare Slope

**Finding**

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 13.90 percent

**Recommendation**

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)**

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3,CA 11B-406.2.2

**Progress**

<b>Record Number</b>	316855	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Southeast Corner Of Angell Street @ 33.912790024191, - 118.120923042297**

**Bottom Landing**

**Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** Not Beveled

**Recommendation**

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

**Costing Info (Estimated)**

Patch lip at curb ramp \$255

Curb Ramp , Landings and Transitions : Bottom Landing Change in Level - Curb Ramps



**Code Reference** ADA 302, 406.2

**Progress**

---

<b>Record Number</b>	316856	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southeast Corner Of Imperial Highway Service Road @ 33.916825544138, -118.120944499969**

Curb Ramp : Side Flare Slope

**Finding**

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 10.60 percent

**Recommendation**

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)**

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3,CA 11B-406.2.2

**Progress**

<b>Record Number</b>	316857	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

**Southeast Corner Of Imperial Highway Service Road @ 33.916825544138, -118.120944499969**

**Top Landing**

Curb Ramp , Landings and Transitions : Top Landing Slope

**Finding**

The slope at the top landing is greater than allowed.

**On-Site Finding** 3.80 percent

**Recommendation**

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)**

Provide compliant landing \$1,260



**Code Reference** ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

**Progress**

<b>Record Number</b>	316858	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southeast Corner Of Spry Street @ 33.920638300524, - 118.120955228806**

Curb Ramp : No Detectable Warnings

**Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

**Recommendation**

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

**Costing Info (Estimated)**

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

**Progress**

<b>Record Number</b>	315709	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southeast Corner Of Spry Street @ 33.920638300524, - 118.120955228806**

Curb Ramp : Curb Ramp Slope

**Finding**

The running slope is greater than allowed.

**On-Site Finding** 13.80 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

**Progress**

<b>Record Number</b>	315710	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southeast Corner Of Spry Street @ 33.920638300524, - 118.120955228806**

Curb Ramp : Side Flare Slope

**Finding**

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 17.50 percent

**Recommendation**

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)**

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3,CA 11B-406.2.2

**Progress**

<b>Record Number</b>	315711	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			



**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southeast Corner Of Spry Street @ 33.920638300524, - 118.120955228806**

**Bottom Landing**

Curb Ramp : Bottom Landing Slope

**Finding**

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

**On-Site Finding** 8.10 percent

**Recommendation**

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)**

Repave landing \$1,260



**Code Reference** ADA 406, 406.2, CA 11B-406.5.8

**Progress**

<b>Record Number</b>	315712	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings And Transitions**

---

**Southeast Corner Of Spry Street @ 33.920638300524, - 118.120955228806**

**Bottom Landing**

**Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** 0.62 inches

**Recommendation**

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

**Costing Info (Estimated)**

Patch lip at curb ramp \$255

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level



**Code Reference** ADA 302, 303, 406.2, 303.1

**Progress**

---

<b>Record Number</b>	315713	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Southeast Corner Of Spry Street @ 33.920638300524, - 118.120955228806**

**Top Landing**

Curb Ramp , Landings and Transitions : Top Landing Slope

**Finding**

The slope at the top landing is greater than allowed.

**On-Site Finding** 2.70 percent

**Recommendation**

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)**

Provide compliant landing \$1,260



**Code Reference** ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

**Progress**

---

<b>Record Number</b>	315714	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southeast Corner Of Washburn Road @ 33.924250579552, - 118.121014237404**

Curb Ramp : No Detectable Warnings

**Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

**Recommendation**

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

**Costing Info (Estimated)**

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

**Progress**

<b>Record Number</b>	315730	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southeast Corner Of Washburn Road @ 33.924250579552, - 118.121014237404**

Curb Ramp : Curb Ramp Slope

**Finding**

The running slope is greater than allowed.

**On-Site Finding** 15.20 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

**Progress**

<b>Record Number</b>	315731	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southeast Corner Of Washburn Road @ 33.924250579552, - 118.121014237404**

Curb Ramp : Curb Ramp - Cross Slope

**Finding**

The cross slope is greater than allowed.

**On-Site Finding** 3.60 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 402, 406.1, 405.3, CA 11B-406.5.7

**Progress**

<b>Record Number</b>	315732	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southeast Corner Of Washburn Road @ 33.924250579552, - 118.121014237404**

Curb Ramp : Side Flare Slope

**Finding**

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 14.00 percent

**Recommendation**

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)**

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3,CA 11B-406.2.2

**Progress**

<b>Record Number</b>	315733	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southeast Corner Of Washburn Road @ 33.924250579552, - 118.121014237404**

**Bottom Landing**

Curb Ramp : Bottom Landing Slope

**Finding**

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

**On-Site Finding** 6.00 percent

**Recommendation**

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)**

Repave landing \$1,260



**Code Reference** ADA 406, 406.2, CA 11B-406.5.8

**Progress**

<b>Record Number</b>	315734	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			



**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings And Transitions**

---

**Southeast Corner Of Washburn Road @ 33.924250579552, - 118.121014237404**

**Bottom Landing**

**Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** 0.62 inches

**Recommendation**

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

**Costing Info (Estimated)**

Patch lip at curb ramp \$255

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level



**Code Reference** ADA 302, 303, 406.2, 303.1

**Progress**

---

<b>Record Number</b>	315735	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Southeast Corner Of Washburn Road @ 33.924250579552, - 118.121014237404**

**Top Landing**

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

**Finding**

There is not enough top landing clear length.

**On-Site Finding** 32.00 inches

**Recommendation**

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

**Costing Info (Estimated)**

Provide compliant landing \$240



**Code Reference** ADA 406, 406.4,CA 11B-406.5.3

**Progress**

---

<b>Record Number</b>	315736	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Adoree Street @ 33.914032085437, - 118.121137619019**

Curb Ramp : No Detectable Warnings

**Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

**Recommendation**

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

**Costing Info (Estimated)**

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

**Progress**

<b>Record Number</b>	315698	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Adoree Street @ 33.914032085437, - 118.121137619019**

Curb Ramp : Curb Ramp Slope

**Finding**

The running slope is greater than allowed.

**On-Site Finding** 8.50 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

**Progress**

<b>Record Number</b>	315699	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Adoree Street @ 33.914032085437, - 118.121137619019**

Curb Ramp : Side Flare Slope

**Finding**

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 14.10 percent

**Recommendation**

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)**

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3,CA 11B-406.2.2

**Progress**

<b>Record Number</b>	315700	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Adoree Street @ 33.914032085437, - 118.121137619019**

**Bottom Landing**

Curb Ramp : Bottom Landing Slope

**Finding**

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

**On-Site Finding** 7.80 percent

**Recommendation**

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)**

Repave landing \$1,260



**Code Reference** ADA 406, 406.2, CA 11B-406.5.8

**Progress**

<b>Record Number</b>	315701	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Southwest Corner Of Adoree Street @ 33.914032085437, -  
118.121137619019**

**Bottom Landing**

**Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** Not Beveled

**Recommendation**

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

**Costing Info (Estimated)**

Patch lip at curb ramp \$255

Curb Ramp , Landings and Transitions : Bottom Landing Change in Level - Curb Ramps



**Code Reference** ADA 302, 406.2

**Progress**

---

<b>Record Number</b>	315702	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Southwest Corner Of Adoree Street @ 33.914032085437, -  
118.121137619019**

**Top Landing**

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

**Finding**

There is not enough top landing clear length.

**On-Site Finding** 40.00 inches

**Recommendation**

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

**Costing Info (Estimated)**

Provide compliant landing \$240



**Code Reference** ADA 406, 406.4,CA 11B-406.5.3

**Progress**

---

<b>Record Number</b>	315703	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			



**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Angell Street @ 33.912774442663, - 118.121129572392**

Curb Ramp : No Detectable Warnings

**Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

**Recommendation**

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

**Costing Info (Estimated)**

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

**Progress**

<b>Record Number</b>	315724	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Angell Street @ 33.912774442663, - 118.121129572392**

Curb Ramp : Curb Ramp Slope

**Finding**

The running slope is greater than allowed.

**On-Site Finding** 11.90 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

**Progress**

<b>Record Number</b>	315725	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Angell Street @ 33.912774442663, - 118.121129572392**

Curb Ramp : Side Flare Slope

**Finding**

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 11.50 percent

**Recommendation**

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)**

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3,CA 11B-406.2.2

**Progress**

<b>Record Number</b>	315726	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Angell Street @ 33.912774442663, - 118.121129572392**

**Bottom Landing**

Curb Ramp : Bottom Landing Slope

**Finding**

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

**On-Site Finding** 6.10 percent

**Recommendation**

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)**

Repave landing \$1,260



**Code Reference** ADA 406, 406.2, CA 11B-406.5.8

**Progress**

<b>Record Number</b>	315727	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Southwest Corner Of Angell Street @ 33.912774442663, -  
118.121129572392**

**Bottom Landing**

**Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** Not Beveled

**Recommendation**

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

**Costing Info (Estimated)**

Patch lip at curb ramp \$255

Curb Ramp , Landings and Transitions : Bottom Landing Change in Level - Curb Ramps



**Code Reference** ADA 302, 406.2

**Progress**

---

<b>Record Number</b>	315728	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Southwest Corner Of Angell Street @ 33.912774442663, -  
118.121129572392**

**Top Landing**

Curb Ramp , Landings and Transitions : Top Landing Slope

**Finding**

The slope at the top landing is greater than allowed.

**On-Site Finding** 3.00 percent

**Recommendation**

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)**

Provide compliant landing \$1,260



**Code Reference** ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

**Progress**

---

<b>Record Number</b>	315729	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Curb Ramps - Exterior : Curb Ramp

#### Southwest Corner Of Foster Road

Curb Ramp : Detectable Warnings Depth

#### Finding

Depth of detectable warnings is not compliant.

**On-Site Finding** 35.00 inches

#### Recommendation

Provide compliant detectable warnings.

Recommendation At least 36.00 inches

#### Costing Info (Estimated)

Install compliant detectable warnings \$190



**Code Reference** CA 11B-705.1.2.2, ADA 705.1.2.2

#### Progress

<b>Record Number</b>	315767	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Curb Ramps - Exterior : Curb Ramp

#### Southwest Corner Of Foster Road

Curb Ramp : Detectable Warning Domes Direction

#### Finding

Detectable warning domes are not aligned in the direction of travel.

**On-Site Finding** Not Compliant

#### Recommendation

Provide compliant detectable warnings with domes aligned in the direction of travel.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install compliant detectable warnings \$190



#### Code Reference

#### Progress

<b>Record Number</b>	315768	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			



**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

**Southwest Corner Of Foster Road @ 33.909882906855, - 118.121137619019**

**Bottom Landing**

Curb Ramp , Landings and Transitions : Bottom Landing Slope

**Finding**

The slope at the bottom landing is greater than allowed.

**On-Site Finding** 5.80 percent

**Recommendation**

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)**

Provide compliant landing \$240



**Code Reference** ADA 402, 406.4, 406.2, 403.3, 406.1, CA 11B-406.5.3

**Progress**

<b>Record Number</b>	315769	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Imperial Highway Service Road @  
33.916818866657, -118.121140301228**

**Bottom Landing**

Curb Ramp : Bottom Landing Slope

**Finding**

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

**On-Site Finding** 6.00 percent

**Recommendation**

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)**

Repave landing \$1,260



**Code Reference** ADA 406, 406.2, CA 11B-406.5.8

**Progress**

<b>Record Number</b>	315722	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Southwest Corner Of Imperial Highway Service Road @  
33.916818866657, -118.121140301228**

**Bottom Landing**

**Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** Not Beveled

**Recommendation**

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

**Costing Info (Estimated)**

Patch lip at curb ramp \$255

Curb Ramp , Landings and Transitions : Bottom Landing Change in Level - Curb Ramps



**Code Reference** ADA 302, 406.2

**Progress**

---

<b>Record Number</b>	315723	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Priscilla Street @ 33.911541266949, - 118.121132254601**

Curb Ramp : No Detectable Warnings

**Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

**Recommendation**

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

**Costing Info (Estimated)**

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

**Progress**

<b>Record Number</b>	315760	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Priscilla Street @ 33.911541266949, - 118.121132254601**

Curb Ramp : Curb Ramp Slope

**Finding**

The running slope is greater than allowed.

**On-Site Finding** 13.40 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

**Progress**

<b>Record Number</b>	315761	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Priscilla Street @ 33.911541266949, - 118.121132254601**

Curb Ramp : Side Flare Slope

**Finding**

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 23.80 percent

**Recommendation**

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)**

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3,CA 11B-406.2.2

**Progress**

<b>Record Number</b>	315762	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Priscilla Street @ 33.911541266949, - 118.121132254601**

**Bottom Landing**

Curb Ramp : Bottom Landing Slope

**Finding**

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

**On-Site Finding** 15.80 percent

**Recommendation**

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)**

Repave landing \$1,260



**Code Reference** ADA 406, 406.2, CA 11B-406.5.8

**Progress**

<b>Record Number</b>	315763	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings And Transitions**

---

**Southwest Corner Of Priscilla Street @ 33.911541266949, - 118.121132254601**

**Bottom Landing**

**Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** 0.75 inches

**Recommendation**

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

**Costing Info (Estimated)**

Patch lip at curb ramp \$255

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level



**Code Reference** ADA 302, 303, 406.2, 303.1

**Progress**

---

<b>Record Number</b>	315764	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			



**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Southwest Corner Of Priscilla Street @ 33.911541266949, - 118.121132254601**

**Top Landing**

Curb Ramp , Landings and Transitions : Top Landing Slope

**Finding**

The slope at the top landing is greater than allowed.

**On-Site Finding** 6.30 percent

**Recommendation**

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)**

Provide compliant landing \$1,260



**Code Reference** ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

**Progress**

---

<b>Record Number</b>	315765	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Southwest Corner Of Priscilla Street @ 33.911541266949, - 118.121132254601**

**Top Landing**

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

**Finding**

There is not enough top landing clear length.

**On-Site Finding** 34.00 inches

**Recommendation**

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

**Costing Info (Estimated)**

Provide compliant landing \$240



**Code Reference** ADA 406, 406.4,CA 11B-406.5.3

**Progress**

---

<b>Record Number</b>	315766	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Spry Street @ 33.920622720431, -  
118.121151030064**

Curb Ramp : No Detectable Warnings

**Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

**Recommendation**

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

**Costing Info (Estimated)**

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

**Progress**

<b>Record Number</b>	315715	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Spry Street @ 33.920622720431, - 118.121151030064**

Curb Ramp : Curb Ramp Slope

**Finding**

The running slope is greater than allowed.

**On-Site Finding** 12.80 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

**Progress**

<b>Record Number</b>	315716	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Spry Street @ 33.920622720431, - 118.121151030064**

Curb Ramp : Curb Ramp - Cross Slope

**Finding**

The cross slope is greater than allowed.

**On-Site Finding** 2.50 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 402, 406.1, 405.3, CA 11B-406.5.7

**Progress**

<b>Record Number</b>	315717	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Curb Ramps - Exterior : Curb Ramp

#### Southwest Corner Of Spry Street @ 33.920622720431, - 118.121151030064

Curb Ramp : Side Flare Slope

#### Finding

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 12.50 percent

#### Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

#### Costing Info (Estimated)

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3, CA 11B-406.2.2

### Progress

<b>Record Number</b>	315718	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Spry Street @ 33.920622720431, - 118.121151030064**

**Bottom Landing**

Curb Ramp : Bottom Landing Slope

**Finding**

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

**On-Site Finding** 14.00 percent

**Recommendation**

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)**

Repave landing \$1,260



**Code Reference** ADA 406, 406.2, CA 11B-406.5.8

**Progress**

<b>Record Number</b>	315719	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings And Transitions**

---

**Southwest Corner Of Spry Street @ 33.920622720431, - 118.121151030064**

**Bottom Landing**

**Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** 1.25 inches

**Recommendation**

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

**Costing Info (Estimated)**

Patch lip at curb ramp \$255

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level



**Code Reference** ADA 302, 303, 406.2, 303.1

**Progress**

---

<b>Record Number</b>	315720	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			



**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

**Southwest Corner Of Spry Street @ 33.920622720431, - 118.121151030064**

**Top Landing**

Curb Ramp , Landings and Transitions : Top Landing Slope

**Finding**

The slope at the top landing is greater than allowed.

**On-Site Finding** 2.80 percent

**Recommendation**

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)**

Provide compliant landing \$1,260



**Code Reference** ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

**Progress**

<b>Record Number</b>	315721	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Washburn Road @ 33.924235120, -  
118.121148347855**

Curb Ramp : No Detectable Warnings

**Finding**

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

**Recommendation**

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

**Costing Info (Estimated)**

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

**Progress**

<b>Record Number</b>	315770	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Washburn Road @ 33.924235120, -  
118.121148347855**

Curb Ramp : Not Wholly Contained Within The Marked Crossing

**Finding**

The curb ramp is not wholly contained within the marked crossing.

**On-Site Finding** Not Found

**Recommendation**

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

**Costing Info (Estimated)**

Install crosswalk \$800



**Code Reference** ADA 406, 406.5

**Progress**

<b>Record Number</b>	315771	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Washburn Road @ 33.924235120, - 118.121148347855**

Curb Ramp : Curb Ramp Slope

**Finding**

The running slope is greater than allowed.

**On-Site Finding** 13.30 percent

**Recommendation**

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

**Costing Info (Estimated)**

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

**Progress**

<b>Record Number</b>	315772	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Curb Ramps - Exterior : Curb Ramp

#### Southwest Corner Of Washburn Road @ 33.924235120, - 118.121148347855

Curb Ramp : Side Flare Slope

#### Finding

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 12.50 percent

#### Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

#### Costing Info (Estimated)

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3,CA 11B-406.2.2

### Progress

<b>Record Number</b>	315773	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp**

**Southwest Corner Of Washburn Road @ 33.924235120, - 118.121148347855**

**Bottom Landing**

Curb Ramp : Bottom Landing Slope

**Finding**

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

**On-Site Finding** 8.20 percent

**Recommendation**

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)**

Repave landing \$1,260



**Code Reference** ADA 406, 406.2, CA 11B-406.5.8

**Progress**

<b>Record Number</b>	315774	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

---

#### Southwest Corner Of Washburn Road @ 33.924235120, - 118.121148347855

##### Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

##### Finding

The slope at the top landing is greater than allowed.

**On-Site Finding** 2.40 percent

##### Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

##### Costing Info (Estimated)

Provide compliant landing \$1,260



**Code Reference** ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

### Progress

---

<b>Record Number</b>	315775	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Southwest Corner Of Washburn Road @ 33.924235120, -  
118.121148347855**

**Top Landing**

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

**Finding**

There is not enough top landing clear length.

**On-Site Finding** 34.00 inches

**Recommendation**

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

**Costing Info (Estimated)**

Provide compliant landing \$240



**Code Reference** ADA 406, 406.4,CA 11B-406.5.3

**Progress**

---

<b>Record Number</b>	315776	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			



## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks

---

#### East Side

**Alley South Of Angle Street @ 33.910241293447, -118.120941817760**

Sidewalks : Vehicular Traffic Cross Slope

#### Finding

Cross slope at vehicular traffic is not compliant.

**On-Site Finding** 4.30 percent

#### Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

#### Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302, CA 11B-403.3

#### Progress

---

<b>Record Number</b>	316846	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Vehicular Traffic

---

#### East Side

#### Driveway South Of Spry Street @ 33.917446547615, -118.120968639851

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

#### Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

**On-Site Finding** Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install compliant detectable warnings \$190



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

#### Progress

---

<b>Record Number</b>	316847	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Vehicular Traffic

---

#### East Side

#### Driveway South Of Spry Street @ 33.917758160558, -118.120963275433

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

#### Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

**On-Site Finding** Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install compliant detectable warnings \$190



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

#### Progress

---

<b>Record Number</b>	316851	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Vehicular Traffic

---

#### East Side

#### Driveway South Of Spry Street @ 33.918018579071, -118.120957911015

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

#### Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

**On-Site Finding** Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install compliant detectable warnings \$190



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

#### Progress

---

<b>Record Number</b>	316848	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Vehicular Traffic

---

#### East Side

#### Driveway South Of Spry Street @ 33.918167707263, -118.120974004269

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

#### Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

**On-Site Finding** Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install compliant detectable warnings \$190



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

#### Progress

---

<b>Record Number</b>	316852	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Vehicular Traffic

---

#### East Side

#### Driveway South Of Spry Street @ 33.918485994920, -118.120957911015

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

#### Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

**On-Site Finding** Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install compliant detectable warnings \$190



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

#### Progress

---

<b>Record Number</b>	316849	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks

---

#### East Side

#### Driveway South Of Spry Street @ 33.918485994920, -118.120957911015

Sidewalks : Vehicular Traffic Cross Slope

#### Finding

Cross slope at vehicular traffic is not compliant.

**On-Site Finding** 7.90 percent

#### Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

#### Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302, CA 11B-403.3

#### Progress

---

<b>Record Number</b>	316850	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Vehicular Traffic

---

#### East Side

#### Driveway South Of Spry Street @ 33.918724153437, -118.120957911015

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

#### Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

**On-Site Finding** Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install compliant detectable warnings \$190



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

#### Progress

---

<b>Record Number</b>	315751	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			



## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Vehicular Traffic

---

#### East Side

#### Driveway South Of Spry Street @ 33.918897763900, -118.120949864388

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

#### Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

**On-Site Finding** Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install compliant detectable warnings \$190



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

#### Progress

---

<b>Record Number</b>	315749	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Vehicular Traffic

---

#### East Side

#### Driveway South Of Spry Street @ 33.919066922472, -118.120974004269

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

#### Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

**On-Site Finding** Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install compliant detectable warnings \$190



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

#### Progress

---

<b>Record Number</b>	315748	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Vehicular Traffic

---

#### East Side

#### Driveway South Of Spry Street @ 33.919322885462, -118.120944499969

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

#### Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

**On-Site Finding** Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install compliant detectable warnings \$190



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

#### Progress

---

<b>Record Number</b>	315750	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Vehicular Traffic

---

#### East Side

#### Driveway South Of Spry Street @ 33.919496494704, -118.120952546597

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

#### Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

**On-Site Finding** Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install compliant detectable warnings \$190



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

#### Progress

---

<b>Record Number</b>	315746	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks

---

#### East Side

#### Driveway South Of Spry Street @ 33.919496494704, -118.120952546597

Sidewalks : Vehicular Traffic Cross Slope

#### Finding

Cross slope at vehicular traffic is not compliant.

**On-Site Finding** 2.90 percent

#### Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

#### Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302, CA 11B-403.3

#### Progress

---

<b>Record Number</b>	315747	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks , Hazards & Gratings**

---

**East Side**

**Northeast Corner of Cheddar Street @ 33.915320871786, -118.120944499969**

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

**Finding**

There is a curb on the designated path of travel.

**On-Site Finding** Not Compliant

**Recommendation**

Provide a compliant curb ramp.

Recommendation See Recommendation

**Costing Info (Estimated)**

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

**Progress**

---

<b>Record Number</b>	316842	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Hazards & Gratings

---

#### East Side

**Northeast Corner of Imperial Highway Service Road @ 33.916916802997, - 118.120931088924**

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

#### Finding

There is a curb on the designated path of travel.

**On-Site Finding** Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

#### Progress

---

<b>Record Number</b>	316844	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks , Surface**

---

**East Side**

**Sidewalk South Of Angell Street @ 33.910408243209, -118.120933771133**

Sidewalks , Surface : Cross Slope

**Finding**

Sidewalk cross slope is not compliant.

**On-Site Finding** 3.90 percent for 51.00 feet

**Recommendation**

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)**

Repave surface \$1,092



**Code Reference** ADA 206, 302, CA 11B-403.3

**Progress**

---

<b>Record Number</b>	316836	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			



## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks

---

#### East Side

#### Sidewalk South Of Angell Street @ 33.911147270225, -118.120944499969

Sidewalks : Missing Sidewalk

#### Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

**On-Site Finding** 120.00 feet

#### Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

#### Costing Info (Estimated)

\$1,260



**Code Reference** ADA 206, 302,CA 11B-302,CA 11B-206

### Progress

---

<b>Record Number</b>	316835	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks**

---

**East Side**

**Sidewalk South Of Angell Street @ 33.912202376003, -118.120936453342**

Sidewalks : Missing Sidewalk

**Finding**

Section of sidewalk is missing and consists of dirt, grass or gravel.

**On-Site Finding** 204.00 feet

**Recommendation**

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

**Costing Info (Estimated)**

\$1,260



**Code Reference** ADA 206, 302,CA 11B-302,CA 11B-206

**Progress**

---

<b>Record Number</b>	316838	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks

---

#### East Side

#### Sidewalk South Of Cheddar Street @ 33.915227385349, -118.120963275433

Sidewalks : Missing Sidewalk

#### Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

**On-Site Finding** 347.00 feet

#### Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

#### Costing Info (Estimated)

\$1,260



**Code Reference** ADA 206, 302,CA 11B-302,CA 11B-206

### Progress

---

<b>Record Number</b>	316837	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Surface

---

#### East Side

#### Sidewalk South Of Washburn Road @ 33.924157102913, -118.121826359

Sidewalks , Surface : Cross Slope

#### Finding

Sidewalk cross slope is not compliant.

**On-Site Finding** 4.20 percent for 60.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

#### Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302, CA 11B-403.3

#### Progress

---

<b>Record Number</b>	315744	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Hazards & Gratings

---

#### East Side

#### Southeast Corner of Cheddar Street @ 33.915227385349, -118.120963275433

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

#### Finding

There is a curb on the designated path of travel.

**On-Site Finding** Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

#### Progress

---

<b>Record Number</b>	316839	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks , Hazards & Gratings**

---

**East Side**

**Tree South Of Imperial Highway @ 33.916300247342, -118.120949864388**

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

**Finding**

Overhead obstruction height is not compliant.

**On-Site Finding** 64.00 inches

**Recommendation**

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

**Costing Info (Estimated)**

Unassigned



**Code Reference** ADA 206, 307.4,CA 11B-307.4

**Progress**

---

<b>Record Number</b>	316845	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks**

**East Side @ 33.924250579552, -118.121014237404**

Sidewalks : 60X60 Turn Area

**Finding**

There is no 60X60 turn area at every 200 feet.

**On-Site Finding** Not Found

**Recommendation**

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

**Costing Info (Estimated)**

\$2,400



**Code Reference** ADA 206, 302

**Progress**

<b>Record Number</b>	316834	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Vehicular Traffic

---

#### West Side

#### Adoree Street West Crossing @ 33.914092184715, -118.121116161346

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

#### Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

**On-Site Finding** Not Found

#### Recommendation

Provide detectable warnings.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install compliant detectable warnings \$190



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

#### Progress

---

<b>Record Number</b>	315697	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			



**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks , Hazards & Gratings**

---

**West Side**

**Curb North Of Imperial Highway Service Road @ 33.916927932120, - 118.121161758900**

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

**Finding**

There is a curb on the designated path of travel.

**On-Site Finding** Not Compliant

**Recommendation**

Provide a compliant curb ramp.

Recommendation See Recommendation

**Costing Info (Estimated)**

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

**Progress**

---

<b>Record Number</b>	315689	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks , Vehicular Traffic**

---

**West Side**

**Driveway North Of Imperial Highway @ 33.917818257208, -118.121113479137**

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

**Finding**

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

**On-Site Finding** Not Found

**Recommendation**

Provide detectable warnings.

Recommendation See Recommendation

**Costing Info (Estimated)**

Install compliant detectable warnings \$190



**Code Reference** ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

**Progress**

---

<b>Record Number</b>	315695	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks

---

#### West Side

#### Driveway North Of Imperial Highway @ 33.917818257208, -118.121113479137

Sidewalks : Vehicular Traffic Cross Slope

#### Finding

Cross slope at vehicular traffic is not compliant.

**On-Site Finding** 7.70 percent

#### Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

#### Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302, CA 11B-403.3

### Progress

---

<b>Record Number</b>	315696	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Dunrobin Avenue - Foster Road to Washburn Road

### Sidewalks - Exterior : Sidewalks , Hazards & Gratings

---

#### West Side

#### Northwest Corner of Priscilla Street @ 33.911610271837, -118.121129572392

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

#### Finding

There is a curb on the designated path of travel.

**On-Site Finding** Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

#### Progress

---

<b>Record Number</b>	315692	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks , Surface**

---

**West Side**

**Sidewalk North Of Adoree Street @ 33.914154509848, -118.121116161346**

Sidewalks , Surface : Cross Slope

**Finding**

Sidewalk cross slope is not compliant.

**On-Site Finding** 4.00 percent for 44.00 feet

**Recommendation**

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)**

Repave surface \$1,092



**Code Reference** ADA 206, 302, CA 11B-403.3

**Progress**

---

<b>Record Number</b>	315685	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks**

---

**West Side**

**Sidewalk North Of Adoree Street @ 33.914715433994, -118.121140301228**

Sidewalks : Missing Sidewalk

**Finding**

Section of sidewalk is missing and consists of dirt, grass or gravel.

**On-Site Finding** 344.00 feet

**Recommendation**

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

**Costing Info (Estimated)**

\$1,260



**Code Reference** ADA 206, 302,CA 11B-302,CA 11B-206

**Progress**

---

<b>Record Number</b>	315684	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks**

---

**West Side**

**Sidewalk North Of Priscilla Street @ 33.911610271837, -118.121129572392**

Sidewalks : Missing Sidewalk

**Finding**

Section of sidewalk is missing and consists of dirt, grass or gravel.

**On-Site Finding** 159.00 feet

**Recommendation**

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

**Costing Info (Estimated)**

\$1,260



**Code Reference** ADA 206, 302,CA 11B-302,CA 11B-206

**Progress**

---

<b>Record Number</b>	315686	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks**

---

**West Side**

**Sidewalk North Of Priscilla Street @ 33.912387129469, -118.121116161346**

Sidewalks : Missing Sidewalk

**Finding**

Section of sidewalk is missing and consists of dirt, grass or gravel.

**On-Site Finding** 98.00 feet

**Recommendation**

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

**Costing Info (Estimated)**

\$1,260



**Code Reference** ADA 206, 302,CA 11B-302,CA 11B-206

**Progress**

---

<b>Record Number</b>	315682	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			



**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks , Surface**

---

**West Side**

**Sidewalk North Of Spry Street @ 33.922899609577, -118.121167123318**

Sidewalks , Surface : Cross Slope

**Finding**

Sidewalk cross slope is not compliant.

**On-Site Finding** 4.00 percent for 35.00 feet

**Recommendation**

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)**

Repave surface \$1,092



**Code Reference** ADA 206, 302, CA 11B-403.3

**Progress**

---

<b>Record Number</b>	315683	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks , Hazards & Gratings**

---

**West Side**

**Tree North Of Adoree Street @ 33.914673142223, -118.121102750301**

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

**Finding**

Overhead obstruction height is not compliant.

**On-Site Finding** 65.00 inches

**Recommendation**

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

**Costing Info (Estimated)**

Unassigned



**Code Reference** ADA 206, 307.4, CA 11B-307.4

**Progress**

---

<b>Record Number</b>	315690	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks , Hazards & Gratings**

---

**West Side**

**Tree North Of Adoree Street @ 33.914802243353, -118.121121525764**

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

**Finding**

Overhead obstruction height is not compliant.

**On-Site Finding** 67.00 inches

**Recommendation**

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

**Costing Info (Estimated)**

Unassigned



**Code Reference** ADA 206, 307.4, CA 11B-307.4

**Progress**

---

<b>Record Number</b>	315694	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**

**Sidewalks - Exterior : Sidewalks**

**West Side @ 33.909882906855, -118.121137619019**

Sidewalks : 60X60 Turn Area

**Finding**

There is no 60X60 turn area at every 200 feet.

**On-Site Finding** Not Found

**Recommendation**

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

**Costing Info (Estimated)**

\$2,400



**Code Reference** ADA 206, 302

**Progress**

<b>Record Number</b>	315681	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Dunrobin Avenue - Foster Road to Washburn Road**



**Dunrobin Avenue - Foster Road to Washburn Road**

Dunrobin Avenue - Foster Road to Washburn Road  
Downey, CA 90424

Date of Inspection  
12/6/2016

**\*Estimated Facility Total: \$117,390**

\*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

**Disability Access Consultants**

(800) 743-7067

Prepared Using

