

Accessibility Survey



City of Downey Blodgett Avenue - Cheyenne Street To Adoree Street

Cheyenne Street To Adoree Street
Downey, CA 90242

Date of Inspection
4/7/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Blodgett Avenue - Cheyenne Street To Adoree Street

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level North Of Cheyenne Street @ 33.914056570333, -118.141612261534

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 4.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 401015 | Resolution | None |
| Progress | Not_Started | Priority | One |
| Actual Date | | Projected Date | 06/30/2018 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Cheyenne Street To Adoree Street

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level North Of Cheyenne Street @ 33.913940823488, -118.141688704491

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 401014 | Resolution | None |
| Progress | Not_Started | Priority | Three |
| Actual Date | | Projected Date | 12/31/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Cheyenne Street To Adoree Street

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level North Of Cheyenne Street @ 33.914189011242, -118.141513019800

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 401013 | Resolution | None |
| Progress | Not_Started | Priority | Three |
| Actual Date | | Projected Date | 12/31/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Cheyenne Street To Adoree Street

Sidewalks - Exterior : Sidewalks

East Side @ 33.913840657823, -118.141762465239

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 401012 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Cheyenne Street To Adoree Street

Sidewalks - Exterior : Sidewalks

West Side @ 33.913915225607, -118.141901940107

Sidewalks : No Sidewalk

Finding

No sidewalk exists at the location.

On-Site Finding Not Found

Recommendation

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 206

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 401016 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Cheyenne Street To Adoree Street



Blodgett Avenue - Cheyenne Street To Adoree Street

**Cheyenne Street To Adoree Street
Downey, CA 90242**

Date of Inspection
4/7/2017

***Estimated Facility Total: \$2,994**

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Blodgett Avenue - Donovan Street To Alameda Street

Donovan Street To Alameda Street
Downey, CA 90242

Date of Inspection
2/9/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Blodgett Avenue - Donovan Street To Alameda Street

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Alameda Street @ 33.924150426006, -118.135164231062

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 357469 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Donovan Street To Alameda Street

Sidewalks - Exterior : Sidewalks

East Side

Melva Street East Crossing @ 33.923935651893, -118.135325163603

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 9.20 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 357470 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Donovan Street To Alameda Street

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South Of Alameda Street @ 33.924478706635, -118.134913444519

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 47.00 inches for 80.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, CA 11B-403.5.1

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 357465 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Donovan Street To Alameda Street

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Alameda Street @ 33.924478706635, -118.134913444519

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.60 percent for 23.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 357466 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Donovan Street To Alameda Street

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South Of Melva Street @ 33.923876672379, -118.135366737843

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 390.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 357468 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Donovan Street To Alameda Street

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Mory Street @ 33.921556408140, -118.136525452137

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.70 percent for 75.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 357467 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Donovan Street To Alameda Street

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South Of Mory Street @ 33.922806131455, -118.135935366154

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 387.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 357464 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Donovan Street To Alameda Street

Sidewalks - Exterior : Sidewalks

East Side @ 33.924478706635, -118.134913444519

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 357463 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Donovan Street To Alameda Street

Sidewalks - Exterior : Sidewalks

West Side

Sidewalk North Of Boyson Street @ 33.923473830076, -118.135865628719

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 215.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 357472 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Donovan Street To Alameda Street

Sidewalks - Exterior : Sidewalks

West Side

Sidewalk North Of Donovan Street To Alameda Street @ 33.921392818780, - 118.136855363846

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 225.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 357471 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Donovan Street To Alameda Street

Sidewalks - Exterior : Sidewalks

West Side

Sidewalk North Of Melva Street @ 33.924088108184, -118.135439157486

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 220.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 357474 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Donovan Street To Alameda Street

Sidewalks - Exterior : Sidewalks

West Side

Sidewalk North Of Mory Street @ 33.922932994596, -118.136082887650

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 160.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 357475 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Donovan Street To Alameda Street

Sidewalks - Exterior : Sidewalks

West Side

Sidewalk North Of Springer Street @ 33.922022691734, -118.136392682791

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 305.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 357473 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Donovan Street To Alameda Street



Blodgett Avenue - Donovan Street To Alameda Street

**Donovan Street To Alameda Street
Downey, CA 90242**

Date of Inspection
2/9/2017

***Estimated Facility Total: \$15,954**

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Blodgett Avenue - Gardendale Street To Priscilla Street

Gardendale Street To Priscilla Street
Downey, CA 90242

Date of Inspection
12/2/2016

Prepared By

Disability Access Consultants

(800) 743-7067

Blodgett Avenue - Gardendale Street To Priscilla Street

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Gardendale Street @ 33.911279715654, - 118.143877387047

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 5.60 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 313012 | Resolution | None |
| Progress | Not_Started | Priority | Five |
| Actual Date | | Projected Date | 06/30/2025 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Gardendale Street To Priscilla Street

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner Of Gardendale Street @ 33.911279715654, - 118.143877387047

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.60 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 313013 | Resolution | None |
| Progress | Not_Started | Priority | Five |
| Actual Date | | Projected Date | 06/30/2025 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Gardendale Street To Priscilla Street

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South Of Priscilla Street @ 33.911411047894, -118.143554180861

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 49.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 313008 | Resolution | None |
| Progress | Not_Started | Priority | Five |
| Actual Date | | Projected Date | 06/30/2025 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Gardendale Street To Priscilla Street

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South Of Priscilla Street @ 33.911788348711, -118.143277913332

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 127.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 313007 | Resolution | None |
| Progress | Not_Started | Priority | Five |
| Actual Date | | Projected Date | 06/30/2025 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Gardendale Street To Priscilla Street

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Tree South Of Priscilla Street @ 33.911436646527, -118.143536746502

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 64.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 313009 | Resolution | None |
| Progress | Not_Started | Priority | Five |
| Actual Date | | Projected Date | 06/30/2025 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Gardendale Street To Priscilla Street

Sidewalks - Exterior : Sidewalks

West Side

Sidewalk North Of Gardendale Avenue @ 33.911300862385, -118.143841177225

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 294.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 313010 | Resolution | None |
| Progress | Not_Started | Priority | Five |
| Actual Date | | Projected Date | 06/30/2025 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Gardendale Street To Priscilla Street



Blodgett Avenue - Gardendale Street To Priscilla Street

**Gardendale Street To Priscilla Street
Downey, CA 90242**

Date of Inspection
12/2/2016

***Estimated Facility Total: \$6,300**

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Blodgett Avenue - Golden Street To Gardendale Avenue

Golden Street To Gardendale Avenue
Downey, CA 90242

Date of Inspection
11/29/2016

Prepared By

Disability Access Consultants

(800) 743-7067

Blodgett Avenue - Golden Street To Gardendale Avenue

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Golden Street @ 33.908961334413, -118.145903795958

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311186 | Resolution | None |
| Progress | Not_Started | Priority | One |
| Actual Date | | Projected Date | 06/30/2018 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Gardendale Street @ 33.909818352588, - 118.145112544298

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311195 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of Golden Street @ 33.908195575818, - 118.146208226681

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311196 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of Golden Street @ 33.908195575818, - 118.146208226681

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 10.90 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311197 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of Golden Street @ 33.908195575818, - 118.146208226681

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 11.50 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311198 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner Of Golden Street @ 33.908195575818, - 118.146208226681

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 6.00 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311199 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Blodgett Avenue @ 33.908280165768, - 118.146375864744

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311191 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Blodgett Avenue @ 33.908280165768, - 118.146375864744

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 11.10 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311192 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Blodgett Avenue @ 33.908280165768, - 118.146375864744

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 19.70 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311193 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner Of Blodgett Avenue @ 33.908280165768, - 118.146375864744

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 0.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311194 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Gardendale Street @ 33.911176207899, - 118.144195228815

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 5.40 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311200 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner Of Golden Street @ 33.911249665029, - 118.144370913506

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 46.50 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311190 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Guy Wire North Of Golden Street @ 33.911166191013, -118.144420534372

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 65.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311182 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Golden Street @ 33.909276317419, -118.145695924759

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.60 percent for 88.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311179 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Tree North Of Golden Street @ 33.909739329195, -118.145370036364

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 71.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311188 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Utility Pole North Of Golden Street @ 33.908431537049, -118.146267235279

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 40.00 inches


Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260

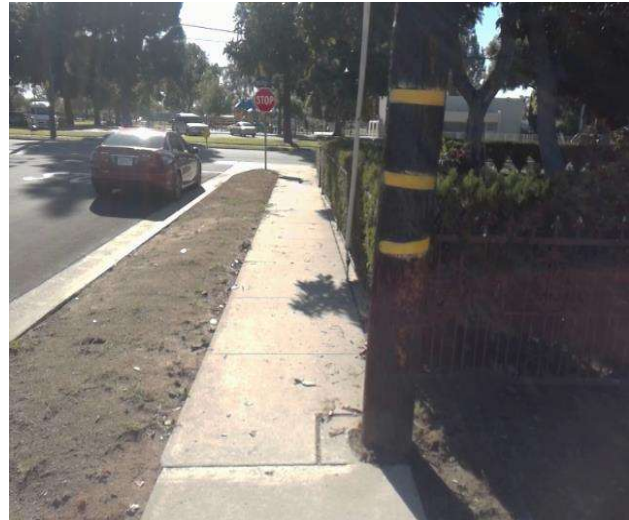

Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311187 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Utility Pole North Of Golden Street @ 33.908872293069, -118.145964145660

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 39.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311189 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Utility Pole North Of Golden Street @ 33.909324176926, -118.145663738251

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 40.50 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311184 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Utility Pole North Of Golden Street @ 33.909769380353, -118.145356625319

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 39.50 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311183 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Utility Pole North Of Golden Street @ 33.910235728450, -118.145052194595

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 39.50 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311185 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Utility Pole North Of Golden Street @ 33.910687605078, -118.144743740559

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 37.50 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311181 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Utility Pole North Of Golden Street @ 33.911130575408, -118.144439309835

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 38.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 311180 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Blodgett Avenue - Golden Street To Gardendale Avenue



Blodgett Avenue - Golden Street To Gardendale Avenue

Golden Street To Gardendale Avenue
Downey, CA 90242

Date of Inspection
11/29/2016

*Estimated Facility Total: \$19,004

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Blodgett Avenue - Parkcliff Street To Prichard Street

Parkcliff Street To Prichard Street
Downey, CA 90242

Date of Inspection
11/28/2016

Prepared By

Disability Access Consultants

(800) 743-7067

Blodgett Avenue - Parkcliff Street To Prichard Street

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Prichard Street @ 33.906127548030, - 118.146688342094

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 11.60 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 310793 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Blodgett Avenue - Parkcliff Street To Prichard Street



Blodgett Avenue - Parkcliff Street To Prichard Street

**Parkcliff Street To Prichard Street
Downey, CA 90242**

Date of Inspection
11/28/2016

***Estimated Facility Total: \$1,260**

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using

