Accessibility Survey



City of Downey Laura Street & Old River School Road

Laura Street & Old River School Road Downey, CA 90242

Date of Inspection 4/18/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Curb Ramps - Exterior : Curb Ramp

Northeast Corner @ 33.937808057040, -118.155577182770

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Record Number	407527	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp

Northeast Corner @ 33.937808057040, -118.155577182770

Curb Ramp : Parallel Curb Ramp Left Side Slope

Finding

The running slope is greater than allowed.

On-Site Finding 13.60 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.2,CA 11B-406

Record Number	407528	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp

Northeast Corner @ 33.937808057040, -118.155577182770

Curb Ramp : Parallel Curb Ramp Left Side Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 4.20 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.3,CA 11B-406.5.7

Progress

Record Number	407529	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value

Curb Ramps - Exterior : Curb Ramp

Northeast Corner @ 33.937808057040, -118.155577182770

Curb Ramp : Parallel Curb Ramp Right Side Slope

Finding

The running slope is greater than allowed.

On-Site Finding 10.40 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.2,CA 11B-406

Progress

Record Number	407530	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner @ 33.937808057040, -118.155577182770

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 6.20 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions : Top Landing Right Side

Slope - Parallel Curb Ramp

Code Reference ADA 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	407531	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Comments	No comments		
Assignment	None	New Value	0

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

Northeast Corner @ 33.937808057040, -118.155577182770

Top Landing

Curb Ramp , Landings And Transitions : Top Landing Right Side Change in Level

Finding

The transition from the top of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.62 inches

Recommendation

Patch the transition area at the top of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$155



Code Reference ADA 303.1

Progress

Record Number407532ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date06/30/2021Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Curb Ramps - Exterior : Curb Ramp

Northwest Corner @ 33.937939348387, -118.155763596296

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number	407536	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Northwest Corner @ 33.937939348387, -118.155763596296

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 7.40 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

Record Number	407537	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

Northwest Corner @ 33.937939348387, -118.155763596296

Bottom Landing

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 1.62 inches

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$255



Curb Ramp , Landings And Transitions : Bottom Landing Change in

Code Reference ADA 302, 303, 406.2, 303.1

Progress

Record Number407538ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date06/30/2021Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner @ 33.937939348387, -118.155763596296

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.50 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Record Number	407539	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner @ 33.937939348387, -118.155763596296

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 41.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number	407540	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner @ 33.937699018310, -118.155667036772

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number	407541	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner @ 33.937699018310, -118.155667036772

Curb Ramp : Curb Ramp Width

Finding

The width of the curb ramp is less than required.

On-Site Finding 41.00 inches

Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.5,CA 11B-406.5.2

Progress

Record Number	407542	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner @ 33.937699018310, -118.155667036772

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 11.40 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Record Number	407543	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

Southeast Corner @ 33.937699018310, -118.155667036772

Bottom Landing

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.62 inches

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$255



Curb Ramp , Landings And Transitions : Bottom Landing Change in

Code Reference ADA 302, 303, 406.2, 303.1

Progress

Record Number	407544	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Reach Ranges - Exterior : Reach Range , Clear Floor Space Width

Southwest Corner To West Crossing

Pedestrian Control - Other

Reach Range , Clear Floor Space Width : Clear Floor Space Width

Finding

The clear floor space width is not compliant.

On-Site Finding 0.00 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 30.00 inches

Costing Info (Estimated)

Redesign space \$2,200



Code Reference ADA 304, 305.3,CA 11B-305

Record Number	407533	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Reach Ranges - Exterior : Reach Range , Clear Floor Space Length

Southwest Corner To West Crossing

Pedestrian Control - Other

Reach Range , Clear Floor Space Length : Clear Floor Space Length

Finding

The clear floor space length is not complaint.

On-Site Finding 0.00 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Redesign space \$2,200



Code Reference ADA 304, 305.3,CA 11B-305,CA 11B-309.2

Record Number	407534	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Reach Ranges - Exterior : Reach Range , Element

Southwest Corner To West Crossing

Pedestrian Control - Other

Reach Range , Element : Element on Accessible Route

Finding

The element is not located on the accessible route.

On-Site Finding None

Recommendation

The element must be located on the accessible route.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 304

Record Number	407535	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Walking Surface

Intersection

East Crossing @ 33.937754650333, -118.155629485846

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Progress

Record Number	407548	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021

Projected Date

\$0.00 Contractor **Actual Cost**

Comments No Comments

Assignment **New Value** 0 None

Intersections - Exterior : Intersections , Walking Surface

Intersection

North Crossing @ 33.937883716485, -118.155665695667

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found


Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240

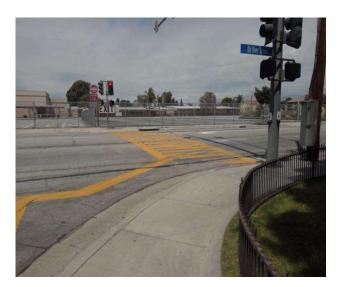

Code Reference

Progress

Record Number	407549	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To East Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 152.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches **Costing Info (Estimated)**

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number407574ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date06/30/2021Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To East Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Controls : Push Button Diameter

Finding

Push button diameter is not compliant.

On-Site Finding 0.37 inches

Recommendation

Provide a compliant push button.

Recommendation At least 2.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number	407575	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northeast Corner To East Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407576	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northeast Corner To East Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407577	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northeast Corner To East Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	407578	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments Assignment	No Comments None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northeast Corner To East Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7,CA MUTCD 4E.08

Record Number	407579	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northeast Corner To East Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number407580ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date06/30/2021Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northeast Corner To East Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407581	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northeast Corner To East Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	407582	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northeast Corner To East Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407583	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northeast Corner To East Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407584	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To North Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Controls : Push Button Location

Finding

Push button is not located at least 10 feet from other accessible pedestrian signals.

On-Site Finding Not Located

Recommendation

Push button must be located at least 10 feet from other accessible pedestrian signals.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,800



Code Reference CA MUTCD 4E.08

Progress

Record Number	407610	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To North Crossing @ 33.937846999410, -118.155581206083

 $Intersections \ , \ Pedestrian \ Signal \ Controls \ : \ Push \ Button \ - \ Distance \\ from \ Crosswalk$

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 142.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



0

Code Reference CA MUTCD 4E.08

Progress

Record Number407611ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date06/30/2021

,

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value

Designated Staff

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To North Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Controls : Push Button Diameter

Finding

Push button diameter is not compliant.

On-Site Finding 0.37 inches

Recommendation

Provide a compliant push button.

Recommendation At least 2.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number407612ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date06/30/2021Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To North Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Length

Finding

There is not enough clear ground space at the push button.

On-Site Finding 24.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

Record Number407613ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date06/30/2021Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To North Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 3.80 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number	407614	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northeast Corner To North Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	407615	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northeast Corner To North Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



0

Code Reference CA MUTCD, CA MUTCD 4E.08

None

Progress

Assignment

Record Number	407616	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northeast Corner To North Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	407617	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northeast Corner To North Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7,CA MUTCD 4E.08

Record Number	407618	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northeast Corner To North Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number407619ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northeast Corner To North Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



0

Code Reference CA MUTCD, CA MUTCD 4E.08

None

Progress

Record Number	407620	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northeast Corner To North Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	407621	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	N. Carrage and be		

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northeast Corner To North Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	407622	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northeast Corner To North Crossing @ 33.937846999410, -118.155581206083

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found


Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900

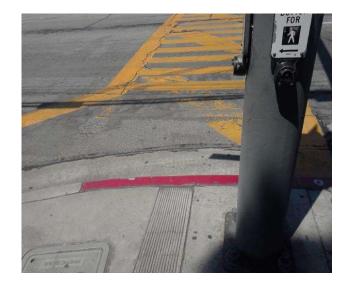

Code Reference CA MUTCD,CA MUTCD 4E.08

Progress

Record Number	407623	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To North Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Controls : Push Button Location

Finding

Push button is not located at least 10 feet from other accessible pedestrian signals.

On-Site Finding Not Located

Recommendation

Push button must be located at least 10 feet from other accessible pedestrian signals.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,800



Code Reference CA MUTCD 4E.08

Progress

Record Number407550ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date06/30/2021Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To North Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Controls : Push Button - Distance

Finding

Push button distance from curb is not compliant.

On-Site Finding 16.00 inches

Recommendation

Provide a compliant push button.

Recommendation 17.00 - 120.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

407551 Resolution **Record Number** None **Progress** Not_Started **Priority** Three

Actual Date

Projected Date 06/30/2021

\$0.00 Contractor **Actual Cost**

Comments No Comments

Assignment New Value 0 None

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To North Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Length

Finding

There is not enough clear ground space at the push button.

On-Site Finding 6.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

Record Number407552ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date06/30/3

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner To North Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407553	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner To North Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	407554	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner To North Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD,CA MUTCD 4E.08

Progress

Record Number	407555	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Assignment None **New Value** 0

No Comments

Designated Staff

Comments

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner To North Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7,CA MUTCD 4E.08

Progress

Record Number	407556	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner To North Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number407557ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner To North Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	407558	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner To North Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	407559	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner To North Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



0

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	407560	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None New Value

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner To North Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	407561	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments Assignment	No Comments None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To West Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Controls : Push Button Location

Finding

Push button is not located at least 10 feet from other accessible pedestrian signals.

On-Site Finding Not Located


Recommendation

Push button must be located at least 10 feet from other accessible pedestrian signals.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,800

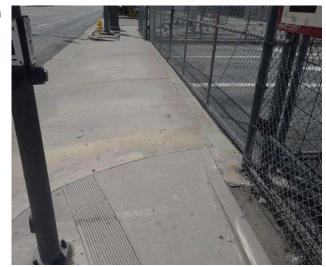

Code Reference CA MUTCD 4E.08

Record Number	407562	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To West Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 64.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number407563ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date06/30/2021Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To West Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 4.60 percent


Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260

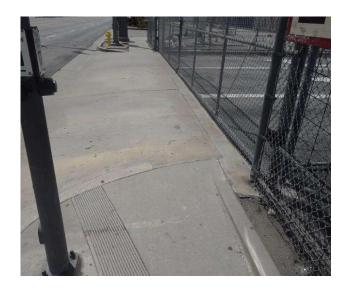

Code Reference CA 11B-305.2,CA MUTCD 4E.08

Record Number	407564	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner To West Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant


Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900

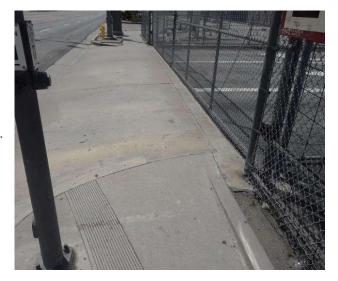

Code Reference CA MUTCD,CA MUTCD 4E.08

Record Number	407565	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner To West Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407566	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner To West Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found


Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158

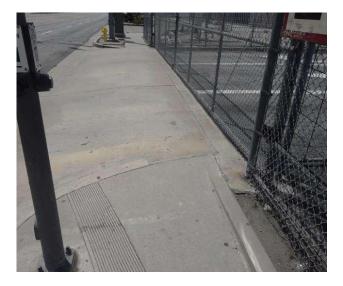

Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407567	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner To West Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7,CA MUTCD 4E.08

Record Number	407568	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northwest Corner To West Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Record Number	407569	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner To West Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407570	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner To West Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407571	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner To West Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407572	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner To West Crossing @ 33.937928222010, -118.155775666237

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407573	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To East Crossing @ 33.937701243592, -118.155676424503

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 143.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number407585ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date06/30/2021

Frojected Date 00/30/202

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To East Crossing @ 33.937701243592, -118.155676424503

Intersections , Pedestrian Signal Controls : Push Button Diameter

Finding

Push button diameter is not compliant.

On-Site Finding 0.37 inches

Recommendation

Provide a compliant push button.

Recommendation At least 2.00 inches

Costing Info (Estimated)

\$900



0

Code Reference CA MUTCD 4E.08

None

Progress

Record Number 407586 Resolution None Not Started **Progress Priority** Three **Actual Date Projected Date** 06/30/2021 Contractor **Actual Cost** \$0.00 Comments No Comments

New Value

Designated Staff

Assignment

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To East Crossing @ 33.937701243592, -118.155676424503

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Length

Finding

There is not enough clear ground space at the push button.

On-Site Finding 47.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

407587 Resolution **Record Number** None **Progress** Not_Started **Priority** Three **Actual Date Projected Date** 06/30/2021 Contractor **Actual Cost** \$0.00 Comments No Comments **New Value** 0 **Assignment** None

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.937701243592, -118.155676424503

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407588	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.937701243592, -118.155676424503

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407589	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.937701243592, -118.155676424503

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407590	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.937701243592, -118.155676424503

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7,CA MUTCD 4E.08

Record Number	407591	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.937701243592, -118.155676424503

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Record Number	407592	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.937701243592, -118.155676424503

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407593	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.937701243592, -118.155676424503

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	407594	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.937701243592, -118.155676424503

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407595	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.937701243592, -118.155676424503

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407596	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.937815845516, -118.155862838030

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 169.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number407597ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date06/30/2021Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.937815845516, -118.155862838030

Intersections , Pedestrian Signal Controls : Push Button Diameter

Finding

Push button diameter is not compliant.

On-Site Finding 0.37 inches

Recommendation

Provide a compliant push button.

Recommendation At least 2.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number	407598	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.937815845516, -118.155862838030

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Length

Finding

There is not enough clear ground space at the push button.

On-Site Finding 1.00 inches


Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unassigned

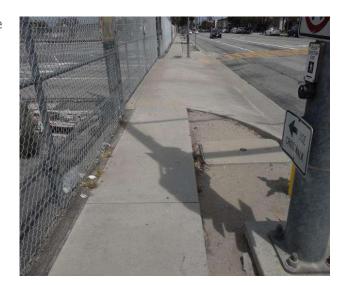

Code Reference CA MUTCD 4E.08

Progress

Record Number	407599	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.937815845516, -118.155862838030

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Width

Finding

There is not enough clear ground space at the push button.

On-Site Finding 1.00 inches


Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 32.00 inches

Costing Info (Estimated)

Unassigned

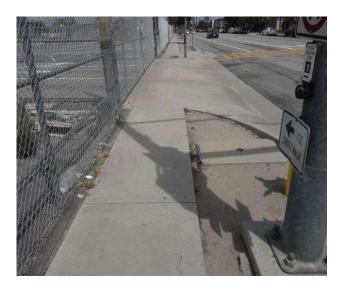

Code Reference CA MUTCD 4E.08

Progress

407600	Resolution	None
Not_Started	Priority	Three
	Projected Date	06/30/2021
\$0.00	Contractor	
	Not_Started	Not_Started

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.937815845516, -118.155862838030

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD,CA MUTCD 4E.08

Record Number	407601	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.937815845516, -118.155862838030

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407602	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.937815845516, -118.155862838030

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found


Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158

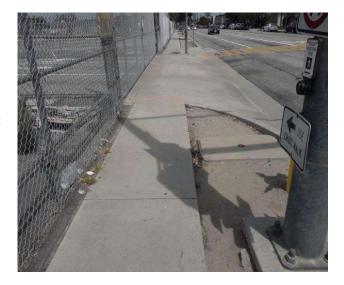

Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407603	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.937815845516, -118.155862838030

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found


Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158

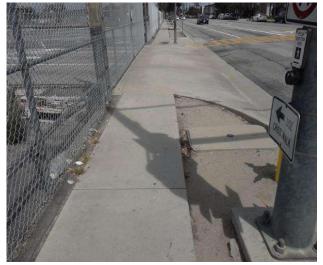

Code Reference CA 11B-703.7.2.7,CA MUTCD 4E.08

Record Number	407604	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southwest Corner To West Crossing @ 33.937815845516, -118.155862838030

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	407605	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.937815845516, -118.155862838030

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD,CA MUTCD 4E.08

Record Number	407606	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.937815845516, -118.155862838030

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407607	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.937815845516, -118.155862838030

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found


Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900

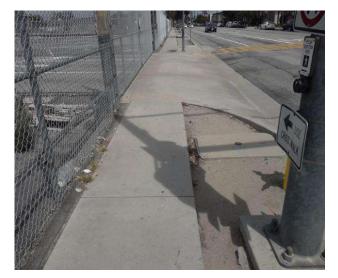

Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	407608	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southwest Corner To West Crossing @ 33.937815845516, -118.155862838030

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD,CA MUTCD 4E.08

Record Number	407609	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing @ 33.937888167039, -118.155809193850

Intersections , Walking Surface : Crosswalk Width

Finding

Crosswalk width is not compliant.

On-Site Finding 48.00 inches


Recommendation

Provide a compliant crosswalk for the intersection with recommended width.

Recommendation At least 72.00 inches

Costing Info (Estimated)

\$1,500

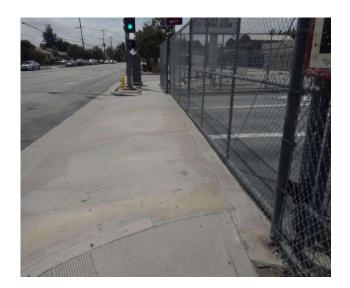

Code Reference

Progress

Record Number	407545	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing @ 33.937888167039, -118.155809193850

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant


Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500

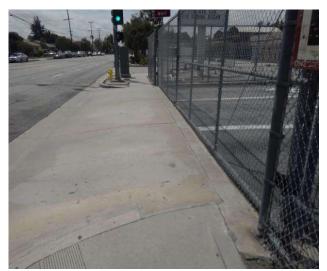

Code Reference

Progress

Record Number	407546	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Assignment None New Value 0

No Comments

Designated Staff

Comments

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing @ 33.937888167039, -118.155809193850

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found


Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240

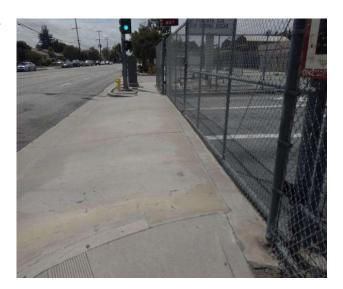

Code Reference

Progress

Record Number	407547	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0



Laura Street & Old River School Road

Laura Street & Old River School Road Downey, CA 90242

Date of Inspection 4/18/2017

*Estimated Facility Total: \$71,933

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Laura Street - Julius Avenue To Old River School Road

Julius Avenue To Old River School Road Downey, CA 90242

Date of Inspection 4/18/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Pomering Road @ 33.936856745046, - 118.154081851244

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Record Number	407510	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Pomering Road @ 33.936856745046, - 118.154081851244

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 12.30 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number	407511	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Pomering Road @ 33.936856745046, - 118.154081851244

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 14.50 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

None

Progress

407512 **Record Number** Resolution None **Progress** Not_Started **Priority** Three **Actual Date Projected Date** 06/30/2021 Contractor **Actual Cost** \$0.00 Comments No Comments

New Value

Designated Staff

Assignment

0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of Pomering Road @ 33.936856745046, - 118.154081851244

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 7.20 percent


Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260

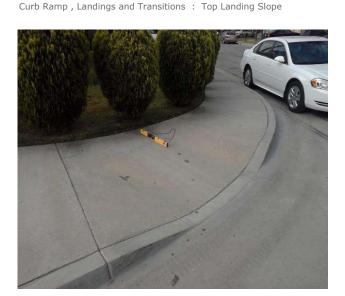

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Record Number	407513	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of Pomering Road @ 33.936856745046, - 118.154081851244

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 24.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number 407514 Resolution None **Progress** Not_Started **Priority** Three **Actual Date Projected Date** 06/30/2021 Contractor **Actual Cost** \$0.00 Comments No Comments **New Value Assignment** 0 None **Designated Staff**

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Pomering Road @ 33.936940193892, - 118.154230713844

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number	407498	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	N V.	
Assignment	None	New Value	0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Pomering Road @ 33.936940193892, - 118.154230713844

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 14.30 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Record Number	407499	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Pomering Road @ 33.936940193892, - 118.154230713844

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 18.30 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Record Number	407500	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner Of Pomering Road @ 33.936940193892, - 118.154230713844

Bottom Landing

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding Not Beveled

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

Costing Info (Estimated)

Patch lip at curb ramp \$255



Curb Ramp , Landings and Transitions : Bottom Landing Change in

Code Reference ADA 302, 406.2

Progress

Record Number	407501	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner Of Pomering Road @ 33.936940193892, - 118.154230713844

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.80 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions : Top Landing Slope

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Record Number	407502	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner Of Pomering Road @ 33.936940193892, - 118.154230713844

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 24.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number407503ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date06/30/2021Actual Cost\$0.00Contractor

No Comments

Assignment None **New Value** 0

Designated Staff

Comments

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

North Side

Driveway East Of Old River School Road @ 33.937514319734, -118.155056834221

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation


Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable \$190

warnings

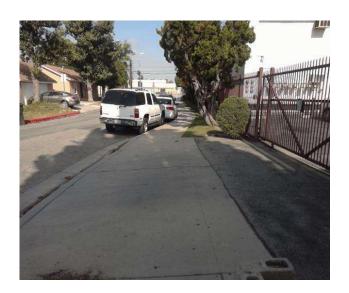

Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

Record Number	407508	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment New Value 0 None

Sidewalks - Exterior : Sidewalks

North Side

Driveway East Of Old River School Road @ 33.937514319734, -118.155056834221

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.70 percent


Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

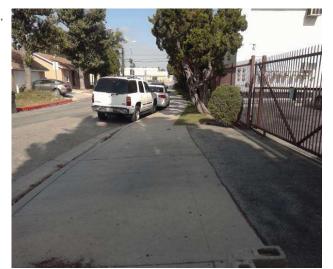

Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	407509	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East Of Old River School Road @ 33.937780241051, -118.155544996262

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 6.70 percent for 79.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Up to 2.08 percent Recommendation

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	407505	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments

Assignment New Value None 0

No Comments

Sidewalks - Exterior : Sidewalks

North Side

Sidewalk East Of Pomering Road @ 33.936787760605, -118.153645992279

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 135.00 feet


Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260

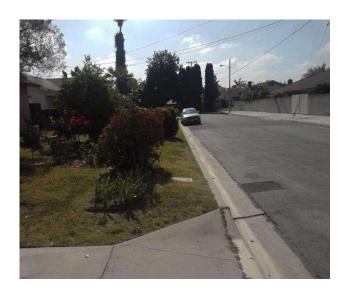

Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	407506	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

North Side

Sign East Of Old River School Road @ 33.937780241051, -118.155544996262

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 40.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1,CA 11B-403.5

Record Number	407507	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

North Side @ 33.937808057040, -118.155577182770

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Record Number	407504	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	Name Wales	0
Assignment Designated Staff	None	New Value	0

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Guy Wire East Of Julius Avenue @ 33.936595271466, -118.153517246246

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 65.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Record Number	407519	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Pomering Road South Crossing @ 33.936889011943, -118.154171705246

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 6.40 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

Record Number	407520	Resolution	None
Progress	Not_Started	Priority	Three

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Julius Avenue @ 33.936595271466, -118.153517246246

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.90 percent for 85.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	407515	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Julius Avenue @ 33.936672044643, -118.153703659773

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.30 percent for 90.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	407516	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Julius Avenue To Old River School Road @ 33.936463978047, - 118.153207451105

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.80 percent for 108.00 feet


Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

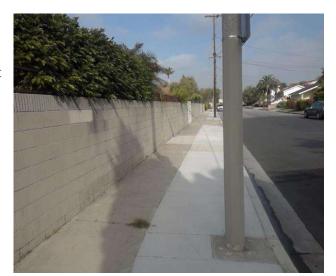

Code Reference ADA 206, 302,CA 11B-403.3

Record Number	407517	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West Of Pomering Road @ 33.936999164360, -118.154362142086

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 460.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number407518ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date06/30/2021Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0



Laura Street - Julius Avenue To Old River School Road

Julius Avenue To Old River School Road Downey, CA 90242

Date of Inspection 4/18/2017

*Estimated Facility Total: \$21,873

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using

