

Accessibility Survey



City of Downey Lemoran Avenue - Cedartree Road to Brookpark Road

Cedartree Road to Brookpark Road
Downey, CA 90242

Date of Inspection
6/20/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Lemoran Avenue - Cedartree Road to Brookpark Road

Sidewalks - Exterior : Sidewalks

East Side @ 33.955610650876, -118.104333579540

Sidewalks : No Sidewalk

Finding

No sidewalk exists at the location.

On-Site Finding Not Found

Recommendation

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 206

Progress

Record Number	453607	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue - Cedartree Road to Brookpark Road

Sidewalks - Exterior : Sidewalks

West Side @ 33.955712992231, -118.104454278946

Sidewalks : No Sidewalk

Finding

No sidewalk exists at the location.

On-Site Finding Not Found

Recommendation

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 206

Progress

Record Number	453608	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue - Cedartree Road to Brookpark Road



Lemoran Avenue - Cedartree Road to Brookpark Road

**Cedartree Road to Brookpark Road
Downey, CA 90242**

Date of Inspection
6/20/2017

***Estimated Facility Total: \$0**

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Lemoran Avenue - Gallatin Road to Raviller Drive

Lemoran Avenue - Gallatin Road to Raviller Drive
Downey, CA 90242

Date of Inspection
1/31/2017

Prepared By
Disability Access Consultants
(800) 743-7067

Lemoran Avenue - Gallatin Road to Raviller Drive

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Gallatin Road @ 33.949494419051, -118.108643889427

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	346961	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue - Gallatin Road to Raviller Drive

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South Of Gallatin Road @ 33.949363145525, -118.108769953251

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 184.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	346959	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue - Gallatin Road to Raviller Drive

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Gallatin Road @ 33.950179708071, -118.108064532280

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.10 percent for 100.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	346960	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue - Gallatin Road to Raviller Drive

Sidewalks - Exterior : Sidewalks

East Side @ 33.950537925135, -118.107777535915

Sidewalks : Turn Area

Finding

Turn area is not level.

On-Site Finding Not Level

Recommendation

Make sure that the turn area is level.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302

Progress

Record Number	346958	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue - Gallatin Road to Raviller Drive

Sidewalks - Exterior : Sidewalks

West Side

Sidewalk North Of Raviller Drive @ 33.949327545890, -118.109663128853

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 783.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	346962	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue - Gallatin Road to Raviller Drive



Lemoran Avenue - Gallatin Road to Raviller Drive

Lemoran Avenue - Gallatin Road to Raviller Drive
Downey, CA 90242

Date of Inspection
1/31/2017

***Estimated Facility Total: \$5,070**

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Lemoran Avenue - Muller Street to End

Muller Street to End
Downey, CA 90242

Date of Inspection
6/13/2017

Prepared By
Disability Access Consultants
(800) 743-7067

Lemoran Avenue - Muller Street to End

Sidewalks - Exterior : Sidewalks

East Side @ 33.938635856723, -118.116231858730

Sidewalks : No Sidewalk

Finding

No sidewalk exists at the location.

On-Site Finding Not Found

Recommendation

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 206

Progress

Record Number	446576	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue - Muller Street to End

Sidewalks - Exterior : Sidewalks

West Side @ 33.938715965943, -118.116355240345

Sidewalks : No Sidewalk

Finding

No sidewalk exists at the location.

On-Site Finding Not Found

Recommendation

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 206

Progress

Record Number	446577	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue - Muller Street to End



Lemoran Avenue - Muller Street to End

Muller Street to End
Downey, CA 90242

Date of Inspection
6/13/2017

*Estimated Facility Total: \$0

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Lemoran Avenue Bridge Overpass & I-5

Lemoran Avenue Bridge Overpass & I-5
Downey, CA 90242

Date of Inspection
8/6/2017

Prepared By
Disability Access Consultants
(800) 743-7067

Lemoran Avenue Bridge Overpass & I-5

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path of Travel from North Ramp to South Ramp @ 33.953535987093, - 118.105362206697

Exterior Walkway

Path Of Travel , Walking Surfaces : Walking Surface Slope

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 12.00 percent for 76.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Install pathway \$3,600



Code Reference ADA 402, 403.3,CA 11B-403.3,CA 11B-402

Progress

Record Number	476834	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Sidewalk from Curb to South Ramp Entrance

Curb to Ramp @ 33.953515963282, -118.106125295162

Path Of Travel , Walking Surfaces : Curb is on The Path of Travel

Finding

There is a curb on the designated path of travel.

On-Site Finding Curb Found

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



Code Reference ADA 402, 206, 302, 303, 406, 403.4, 303.4

Progress

Record Number	476830	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Sidewalk from Curb to South Ramp Entrance @ 33.953515963282, - 118.106125295162

Exterior Walkway

Path Of Travel , Walking Surfaces : Walking Surface Slope

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 28.60 percent for 3.50 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Install pathway \$3,600



Code Reference ADA 402, 403.3,CA 11B-403.3,CA 11B-402

Progress

Record Number	476828	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Sidewalk from Curb to South Ramp Entrance @ 33.953515963282, - 118.106125295162

Exterior Walkway

Path Of Travel , Walking Surfaces : Sidewalk Width

Finding

The width of the path of travel is insufficient.

On-Site Finding 45.00 inches

Recommendation

Widen the primary path of travel to provide the correct width.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Widen pathway \$3,500



Code Reference ADA 210, 504, 403.5.1, CA 11B-403.5.1

Progress

Record Number	476829	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Sidewalk from the Public Right of Way North Entrance

Curb to Ramp @ 33.953296813486, -118.104992061853

Path Of Travel , Walking Surfaces : Curb is on The Path of Travel

Finding

There is a curb on the designated path of travel.

On-Site Finding Curb Found

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



Code Reference ADA 402, 206, 302, 303, 406, 403.4, 303.4

Progress

Record Number	476833	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Path of Travel - Exterior : Path Of Travel , Path Of Travel

Sidewalk from the Public Right of Way North Entrance @ 33.953296813486, -118.104992061853

Path Of Travel , Path Of Travel : No Designated Accessible Route

Finding

There is no compliant accessible route from the public right of way to the accessible entrance of the facility.

On-Site Finding None Found

Recommendation

Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.

Recommendation See Recommendation

Costing Info (Estimated)

Install Pathway \$1,840



Code Reference ADA 206, 206.2, 402.1

Progress

Record Number	476831	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Sidewalk from the Public Right of Way North Entrance @ 33.953296813486, -118.104992061853

Exterior Walkway

Path Of Travel , Walking Surfaces : Sidewalk Width

Finding

The width of the path of travel is insufficient.

On-Site Finding 1.00 inches

Recommendation

Widen the primary path of travel to provide the correct width.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Widen pathway \$3,500



Code Reference ADA 210, 504, 403.5.1, CA 11B-403.5.1

Progress

Record Number	476832	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Path of Travel - Exterior : Path Of Travel , Path Of Travel

Sidewalk from the Public Right of Way South Entrance @ 33.953515963282, -118.106125295162

Path Of Travel , Path Of Travel : No Designated Accessible Route

Finding

There is no compliant accessible route from the public right of way to the accessible entrance of the facility.

On-Site Finding None Found

Recommendation

Provide at least one accessible route from the public right of way to the accessible entrance of the facility. Make certain to post signage indicating the direction to accessible building entrances at every major junction along the accessible route. Signs shall include the International Symbol of Accessibility.

Recommendation See Recommendation

Costing Info (Estimated)

Install Pathway \$1,840



Code Reference ADA 206, 206.2, 402.1

Progress

Record Number	476871	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Sidewalk from to Curb to North Ramp Entrance @ 33.953296813486, - 118.104992061853

Exterior Walkway

Path Of Travel , Walking Surfaces : Walking Surface Slope

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 21.00 percent for 4.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Install pathway \$3,600



Code Reference ADA 402, 403.3,CA 11B-403.3,CA 11B-402

Progress

Record Number	476872	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Sidewalk from to Curb to North Ramp Entrance @ 33.953296813486, - 118.104992061853

Exterior Walkway

Path Of Travel , Walking Surfaces : Sidewalk Width

Finding

The width of the path of travel is insufficient.

On-Site Finding 46.00 inches for 1.00 feet

Recommendation

Widen the primary path of travel to provide the correct width.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Widen pathway \$3,500



Code Reference ADA 210, 504, 403.5.1, CA 11B-403.5.1

Progress

Record Number	476873	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Ramp Run

North Ramp

Run 1

Ramp , Ramp Run : Ramp Run Slope

Finding

The slope of the ramp is greater than the allowed slope.

On-Site Finding 23.10 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Correct ramp slope \$3,600



Code Reference ADA 405, 405.2, CA 11B-405.2

Notes : Bush Vines Interruptes Right Grip Surface

Progress

Record Number	476847	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Surface

North Ramp

Run 1

Ramp , Surface : Surface Change in Level

Finding

There is a change in elevation greater than allowed on the primary path of travel of the ramp that is not beveled.

On-Site Finding 0.50 inches

Recommendation

Bevel the area or resurface the area to provide a smooth and level path of travel.

Recommendation 0.25 - 0.50 inches

Costing Info (Estimated)

Patch pathway \$1,840



Code Reference ADA 405.7.1

Notes : Bush Vines Interruptes Right Grip Surface

Progress

Record Number	476848	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Landing

North Ramp

Run 1 Bottom Landing

Ramp , Landing : Landing Slope

Finding

The slope of the landing is greater than required.

On-Site Finding 12.60 percent

Recommendation

Modify the landing to create a slope in any direction not exceeding the required maximum value.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Modify ramp landing \$2,872



Code Reference ADA 402, 405.7.1, CA 11B-405.7.1

Notes : Bush Vines Interruptes Right Grip Surface

Progress

Record Number	476849	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Landing

North Ramp

Run 1 Intermediate Landing

Ramp , Landing : Landing Length

Finding

The length of the landing is less than the required minimum length.

On-Site Finding 17.00 inches

Recommendation

Modify or replace the landing to provide the minimum required length and width.

Recommendation At least 60.00 inches

Costing Info (Estimated)

\$26



Code Reference ADA 405.7, 405.7.3, CA 11B-405.7

Notes : Bush Vines Interruptes Right Grip Surface

Progress

Record Number	476850	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Landing

North Ramp

Run 1 Intermediate Landing

Ramp , Landing : Landing Slope

Finding

The slope of the landing is greater than required.

On-Site Finding 6.60 percent

Recommendation

Modify the landing to create a slope in any direction not exceeding the required maximum value.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Modify ramp landing \$2,872



Code Reference ADA 402, 405.7.1,CA 11B-405.7.1

Notes : Bush Vines Interruptes Right Grip Surface

Progress

Record Number	476851	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

North Ramp

Run 1 Left Handrail

Ramp , Handrail : Handrail Extension

Finding

The ends of the handrails end abruptly.

On-Site Finding Not Compliant

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending the required distance beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1

Notes : Bush Vines Interruptes Right Grip Surface

Progress

Record Number	476852	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

North Ramp

Run 1 Left Handrail

Ramp , Handrail : Handrail Extension not Parallel

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, CA 11B-505.10.1

Notes : Bush Vines Interruptes Right Grip Surface

Progress

Record Number	476853	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

North Ramp

Run 1 Left Handrail

Ramp , Handrail : Handrail Extension Length

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding 0.00 inches

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, CA 11B-505.10.1

Notes : Bush Vines Interruptes Right Grip Surface

Progress

Record Number	476854	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

North Ramp

Run 1 Right Handrail

Ramp , Handrail : Handrail Interrupted

Finding

The gripping surface of the handrails are interrupted by posts, or by a lack of smooth connections.

On-Site Finding Interrupted

Recommendation

Replace the handrails on each side to provide a smooth and continuous gripping surface. The gripping surface shall be smooth and free from interruptions.

Recommendation See Recommendation

Costing Info (Estimated)

Attach pipe railing to wall \$2,320



Code Reference ADA 405, 405.8, 505.6

Notes : Bush Vines Interruptes Right Grip Surface

Progress

Record Number	476855	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

North Ramp

Run 1 Right Handrail

Ramp , Handrail : Handrail Extension

Finding

The ends of the handrails end abruptly.

On-Site Finding Not Compliant

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending the required distance beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1

Notes : Bush Vines Interruptes Right Grip Surface

Progress

Record Number	476856	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

North Ramp

Run 1 Right Handrail

Ramp , Handrail : Handrail Extension not Parallel

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, CA 11B-505.10.1

Notes : Bush Vines Interruptes Right Grip Surface

Progress

Record Number	476857	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

North Ramp

Run 1 Right Handrail

Ramp , Handrail : Handrail Extension Length

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding 0.00 inches

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, CA 11B-505.10.1

Notes : Bush Vines Interruptes Right Grip Surface

Progress

Record Number	476858	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

North Ramp

Run 1 Right Handrail

Ramp , Handrail : Handrail Height

Finding

The height of the handrails on the ramp is not within the required range above the surface of the ramp.

On-Site Finding 41.75 inches

Recommendation

Modify or replace the handrails on the ramp to provide a gripping surface height within the required range above the ramp surface.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Set hand-forged wrought iron railing in concrete \$3,918



Code Reference ADA 405, 405.8, 505.4,CA 11B-405.8,CA 11B-505.4

Notes : Bush Vines Interruptes Right Grip Surface

Progress

Record Number	476859	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Ramp Run

North Ramp

Run 2

Ramp , Ramp Run : Vertical Clearance Height

Finding

Ramp run does not have enough vertical clearance height.

On-Site Finding 75.00 inches

Recommendation

Provide compliant vertical clearance for the ramp run.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 307.4,CA 11B-307.4

Progress

Record Number	476860	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Ramp Run

North Ramp

Run 2

Ramp , Ramp Run : Ramp Run Slope

Finding

The slope of the ramp is greater than the allowed slope.

On-Site Finding 18.80 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Correct ramp slope \$3,600



Code Reference ADA 405, 405.2, CA 11B-405.2

Progress

Record Number	476861	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Ramp Run

North Ramp

Run 2

Ramp , Ramp Run : Ramp Run Cross Slope

Finding

The cross slope of the ramp is greater than the allowed cross slope.

On-Site Finding 4.20 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Correct ramp slope \$3,600



Code Reference ADA 403, 405.3, CA 11B-405.3

Progress

Record Number	476862	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

North Ramp

Run 2 Left Handrail

Ramp , Handrail : Handrail Extension

Finding

The ends of the handrails end abruptly.

On-Site Finding Not Compliant

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending the required distance beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1

Progress

Record Number	476868	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

North Ramp

Run 2 Left Handrail

Ramp , Handrail : Handrail Extension not Parallel

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, CA 11B-505.10.1

Progress

Record Number	476869	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

North Ramp

Run 2 Left Handrail

Ramp , Handrail : Handrail Extension Length

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding 0.00 inches


Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400

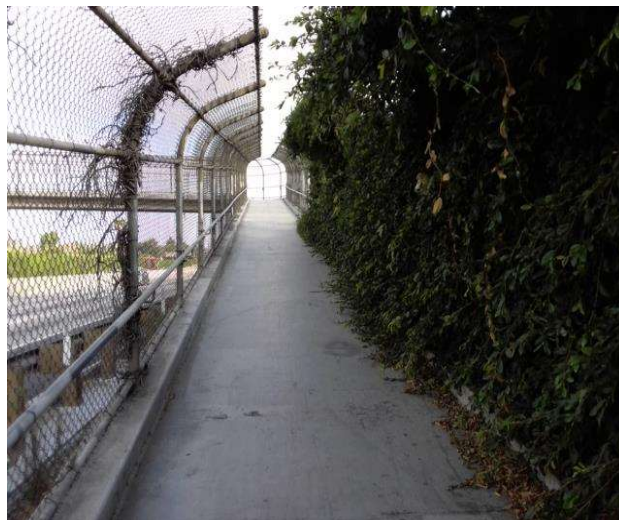

Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, CA 11B-505.10.1

Progress

Record Number	476870	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

North Ramp

Run 2 Right Handrail

Ramp , Handrail : Handrail Interrupted

Finding

The gripping surface of the handrails are interrupted by posts, or by a lack of smooth connections.

On-Site Finding Interrupted

Recommendation

Replace the handrails on each side to provide a smooth and continuous gripping surface. The gripping surface shall be smooth and free from interruptions.

Recommendation See Recommendation

Costing Info (Estimated)

Attach pipe railing to wall \$2,320



Code Reference ADA 405, 405.8, 505.6

Progress

Record Number	476863	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

North Ramp

Run 2 Right Handrail

Ramp , Handrail : Handrail Extension

Finding

The ends of the handrails end abruptly.

On-Site Finding Not Compliant

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending the required distance beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1

Progress

Record Number	476864	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

North Ramp

Run 2 Right Handrail

Ramp , Handrail : Handrail Extension not Parallel

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, CA 11B-505.10.1

Progress

Record Number	476865	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

North Ramp

Run 2 Right Handrail

Ramp , Handrail : Handrail Extension Length

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding 0.00 inches

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, CA 11B-505.10.1

Progress

Record Number	476866	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

North Ramp

Run 2 Right Handrail

Ramp , Handrail : Handrail Near Abrasive Wall

Finding

The surface of the wall adjacent to the handrail is abrasive.

On-Site Finding Abrasive

Recommendation

Modify the surface of the wall adjacent to the handrail so that the surface is smooth and nonabrasive.

Recommendation See Recommendation

Costing Info (Estimated)

Attach pipe railing to wall \$2,320



Code Reference ADA 505, 405.8, 505.8

Progress

Record Number	476867	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Ramp Run

South Ramp

Run 1

Ramp , Ramp Run : Ramp Run Slope

Finding

The slope of the ramp is greater than the allowed slope.

On-Site Finding 22.90 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Correct ramp slope \$3,600



Code Reference ADA 405, 405.2, CA 11B-405.2

Notes : Bush Vines Interrupts Left Grip Surface

Progress

Record Number	476835	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Landing

South Ramp

Run 1 Bottom Landing

Ramp , Landing : Landing Slope

Finding

The slope of the landing is greater than required.

On-Site Finding 8.70 percent

Recommendation

Modify the landing to create a slope in any direction not exceeding the required maximum value.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Modify ramp landing \$2,872



Code Reference ADA 402, 405.7.1, CA 11B-405.7.1

Notes : Bush Vines Interrupts Left Grip Surface

Progress

Record Number	476836	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

South Ramp

Run 1 Left Handrail

Ramp , Handrail : Handrail Interrupted

Finding

The gripping surface of the handrails are interrupted by posts, or by a lack of smooth connections.

On-Site Finding Interrupted

Recommendation

Replace the handrails on each side to provide a smooth and continuous gripping surface. The gripping surface shall be smooth and free from interruptions.

Recommendation See Recommendation

Costing Info (Estimated)

Attach pipe railing to wall \$2,320



Code Reference ADA 405, 405.8, 505.6

Notes : Bush Vines Interrupts Left Grip Surface

Progress

Record Number	476842	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

South Ramp

Run 1 Left Handrail

Ramp , Handrail : Handrail Extension

Finding

The ends of the handrails end abruptly.

On-Site Finding Not Compliant

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending the required distance beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1

Notes : Bush Vines Interrupts Left Grip Surface

Progress

Record Number	476843	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

South Ramp

Run 1 Left Handrail

Ramp , Handrail : Handrail Extension not Parallel

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, CA 11B-505.10.1

Notes : Bush Vines Interrupts Left Grip Surface

Progress

Record Number	476844	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

South Ramp

Run 1 Left Handrail

Ramp , Handrail : Handrail Extension Length

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding 0.00 inches

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, CA 11B-505.10.1

Notes : Bush Vines Interrupts Left Grip Surface

Progress

Record Number	476845	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

South Ramp

Run 1 Left Handrail

Ramp , Handrail : Handrail Height

Finding

The height of the handrails on the ramp is not within the required range above the surface of the ramp.

On-Site Finding 38.50 inches

Recommendation

Modify or replace the handrails on the ramp to provide a gripping surface height within the required range above the ramp surface.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Set hand-forged wrought iron railing in concrete \$3,918



Code Reference ADA 405, 405.8, 505.4,CA 11B-405.8,CA 11B-505.4

Notes : Bush Vines Interrupts Left Grip Surface

Progress

Record Number	476846	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

South Ramp

Run 1 Right Handrail

Ramp , Handrail : Handrail Extension

Finding

The ends of the handrails end abruptly.

On-Site Finding Not Compliant

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending the required distance beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1

Notes : Bush Vines Interrupts Left Grip Surface

Progress

Record Number	476838	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

South Ramp

Run 1 Right Handrail

Ramp , Handrail : Handrail Extension not Parallel

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, CA 11B-505.10.1

Notes : Bush Vines Interrupts Left Grip Surface

Progress

Record Number	476839	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

South Ramp

Run 1 Right Handrail

Ramp , Handrail : Handrail Extension Length

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding 0.00 inches

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Provide compliant handrail extensions \$2,400



Code Reference ADA 405, 405.8, 505.10.1, CA 11B-405.8, CA 11B-505.10.1

Notes : Bush Vines Interrupts Left Grip Surface

Progress

Record Number	476840	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Handrail

South Ramp

Run 1 Right Handrail

Ramp , Handrail : Handrail Height

Finding

The height of the handrails on the ramp is not within the required range above the surface of the ramp.

On-Site Finding 38.25 inches

Recommendation

Modify or replace the handrails on the ramp to provide a gripping surface height within the required range above the ramp surface.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Set hand-forged wrought iron railing in concrete \$3,918



Code Reference ADA 405, 405.8, 505.4, CA 11B-405.8, CA 11B-505.4

Notes : Bush Vines Interrupts Left Grip Surface

Progress

Record Number	476841	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5

Ramps - Exterior : Ramp , Landing

South Ramp

Run 1 Top Landing

Ramp , Landing : Landing Slope

Finding

The slope of the landing is greater than required.

On-Site Finding 5.30 percent

Recommendation

Modify the landing to create a slope in any direction not exceeding the required maximum value.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Modify ramp landing \$2,872



Code Reference ADA 402, 405.7.1,CA 11B-405.7.1

Notes : Bush Vines Interrupts Left Grip Surface

Progress

Record Number	476837	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Lemoran Avenue Bridge Overpass & I-5



Lemoran Avenue Bridge Overpass & I-5

Lemoran Avenue Bridge Overpass & I-5
Downey, CA 90242

Date of Inspection
8/6/2017

*Estimated Facility Total: \$121,968

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using

