
# Accessibility Survey

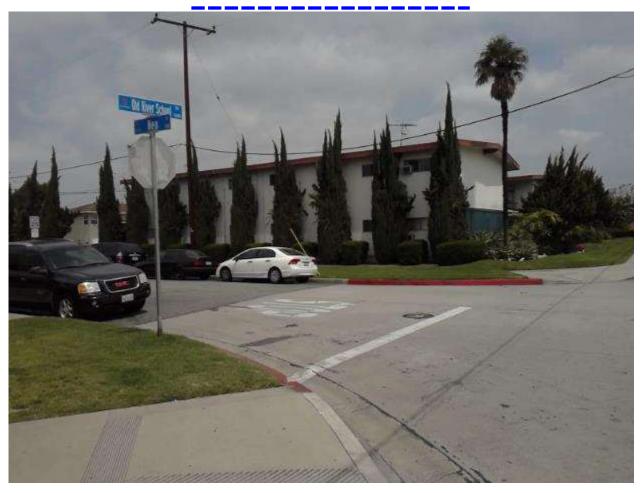

# City of Downey Neo Street - Old River School Drive To End

Old River School Drive To End Downey, CA 90242

Date of Inspection 4/24/2017

Prepared By Disability Access Consultants (800) 743-7067

# Sidewalks - Exterior : Sidewalks , Change in Level

# **North Side**

#### Change In Level West Of Haro Avenue @ 33.946158006182, -118.152945935726

Sidewalks, Change in Level : Change in Level Non Beveled

#### Finding

There is a change in elevation greater than recommended value.

**On-Site Finding** 1.25 inches


#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### **Costing Info (Estimated)**

Remove tripping hazards \$198

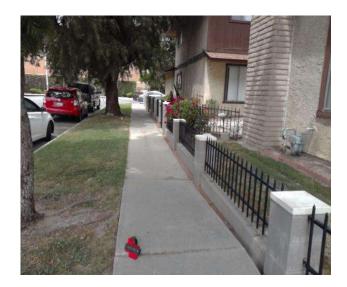

Code	Reference	ADA	206,	302
Couc		11011	200,	202

<b>Record Number</b>	410819	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		<b>Projected Date</b>	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

# Sidewalks - Exterior : Sidewalks , Change in Level

# **North Side**

#### Change In Level West Of Haro Avenue @ 33.946165793894, -118.152970075607

Sidewalks , Change in Level : Change in Level Non Beveled

#### Finding

There is a change in elevation greater than recommended value.

**On-Site Finding** 1.00 inches


#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### **Costing Info (Estimated)**

Remove tripping hazards \$198

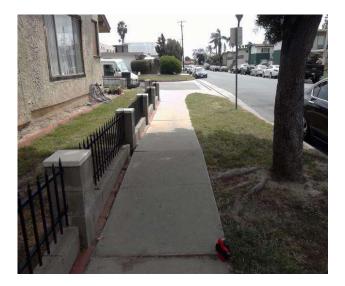

Code	Reference	ADA	206,	302
Coue	Reference		200,	JUZ

Record Number Progress Actual Date	410818 Not_Started	Resolution Priority Projected Date	None Two 06/30/2021
Actual Cost	\$0.00 No Comments	Contractor	
Assignment Designated Staff	None	New Value	0

# Sidewalks - Exterior : Sidewalks , Change in Level

# **North Side**

#### Change In Level West Of Haro Avenue @ 33.946192494613, -118.153038471937

Sidewalks , Change in Level : Change in Level Non Beveled

#### Finding

There is a change in elevation greater than recommended value.

**On-Site Finding** 1.12 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### **Costing Info (Estimated)**

Remove tripping hazards \$198



Code	Reference	ADA	206,	302
Coue	Reference		200,	JUZ

Record Number	410816	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

# Sidewalks - Exterior : Sidewalks , Change in Level

# **North Side**

#### Change In Level West Of Haro Avenue @ 33.946225870501, -118.153093457222

Sidewalks , Change in Level : Change in Level Non Beveled

#### Finding

There is a change in elevation greater than recommended value.

**On-Site Finding** 1.12 inches


#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### **Costing Info (Estimated)**

Remove tripping hazards \$198

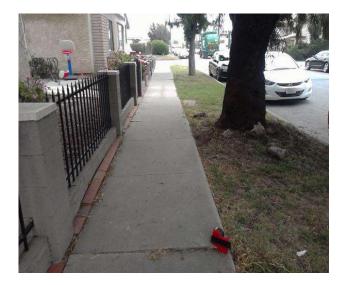

Code	Reference	ADA	206	302
Coue	Reference	ADA	200,	30Z

Record Number	410817	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		<b>Projected Date</b>	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

# Sidewalks - Exterior : Sidewalks , Hazards & Gratings

### **North Side**

#### Curb Northwest Corner Of Adco Avenue @ 33.945530536800, -118.151811361313

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

#### Finding


There is a curb on the designated path of travel.

**On-Site Finding** Not Compliant

#### Recommendation

Provide a compliant curb ramp.

RecommendationSee RecommendationCosting Info (Estimated)Install curb ramp\$2,500

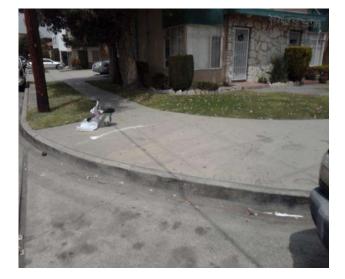

**Code Reference** ADA 402, 303, 406, 403.4, 303.4

<b>Record Number</b>	410820	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

# Sidewalks - Exterior : Sidewalks , Vehicular Traffic

### **North Side**

#### Driveway West Of Adco Avenue @ 33.945664041311, -118.152055442333

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

#### Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

**On-Site Finding** Not Found

#### Recommendation

Provide detectable warnings.

RecommendationSee RecommendationCosting Info (Estimated)Install compliant detectable\$190



Code Reference

ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

## Progress

warnings

Record Number	410821	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

# **North Side**

# Driveway West Of Adco Avenue @ 33.945664041311, -118.152055442333

Sidewalks : Vehicular Traffic Cross Slope

#### Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.30 percent


#### Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)** 

Repave surface \$1,092

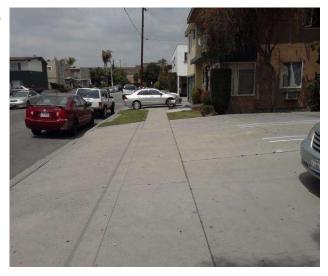

**Code Reference** ADA 206, 302,CA 11B-403.3

<b>Record Number</b>	410822	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

# **North Side**

## Sidewalk West Of Adco Avenue @ 33.945780857587, -118.152290135622

Sidewalks : Missing Sidewalk

## Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

**On-Site Finding** 147.00 feet

#### Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 20

ADA 206, 302,CA 11B-302,CA 11B-206

Record Number	410815	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

# Sidewalks - Exterior : Sidewalks , Surface

# **North Side**

#### Sidewalk West Of Haro Avenue @ 33.946131305452, -118.152912408113

Sidewalks , Surface : Cross Slope

#### Finding

Sidewalk cross slope is not compliant.

**On-Site Finding** 4.40 percent for 8.00 feet


#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)** 

Repave surface \$1,092

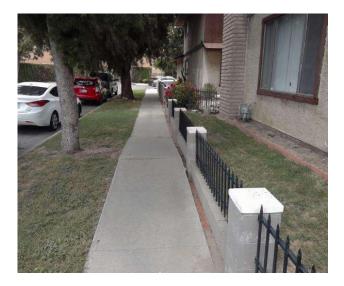

**Code Reference** ADA 206, 302,CA 11B-403.3

<b>Record Number</b>	410810	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

# Sidewalks - Exterior : Sidewalks , Surface

# **North Side**

#### Sidewalk West Of Haro Avenue @ 33.946131305452, -118.152912408113

Sidewalks , Surface : Running Slope

#### Finding

Sidewalk running slope is not compliant.

**On-Site Finding** 6.70 percent for 20.00 feet


#### Recommendation

Repave the sidewalk surface with the recommended running slope.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)** 

Repave surface \$1,184

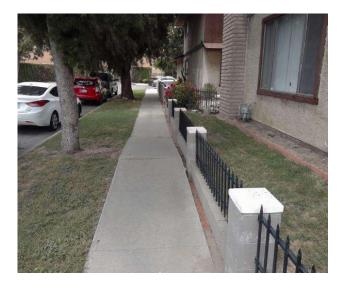

Code	Reference	ADA	206,	302
Couc	Reference	ADA	200,	J02

<b>Record Number</b>	410811	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

# Sidewalks - Exterior : Sidewalks , Surface

# **North Side**

#### Sidewalk West Of Haro Avenue @ 33.946192494613, -118.153038471937

Sidewalks , Surface : Cross Slope

#### Finding

Sidewalk cross slope is not compliant.

**On-Site Finding** 3.80 percent for 12.00 feet


#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)** 

Repave surface \$1,092

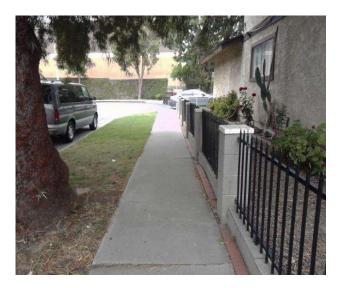

**Code Reference** ADA 206, 302,CA 11B-403.3

Record Number	410812	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

# **North Side**

Sidewalk West Of Old River School Drive @ 33.944994291571, -118.150820285082

Sidewalks : Missing Sidewalk

# Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

**On-Site Finding** 140.00 feet

#### Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

**Costing Info (Estimated)** 

\$1,260



Code Reference

ADA 206, 302,CA 11B-302,CA 11B-206

Record Number	410813	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

# **North Side**

Sidewalk West Of Old River School Drive @ 33.945231263427, -118.151260167360

Sidewalks : Missing Sidewalk

# Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

**On-Site Finding** 140.00 feet

#### Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

**Costing Info (Estimated)** 

\$1,260



**Code Reference** ADA 206, 302,CA 11B-302,CA 11B-206

Record Number	410814	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

**Curb Ramps - Exterior : Curb Ramp** 

# Northeast Corner Of Old River School Drive @ 33.944995404116, - 118.150767982006

Curb Ramp : No Detectable Warnings

# Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

# Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

### **Costing Info (Estimated)**

Provide detectable warning to \$248 surface



Code	Reference	CA 11B-4	406.5.12
		0/(110	10010111

Record Number	410799	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

**Curb Ramps - Exterior : Curb Ramp** 

# Northeast Corner Of Old River School Drive @ 33.944995404116, - 118.150767982006

Curb Ramp : Side Flare Slope

# Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 11.30 percent

#### Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

#### **Costing Info (Estimated)**

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3, CA 11B-406.2.2

Record Number	410800	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

**Curb Ramps - Exterior : Curb Ramp** 

# Northeast Corner Of Old River School Drive @ 33.944995404116, - 118.150767982006

**Bottom Landing** 

#### Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

**On-Site Finding** 9.40 percent

#### Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)** 

Repave landing \$1,260



Curb Ramp : Bottom Landing Slope

**Code Reference** ADA 406, 406.2, CA 11B-406.5.8

Record Number	410801	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

# Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

# Northeast Corner Of Old River School Drive @ 33.944995404116, - 118.150767982006

**Bottom Landing** 

#### Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** Not Beveled


#### Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

**Costing Info (Estimated)** 

Patch lip at curb ramp \$255

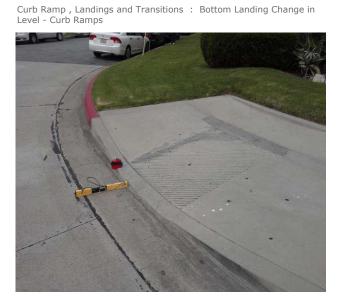

Code	Reference	ADA	302.	406.2
Couc		101	502,	100.2

<b>Record Number</b>	410802	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

# Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

# Northeast Corner Of Old River School Drive @ 33.944995404116, - 118.150767982006

Top Landing

# Finding

There is not enough top landing clear length.

**On-Site Finding** 47.50 inches

#### Recommendation


Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

# **Costing Info (Estimated)**

Provide compliant landing \$240

Curb Ramp , Landings and Transitions  $\ : \ \mbox{Top}$  Landing Clear Length - Landings

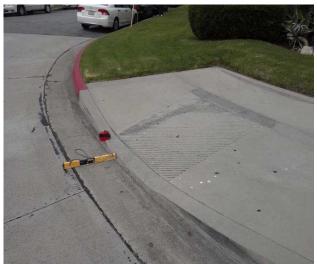

	Code Reference	ADA 406, 406.4,CA 11B-406.5.3
--	----------------	-------------------------------

<b>Record Number</b>	410803	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

Sidewalks - Exterior : Sidewalks

# South Side @ 33.944869686386, -118.150912821293

Sidewalks : No Sidewalk

#### Finding

No sidewalk exists at the location.

**On-Site Finding** Not Found

# Recommendation

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

**Costing Info (Estimated)** 

Unassigned



Code Reference ADA 206

Record Number	410798	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

**Curb Ramps - Exterior : Curb Ramp** 

# Southwest Corner Of Old River School Drive @ 33.944838535062, - 118.150892704725

Curb Ramp : No Detectable Warnings

# Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

# Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

# **Costing Info (Estimated)**

Provide detectable warning to \$248 surface



Code Reference	CA 11B-406.5.12
	0/1 110 10010111

Record Number	410804	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

**Curb Ramps - Exterior : Curb Ramp** 

# Southwest Corner Of Old River School Drive @ 33.944838535062, - 118.150892704725

Curb Ramp : Side Flare Slope

# Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 13.10 percent

#### Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

**Costing Info (Estimated)** 

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3, CA 11B-406.2.2

Record Number	410805	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

# Curb Ramps - Exterior : Curb Ramp, Ramp Run

# Southwest Corner Of Old River School Drive @ 33.944838535062, - 118.150892704725

Curb Ramp, Ramp Run : Grade Break

#### Finding

Curb ramp run surface has a grade break.

**On-Site Finding** Not Compliant

# Recommendation

Provide a compliant curb ramp.

Recommendation	See Recommendation
Costing Info (Estim	ated)
Install curb ramp	\$1,440



Code Reference	CA 11B-406.5.6
	CA IID 400.3.0

Record Number	410806	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

**Curb Ramps - Exterior : Curb Ramp** 

# Southwest Corner Of Old River School Drive @ 33.944838535062, - 118.150892704725

**Bottom Landing** 

#### Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

**On-Site Finding** 11.60 percent

#### Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)** 

Repave landing \$1,260



Curb Ramp : Bottom Landing Slope

**Code Reference** ADA 406, 406.2, CA 11B-406.5.8

<b>Record Number</b>	410807	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

# Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

# Southwest Corner Of Old River School Drive @ 33.944838535062, - 118.150892704725

**Bottom Landing** 

#### Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** 0.62 inches

#### Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

**Costing Info (Estimated)** 

Patch lip at curb ramp \$255

 $\operatorname{Curb}\nolimits$  Ramp , Landings And Transitions  $\ : \$ Bottom Landing Change in Level



**Code Reference** ADA 302, 303, 406.2, 303.1

Record Number	410808	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

# Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

# Southwest Corner Of Old River School Drive @ 33.944838535062, - 118.150892704725

Top Landing

#### Finding

There is not enough top landing clear length.

**On-Site Finding** 47.00 inches

#### Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

### **Costing Info (Estimated)**

Provide compliant landing \$240





Code Reference ADA 406, 40	06.4,CA 11B-406.5.3	3
----------------------------	---------------------	---

<b>Record Number</b>	410809	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			



# Neo Street - Old River School Drive To End

# Old River School Drive To End Downey, CA 90242

Date of Inspection 4/24/2017

# \*Estimated Facility Total: \$19,768

\*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.


Prepared By

# **Disability Access Consultants**

(800) 743-7067



# **Accessibility Survey**

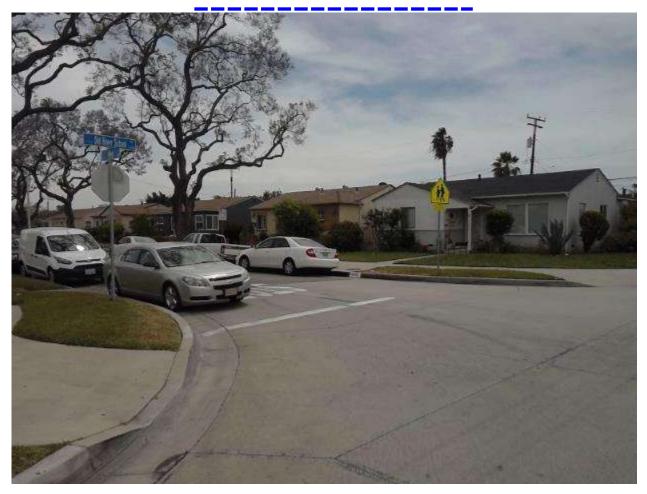

# City of Downey Neo Street - Old River School Road To Norlain Avenue

Old River School Road To Norlain Avenue Downey, CA 90242

Date of Inspection 4/25/2017

Prepared By Disability Access Consultants (800) 743-7067

**Curb Ramps - Exterior : Curb Ramp** 

# Northeast Corner Of Old River School Road @ 33.944672765321, - 118.150652647018

Curb Ramp : No Detectable Warnings

# Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

# Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

# **Costing Info (Estimated)**

Provide detectable warning to \$248 surface



Code Reference	CA 11B-406.5.12
	0/(110 10010111

Record Number	411930	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

**Curb Ramps - Exterior : Curb Ramp** 

# Northeast Corner Of Old River School Road @ 33.944672765321, - 118.150652647018

Curb Ramp : Curb Ramp Slope

# Finding

The running slope is greater than allowed.

On-Site Finding 10.10 percent

# Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent
Costing Info (Estimated)
Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

<b>Record Number</b>	411931	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

**Curb Ramps - Exterior : Curb Ramp** 

# Northeast Corner Of Old River School Road @ 33.944672765321, - 118.150652647018

Curb Ramp : Side Flare Slope

# Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 19.90 percent

#### Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

#### **Costing Info (Estimated)**

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3, CA 11B-406.2.2

<b>Record Number</b>	411932	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

**Curb Ramps - Exterior : Curb Ramp** 

# Northeast Corner Of Old River School Road @ 33.944672765321, - 118.150652647018

**Bottom Landing** 

# Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

**On-Site Finding** 13.40 percent

## Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)** 

Repave landing \$1,260



Curb Ramp : Bottom Landing Slope

**Code Reference** ADA 406, 406.2, CA 11B-406.5.8

<b>Record Number</b>	411933	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

# Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

# Northeast Corner Of Old River School Road @ 33.944672765321, - 118.150652647018

Top Landing

# Finding

The slope at the top landing is greater than allowed.

On-Site Finding 4.60 percent

## Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

#### **Costing Info (Estimated)**

Provide compliant landing \$1,260



Curb Ramp, Landings and Transitions : Top Landing Slope

Cada Defenses	ADA 402 40C 4	402 2 406 1	
Code Reference	ADA 402, 406.4,	403.3, 406.1	,CA 11B-406.5.3

Record Number	411934	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

**Curb Ramps - Exterior : Curb Ramp** 

# Southeast Corner Of Old School River Road @ 33.944551497320, - 118.150772005320

Curb Ramp : No Detectable Warnings

# Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

# Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

# **Costing Info (Estimated)**

Provide detectable warning to \$248 surface



Code Re	eference	CA	11B-406.5.12
		· · ·	

Record Number	411925	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

**Curb Ramps - Exterior : Curb Ramp** 

# Southeast Corner Of Old School River Road @ 33.944551497320, - 118.150772005320

Curb Ramp : Curb Ramp Slope

# Finding

The running slope is greater than allowed.

On-Site Finding 14.20 percent

# Recommendation

Provide a compliant curb ramp.

RecommendationUp to 8.33 percentCosting Info (Estimated)Install curb ramp\$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

<b>Record Number</b>	411926	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

**Curb Ramps - Exterior : Curb Ramp** 

# Southeast Corner Of Old School River Road @ 33.944551497320, - 118.150772005320

Curb Ramp : Side Flare Slope

# Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 18.50 percent

#### Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

#### **Costing Info (Estimated)**

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3, CA 11B-406.2.2

<b>Record Number</b>	411927	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

# Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

# Southeast Corner Of Old School River Road @ 33.944551497320, - 118.150772005320

Top Landing

# Finding

The slope at the top landing is greater than allowed.

On-Site Finding 4.90 percent

## Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

#### **Costing Info (Estimated)**

Provide compliant landing \$1,260



	101 100 100 1	400 0 400 4 00 440 400 5 0
Code Reference	ADA 402, 406.4,	403.3, 406.1,CA 11B-406.5.3

Record Number	411928	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

# Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

# Southeast Corner Of Old School River Road @ 33.944551497320, - 118.150772005320

Top Landing

#### Finding

There is not enough top landing clear length.

On-Site Finding 37.00 inches

#### Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

# **Costing Info (Estimated)**

Provide compliant landing \$240



Curb Ramp, Landings and Transitions : Top Landing Clear Length -

Code Reference	ADA 406, 406.4,CA 11B-406.5.3
----------------	-------------------------------

Record Number	411929	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

Sidewalks - Exterior : Sidewalks

# North Side @ 33.944672765321, -118.150652647018

Sidewalks : No Sidewalk

### Finding

No sidewalk exists at the location.

**On-Site Finding** Not Found

#### Recommendation

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

**Costing Info (Estimated)** 

Unassigned



Code Reference ADA 206

<b>Record Number</b>	411938	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

# Sidewalks - Exterior : Sidewalks , Surface

# **South Side**

#### Sidewalk West Of Norlain Avenue @ 33.944449142542, -118.150525242090

Sidewalks , Surface : Cross Slope

#### Finding

Sidewalk cross slope is not compliant.

**On-Site Finding** 4.00 percent for 8.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)** 

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

Notes : Surface is rough and uneven for 2 feet.

<b>Record Number</b>	411936	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

# Sidewalks - Exterior : Sidewalks , Surface

# **South Side**

#### Sidewalk West Of Norlain Avenue @ 33.944449142542, -118.150525242090

Sidewalks , Surface : Running Slope

#### Finding

Sidewalk running slope is not compliant.

On-Site Finding 8.20 percent for 1.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended running slope.

Recommendation Up to 5.00 percent

**Costing Info (Estimated)** 

Repave surface \$1,184



# Code ReferenceADA 206, 302

Notes : Surface is rough and uneven for 2 feet.

Record Number	411937	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks

# South Side @ 33.944253333060, -118.150037080050

Sidewalks : 60X60 Turn Area

#### Finding

There is no 60X60 turn area at every 200 feet.

**On-Site Finding** Not Found

#### Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

**Costing Info (Estimated)** 

\$2,400



Code Reference ADA 206, 302

Record Number	411935	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			



# Neo Street - Old River School Road To Norlain Avenue

# Old River School Road To Norlain Avenue Downey, CA 90242

Date of Inspection 4/25/2017

# \*Estimated Facility Total: \$14,392

\*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

# **Disability Access Consultants**

(800) 743-7067

