

## Accessibility Survey

---



## City of Downey Horley Avenue - Adwen Street To Arnett Street

Adwen Street To Arnett Street  
Downey, CA 90242

Date of Inspection  
4/11/2017

Prepared By  
**Disability Access Consultants**  
(800) 743-7067

## Horley Avenue - Adwen Street To Arnett Street

### Sidewalks - Exterior : Sidewalks , Change in Level

---

#### West Side

#### Change In Level North Of Adwen Street @ 33.942043769838, -118.145678490400

Sidewalks , Change in Level : Change in Level Non Beveled

#### Finding

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.87 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### Costing Info (Estimated)

Remove tripping hazards \$198



**Code Reference** ADA 206, 302

#### Progress

---

<b>Record Number</b>	404265	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Two
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2019
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Horley Avenue - Adwen Street To Arnett Street**

**Sidewalks - Exterior : Sidewalks , Change in Level**

---

**West Side**

**Change In Level North Of Adwen Street @ 33.942758045793, -118.145144730806**

Sidewalks , Change in Level : Change in Level Non Beveled

**Finding**

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.50 inches


**Recommendation**

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)**

Remove tripping hazards \$198

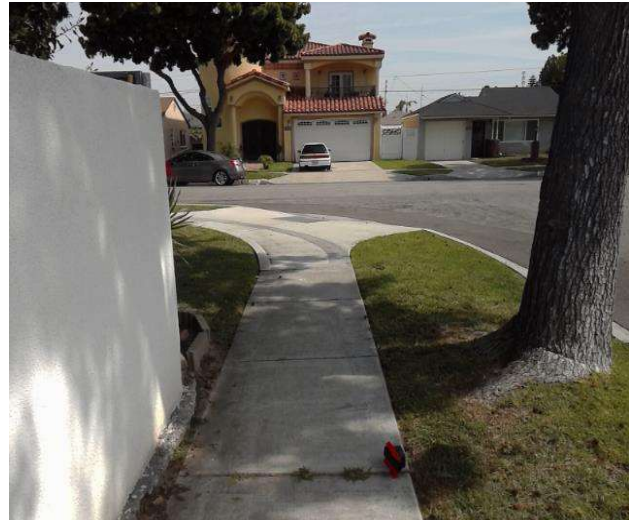

**Code Reference** ADA 206, 302

**Progress**

---

<b>Record Number</b>	404264	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Two
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2019
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

## Horley Avenue - Adwen Street To Arnett Street

### Curb Ramps - Exterior : Curb Ramp

---

#### Northeast Corner Of Arnett Street @ 33.942726893696, - 118.144977092743

Curb Ramp : Curb Ramp Slope

#### Finding

The running slope is greater than allowed.

**On-Site Finding** 9.80 percent

#### Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

#### Costing Info (Estimated)

Install curb ramp \$1,300



**Code Reference** ADA 406, 406.1, 405.2, CA 11B-406

### Progress

---

<b>Record Number</b>	404269	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

## Horley Avenue - Adwen Street To Arnett Street

### Curb Ramps - Exterior : Curb Ramp

#### Northeast Corner Of Arnett Street @ 33.942726893696, - 118.144977092743

##### Bottom Landing

Curb Ramp : Bottom Landing Slope

##### Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

**On-Site Finding** 10.30 percent

##### Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

##### Costing Info (Estimated)

Repave landing \$1,260



**Code Reference** ADA 406, 406.2, CA 11B-406.5.8

### Progress

<b>Record Number</b>	404270	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			



**Horley Avenue - Adwen Street To Arnett Street**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Northeast Corner Of Arnett Street @ 33.942726893696, -  
118.144977092743**

**Top Landing**

**Finding**

There is not enough top landing clear length.

**On-Site Finding** 46.50 inches

**Recommendation**

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

**Costing Info (Estimated)**

Provide compliant landing \$240

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings



**Code Reference** ADA 406, 406.4,CA 11B-406.5.3

**Progress**

---

<b>Record Number</b>	404271	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Horley Avenue - Adwen Street To Arnett Street**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Northwest Corner Of Adwen Street @ 33.941409594574, - 118.146137148142**

**Top Landing**

**Finding**

There is not enough top landing clear length.

**On-Site Finding** 45.00 inches

**Recommendation**

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

**Costing Info (Estimated)**

Provide compliant landing \$240

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings



**Code Reference** ADA 406, 406.4,CA 11B-406.5.3

**Progress**

---

<b>Record Number</b>	404268	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

## Horley Avenue - Adwen Street To Arnett Street

### Curb Ramps - Exterior : Curb Ramp

---

#### Southwest Corner Of Arnett Street @ 33.942805886492, - 118.145105838776

##### Bottom Landing

Curb Ramp : Bottom Landing Slope

##### Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

**On-Site Finding** 14.80 percent

##### Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

##### Costing Info (Estimated)

Repave landing \$1,260



**Code Reference** ADA 406, 406.2, CA 11B-406.5.8

### Progress

---

<b>Record Number</b>	404261	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			



## Horley Avenue - Adwen Street To Arnett Street

### Sidewalks - Exterior : Sidewalks , Surface

---

#### East Side

#### Sidewalk South Of Arnett Street @ 33.942641225369, -118.145032078028

Sidewalks , Surface : Cross Slope

#### Finding

Sidewalk cross slope is not compliant.

**On-Site Finding** 4.70 percent for 466.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

#### Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302, CA 11B-403.3

#### Progress

---

<b>Record Number</b>	404267	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Horley Avenue - Adwen Street To Arnett Street**

**Sidewalks - Exterior : Sidewalks**

**East Side @ 33.942706867341, -118.144982457161**

Sidewalks : 60X60 Turn Area

**Finding**

There is no 60X60 turn area at every 200 feet.

**On-Site Finding** Not Found

**Recommendation**

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

**Costing Info (Estimated)**

\$2,400



**Code Reference** ADA 206, 302

**Progress**

<b>Record Number</b>	404266	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Horley Avenue - Adwen Street To Arnett Street**

**Sidewalks - Exterior : Sidewalks , Surface**

---

**West Side**

**Sidewalk North Of Adwen Street @ 33.942327478294, -118.145459890366**

Sidewalks , Surface : Cross Slope

**Finding**

Sidewalk cross slope is not compliant.

**On-Site Finding** 4.60 percent for 133.00 feet

**Recommendation**

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)**

Repave surface \$1,092



**Code Reference** ADA 206, 302, CA 11B-403.3

**Progress**

---

<b>Record Number</b>	404263	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments	<b>New Value</b>	0
<b>Assignment</b>	None		
<b>Designated Staff</b>			

**Horley Avenue - Adwen Street To Arnett Street**

**Sidewalks - Exterior : Sidewalks**

**West Side @ 33.941438521970, -118.146121054888**

Sidewalks : 60X60 Turn Area

**Finding**

There is no 60X60 turn area at every 200 feet.

**On-Site Finding** Not Found

**Recommendation**

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

**Costing Info (Estimated)**

\$2,400



**Code Reference** ADA 206, 302

**Progress**

<b>Record Number</b>	404262	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Horley Avenue - Adwen Street To Arnett Street**



**Horley Avenue - Adwen Street To Arnett Street**

**Adwen Street To Arnett Street  
Downey, CA 90242**

Date of Inspection  
4/11/2017

**\*Estimated Facility Total: \$11,680**

\*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

**Disability Access Consultants**

(800) 743-7067

Prepared Using





# Accessibility Survey

---



## City of Downey Horley Avenue - Brunache Street To Nada Street

Brunache Street To Nada Street  
Downey, CA 90242

Date of Inspection  
4/18/2017

Prepared By  
**Disability Access Consultants**  
(800) 743-7067



**Horley Avenue - Brunache Street To Nada Street**

**Sidewalks - Exterior : Sidewalks**

**East Side @ 33.935587199852, -118.150263726711**

Sidewalks : No Sidewalk

**Finding**

No sidewalk exists at the location.

**On-Site Finding** Not Found

**Recommendation**

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

**Costing Info (Estimated)**

Unassigned



**Code Reference** ADA 206

**Progress**

<b>Record Number</b>	407481	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Horley Avenue - Brunache Street To Nada Street**



**Horley Avenue - Brunache Street To Nada Street**

**Brunache Street To Nada Street  
Downey, CA 90242**

Date of Inspection  
4/18/2017

**\*Estimated Facility Total: \$0**

\*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

**Disability Access Consultants**

(800) 743-7067

Prepared Using



## Accessibility Survey

---



### City of Downey Horley Avenue - Cecilia Street to Muller Street

Cecilia Street to Muller Street  
Downey, CA 90242

Date of Inspection  
7/3/2017

Prepared By  
**Disability Access Consultants**  
(800) 743-7067

**Horley Avenue - Cecilia Street to Muller Street**

**Sidewalks - Exterior : Sidewalks**

**East Side @ 33.949086135470, -118.140059262514**

Sidewalks : No Sidewalk

**Finding**

No sidewalk exists at the location.

**On-Site Finding** Not Found

**Recommendation**

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

**Costing Info (Estimated)**

Unassigned



**Code Reference** ADA 206

**Progress**

<b>Record Number</b>	462507	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Horley Avenue - Cecilia Street to Muller Street**

**Sidewalks - Exterior : Sidewalks**

**West Side @ 33.949158447419, -118.140188008547**

Sidewalks : No Sidewalk

**Finding**

No sidewalk exists at the location.

**On-Site Finding** Not Found

**Recommendation**

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

**Costing Info (Estimated)**

Unassigned



**Code Reference** ADA 206

**Progress**

<b>Record Number</b>	462506	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			



**Horley Avenue - Cecilia Street to Muller Street**



**Horley Avenue - Cecilia Street to Muller Street**

**Cecilia Street to Muller Street  
Downey, CA 90242**

Date of Inspection  
7/3/2017

**\*Estimated Facility Total: \$0**

\*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

**Disability Access Consultants**

(800) 743-7067

Prepared Using





## Accessibility Survey

---



## City of Downey Horley Avenue - Irwingrove Drive to Florence Avenue

Irwingrove Drive to Florence Avenue  
Downey, CA 90242

Date of Inspection  
7/3/2017

Prepared By

**Disability Access Consultants**

(800) 743-7067

## Horley Avenue - Irwingrove Drive to Florence Avenue

### Sidewalks - Exterior : Sidewalks

---

**East Side @ 33.955105616737, -118.137006908655**

Sidewalks : No Sidewalk

#### Finding

No sidewalk exists at the location.

**On-Site Finding** Not Found

#### Recommendation

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

#### Costing Info (Estimated)

Unassigned



**Code Reference** ADA 206

### Progress

---

<b>Record Number</b>	462043	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

## Horley Avenue - Irwingrove Drive to Florence Avenue

### Sidewalks - Exterior : Sidewalks

---

**West Side @ 33.955179035983, -118.137136995792**

Sidewalks : No Sidewalk

#### Finding

No sidewalk exists at the location.

**On-Site Finding** Not Found

#### Recommendation

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

#### Costing Info (Estimated)

Unassigned



**Code Reference** ADA 206

### Progress

---

<b>Record Number</b>	462042	<b>Resolution</b>	None
<b>Progress</b>	Not_Started	<b>Priority</b>	Five
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2025
<b>Actual Cost</b>	\$0.00	<b>Contractor</b>	
<b>Comments</b>	No Comments		
<b>Assignment</b>	None	<b>New Value</b>	0
<b>Designated Staff</b>			

**Horley Avenue - Irwingrove Drive to Florence Avenue**



**Horley Avenue - Irwingrove Drive to Florence Avenue**

**Irwingrove Drive to Florence Avenue  
Downey, CA 90242**

Date of Inspection  
7/3/2017

**\*Estimated Facility Total: \$0**

\*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

**Disability Access Consultants**

(800) 743-7067

Prepared Using

