## **Accessibility Survey**



# 10th Street - Brookshire Avenue to Birchdale Avenue

Brookshire Avenue to Birchdale Avenue Downey, CA 90242

Date of Inspection 7/14/2017

Prepared By

**Disability Access Consultants** 

(800) 743-7067

## Sidewalks - Exterior : Sidewalks , Change in Level

## **North Side**

## Change in Level East of Brookshire Avenue @ 33.947628758485, -118.120503276587

Sidewalks , Change in Level : Change in Level Non Beveled

## **Finding**

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches


#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198

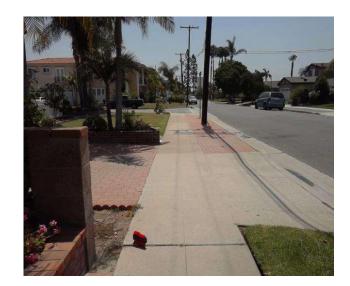

Code Reference ADA 206, 302

## **Progress**

Record Number470164ResolutionNoneProgressNot\_StartedPriorityTwo

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

**Assignment** None **New Value** 0

## Sidewalks - Exterior : Sidewalks , Change in Level

## **North Side**

## Change in Level East of Brookshire Avenue @ 33.947639883594, -118.120523393154

Sidewalks , Change in Level : Change in Level Non Beveled

## **Finding**

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.50 inches

#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198



Code Reference ADA 206, 302

## **Progress**

Record Number470168ResolutionNoneProgressNot\_StartedPriorityTwoActual DateProjected Date06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

**Assignment** None **New Value** 0

## Sidewalks - Exterior : Sidewalks , Change in Level

## **North Side**

## Change in Level East of Brookshire Avenue @ 33.948187237195, -118.121607005596

Sidewalks , Change in Level : Change in Level Non Beveled

## **Finding**

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.50 inches


#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198

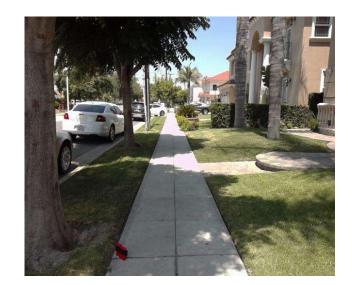

Code Reference ADA 206, 302

## **Progress**

Record Number470169ResolutionNoneProgressNot\_StartedPriorityTwoActual DateProjected Date06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

**Assignment** None **New Value** 0

## Sidewalks - Exterior : Sidewalks , Change in Level

## **North Side**

## Change in Level East of Brookshire Avenue @ 33.948354112592, -118.121940940619

Sidewalks , Change in Level : Change in Level Non Beveled

## **Finding**

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.50 inches


#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198

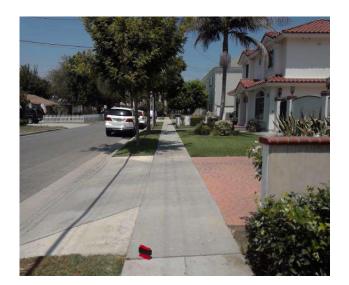

Code Reference ADA 206, 302

## **Progress**

Record Number470166ResolutionNoneProgressNot\_StartedPriorityTwoActual DateProjected Date06/30/2021

Actual Cost \$0.00 Contractor

**Comments** No Comments

**Assignment** None **New Value** 0

## Sidewalks - Exterior : Sidewalks , Change in Level

## **South Side**

## Change in Level West of Birchdale Avenue @ 33.948286249970, -118.122111260891

Sidewalks , Change in Level : Change in Level Non Beveled

## Finding

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.50 inches


#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

**Costing Info (Estimated)** 

Remove tripping hazards \$198

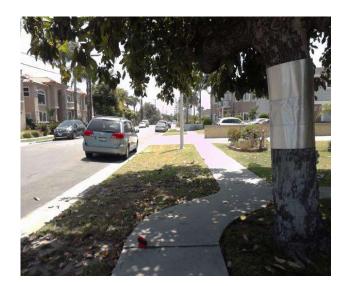

Code Reference ADA 206, 302

## **Progress**

<b>Record Number</b>	470177	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		<b>Projected Date</b>	06/30/2021
<b>Actual Cost</b>	\$0.00	Contractor	

**Comments** No Comments

**Assignment** None **New Value** 0

## Sidewalks - Exterior : Sidewalks , Hazards & Gratings

## **North Side**

## Northeast Corner of Brookshire Avenue @ 33.948690087400, -118.122611492872

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

## Finding

There is a curb on the designated path of travel.

**On-Site Finding** Not Compliant


#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

**Costing Info (Estimated)** 

Install curb ramp \$2,500

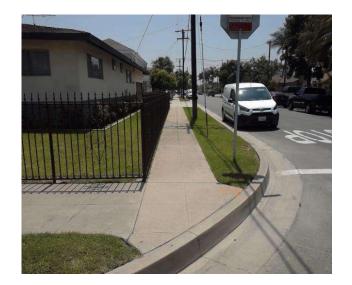

**Code Reference** ADA 402, 303, 406, 403.4, 303.4

## **Progress**

Record Number	470170	Resolution	None
Progress	Not_Started	Priority	Seven
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

**Assignment** None **New Value** 0

## Sidewalks - Exterior : Sidewalks , Hazards & Gratings

## **North Side**

## Northwest Corner of Birchdale Avenue @ 33.947530857457, -118.120296746492

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

## **Finding**

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

**Costing Info (Estimated)** 

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

## **Progress**

<b>Record Number</b>	470165	Resolution	None
Progress	Not_Started	Priority	Seven
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2032

Actual Cost \$0.00 Contractor

**Comments** No Comments

**Assignment** None **New Value** 0

## Sidewalks - Exterior : Sidewalks , Surface

## **North Side**

## Sidewalk East of Brookshire Avenue @ 33.948187237195, -118.121607005596

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

**On-Site Finding** 4.30 percent for 110.00 feet

## Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)** 

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

## **Progress**

<b>Record Number</b>	470163	Resolution	None
Progress	Not_Started	Priority	Seven
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2032

Actual Cost \$0.00 Contractor

**Comments** No Comments

**Assignment** None **New Value** 0

## Sidewalks - Exterior : Sidewalks , Hazards & Gratings

## **North Side**

## Tree East of Brookshire Avenue @ 33.948490950174, -118.122211843729

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

## **Finding**

Overhead obstruction height is not compliant.

On-Site Finding 68.00 inches


#### Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

**Costing Info (Estimated)** 

Unassigned

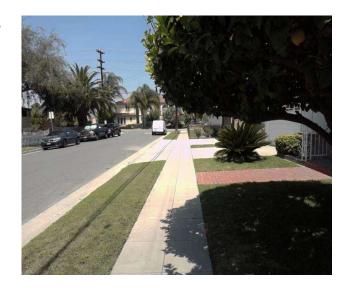

**Code Reference** ADA 206, 307.4,CA 11B-307.4

## **Progress**

Record Number	470167	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
<b>Actual Cost</b>	\$0.00	Contractor	

**Comments** No Comments

**Assignment** None **New Value** 0

**Sidewalks - Exterior : Sidewalks** 

## North Side @ 33.948691199897, -118.122610151768

Sidewalks : 60X60 Turn Area

## **Finding**

There is no 60X60 turn area at every 200 feet.

**On-Site Finding** Not Found


#### Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

**Costing Info (Estimated)** 

\$2,400

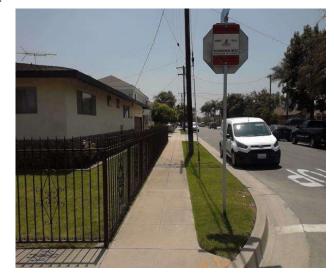

Code Reference ADA 206, 302

## **Progress**

Record Number	470162	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
<b>Actual Cost</b>	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			

## **Sidewalks - Exterior : Sidewalks , Surface**

## **South Side**

## Sidewalk West of Birchdale Avenue @ 33.947824560203, -118.121183216572

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

**On-Site Finding** 4.00 percent for 59.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)** 

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

## **Progress**

<b>Record Number</b>	470172	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2032
Actual Cost	\$0.00	Contractor	

**Comments** No Comments

**Assignment** None **New Value** 0

**Sidewalks - Exterior : Sidewalks** 

## **South Side**

## Sidewalk West of Birchdale Avenue @ 33.947920235878, -118.121357560158

Sidewalks : Missing Sidewalk

## Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

**On-Site Finding** 64.00 feet

#### Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

**Costing Info (Estimated)** 

\$1,260



**Code Reference** ADA 206, 302,CA 11B-302,CA 11B-206

## **Progress**

<b>Record Number</b>	470173	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2037
<b>Actual Cost</b>	\$0.00	Contractor	

**Comments** No Comments

Assignment None New Value 0

**Sidewalks - Exterior : Sidewalks** 

## **South Side**

## Sidewalk West of Birchdale Avenue @ 33.948085999294, -118.121715635061

Sidewalks : Missing Sidewalk

## Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

**On-Site Finding** 5.00 feet


#### Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

**Costing Info (Estimated)** 

\$1,260

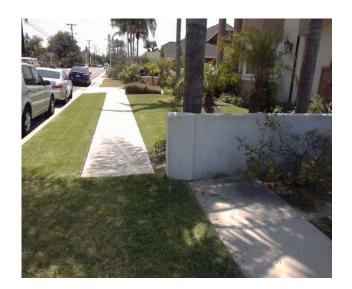

**Code Reference** ADA 206, 302,CA 11B-302,CA 11B-206

## **Progress**

Record Number	470174	Resolution	None
Progress	Not_Started	Priority	Seven
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2037
<b>Actual Cost</b>	\$0.00	Contractor	

**Comments** No Comments

**Assignment** None **New Value** 0

## **Sidewalks - Exterior : Sidewalks , Surface**

## **South Side**

## Sidewalk West of Birchdale Avenue @ 33.948085999294, -118.121715635061

Sidewalks , Surface : Cross Slope

## **Finding**

Sidewalk cross slope is not compliant.

**On-Site Finding** 3.70 percent for 170.00 feet

## Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

**Costing Info (Estimated)** 

Repave surface \$1,092



**Code Reference** ADA 206, 302,CA 11B-403.3

## **Progress**

<b>Record Number</b>	470175	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

**Comments** No Comments

Assignment None New Value 0

**Sidewalks - Exterior : Sidewalks** 

## **South Side**

## Sidewalk West of Birchdale Avenue @ 33.948334087562, -118.122197091579

Sidewalks : Missing Sidewalk

## **Finding**

Section of sidewalk is missing and consists of dirt, grass or gravel.

**On-Site Finding** 195.00 feet

#### Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

**Costing Info (Estimated)** 

\$1,260



**Code Reference** ADA 206, 302,CA 11B-302,CA 11B-206

## **Progress**

<b>Record Number</b>	470176	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		<b>Projected Date</b>	06/30/2037

Actual Cost \$0.00 Contractor

**Comments** No Comments

**Assignment** None **New Value** 0

**Sidewalks - Exterior : Sidewalks** 

## South Side @ 33.947810097591, -118.121160417795

Sidewalks : 60X60 Turn Area

## **Finding**

There is no 60X60 turn area at every 200 feet.

**On-Site Finding** Not Found

#### Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

**Costing Info (Estimated)** 

\$2,400



Code Reference ADA 206, 302

## **Progress**

<b>Record Number</b>	470171	Resolution	None
Progress	Not_Started	Priority	Seven
<b>Actual Date</b>		<b>Projected Date</b>	06/30/2032
<b>Actual Cost</b>	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
<b>Designated Staff</b>			



10th Street - Brookshire Avenue to Birchdale Avenue

## Brookshire Avenue to Birchdale Avenue Downey, CA 90242

Date of Inspection 7/14/2017

\*Estimated Facility Total: \$17,846

\*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

**Disability Access Consultants** 

(800) 743-7067

**Prepared Using** 

