

Accessibility Survey



City of Downey Downey Avenue & De Palma Street

Downey Avenue & De Palma Street
Downey, CA 90242

Date of Inspection
1/31/2017

Prepared By
Disability Access Consultants
(800) 743-7067

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp

Northwest Corner @ 33.933496470239, -118.137798160315

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347866 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp

Northwest Corner @ 33.933496470239, -118.137798160315

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 10.80 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347867 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp

Northwest Corner @ 33.933496470239, -118.137798160315

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 18.10 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347868 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp

Northwest Corner @ 33.933496470239, -118.137798160315

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 8.40 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347869 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

Northwest Corner @ 33.933496470239, -118.137798160315

Bottom Landing

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.87 inches

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$255



Code Reference ADA 302, 303, 406.2, 303.1

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347870 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner @ 33.933496470239, -118.137798160315

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 44.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347871 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp

Southeast Corner @ 33.933203830758, -118.137708306313

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347872 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp

Southeast Corner @ 33.933203830758, -118.137708306313

Curb Ramp : Parallel Curb Ramp Left Side Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 5.90 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347873 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp

Southeast Corner @ 33.933203830758, -118.137708306313

Curb Ramp : Parallel Curb Ramp Right Side Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 5.40 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347874 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner @ 33.933203830758, -118.137708306313

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Slope

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 8.70 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 402, 406.4, 406.2, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347875 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner @ 33.933203830758, -118.137708306313

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 4.90 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347876 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

Southeast Corner @ 33.933203830758, -118.137708306313

Top Landing

Curb Ramp , Landings And Transitions : Top Landing Change in Level

Finding

The transition from the top of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.75 inches

Recommendation

Patch the transition area at the top of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$155



Code Reference ADA 302, 303.1

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347877 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner @ 33.933203830758, -118.137708306313

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Right Side
Change in Level - Curb Ramps

Finding

The transition from the top of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.50 inches

Recommendation

Patch the transition area at the top of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation 0.25 - 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$155



Code Reference ADA 406.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347878 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp

Southwest Corner To South Crossing @ 33.933305086358, - 118.137896060944

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347879 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp

Southwest Corner To South Crossing @ 33.933305086358, - 118.137896060944

Curb Ramp : Parallel Curb Ramp Right Side Slope

Finding

The running slope is greater than allowed.

On-Site Finding 9.90 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347880 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp

Southwest Corner To South Crossing @ 33.933305086358, - 118.137896060944

Curb Ramp : Parallel Curb Ramp Right Side Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 5.30 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347881 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner To South Crossing @ 33.933305086358, - 118.137896060944

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Slope

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 8.30 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 402, 406.4, 406.2, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347882 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner To South Crossing @ 33.933305086358, - 118.137896060944

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Right Side Clear Length - Parallel Curb Ramp

Finding

There is not enough top landing clear length.

On-Site Finding 43.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406.4,CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347883 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp

**Southwest Corner To West Crossing @ 33.933376299015, -
118.137881308794**

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347884 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp

Southwest Corner To West Crossing @ 33.933376299015, - 118.137881308794

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 11.20 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347885 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp

Southwest Corner To West Crossing @ 33.933376299015, - 118.137881308794

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 6.90 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347886 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

Southwest Corner To West Crossing @ 33.933376299015, - 118.137881308794

Bottom Landing

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 1.50 inches

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$255



Code Reference ADA 302, 303, 406.2, 303.1

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347887 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner To West Crossing @ 33.933376299015, - 118.137881308794

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347888 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner To West Crossing @ 33.933376299015, - 118.137881308794

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 43.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347889 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & De Palma Street

South Crossing @ 33.933262803814, -118.137820959091

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347890 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & De Palma Street

South Crossing @ 33.933262803814, -118.137820959091

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347891 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & De Palma Street

Southeast Corner To South Crossing @ 33.933233873641, -118.137676119804

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 133.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347909 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & De Palma Street

Southeast Corner To South Crossing @ 33.933233873641, -118.137676119804

Intersections , Pedestrian Signal Controls : Push Button Height

Finding

Push button height is not compliant.

On-Site Finding 38.50 inches

Recommendation

Provide a compliant push button.

Recommendation 41.00 - 48.00 inches

Costing Info (Estimated)

\$900



Code Reference ADA 308, 308.3, CA MUTCD 4E.09, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347910 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & De Palma Street

Southeast Corner To South Crossing @ 33.933233873641, -118.137676119804

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Width

Finding

There is not enough clear ground space at the push button.

On-Site Finding 17.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 32.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347911 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & De Palma Street

Southeast Corner To South Crossing @ 33.933233873641, -118.137676119804

Intersections , Pedestrian Signal Controls : Push Button - Clear
Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 4.70 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347912 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & De Palma Street

Southeast Corner To South Crossing @ 33.933233873641, -118.137676119804

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347913 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & De Palma Street

Southeast Corner To South Crossing @ 33.933233873641, -118.137676119804

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347914 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & De Palma Street

Southeast Corner To South Crossing @ 33.933233873641, -118.137676119804

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347915 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & De Palma Street

Southeast Corner To South Crossing @ 33.933233873641, -118.137676119804

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347916 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & De Palma Street

Southeast Corner To South Crossing @ 33.933233873641, -118.137676119804

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347917 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & De Palma Street

Southeast Corner To South Crossing @ 33.933233873641, -118.137676119804

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347918 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & De Palma Street

Southeast Corner To South Crossing @ 33.933233873641, -118.137676119804

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347919 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & De Palma Street

Southeast Corner To South Crossing @ 33.933233873641, -118.137676119804

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347920 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & De Palma Street

Southeast Corner To South Crossing @ 33.933233873641, -118.137676119804

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347921 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & De Palma Street

Southwest Corner To South Crossing @ 33.933337354600, -118.137886673212

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 109.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347896 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & De Palma Street

Southwest Corner To South Crossing @ 33.933337354600, -118.137886673212

Intersections , Pedestrian Signal Controls : Push Button Height

Finding

Push button height is not compliant.

On-Site Finding 38.25 inches

Recommendation

Provide a compliant push button.

Recommendation 41.00 - 48.00 inches

Costing Info (Estimated)

\$900



Code Reference ADA 308, 308.3, CA MUTCD 4E.09, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347897 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & De Palma Street

Southwest Corner To South Crossing @ 33.933337354600, -118.137886673212

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Length

Finding

There is not enough clear ground space at the push button.

On-Site Finding 26.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347898 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & De Palma Street

Southwest Corner To South Crossing @ 33.933337354600, -118.137886673212

Intersections , Pedestrian Signal Controls : Push Button - Clear
Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 6.80 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347899 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & De Palma Street

Southwest Corner To South Crossing @ 33.933337354600, -118.137886673212

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347900 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & De Palma Street

Southwest Corner To South Crossing @ 33.933337354600, -118.137886673212

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347901 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & De Palma Street

Southwest Corner To South Crossing @ 33.933337354600, -118.137886673212

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347902 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & De Palma Street

Southwest Corner To South Crossing @ 33.933337354600, -118.137886673212

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347903 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & De Palma Street

Southwest Corner To South Crossing @ 33.933337354600, -118.137886673212

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347904 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & De Palma Street

Southwest Corner To South Crossing @ 33.933337354600, -118.137886673212

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347905 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & De Palma Street

Southwest Corner To South Crossing @ 33.933337354600, -118.137886673212

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347906 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & De Palma Street

Southwest Corner To South Crossing @ 33.933337354600, -118.137886673212

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347907 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & De Palma Street

Southwest Corner To South Crossing @ 33.933337354600, -118.137886673212

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347908 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & De Palma Street

West Crossing @ 33.933441948130, -118.137838393450

Intersections , Walking Surface : Cross Slope

Finding

Intersection walking surface cross slope is not compliant.

On-Site Finding 3.10 percent

Recommendation

Repave the walking surface with recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference

Notes : No APS for West Crossing

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347892 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & De Palma Street

West Crossing @ 33.933441948130, -118.137838393450

Intersections , Walking Surface : Crosswalk - Pavement Stripes

Finding

Crosswalk pavement is not marked with stripes between 6" and 24" wide.

On-Site Finding Not Compliant

Recommendation

Re-stripe the crosswalk pavement with stripes between 6" minimum and 24" maximum.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Notes : No APS for West Crossing

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347893 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & De Palma Street

West Crossing @ 33.933441948130, -118.137838393450

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Notes : No APS for West Crossing

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347894 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & De Palma Street

West Crossing @ 33.933441948130, -118.137838393450

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Notes : No APS for West Crossing

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347895 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & De Palma Street



Downey Avenue & De Palma Street

Downey Avenue & De Palma Street
Downey, CA 90242

Date of Inspection
1/31/2017

*Estimated Facility Total: \$39,760

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Downey Avenue & Firestone Boulevard

Downey Avenue & Firestone Boulevard
Downey, CA 90240

Date of Inspection
5/23/2017

Prepared By
Disability Access Consultants
(800) 743-7067

Downey Avenue & Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner of Firestone Boulevard @ 33.940197972910, - 118.132960796356

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 8.00 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435096 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner of Firestone Boulevard @ 33.940197972910, - 118.132960796356

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.40 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435097 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northwest Corner of Firestone Boulevard @ 33.940298107586, - 118.133183419704

Curb Ramp : Appurtenances

Finding

Utilities, gratings or other appurtenances are located on the curb ramp.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp free of appurtenances.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$1,440



Code Reference ADA 303.3, CA 11B-303.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435095 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Firestone Boulevard @ 33.939948748318, - 118.133129775524

Curb Ramp : Appurtenances

Finding

Utilities, gratings or other appurtenances are located on the curb ramp.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp free of appurtenances.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$1,440



Code Reference ADA 303.3, CA 11B-303.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435092 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Firestone Boulevard @ 33.939948748318, - 118.133129775524

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 9.40 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435093 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner of Firestone Boulevard @ 33.939948748318, - 118.133129775524

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 46.25 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435094 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southwest Corner of Firestone Boulevard @ 33.940064459827, - 118.133347034454

Curb Ramp : Appurtenances

Finding

Utilities, gratings or other appurtenances are located on the curb ramp.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp free of appurtenances.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$1,440



Code Reference ADA 303.3, CA 11B-303.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435091 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & Firestone Boulevard

East Crossing @ 33.940066685046, -118.133043944836

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435098 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Firestone Boulevard

East Crossing North to South @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 178.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435146 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Firestone Boulevard

East Crossing North to South @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Controls : Push Button - Clear
Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 3.30 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435147 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

East Crossing North to South @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435148 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

East Crossing North to South @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435149 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

East Crossing North to South @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435150 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

East Crossing North to South @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435151 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

East Crossing North to South @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435152 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

East Crossing North to South @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435153 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

East Crossing North to South @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435154 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

East Crossing North to South @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435155 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

East Crossing North to South @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435156 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Firestone Boulevard

East Crossing South to North @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 180.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435177 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

East Crossing South to North @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435178 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

East Crossing South to North @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435179 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

East Crossing South to North @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435180 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

East Crossing South to North @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435181 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

East Crossing South to North @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435182 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

East Crossing South to North @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435183 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

East Crossing South to North @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435184 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

East Crossing South to North @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435185 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

East Crossing South to North @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435186 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & Firestone Boulevard

North Crossing @ 33.940249152870, -118.133081495762

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435101 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Firestone Boulevard

North Crossing East to West @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 98.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435135 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Firestone Boulevard

North Crossing East to West @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Controls : Push Button - Clear
Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 7.70 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435136 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

North Crossing East to West @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435137 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

North Crossing East to West @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435138 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

North Crossing East to West @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435139 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

North Crossing East to West @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435140 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

North Crossing East to West @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435141 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

North Crossing East to West @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435142 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

North Crossing East to West @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435143 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

North Crossing East to West @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435144 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

North Crossing East to West @ 33.940197972910, -118.132960796356

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435145 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Firestone Boulevard

North Crossing West to East @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 124.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435114 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Firestone Boulevard

North Crossing West to East @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Controls : Push Button - Clear
Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 4.20 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435115 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

North Crossing West to East @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435116 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

North Crossing West to East @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435117 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

North Crossing West to East @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435118 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

North Crossing West to East @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435119 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

North Crossing West to East @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435120 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

North Crossing West to East @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435121 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

North Crossing West to East @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435122 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

North Crossing West to East @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435123 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

North Crossing West to East @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435124 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & Firestone Boulevard

South Crossing @ 33.944378870, -118.133231699467

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435100 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Firestone Boulevard

South Crossing East to West @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 95.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435102 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Firestone Boulevard

South Crossing East to West @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Length

Finding

There is not enough clear ground space at the push button.

On-Site Finding 45.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435103 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Firestone Boulevard

South Crossing East to West @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Controls : Push Button - Clear
Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 8.30 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435104 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

South Crossing East to West @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435105 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

South Crossing East to West @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435106 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

South Crossing East to West @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435107 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

South Crossing East to West @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435108 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

South Crossing East to West @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435109 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

South Crossing East to West @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435110 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

South Crossing East to West @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435111 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

South Crossing East to West @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435112 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

South Crossing East to West @ 33.939948748318, -118.133129775524

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435113 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Firestone Boulevard

South Crossing West to East @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 140.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435125 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

South Crossing West to East @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435126 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

South Crossing West to East @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435127 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

South Crossing West to East @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435128 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

South Crossing West to East @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435129 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

South Crossing West to East @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435130 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

South Crossing West to East @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435131 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

South Crossing West to East @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435132 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

South Crossing West to East @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435133 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

South Crossing West to East @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435134 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & Firestone Boulevard

West Crossing @ 33.940180171178, -118.133274614811

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435099 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Firestone Boulevard

West Crossing North to South @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 212.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435167 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

West Crossing North to South @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435168 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

West Crossing North to South @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435169 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

West Crossing North to South @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435170 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

West Crossing North to South @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435171 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

West Crossing North to South @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435172 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

West Crossing North to South @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435173 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

West Crossing North to South @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435174 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

West Crossing North to South @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435175 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

West Crossing North to South @ 33.940298107586, -118.133183419704

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435176 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Firestone Boulevard

West Crossing South to North @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 132.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435157 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

West Crossing South to North @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435158 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

West Crossing South to North @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435159 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

West Crossing South to North @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435160 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

West Crossing South to North @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435161 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Firestone Boulevard

West Crossing South to North @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435162 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

West Crossing South to North @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435163 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

West Crossing South to North @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435164 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

West Crossing South to North @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435165 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Firestone Boulevard

West Crossing South to North @ 33.940064459827, -118.133347034454

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435166 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Firestone Boulevard



Downey Avenue & Firestone Boulevard

Downey Avenue & Firestone Boulevard
Downey, CA 90240

Date of Inspection
5/23/2017

*Estimated Facility Total: \$67,572

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Downey Avenue & Gardendale Street

Downey Avenue & Gardendale Street
Downey, CA 90242

Date of Inspection
2/2/2017

Prepared By
Disability Access Consultants
(800) 743-7067

Downey Avenue & Gardendale Street

Curb Ramps - Exterior : Curb Ramp , Ramp Run

Northeast Corner @ 33.914923553720, -118.151539117098

Curb Ramp , Ramp Run : Grade Break

Finding

Curb ramp run surface has a grade break.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$1,440



Code Reference CA 11B-406.5.6

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350020 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & Gardendale Street

East Crossing @ 33.914822276270, -118.151616901159

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350021 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & Gardendale Street

North Crossing @ 33.915011475805, -118.151665180922

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350022 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Gardendale Street

Northeast Corner - East Crossing @ 33.914899069073, -118.151536434889

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 132.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350035 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Gardendale Street

Northeast Corner - East Crossing @ 33.914899069073, -118.151536434889

Intersections , Pedestrian Signal Controls : Push Button Height

Finding

Push button height is not compliant.

On-Site Finding 40.00 inches

Recommendation

Provide a compliant push button.

Recommendation 41.00 - 48.00 inches

Costing Info (Estimated)

\$900



Code Reference ADA 308, 308.3, CA MUTCD 4E.09, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350036 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northeast Corner - East Crossing @ 33.914899069073, -118.151536434889

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350037 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northeast Corner - East Crossing @ 33.914899069073, -118.151536434889

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350038 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northeast Corner - East Crossing @ 33.914899069073, -118.151536434889

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350039 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northeast Corner - East Crossing @ 33.914899069073, -118.151536434889

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350040 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northeast Corner - East Crossing @ 33.914899069073, -118.151536434889

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350041 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Gardendale Street

Northeast Corner - East Crossing @ 33.914899069073, -118.151536434889

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350042 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Gardendale Street

Northeast Corner - East Crossing @ 33.914899069073, -118.151536434889

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350043 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Gardendale Street

Northeast Corner - East Crossing @ 33.914899069073, -118.151536434889

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350044 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Gardendale Street

Northeast Corner - East Crossing @ 33.914899069073, -118.151536434889

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350045 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Gardendale Street

Northeast Corner - North Crossing @ 33.914963619491, -118.151555210352

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 135.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350046 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Gardendale Street

Northeast Corner - North Crossing @ 33.914963619491, -118.151555210352

Intersections , Pedestrian Signal Controls : Push Button Height

Finding

Push button height is not compliant.

On-Site Finding 40.00 inches

Recommendation

Provide a compliant push button.

Recommendation 41.00 - 48.00 inches

Costing Info (Estimated)

\$900



Code Reference ADA 308, 308.3, CA MUTCD 4E.09, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350047 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northeast Corner - North Crossing @ 33.914963619491, -118.151555210352

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350048 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northeast Corner - North Crossing @ 33.914963619491, -118.151555210352

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350049 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northeast Corner - North Crossing @ 33.914963619491, -118.151555210352

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350050 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northeast Corner - North Crossing @ 33.914963619491, -118.151555210352

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350051 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northwest Corner - North Crossing @ 33.914963619491, -118.151555210352

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350052 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Gardendale Street

Northeast Corner - North Crossing @ 33.914963619491, -118.151555210352

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350053 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Gardendale Street

Northeast Corner - North Crossing @ 33.914963619491, -118.151555210352

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350054 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Gardendale Street

Northeast Corner - North Crossing @ 33.914963619491, -118.151555210352

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350055 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Gardendale Street

Northeast Corner - North Crossing @ 33.914963619491, -118.151555210352

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350056 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Gardendale Street

Northwest Corner - North Crossing @ 33.915073800265, -118.151744306087

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 129.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350024 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Gardendale Street

Northwest Corner - North Crossing @ 33.915073800265, -118.151744306087

Intersections , Pedestrian Signal Controls : Push Button Height

Finding

Push button height is not compliant.

On-Site Finding 40.00 inches

Recommendation

Provide a compliant push button.

Recommendation 41.00 - 48.00 inches

Costing Info (Estimated)

\$900



Code Reference ADA 308, 308.3, CA MUTCD 4E.09, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350025 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northwest Corner - North Crossing @ 33.915073800265, -118.151744306087

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350026 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northwest Corner - North Crossing @ 33.915073800265, -118.151744306087

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350027 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northwest Corner - North Crossing @ 33.915073800265, -118.151744306087

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350028 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northwest Corner - North Crossing @ 33.915073800265, -118.151744306087

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350029 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northwest Corner - North Crossing @ 33.915073800265, -118.151744306087

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350030 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Gardendale Street

Northwest Corner - North Crossing @ 33.915073800265, -118.151744306087

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350031 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Gardendale Street

Northwest Corner - North Crossing @ 33.915073800265, -118.151744306087

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350032 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Gardendale Street

Northwest Corner - North Crossing @ 33.915073800265, -118.151744306087

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350033 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Gardendale Street

Northwest Corner - North Crossing @ 33.915073800265, -118.151744306087

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350034 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Gardendale Street

Northwest Corner - West Crossing @ 33.915047089788, -118.151803314686

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 126.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350057 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Gardendale Street

Northwest Corner - West Crossing @ 33.915047089788, -118.151803314686

Intersections , Pedestrian Signal Controls : Push Button Height

Finding

Push button height is not compliant.

On-Site Finding 40.00 inches

Recommendation

Provide a compliant push button.

Recommendation 41.00 - 48.00 inches

Costing Info (Estimated)

\$900



Code Reference ADA 308, 308.3, CA MUTCD 4E.09, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350058 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northwest Corner - West Crossing @ 33.915047089788, -118.151803314686

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350059 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northwest Corner - West Crossing @ 33.915047089788, -118.151803314686

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350060 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northwest Corner - West Crossing @ 33.915047089788, -118.151803314686

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD,CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350061 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northwest Corner - West Crossing @ 33.915047089788, -118.151803314686

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350062 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Gardendale Street

Northwest Corner - West Crossing @ 33.915047089788, -118.151803314686

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350063 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Gardendale Street

Northwest Corner - West Crossing @ 33.915047089788, -118.151803314686

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350064 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Gardendale Street

Northwest Corner - West Crossing @ 33.915047089788, -118.151803314686

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350065 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Gardendale Street

Northwest Corner - West Crossing @ 33.915047089788, -118.151803314686

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350066 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Gardendale Street

Northwest Corner - West Crossing @ 33.915047089788, -118.151803314686

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350067 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & Gardendale Street

West Crossing @ 33.914964732429, -118.151863664389

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 350023 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Gardendale Street



Downey Avenue & Gardendale Street

**Downey Avenue & Gardendale Street
Downey, CA 90242**

Date of Inspection
2/2/2017

***Estimated Facility Total: \$33,636**

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Downey Avenue & Stewart And Gray Road

Downey Avenue & Stewart And Gray Road
Downey, CA 90240

Date of Inspection
5/23/2017

Prepared By
Disability Access Consultants
(800) 743-7067

Downey Avenue & Stewart And Gray Road

Curb Ramps - Exterior : Curb Ramp

Northeast Corner of Stewart And Gray Road @ 33.932242452916, - 118.138778507710

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435089 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner of Stewart And Gray Road @ 33.932242452916, - 118.138778507710

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Of Diagonal Curb Ramp - Clear Space

Finding

There is less than the required clear space.

On-Site Finding 12.00 inches

Recommendation

Provide sufficient clear space at the bottom of the curb ramp that does not accumulate water.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$255



Code Reference ADA 406, 406.6, 406.1, 405.10

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435090 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Curb Ramps - Exterior : Curb Ramp

Northwest Corner of Stewart And Gray Road @ 33.932242452916, - 118.138778507710

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 434989 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Curb Ramps - Exterior : Curb Ramp

Northwest Corner of Stewart And Gray Road @ 33.932242452916, -118.138778507710

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 434990 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Curb Ramps - Exterior : Curb Ramp

Northwest Corner of Stewart And Gray Road @ 33.932242452916, - 118.138778507710

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 6.70 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 434991 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Stewart And Gray Road @ 33.931906413194, - 118.138689994812

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 434986 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Stewart And Gray Road @ 33.931906413194, - 118.138689994812

Curb Ramp : Appurtenances

Finding

Utilities, gratings or other appurtenances are located on the curb ramp.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp free of appurtenances.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$1,440



Code Reference ADA 303.3, CA 11B-303.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 434987 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner of Stewart And Gray Road @ 33.931906413194, - 118.138689994812

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.40 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 434988 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Curb Ramps - Exterior : Curb Ramp

Southwest Corner of Stewart And Gray Road @ 33.931906413194, - 118.138689994812

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 434992 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Curb Ramps - Exterior : Curb Ramp

Southwest Corner of Stewart And Gray Road @ 33.931906413194, - 118.138689994812

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 434993 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Curb Ramps - Exterior : Curb Ramp

Southwest Corner of Stewart And Gray Road @ 33.931906413194, - 118.138689994812

Curb Ramp : Appurtenances

Finding

Utilities, gratings or other appurtenances are located on the curb ramp.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp free of appurtenances.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$1,440



Code Reference ADA 303.3, CA 11B-303.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 434994 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner of Stewart And Gray Road @ 33.931906413194, - 118.138689994812

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.80 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 434995 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner of Stewart And Gray Road @ 33.931906413194, - 118.138689994812

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Right Side Slope - Parallel Curb Ramp

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.80 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 434996 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & Stewart And Gray Road

East Crossing @ 33.932031037352, -118.138574659824

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 434997 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & Stewart And Gray Road

East Crossing @ 33.932031037352, -118.138574659824

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 434998 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Stewart And Gray Road

East Crossing North to South @ 33.932093349362, -118.138499557972

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 153.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435079 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

East Crossing North to South @ 33.932093349362, -118.138499557972

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435080 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

East Crossing North to South @ 33.932093349362, -118.138499557972

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435081 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

East Crossing North to South @ 33.932093349362, -118.138499557972

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435082 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

East Crossing North to South @ 33.932093349362, -118.138499557972

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435083 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

East Crossing North to South @ 33.932093349362, -118.138499557972

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435084 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

East Crossing North to South @ 33.932093349362, -118.138499557972

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435085 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

East Crossing North to South @ 33.932093349362, -118.138499557972

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435086 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

East Crossing North to South @ 33.932093349362, -118.138499557972

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435087 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

East Crossing North to South @ 33.932093349362, -118.138499557972

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435088 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Stewart And Gray Road

East Crossing South to North @ 33.931915314926, -118.138652443886

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 141.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435026 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

East Crossing South to North @ 33.931915314926, -118.138652443886

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435027 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

East Crossing South to North @ 33.931915314926, -118.138652443886

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435028 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

East Crossing South to North @ 33.931915314926, -118.138652443886

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435029 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

East Crossing South to North @ 33.931915314926, -118.138652443886

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435030 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

East Crossing South to North @ 33.931915314926, -118.138652443886

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435031 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

East Crossing South to North @ 33.931915314926, -118.138652443886

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435032 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

East Crossing South to North @ 33.931915314926, -118.138652443886

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435033 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

East Crossing South to North @ 33.931915314926, -118.138652443886

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435034 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

East Crossing South to North @ 33.931915314926, -118.138652443886

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435035 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & Stewart And Gray Road

North Crossing @ 33.932182366441, -118.138633668423

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435002 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & Stewart And Gray Road

North Crossing @ 33.932182366441, -118.138633668423

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435003 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Stewart And Gray Road

North Crossing East to West @ 33.932140083340, -118.138515651226

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 148.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435057 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Stewart And Gray Road

North Crossing East to West @ 33.932140083340, -118.138515651226

Intersections , Pedestrian Signal Controls : Push Button - Clear
Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 4.80 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435058 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

North Crossing East to West @ 33.932140083340, -118.138515651226

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435059 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

North Crossing East to West @ 33.932140083340, -118.138515651226

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435060 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

North Crossing East to West @ 33.932140083340, -118.138515651226

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435061 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

North Crossing East to West @ 33.932140083340, -118.138515651226

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435062 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

North Crossing East to West @ 33.932140083340, -118.138515651226

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435063 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

North Crossing East to West @ 33.932140083340, -118.138515651226

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435064 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

North Crossing East to West @ 33.932140083340, -118.138515651226

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435065 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

North Crossing East to West @ 33.932140083340, -118.138515651226

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435066 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

North Crossing East to West @ 33.932140083340, -118.138515651226

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435067 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Stewart And Gray Road

North Crossing West to East @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 105.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435068 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Stewart And Gray Road

North Crossing West to East @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Controls : Push Button - Clear
Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 10.00 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435069 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

North Crossing West to East @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435070 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

North Crossing West to East @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435071 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

North Crossing West to East @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435072 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

North Crossing West to East @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435073 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

North Crossing West to East @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435074 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

North Crossing West to East @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435075 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

North Crossing West to East @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435076 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

North Crossing West to East @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435077 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

North Crossing West to East @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435078 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & Stewart And Gray Road

South Crossing @ 33.931968725296, -118.138794600964

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 434999 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Stewart And Gray Road

South Crossing East to West @ 33.931906413194, -118.138689994812

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 156.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435047 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

South Crossing East to West @ 33.931906413194, -118.138689994812

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435048 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

South Crossing East to West @ 33.931906413194, -118.138689994812

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435049 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

South Crossing East to West @ 33.931906413194, -118.138689994812

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435050 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

South Crossing East to West @ 33.931906413194, -118.138689994812

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435051 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

South Crossing East to West @ 33.931906413194, -118.138689994812

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435052 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

South Crossing East to West @ 33.931906413194, -118.138689994812

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435053 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

South Crossing East to West @ 33.931906413194, -118.138689994812

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435054 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

South Crossing East to West @ 33.931906413194, -118.138689994812

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435055 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

South Crossing East to West @ 33.931906413194, -118.138689994812

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435056 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Stewart And Gray Road

South Crossing West to East @ 33.932006557621, -118.138901889324

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 94.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435004 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Stewart And Gray Road

South Crossing West to East @ 33.932006557621, -118.138901889324

Intersections , Pedestrian Signal Controls : Push Button - Clear
Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 5.70 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435005 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

South Crossing West to East @ 33.932006557621, -118.138901889324

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435006 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

South Crossing West to East @ 33.932006557621, -118.138901889324

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435007 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

South Crossing West to East @ 33.932006557621, -118.138901889324

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435008 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

South Crossing West to East @ 33.932006557621, -118.138901889324

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435009 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

South Crossing West to East @ 33.932006557621, -118.138901889324

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435010 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

South Crossing West to East @ 33.932006557621, -118.138901889324

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435011 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

South Crossing West to East @ 33.932006557621, -118.138901889324

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435012 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

South Crossing West to East @ 33.932006557621, -118.138901889324

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435013 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

South Crossing West to East @ 33.932006557621, -118.138901889324

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435014 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & Stewart And Gray Road

West Crossing @ 33.932126730778, -118.138837516308

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435000 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & Stewart And Gray Road

West Crossing @ 33.932126730778, -118.138837516308

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435001 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Stewart And Gray Road

West Crossing North to South @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 160.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435015 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Stewart And Gray Road

West Crossing North to South @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Controls : Push Button - Clear
Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 2.40 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435016 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

West Crossing North to South @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435017 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

West Crossing North to South @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435018 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

West Crossing North to South @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435019 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

West Crossing North to South @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435020 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

West Crossing North to South @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435021 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

West Crossing North to South @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435022 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

West Crossing North to South @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435023 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

West Crossing North to South @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435024 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

West Crossing North to South @ 33.932242452916, -118.138778507710

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435025 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Stewart And Gray Road

West Crossing South to North @ 33.932055517076, -118.138909935951

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 124.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435036 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & Stewart And Gray Road

West Crossing South to North @ 33.932055517076, -118.138909935951

Intersections , Pedestrian Signal Controls : Push Button - Clear
Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 5.40 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435037 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

West Crossing South to North @ 33.932055517076, -118.138909935951

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435038 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

West Crossing South to North @ 33.932055517076, -118.138909935951

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435039 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

West Crossing South to North @ 33.932055517076, -118.138909935951

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435040 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

West Crossing South to North @ 33.932055517076, -118.138909935951

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435041 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & Stewart And Gray Road

West Crossing South to North @ 33.932055517076, -118.138909935951

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435042 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

West Crossing South to North @ 33.932055517076, -118.138909935951

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435043 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

West Crossing South to North @ 33.932055517076, -118.138909935951

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435044 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

West Crossing South to North @ 33.932055517076, -118.138909935951

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435045 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & Stewart And Gray Road

West Crossing South to North @ 33.932055517076, -118.138909935951

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 435046 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue & Stewart And Gray Road



Downey Avenue & Stewart And Gray Road

Downey Avenue & Stewart And Gray Road
Downey, CA 90240

Date of Inspection
5/23/2017

*Estimated Facility Total: \$70,719

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Downey Avenue - Florence Avenue To Firestone Boulevard

Florence Avenue To Firestone Boulevard
Downey, CA 90241

Date of Inspection
1/31/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

East Side South Of Lexington Road @ 33.948793549574, -
118.127532005310

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.20 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348299 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of 2nd Street @ 33.941016848578, -118.132326453924

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348295 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of 2nd Street @ 33.941016848578, -118.132326453924

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348296 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of 3rd Street @ 33.941855742928, -118.131674677134

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348125 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of 3rd Street @ 33.941855742928, -118.131674677134

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348126 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of 3rd Street @ 33.941855742928, -118.131674677134

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 9.60 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348127 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of 3rd Street @ 33.941855742928, -118.131674677134

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 11.80 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348128 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner Of 3rd Street @ 33.941855742928, -118.131674677134

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Of Diagonal Curb Ramp - Clear Space

Finding

There is less than the required clear space.

On-Site Finding 46.00 inches

Recommendation

Provide sufficient clear space at the bottom of the curb ramp that does not accumulate water.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$255



Code Reference ADA 406, 406.6, 406.1, 405.10

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348129 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of 3rd Street @ 33.941855742928, -118.131674677134

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 10.80 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348130 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of 5th Street @ 33.943816097759, -118.130243718624

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348337 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of 5th Street @ 33.943816097759, -118.130243718624

Curb Ramp : Appurtenances

Finding

Utilities, gratings or other appurtenances are located on the curb ramp.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp free of appurtenances.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$1,440



Code Reference ADA 303.3, CA 11B-303.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348338 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner Of 5th Street @ 33.943816097759, -118.130243718624

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Of Diagonal Curb Ramp - Clear Space

Finding

There is less than the required clear space.

On-Site Finding 22.00 inches

Recommendation

Provide sufficient clear space at the bottom of the curb ramp that does not accumulate water.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$255



Code Reference ADA 406, 406.6, 406.1, 405.10

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348339 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner Of 5th Street @ 33.943816097759, -118.130243718624

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.30 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348340 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of 6th Street @ 33.945049918826, -118.129958063364

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348300 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of 6th Street @ 33.945049918826, -118.129958063364

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 15.40 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348301 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of 6th Street @ 33.945049918826, -118.129958063364

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 19.10 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348302 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of 6th Street @ 33.945049918826, -118.129958063364

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 5.50 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348303 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner Of 6th Street @ 33.945049918826, -118.129958063364

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 0.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348304 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of Firestone Boulevard @ 33.940167932485, - 118.132978230715

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 10.50 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348313 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of La Villa Street @ 33.943167472299, - 118.130648732185

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348297 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of La Villa Street @ 33.943167472299, - 118.130648732185

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348298 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

**Northwest Corner Of 2nd Street @ 33.941084716996, -
118.132465928793**

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348184 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

**Northwest Corner Of 2nd Street @ 33.941084716996, -
118.132465928793**

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 14.20 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348185 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of 4th Street

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348318 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of 4th Street

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348319 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner Of 4th Street

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 47.50 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348320 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of 5th Street @ 33.943945154723, -118.130494505167

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348332 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of 5th Street @ 33.943945154723, -118.130494505167

Curb Ramp : Parallel Curb Ramp Left Side Width

Finding

The width of the curb ramp is less than required.

On-Site Finding 42.00 inches

Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1,CA 11B-406.5.2,CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348333 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner Of 5th Street @ 33.943945154723, -118.130494505167

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Slope

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 3.20 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 402, 406.4, 406.2, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348334 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Firestone Boulevard @ 33.940303670620, - 118.133147209883

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 10.50 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348347 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of 2nd Street @ 33.940893350170, -118.132423013449

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348305 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of 2nd Street @ 33.940893350170, -118.132423013449

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348306 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of 2nd Street @ 33.940893350170, -118.132423013449

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 10.10 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348307 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | Category_1 | | |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of 3rd Street @ 33.941725570208, -118.131769895554

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348348 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of 3rd Street @ 33.941725570208, -118.131769895554

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348349 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of 5th Street @ 33.943678140099, -118.130317479372

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348328 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of 5th Street @ 33.943678140099, -118.130317479372

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348329 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of 5th Street @ 33.943678140099, -118.130317479372

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Slope

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 7.70 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 402, 406.4, 406.2, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348330 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

Southeast Corner Of 5th Street @ 33.943678140099, -118.130317479372

Bottom Landing

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 1.00 inches

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$255



Code Reference ADA 302, 303, 406.2, 303.1

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348331 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of 6th Street @ 33.944877474216, -118.130978708

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348131 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of 6th Street @ 33.944877474216, -118.130978708

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 13.50 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348132 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of 6th Street @ 33.944877474216, -118.130978708

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 19.60 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348133 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of 6th Street @ 33.944877474216, -118.130978708

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Change in Level - Curb Ramps

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding Not Beveled

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

Costing Info (Estimated)

Patch lip at curb ramp \$255



Code Reference ADA 302, 406.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348134 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | Category_1 | | |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of 6th Street @ 33.944877474216, -118.130978708

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 0.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348135 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of Cherokee Drive @ 33.947517507308, - 118.128426522017

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Of Diagonal Curb Ramp - Clear Space

Finding

There is less than the required clear space.

On-Site Finding 36.00 inches

Recommendation

Provide sufficient clear space at the bottom of the curb ramp that does not accumulate water.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$255



Code Reference ADA 406, 406.6, 406.1, 405.10

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348335 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of Cherokee Drive @ 33.947517507308, - 118.128426522017

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 45.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348336 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Florence Avenue @ 33.951263254448, - 118.125724196434

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348136 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Florence Avenue @ 33.951263254448, - 118.125724196434

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348137 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Florence Avenue @ 33.951263254448, - 118.125724196434

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 10.80 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348138 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Florence Avenue @ 33.951263254448, - 118.125724196434

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 21.80 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348139 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Florence Avenue @ 33.951263254448, - 118.125724196434

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 10.00 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348140 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of Florence Avenue @ 33.951263254448, - 118.125724196434

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Change in Level - Curb Ramps

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding Not Beveled

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

Costing Info (Estimated)

Patch lip at curb ramp \$255



Code Reference ADA 302, 406.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348141 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of Florence Avenue @ 33.951263254448, - 118.125724196434

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 0.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348142 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of La Villa Street @ 33.943052877578, - 118.130727857351

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348321 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

**Southeast Corner Of La Villa Street @ 33.943052877578, -
118.130727857351**

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348322 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Southeast Corner Of La Villa Street @ 33.943052877578, -
118.130727857351**

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.90 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348323 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of Lexington Road @ 33.950582424044, - 118.126217722893

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347328 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of 2nd Street - Left @ 33.940942304515, - 118.132555782795

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348350 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of 2nd Street - Left @ 33.940942304515, - 118.132555782795

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 7.30 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

| | | | |
|------------------|-------------|----------------|------------|
| Record Number | 348351 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of 2nd Street - Right @ 33.940997934419, - 118.132551759481

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348314 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of 2nd Street - Right @ 33.940997934419, - 118.132551759481

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348315 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | Category_1 | | |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of 2nd Street - Right @ 33.940997934419, - 118.132551759481

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 11.50 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348316 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner Of 2nd Street - Right @ 33.940997934419, - 118.132551759481

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.00 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348317 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

**Southwest Corner Of 3rd Street @ 33.941819027566, -
118.131932169199**

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348324 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

**Southwest Corner Of 3rd Street @ 33.941819027566, -
118.131932169199**

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348325 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Southwest Corner Of 3rd Street @ 33.941819027566, -
118.131932169199**

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Of Diagonal
Curb Ramp - Clear Space

Finding

There is less than the required clear space.

On-Site Finding 44.00 inches

Recommendation

Provide sufficient clear space at the bottom of the curb ramp that does not accumulate water.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$255



Code Reference ADA 406, 406.6, 406.1, 405.10

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348326 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of 4th Street @ 33.942628987030, -118.131272345781

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348352 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of 5th Street @ 33.943780495804, -118.130517303944

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348308 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of 5th Street @ 33.943780495804, -118.130517303944

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348309 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner Of 5th Street @ 33.943780495804, -118.130517303944

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Of Diagonal Curb Ramp - Clear Space

Finding

There is less than the required clear space.

On-Site Finding 32.00 inches

Recommendation

Provide sufficient clear space at the bottom of the curb ramp that does not accumulate water.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$255



Code Reference ADA 406, 406.6, 406.1, 405.10

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348310 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of 5th Street @ 33.943780495804, -118.130517303944

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 9.80 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348311 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner Of 5th Street @ 33.943780495804, -118.130517303944

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.80 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348312 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Florence Avenue @ 33.951368938418, - 118.125956207514

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348341 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Florence Avenue @ 33.951368938418, - 118.125956207514

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348342 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Florence Avenue @ 33.951368938418, - 118.125956207514

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 9.90 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348343 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Florence Avenue @ 33.951368938418, - 118.125956207514

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 23.50 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348344 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Florence Avenue @ 33.951368938418, - 118.125956207514

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 9.70 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348345 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner Of Florence Avenue @ 33.951368938418, - 118.125956207514

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 0.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348346 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

West Side North Of 7th Street @ 33.948893674138, -118.127730488777

Curb Ramp : Appurtenances

Finding

Utilities, gratings or other appurtenances are located on the curb ramp.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp free of appurtenances.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$1,440



Code Reference ADA 303.3, CA 11B-303.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348327 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of 6th Street @ 33.943968518462, -118.130208849907

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

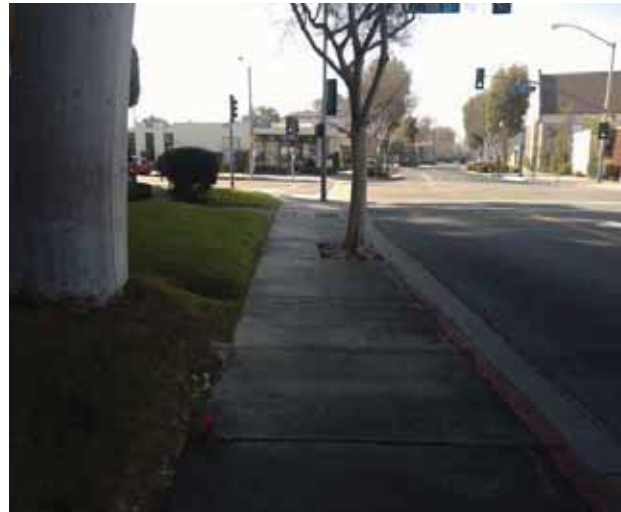

Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348114 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of 6th Street @ 33.944717267297, -118.130039870739

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348111 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Florence Avenue @ 33.950768206737, - 118.126098364592

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347329 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of La Villa Street @ 33.942596722308, -118.131064474583

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348109 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Lexington Road @ 33.950556837174, -118.126245886087

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348112 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Cherokee Drive @ 33.946769895628, -118.128988444805

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348117 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Cherokee Drive @ 33.946769895628, -118.128988444805

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348118 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Florence Avenue @ 33.951076360370, -118.125879764557

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347331 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Florence Avenue @ 33.951076360370, -118.125879764557

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 8.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347332 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of La Villa Street @ 33.942087160604, -118.131490945816

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348124 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of La Villa Street @ 33.942329703455, -118.131295144558

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348122 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of La Villa Street @ 33.942732456571, -118.130969256163

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348121 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Lexington Road @ 33.949127297664, -118.127287924290

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348119 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Lexington Road @ 33.949127297664, -118.127287924290

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 11.80 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348120 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Guy Wire South Of 7th Street @ 33.946152443531, -118.129451125860

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 60.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348110 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Guy Wire South Of Cherokee Drive @ 33.947081401293, -118.128748387098

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 60.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348115 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Guy Wire South Of Florence Avenue @ 33.950888353412, -118.126008510590

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 60.00 inches


Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned

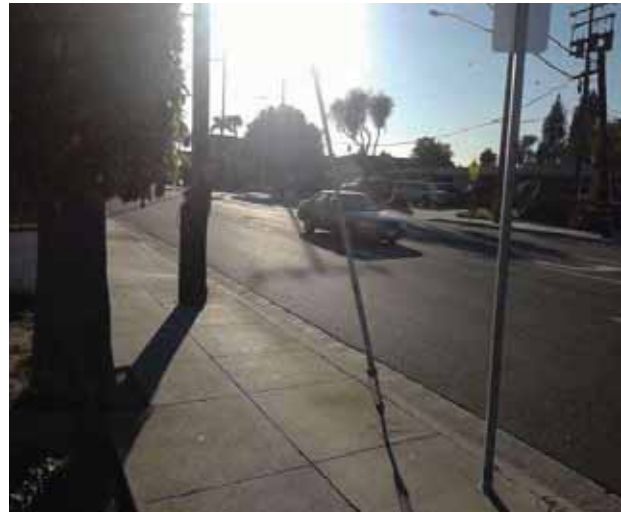

Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 347330 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side

La Villa Street East Crossing @ 33.943118519233, -118.130698353052

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 7.80 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348123 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of 3rd Street @ 33.941535317414, -118.131930828094

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.40 percent for 45.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348100 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of 6th Street @ 33.943984094285, -118.130202144384

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.60 percent for 15.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348103 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of 6th Street @ 33.944619, -118.130023777485

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.00 percent for 75.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348106 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of 7th Street @ 33.945491597945, -118.129844069481

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.60 percent for 100.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348107 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Cherokee Drive @ 33.946694244080, -118.129050135612

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.80 percent for 25.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348102 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Cherokee Drive @ 33.947501932132, -118.128460049629

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.40 percent for 30.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348105 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Lexington Road @ 33.948636687519, -118.127627223730

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.70 percent for 150.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348104 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South Of Lexington Road @ 33.950482301466, -118.126288801432

Sidewalks : Opening

Finding

Ground surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the surface opening does not allow passage of a sphere more than ½ inch in diameter.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348101 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Lexington Road @ 33.950556837174, -118.126245886087

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.10 percent for 200.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348108 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Tree South Of 7th Street @ 33.945217912917, -118.129920512438

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 60.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348116 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2018 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Tree South Of Lexington Road @ 33.947979198741, -118.128124773502

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 62.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348113 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2018 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of 3rd Street @ 33.942032643997, -118.131784647703

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348164 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of 3rd Street @ 33.942066021516, -118.131756484509

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348163 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of 4th Street @ 33.943504580145, -118.130660802126

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348171 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of 4th Street @ 33.943520156052, -118.130643367767

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348166 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of 6th Street @ 33.945555012643, -118.130133748055

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348170 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of 6th Street @ 33.945787532798, -118.129976838827

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348165 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of 6th Street @ 33.945948850236, -118.129872232676

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348167 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of 6th Street @ 33.945975551023, -118.129845410585

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348161 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of 6th Street @ 33.946042302956, -118.129797130823

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348162 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of 7th Street @ 33.947995886336, -118.128380924463

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348156 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of 7th Street @ 33.950224207167, -118.126770257950

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348159 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of 7th Street @ 33.950694783685, -118.126420229673

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348157 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North Of 3rd Street @ 33.942435398518, -118.131439983845

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348172 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North Of 5th Street @ 33.944004120339, -118.130466341972

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348183 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North Of 6th Street @ 33.945684066970, -118.130064010620

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348173 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks

West Side

Driveway North Of 6th Street @ 33.945684066970, -118.130064010620

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 10.00 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348174 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North Of 7th Street @ 33.947928023428, -118.128426522017

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348178 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North Of 7th Street @ 33.948116036926, -118.128281682730

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348176 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks

West Side

Driveway North Of 7th Street @ 33.948116036926, -118.128281682730

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348177 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North Of 7th Street @ 33.949075010549, -118.127593696117

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348181 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks

West Side

Driveway North Of 7th Street @ 33.949075010549, -118.127593696117

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 10.10 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348182 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North Of 7th Street @ 33.951085260097, -118.126141279936

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348179 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks

West Side

Driveway North Of 7th Street @ 33.951085260097, -118.126141279936

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 10.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348180 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North Of Firestone Boulevard

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348175 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Light Pole North Of 5th Street @ 33.945024330293, -118.130199462175

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 41.50 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348168 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of 3rd Street @ 33.941963663749, -118.131843656301

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.80 percent for 85.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348150 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of 4th Street @ 33.942912693536, -118.131112754345

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.30 percent for 45.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348149 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of 5th Street @ 33.944486969322, -118.130341619253

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.40 percent for 35.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348153 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of 6th Street @ 33.945555012643, -118.130133748055

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.60 percent for 5.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348143 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of 6th Street @ 33.945555012643, -118.130133748055

Sidewalks , Surface : Running Slope

Finding

Sidewalk running slope is not compliant.

On-Site Finding 6.50 percent for 5.00 feet

Recommendation

Repave the sidewalk surface with the recommended running slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,184



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348144 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of 6th Street @ 33.945760831951, -118.129995614290

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.60 percent for 75.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348154 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of 7th Street

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.40 percent for 15.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348145 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of 7th Street @ 33.947995886336, -118.128380924463

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.80 percent for 55.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348151 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of 7th Street @ 33.949606780129, -118.127215504646

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.20 percent for 25.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348155 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of 7th Street @ 33.949802577296, -118.127069324255

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.30 percent for 50.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348147 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of 7th Street @ 33.950432240133, -118.126612007618

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.40 percent for 120.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348152 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of 7th Street @ 33.950996262782, -118.126206994057

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.50 percent for 35.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348148 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of 7th Street @ 33.951285503716, -118.126004487276

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.90 percent for 30.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348146 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Tree North Of 3rd Street @ 33.942224008261, -118.131639808416

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 62.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348160 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2018 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Tree North Of 5th Street @ 33.944722830042, -118.130289316177

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 32.50 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348158 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Tree North Of 5th Street @ 33.944931989001, -118.130235671997

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 19.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1,CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348169 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & 5th Street

East Crossing @ 33.943754906889, -118.130279928446

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348189 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & 5th Street

East Crossing @ 33.943754906889, -118.130279928446

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348190 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & 5th Street

North Crossing @ 33.943899539784, -118.130368441343

Intersections , Walking Surface : Slope

Finding

Intersection walking surface slope is not compliant.

On-Site Finding 5.80 percent

Recommendation

Repave the walking surface with recommended slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

\$1,260



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348193 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & 5th Street

North Crossing @ 33.943899539784, -118.130368441343

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348194 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northeast Corner - Left @ 33.943861712743, -118.130259811878

Intersections , Pedestrian Signal Signage : Ambient Sound Level

Finding

Ambient sound level at the signal is not compliant.

On-Site Finding 0.00 decibels

Recommendation

Provide compliant pedestrian signal.

Recommendation 2.00 - 5.00 decibels

Costing Info (Estimated)

\$900



Code Reference

MUTCD 4E.06,PROWAG 2.5.2.2 G,CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348258 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Northeast Corner - Left @ 33.943861712743, -118.130259811878

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 118.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348259 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Northeast Corner - Left @ 33.943861712743, -118.130259811878

Intersections , Pedestrian Signal Controls : Push Button - Clear
Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 7.00 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348260 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northeast Corner - Left @ 33.943861712743, -118.130259811878

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348261 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northeast Corner - Left @ 33.943861712743, -118.130259811878

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348262 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northeast Corner - Left @ 33.943861712743, -118.130259811878

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348263 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northeast Corner - Left @ 33.943861712743, -118.130259811878

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348264 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northeast Corner - Left @ 33.943861712743, -118.130259811878

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348265 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Northeast Corner - Left @ 33.943861712743, -118.130259811878

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD,CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348266 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Northeast Corner - Left @ 33.943861712743, -118.130259811878

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD,CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348267 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Northeast Corner - Left @ 33.943861712743, -118.130259811878

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348268 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Northeast Corner - Left @ 33.943861712743, -118.130259811878

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348269 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northeast Corner - Right @ 33.943809422394, -118.130228966475

Intersections , Pedestrian Signal Signage : Ambient Sound Level

Finding

Ambient sound level at the signal is not compliant.

On-Site Finding 0.00 decibels

Recommendation

Provide compliant pedestrian signal.

Recommendation 2.00 - 5.00 decibels

Costing Info (Estimated)

\$900



Code Reference

MUTCD 4E.06,PROWAG 2.5.2.2 G,CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348208 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Northeast Corner - Right @ 33.943809422394, -118.130228966475

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 151.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348209 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Northeast Corner - Right @ 33.943809422394, -118.130228966475

Intersections , Pedestrian Signal Controls : Push Button Face

Finding

Push button face is not parallel to crosswalk.

On-Site Finding Not Parallel

Recommendation

Push button face must be parallel to crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348210 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Northeast Corner - Right @ 33.943809422394, -118.130228966475

Intersections , Pedestrian Signal Controls : Push Button Diameter

Finding

Push button diameter is not compliant.

On-Site Finding 0.37 inches

Recommendation

Provide a compliant push button.

Recommendation At least 2.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348211 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northeast Corner - Right @ 33.943809422394, -118.130228966475

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348212 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northeast Corner - Right @ 33.943809422394, -118.130228966475

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348213 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northeast Corner - Right @ 33.943809422394, -118.130228966475

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348214 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northeast Corner - Right @ 33.943809422394, -118.130228966475

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348215 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northeast Corner - Right @ 33.943809422394, -118.130228966475

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348216 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Northeast Corner - Right @ 33.943809422394, -118.130228966475

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348217 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Northeast Corner - Right @ 33.943809422394, -118.130228966475

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348218 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Northeast Corner - Right @ 33.943809422394, -118.130228966475

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348219 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Northeast Corner - Right @ 33.943809422394, -118.130228966475

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348220 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northwest Corner - Left @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Signage : Ambient Sound Level

Finding

Ambient sound level at the signal is not compliant.

On-Site Finding 0.00 decibels

Recommendation

Provide compliant pedestrian signal.

Recommendation 2.00 - 5.00 decibels

Costing Info (Estimated)

\$900



Code Reference

MUTCD 4E.06,PROWAG 2.5.2.2 G,CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348195 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Northwest Corner - Left @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 142.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348196 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Northwest Corner - Left @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Controls : Push Button Face

Finding

Push button face is not parallel to crosswalk.

On-Site Finding Not Parallel

Recommendation

Push button face must be parallel to crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348197 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Northwest Corner - Left @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Controls : Push Button Diameter

Finding

Push button diameter is not compliant.

On-Site Finding 0.37 inches

Recommendation

Provide a compliant push button.

Recommendation At least 2.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348198 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northwest Corner - Left @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348199 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northwest Corner - Left @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348200 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northwest Corner - Left @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348201 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northwest Corner - Left @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348202 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northwest Corner - Left @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348203 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Northwest Corner - Left @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348204 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Northwest Corner - Left @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348205 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Northwest Corner - Left @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348206 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Northwest Corner - Left @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348207 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northwest Corner - Right @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Signage : Ambient Sound Level

Finding

Ambient sound level at the signal is not compliant.

On-Site Finding 0.00 decibels

Recommendation

Provide compliant pedestrian signal.

Recommendation 2.00 - 5.00 decibels

Costing Info (Estimated)

\$900



Code Reference

MUTCD 4E.06,PROWAG 2.5.2.2 G,CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348233 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Northwest Corner - Right @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 142.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348234 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Northwest Corner - Right @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Controls : Push Button Face

Finding

Push button face is not parallel to crosswalk.

On-Site Finding Not Parallel

Recommendation

Push button face must be parallel to crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348235 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Northwest Corner - Right @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Controls : Push Button Diameter

Finding

Push button diameter is not compliant.

On-Site Finding 0.37 inches

Recommendation

Provide a compliant push button.

Recommendation At least 2.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348236 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northwest Corner - Right @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348237 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northwest Corner - Right @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348238 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northwest Corner - Right @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348239 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northwest Corner - Right @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348240 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Northwest Corner - Right @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348241 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Northwest Corner - Right @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348242 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Northwest Corner - Right @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348243 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Northwest Corner - Right @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348244 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Northwest Corner - Right @ 33.943964068227, -118.130471706390

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348245 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & 5th Street

South Crossing @ 33.943720417470, -118.130424767733

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348191 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & 5th Street

South Crossing @ 33.943720417470, -118.130424767733

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348192 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southeast Corner - Left @ 33.943682590350, -118.130293339491

Intersections , Pedestrian Signal Signage : Ambient Sound Level

Finding

Ambient sound level at the signal is not compliant.

On-Site Finding 0.00 decibels

Recommendation

Provide compliant pedestrian signal.

Recommendation 2.00 - 5.00 decibels

Costing Info (Estimated)

\$900



Code Reference

MUTCD 4E.06,PROWAG 2.5.2.2 G,CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348246 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Southeast Corner - Left @ 33.943682590350, -118.130293339491

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 131.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348247 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Southeast Corner - Left @ 33.943682590350, -118.130293339491

Intersections , Pedestrian Signal Controls : Push Button Face

Finding

Push button face is not parallel to crosswalk.

On-Site Finding Not Parallel

Recommendation

Push button face must be parallel to crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348248 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southeast Corner - Left @ 33.943682590350, -118.130293339491

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348249 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southeast Corner - Left @ 33.943682590350, -118.130293339491

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348250 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southeast Corner - Left @ 33.943682590350, -118.130293339491

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD,CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348251 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southeast Corner - Left @ 33.943682590350, -118.130293339491

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348252 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southeast Corner - Left @ 33.943682590350, -118.130293339491

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348253 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Southeast Corner - Left @ 33.943682590350, -118.130293339491

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348254 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Southeast Corner - Left @ 33.943682590350, -118.130293339491

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348255 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Southeast Corner - Left @ 33.943682590350, -118.130293339491

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348256 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Southeast Corner - Left @ 33.943682590350, -118.130293339491

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348257 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southeast Corner - Right @ 33.943661451657, -118.130371123552

Intersections , Pedestrian Signal Signage : Ambient Sound Level

Finding

Ambient sound level at the signal is not compliant.

On-Site Finding 0.00 decibels

Recommendation

Provide compliant pedestrian signal.

Recommendation 2.00 - 5.00 decibels

Costing Info (Estimated)

\$900



Code Reference

MUTCD 4E.06,PROWAG 2.5.2.2 G,CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348281 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Southeast Corner - Right @ 33.943661451657, -118.130371123552

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 131.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348282 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Southeast Corner - Right @ 33.943661451657, -118.130371123552

Intersections , Pedestrian Signal Controls : Push Button Face

Finding

Push button face is not parallel to crosswalk.

On-Site Finding Not Parallel

Recommendation

Push button face must be parallel to crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348283 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Southeast Corner - Right @ 33.943661451657, -118.130371123552

Intersections , Pedestrian Signal Controls : Push Button Height

Finding

Push button height is not compliant.

On-Site Finding 0.50 inches

Recommendation

Provide a compliant push button.

Recommendation 41.00 - 48.00 inches

Costing Info (Estimated)

\$900



Code Reference ADA 308, 308.3, CA MUTCD 4E.09, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348284 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Southeast Corner - Right @ 33.943661451657, -118.130371123552

Intersections , Pedestrian Signal Controls : Push Button - Clear
Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 45.00 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348285 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southeast Corner - Right @ 33.943661451657, -118.130371123552

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348286 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southeast Corner - Right @ 33.943661451657, -118.130371123552

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348287 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southeast Corner - Right @ 33.943661451657, -118.130371123552

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348288 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southeast Corner - Right @ 33.943661451657, -118.130371123552

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348289 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southeast Corner - Right @ 33.943661451657, -118.130371123552

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348290 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Southeast Corner - Right @ 33.943661451657, -118.130371123552

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348291 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Southeast Corner - Right @ 33.943661451657, -118.130371123552

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348292 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Southeast Corner - Right @ 33.943661451657, -118.130371123552

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference

CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348293 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Southeast Corner - Right @ 33.943661451657, -118.130371123552

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348294 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southwest Corner - Left @ 33.943728205405, -118.130503892899

Intersections , Pedestrian Signal Signage : Ambient Sound Level

Finding

Ambient sound level at the signal is not compliant.

On-Site Finding 0.00 decibels

Recommendation

Provide compliant pedestrian signal.

Recommendation 2.00 - 5.00 decibels

Costing Info (Estimated)

\$900



Code Reference

MUTCD 4E.06,PROWAG 2.5.2.2 G,CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348270 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Southwest Corner - Left @ 33.943728205405, -118.130503892899

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 125.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348271 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southwest Corner - Left @ 33.943728205405, -118.130503892899

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348272 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southwest Corner - Left @ 33.943728205405, -118.130503892899

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348273 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southwest Corner - Left @ 33.943728205405, -118.130503892899

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348274 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southwest Corner - Left @ 33.943728205405, -118.130503892899

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348275 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southwest Corner - Left @ 33.943728205405, -118.130503892899

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348276 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Southwest Corner - Left @ 33.943728205405, -118.130503892899

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348277 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Southwest Corner - Left @ 33.943728205405, -118.130503892899

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348278 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Southwest Corner - Left @ 33.943728205405, -118.130503892899

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348279 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Southwest Corner - Left @ 33.943728205405, -118.130503892899

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348280 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southwest Corner - Right @ 33.943787171172, -118.130525350571

Intersections , Pedestrian Signal Signage : Ambient Sound Level

Finding

Ambient sound level at the signal is not compliant.

On-Site Finding 0.00 decibels

Recommendation

Provide compliant pedestrian signal.

Recommendation 2.00 - 5.00 decibels

Costing Info (Estimated)

\$900



Code Reference

MUTCD 4E.06, PROWAG 2.5.2.2 G, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348221 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Southwest Corner - Right @ 33.943787171172, -118.130525350571

Intersections , Pedestrian Signal Controls : Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 124.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348222 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Downey Avenue & 5th Street

Southwest Corner - Right @ 33.943787171172, -118.130525350571

Intersections , Pedestrian Signal Controls : Push Button Face

Finding

Push button face is not parallel to crosswalk.

On-Site Finding Not Parallel

Recommendation

Push button face must be parallel to crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348223 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southwest Corner - Right @ 33.943787171172, -118.130525350571

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

No tactile arrow provided for the signal.

On-Site Finding Not Found

Recommendation

Provide a compliant tactile arrow at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348224 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southwest Corner - Right @ 33.943787171172, -118.130525350571

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348225 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southwest Corner - Right @ 33.943787171172, -118.130525350571

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348226 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southwest Corner - Right @ 33.943787171172, -118.130525350571

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference

CA 11B-703.7.2.7, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348227 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Downey Avenue & 5th Street

Southwest Corner - Right @ 33.943787171172, -118.130525350571

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348228 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Southwest Corner - Right @ 33.943787171172, -118.130525350571

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348229 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Southwest Corner - Right @ 33.943787171172, -118.130525350571

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348230 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Southwest Corner - Right @ 33.943787171172, -118.130525350571

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348231 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Downey Avenue & 5th Street

Southwest Corner - Right @ 33.943787171172, -118.130525350571

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348232 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & 5th Street

West Crossing @ 33.943869500664, -118.130507916212

Intersections , Walking Surface : Slope

Finding

Intersection walking surface slope is not compliant.

On-Site Finding 5.40 percent

Recommendation

Repave the walking surface with recommended slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

\$1,260



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348186 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2026 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & 5th Street

West Crossing @ 33.943869500664, -118.130507916212

Intersections , Walking Surface : Crosswalk - Traffic Stop Bars

Finding

Traffic stop bars are not at a minimum of 4 feet from crosswalk.

On-Site Finding Not Compliant

Recommendation

Traffic stop bars shall be at a minimum of 4 feet from crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348187 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2019 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard

Intersections - Exterior : Intersections , Walking Surface

Downey Avenue & 5th Street

West Crossing @ 33.943869500664, -118.130507916212

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 348188 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | Category_1 | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Florence Avenue To Firestone Boulevard



Downey Avenue - Florence Avenue To Firestone Boulevard

Florence Avenue To Firestone Boulevard
Downey, CA 90241

Date of Inspection
1/31/2017

*Estimated Facility Total: \$176,742

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Gainford Street/ Valdina Drive to Florence Avenue
Downey, CA 90242

Date of Inspection

7/17/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Dinsdale Street @ 33.951629254163, -118.125484138727

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471178 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Dinsdale Street @ 33.951961878678, -118.125226646662

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.87 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471177 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Otto Street @ 33.952591525538, -118.124778717756

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471179 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Otto Street @ 33.953632768780, -118.124286532402

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471203 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Curb Ramps - Exterior : Curb Ramp

West Side North of Valdina Drive @ 33.954206782043, -118.123870795

Curb Ramp : Curb Ramp Width

Finding

The width of the curb ramp is less than required.

On-Site Finding 36.00 inches

Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.5, CA 11B-406.5.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471189 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Bush South of Gainford Street/ Valdina Drive @ 33.953226729929, - 118.124302625656

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 27.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471180 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks

East Side

Dacosta Street East Crossing @ 33.953608295261, -118.124046474695

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 10.70 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471182 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks

East Side

Dinsdale Street East Crossing @ 33.952355686624, -118.124943673611

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 7.30 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471186 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Dinsdale Street @ 33.951762749108, -118.125376850367

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471187 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Dinsdale Street @ 33.951762749108, -118.125376850367

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 10.50 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471188 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Dinsdale Street @ 33.952082023668, -118.125147521496

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471183 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Dinsdale Street @ 33.952082023668, -118.125147521496

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 12.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471184 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Gainford Street/ Valdina Drive @ 33.953869716585, - 118.123834580183

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471181 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks

East Side

Otto Street East Crossing @ 33.952970868836, -118.124497085810

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 9.50 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471185 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Dinsdale Street @ 33.951881781924, -118.125301748514

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.50 percent for 164.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471172 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Gainford Street/ Valdina Drive @ 33.953479252949, - 118.124120235443

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.60 percent for 189.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471173 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Gainford Street/ Valdina Drive @ 33.953845243133, - 118.123853355646

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.30 percent for 72.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471175 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Otto Street @ 33.952591525538, -118.124778717756

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.50 percent for 42.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471174 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Tree South of Gainford Street/ Valdina Drive @ 33.953953148753, - 118.123768866062

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 68.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471176 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks

East Side @ 33.954106663729, -118.123670965433

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471171 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Florence Avenue @ 33.952095373101, -118.125425130129

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471209 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Florence Avenue @ 33.952095373101, -118.125425130129

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 11.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471210 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Florence Avenue @ 33.952244441626, -118.125308454037

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471206 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Florence Avenue @ 33.952244441626, -118.125308454037

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 11.90 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471207 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Valdina Drive @ 33.954251279033, -118.123838603497

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 2.50 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471205 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Guy Wire North of Florence Avenue @ 33.951908480850, -118.12555217266

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 65.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471197 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Hydrant North of Otto Street @ 33.953192244348, -118.124605715275

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 44.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471199 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Hydrant North of Otto Street @ 33.954194545366, -118.123881518841

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 38.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471201 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks

West Side

Otto Street West Crossing @ 33.953079888004, -118.124694228172

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 6.30 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471208 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of Florence Avenue @ 33.951825046677, -118.125626295805

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.60 percent for 44.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471195 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of Florence Avenue @ 33.952157670427, -118.125372827053

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.60 percent for 312.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471191 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks

West Side

Sidewalk North of Florence Avenue @ 33.952894110358, -118.124841749668

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 45.50 inches for 40.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-403.5.1

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471192 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of Florence Avenue @ 33.952894110358, -118.124841749668

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.20 percent for 16.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471193 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of Otto Street @ 33.953182232403, -118.124616444111

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.60 percent for 300.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471194 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Tree North of Florence Avenue @ 33.952026401009, -118.125484138727

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 78.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471196 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Tree North of Florence Avenue @ 33.952157670427, -118.125372827053

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 62.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471200 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Utility Pole North of Otto Street @ 33.953325736841, -118.124510496855

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 38.50 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471198 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Utility Pole North of Otto Street @ 33.953685053095, -118.124250322580

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 36.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471204 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Utility Pole North of Otto Street @ 33.954035468413, -118.123996853828

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 34.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471202 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

Sidewalks - Exterior : Sidewalks

West Side @ 33.951628141704, -118.125769793987

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471190 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue



Downey Avenue - Gainford Street/ Valdina Drive to Florence Avenue

**Gainford Street/ Valdina Drive to Florence Avenue
Downey, CA 90242**

Date of Inspection
7/17/2017

***Estimated Facility Total: \$35,226**

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Gallatin Road to Gainford Street/ Valdina Drive
Downey, CA 90242

Date of Inspection

7/17/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Noren Street @ 33.955996655125, -118.122148811817

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471239 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Noren Street @ 33.956025577563, -118.122108578682

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471240 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Noren Street @ 33.956139042417, -118.122021406889

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471236 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Noren Street @ 33.958322655182, -118.120512664318

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

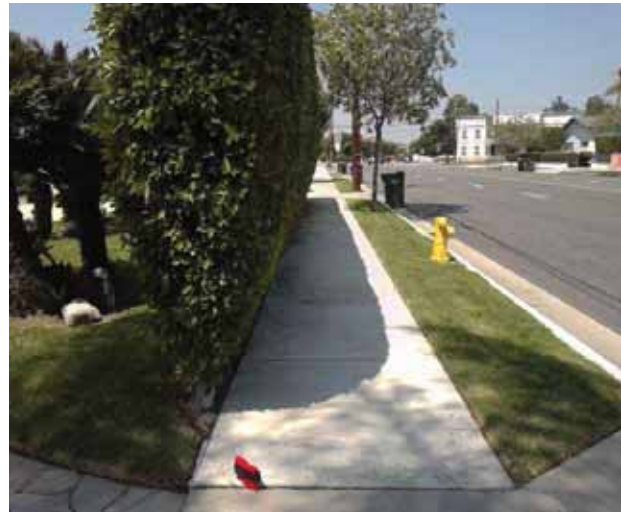

Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471223 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Noren Street @ 33.955785298548, -118.122319132090

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471235 | Resolution | None |
| Progress | Not_Started | Priority | Three |
| Actual Date | | Projected Date | 12/31/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Noren Street @ 33.956486110443, -118.121733069420

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471237 | Resolution | None |
| Progress | Not_Started | Priority | Three |
| Actual Date | | Projected Date | 12/31/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Curb Ramps - Exterior : Curb Ramp

West Side North of Gainford Street/ Valdina Drive @ 33.954285764185, - 118.123815804720

Curb Ramp : Curb Ramp Width

Finding

The width of the curb ramp is less than required.

On-Site Finding 34.00 inches

Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.5, CA 11B-406.5.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471244 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Stamps Avenue @ 33.957205827127, -118.121142983437

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471242 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Stamps Avenue @ 33.957205827127, -118.121142983437

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 5.00 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471243 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Gallatin Road @ 33.958513982820, -118.120058029890

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 7.80 percent for 92.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Notes : 7 Openings Within 92 Feet

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471233 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South of Gallatin Road @ 33.958513982820, -118.120058029890

Sidewalks : Opening

Finding

Ground surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the surface opening does not allow passage of a sphere more than 1/2 inch in diameter.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 302

Notes : 7 Openings Within 92 Feet

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471234 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Noren Street @ 33.955107841563, -118.122879713774

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.60 percent for 58.00 feet


Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

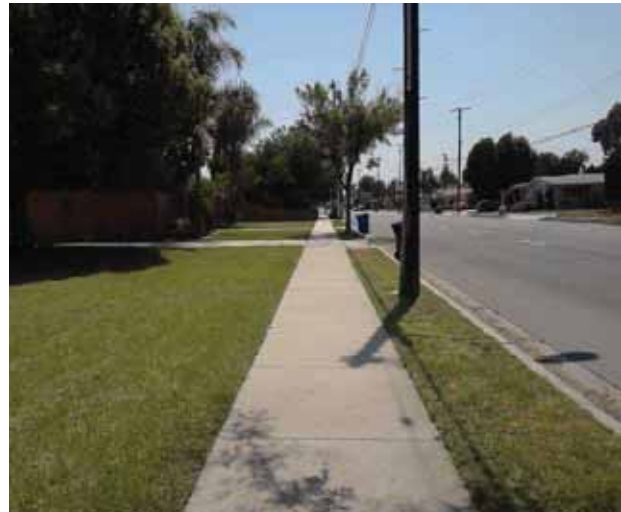

Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471232 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Noren Street @ 33.955878740468, -118.122242689133

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.00 percent for 269.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471231 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks

East Side

Stamps Avenue East Crossing @ 33.957550666039, -118.120866715908

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 13.10 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471241 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Tree South of Noren Street @ 33.955967732677, -118.122159540653

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 75.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471238 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks

East Side @ 33.958901086260, -118.119730800390

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471230 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Brick Pillars North of Gainford Street/ Valdina Drive @ 33.955077806400, - 118.123200237751

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 45.50 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Notes : 11 Pillars

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471216 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Bush North of Gainford Street/ Valdina Drive @ 33.955201284227, - 118.123094290495

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 25.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471221 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Bush North of Gainford Street/ Valdina Drive @ 33.956255844314, - 118.122230619192

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 27.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471220 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Bush North of Noren Street @ 33.957510620302, -118.121195286512

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 36.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471219 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Bush North of Noren Street @ 33.958322655182, -118.120512664318

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 37.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471218 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Gainford Street/ Valdina Drive @ 33.954843086793, - 118.123397380114

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 7.30 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471225 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Gainford Street/ Valdina Drive @ 33.954843086793, - 118.123397380114

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 2.60 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471226 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Noren Street @ 33.957334863787, -118.121329396963

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471227 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Noren Street @ 33.957334863787, -118.121329396963

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.90 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471228 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Noren Street @ 33.957907739698, -118.120865374804

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471229 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of Noren Street @ 33.957374909607, -118.121302574873

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.70 percent for 59.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471215 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Tree North of Gainford Street/ Valdina Drive @ 33.955261354456, - 118.123046010733

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 56.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471222 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Tree North of Gainford Street/ Valdina Drive @ 33.956489447629, - 118.122033476830

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 73.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471224 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Tree North of Noren Street @ 33.958905535715, -118.120037913322

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 78.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471217 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Sidewalks - Exterior : Sidewalks

West Side @ 33.954865335125, -118.123373240232

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 471214 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive



Downey Avenue - Gallatin Road to Gainford Street/ Valdina Drive

Gallatin Road to Gainford Street/ Valdina Drive
Downey, CA 90242

Date of Inspection
7/17/2017

*Estimated Facility Total: \$23,986

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Downey Avenue - Gallatin Road to Vista Del Rio Avenue

Gallatin Road to Vista Del Rio Avenue
Downey, CA 90242

Date of Inspection
7/7/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Downey Avenue - Gallatin Road to Vista Del Rio Avenue

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level North of Gallatin Road to Vista Del Rio Avenue @ 33.959970061038, -118.118222057819

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

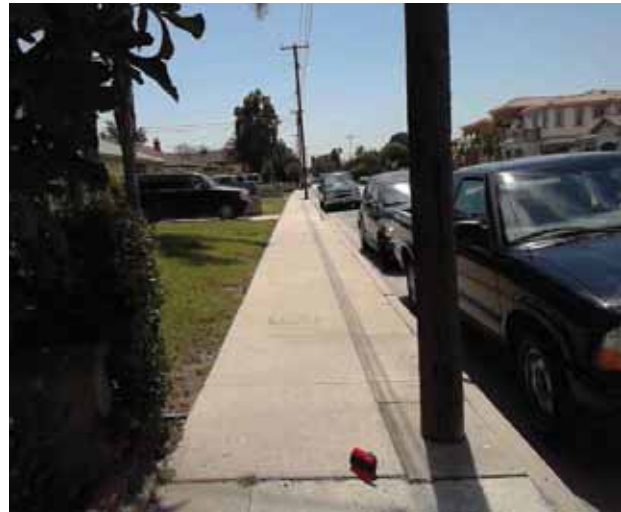

Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 466634 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Vista Del Rio Avenue

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk North of Gallatin Road @ 33.959145805917, -118.119520246983

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 237.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 466633 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Vista Del Rio Avenue

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk North of Gallatin Road to Vista Del Rio Avenue @ 33.959544030036, - 118.118884563446

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.30 percent for 357.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 466632 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Vista Del Rio Avenue

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk North of Gallatin Road to Vista Del Rio Avenue @ 33.960227013431, - 118.117795586586

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 70.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 466630 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Vista Del Rio Avenue

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk North of Gallatin Road to Vista Del Rio Avenue @ 33.960313776401, - 118.117657452822

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.40 percent for 52.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 466631 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Vista Del Rio Avenue

Sidewalks - Exterior : Sidewalks

East Side @ 33.959145805917, -118.119520246983

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 466629 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Vista Del Rio Avenue

Sidewalks - Exterior : Sidewalks

West Side @ 33.959254817174, -118.119659721851

Sidewalks : No Sidewalk

Finding

No sidewalk exists at the location.

On-Site Finding Not Found

Recommendation

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 206

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 466635 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gallatin Road to Vista Del Rio Avenue



Downey Avenue - Gallatin Road to Vista Del Rio Avenue

Gallatin Road to Vista Del Rio Avenue
Downey, CA 90242

Date of Inspection
7/7/2017

*Estimated Facility Total: \$7,302

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Downey Avenue - Gardendale Street To Imperial Highway

Gardendale Street To Imperial Highway
Downey, CA 90242

Date of Inspection
2/5/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Imperial Highway @ 33.920758489720, - 118.147172480822

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356040 | Resolution | None |
| Progress | Not_Started | Priority | One |
| Actual Date | | Projected Date | 06/30/2018 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Cheyenne Avenue @ 33.916387055086, - 118.150753229856

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 2.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352695 | Resolution | None |
| Progress | Not_Started | Priority | One |
| Actual Date | | Projected Date | 06/30/2018 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Puritan Street @ 33.917097094603, -118.150216788054

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 3.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352692 | Resolution | None |
| Progress | Not_Started | Priority | One |
| Actual Date | | Projected Date | 06/30/2018 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Cheyenne Avenue @ 33.915569055520, - 118.151080459356

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356045 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Devenir Street @ 33.916791043812, -118.150159120560

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.87 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356043 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Devenir Street @ 33.916791043812, -118.150167167187

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356042 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Lyndora Street @ 33.918065320771, -118.149202913046

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356052 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Lyndora Street @ 33.918130981688, -118.149146586657

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356044 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Lyndora Street @ 33.920018433181, -118.147719651461

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356046 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Puritan Street @ 33.916006435857, -118.150749206543

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356041 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Puritan Street @ 33.916094356824, -118.150714337826

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356051 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Adoree Street @ 33.919841486380, -118.148147463799

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356010 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Adoree Street @ 33.920396808756, -118.147730380297

Sidewalks , Change in Level : Change in Level - Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation not exceed a .5 beveled inch.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356006 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Adoree Street @ 33.920531465541, -118.147625774145

Sidewalks , Change in Level : Change in Level - Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation not exceed a .5 beveled inch.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356012 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Adoree Street @ 33.920545932786, -118.147620409727

Sidewalks , Change in Level : Change in Level - Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation not exceed a .5 beveled inch.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356008 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Comolette Avenue @ 33.918401415099, - 118.149240463972

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.25 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356011 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Puritan Street @ 33.917311885955, -118.150053173304

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352694 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Imperial Highway @ 33.920834164312, - 118.147108107805

Sidewalks , Change in Level : Change in Level - Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation not exceed a .5 beveled inch.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356049 | Resolution | None |
| Progress | Not_Started | Priority | Three |
| Actual Date | | Projected Date | 12/31/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Lyndora Street @ 33.920490289522, -118.147370964289

Sidewalks , Change in Level : Change in Level - Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation not exceed a .5 beveled inch.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356047 | Resolution | None |
| Progress | Not_Started | Priority | Three |
| Actual Date | | Projected Date | 12/31/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Adoree Street @ 33.919768036656, -118.148211836815

Sidewalks , Change in Level : Change in Level - Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation not exceed a .5 beveled inch.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356007 | Resolution | None |
| Progress | Not_Started | Priority | Three |
| Actual Date | | Projected Date | 12/31/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Gardendale Street @ 33.915442181414, - 118.151445239782

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352697 | Resolution | None |
| Progress | Not_Started | Priority | Three |
| Actual Date | | Projected Date | 12/31/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner Of Cheyenne Avenue @ 33.915820577311, - 118.150880634785

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Slope

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 2.70 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 402, 406.4, 406.2, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356018 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner Of Cheyenne Avenue @ 33.915820577311, - 118.150880634785

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Right Side Slope - Parallel Curb Ramp

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.60 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356019 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Northeast Corner Of Lyndora Street @ 33.920663896386, -
118.147235512733**

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356020 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of Puritan Street @ 33.916433797682, - 118.150427341461

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356021 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Priscilla Avenue @ 33.915583523608, - 118.151368796825

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 2.90 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352680 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of Cheyenne Avenue @ 33.915672557940, - 118.150978535414

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Slope

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 2.80 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 402, 406.4, 406.2, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356017 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Comolette Avenue @ 33.917854982918, - 118.149353116751

Curb Ramp : Detectable Warning Domes Direction

Finding

Detectable warning domes are not aligned in the direction of travel.

On-Site Finding Not Compliant

Recommendation

Provide compliant detectable warnings with domes aligned in the direction of travel.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356060 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of Comolette Avenue @ 33.917854982918, - 118.149353116751

Bottom Landing

Curb Ramp , Landings and Transitions : Landing Accumulates Water - Wet Conditions

Finding

The curb ramp landing accumulates water.

On-Site Finding Accumulates Water

Recommendation

Provide sufficient clear space at the bottom of the curb ramp that does not accumulate water.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant landing \$255



Code Reference ADA 405, 406.1, 405.10

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356061 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Devenir Street @ 33.917232869510, - 118.149794340134

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356016 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Cheyenne Avenue @ 33.916054291584, - 118.151026815176

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352705 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Priscilla Avenue @ 33.915452197798, - 118.151459991932

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352681 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**West Side Alley North Curb Ramp North Of Priscilla Avenue @
33.915846174620, -118.151174336672**

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Notes : Detectable warnings are damaged.

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352703 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

West Side Alley North Curb Ramp North Of Priscilla Avenue @ 33.915846174620, -118.151174336672

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Slope

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 3.50 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 402, 406.4, 406.2, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352704 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Bush South Of Imperial Highway @ 33.920774069789, -118.147156387568

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 38.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356053 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Bush South Of Puritan Street @ 33.916022016794, -118.150742501020

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 33.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356050 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Cheyenne Avenue @ 33.915217368939, -118.151348680258

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356056 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Cheyenne Avenue @ 33.915308629520, -118.151277601719

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356058 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Cheyenne Avenue @ 33.915308629520, -118.151277601719

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 2.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356059 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Imperial Highway @ 33.920845292923, -118.147106766701

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356055 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Imperial Highway @ 33.921190279137, -118.146863471

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356054 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Puritan Street East Crossing @ 33.916341425385, -118.150482326746

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 9.00 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356057 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Cheyenne Avenue @ 33.915185093832, -118.151378184557

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.80 percent for 80.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356025 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Cheyenne Avenue @ 33.915239627626, -118.151333928108

Sidewalks , Surface : Not Slip Resistant

Finding

Sidewalk surface is not slip resistant.

On-Site Finding Not Compliant

Recommendation

Make sure that the sidewalk surface is firm, stable and slip resistant.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356027 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Cheyenne Avenue @ 33.915239627626, -118.151333928108

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.60 percent for 13.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356028 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Comolette Avenue @ 33.917699176767, -118.149471133947

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.10 percent for 25.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356026 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South Of Devenir Street @ 33.916829995792, -118.150132298470

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 47.00 inches for 51.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, CA 11B-403.5.1

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356034 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Devenir Street @ 33.916829995792, -118.150132298470

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.80 percent for 61.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356035 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Devenir Street @ 33.917010287581, -118.149991482496

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.10 percent for 25.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356031 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Imperial Highway @ 33.920834164312, -118.147108107805

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.50 percent for 21.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356024 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Imperial Highway @ 33.921070090550, -118.146925717592

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.70 percent for 87.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356036 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South Of Imperial Highway @ 33.921070090550, -118.146925717592

Sidewalks : Opening

Finding

Ground surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the surface opening does not allow passage of a sphere more than ½ inch in diameter.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356037 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Lyndora Street @ 33.918130981688, -118.149146586657

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.70 percent for 9.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356038 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Lyndora Street @ 33.918551655512, -118.148820698261

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.00 percent for 40.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356039 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Lyndora Street @ 33.918856587091, -118.148595392704

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.90 percent for 48.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356033 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Lyndora Street @ 33.919193791180, -118.148349970579

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.60 percent for 68.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356032 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Lyndora Street @ 33.919507623490, -118.148107230663

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.90 percent for 38.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356023 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Lyndora Street @ 33.919766923781, -118.147900700569

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.10 percent for 45.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356029 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Lyndora Street @ 33.920532578406, -118.147336095572

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.90 percent for 269.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356030 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Tree South Of Lyndora Street @ 33.920295537811, -118.147505074739

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 58.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356048 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side @ 33.921243696233, -118.146806359291

Sidewalks : Turn Area

Finding

Turn area is not level.

On-Site Finding Not Level

Recommendation

Make sure that the turn area is level.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356022 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks

West Side

Adoree Street West Crossing @ 33.918804281387, -118.148936033249

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.90 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356013 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Alley North Of Gardendale Street @ 33.915255208704, -118.151615560055

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352701 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Bush North Of Gardendale Street @ 33.915112753030, -118.151712119579

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 52.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352691 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Bush North Of Priscilla Avenue @ 33.915614685634, -118.151341974735

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 44.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352693 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks

West Side

Cheyenne Avenue West Crossing

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 2.80 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352698 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks

West Side

Devenir Street West Crossing @ 33.917466579910, -118.149976730347

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 2.80 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352702 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks

West Side

Driveway North Of Cheyenne Avenue @ 33.916599622396, -118.150592297316

Sidewalks : Vehicular Traffic Surface

Finding

Surface is not firm, stable or slip resistant.

On-Site Finding Not Compliant

Recommendation

Provide compliant surface at vehicular traffic.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352699 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North Of Comolette Avenue @ 33.918452608158, -118.149194866419

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356015 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks

West Side

Driveway North Of Comolette Avenue @ 33.918583929344, -118.149086236954

Sidewalks : Vehicular Traffic Surface

Finding

Surface is not firm, stable or slip resistant.

On-Site Finding Not Compliant

Recommendation

Provide compliant surface at vehicular traffic.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356014 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks

West Side

Driveway North Of Devenir Street @ 33.917814918507, -118.149676322937

Sidewalks : Vehicular Traffic Surface

Finding

Surface is not firm, stable or slip resistant.

On-Site Finding Not Compliant

Recommendation

Provide compliant surface at vehicular traffic.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352700 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Adoree Street @ 33.919841486380, -118.148147463799

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.40 percent for 9.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 355998 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Adoree Street @ 33.919966128190, -118.148054927588

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.60 percent for 40.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356005 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Adoree Street @ 33.920723990987, -118.147487640381

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.80 percent for 25.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356000 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks

West Side

Sidewalk North Of Adoree Street @ 33.920897597374, -118.147345483303

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 47.00 inches for 157.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, CA 11B-403.5.1

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 355999 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Adoree Street @ 33.921153554865, -118.147169798613

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.90 percent for 18.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 355997 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Adoree Street @ 33.918913344309, -118.148860931396

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.90 percent for 19.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356001 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Adoree Street @ 33.919381868129, -118.148504197598

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.10 percent for 78.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356002 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Cheyenne Avenue @ 33.916387055086, -118.150753229856

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.20 percent for 9.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352689 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Cheyenne Avenue @ 33.916511701950, -118.150663375854

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.10 percent for 14.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352688 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Comolette Avenue @ 33.918327964134, -118.149282038212

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.20 percent for 29.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356003 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Comolette Avenue @ 33.918634009404, -118.149051368237

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 2.80 percent for 27.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356004 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Devenir Street @ 33.917560063890, -118.149870783091

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.80 percent for 148.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352687 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Gardendale Street @ 33.915047089788, -118.151763081551

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.00 percent for 54.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352684 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks

West Side

Sidewalk North Of Priscilla Avenue @ 33.915863981439, -118.151158243418

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 47.00 inches for 64.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, CA 11B-403.5.1

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352683 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Puritan Street @ 33.916976900242, -118.150313347578

Sidewalks , Surface : Not Slip Resistant

Finding

Sidewalk surface is not slip resistant.

On-Site Finding Not Compliant

Recommendation

Make sure that the sidewalk surface is firm, stable and slip resistant.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352685 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Puritan Street @ 33.916976900242, -118.150313347578

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.10 percent for 68.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352686 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Tree North Of Comolette Avenue @ 33.918336867285, -118.149276673794

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 52.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 356009 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Tree North Of Gardendale Street @ 33.915192884376, -118.151651769876

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 68.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352696 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Tree North Of Puritan Street @ 33.917311885955, -118.150053173304

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 48.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 352690 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway

Sidewalks - Exterior : Sidewalks

West Side @ 33.915047089788, -118.151763081551

Sidewalks : Turn Area

Finding

Turn area is not level.

On-Site Finding Not Level

Recommendation

Make sure that the turn area is level.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 355996 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Gardendale Street To Imperial Highway



Downey Avenue - Gardendale Street To Imperial Highway

Gardendale Street To Imperial Highway
Downey, CA 90242

Date of Inspection
2/5/2017

*Estimated Facility Total: \$61,835

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Downey Avenue - Stewart & Gray Road to Texas Street

Stewart & Gray Road to Texas Street
Downey, CA 90242

Date of Inspection
7/31/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Texas Street @ 33.935543805773, -118.136013150215

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476028 | Resolution | None |
| Progress | Not_Started | Priority | One |
| Actual Date | | Projected Date | 06/30/2018 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Cleta Street @ 33.934188564171, -118.136990815401

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.25 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476035 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Cleta Street @ 33.934203029097, -118.136972039938

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476031 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Cleta Street @ 33.934203029097, -118.136972039938

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.12 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476037 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Cleta Street @ 33.934486763681, -118.136770874262

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476032 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Cleta Street @ 33.934731553544, -118.136595189571

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476036 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Fontana Street @ 33.932381541817, -118.138330578804

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476027 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Luxor Street @ 33.933180464065, -118.137721717358

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476039 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Luxor Street @ 33.933258353019, -118.137645274401

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476038 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Texas Street @ 33.935538242427, -118.136018514633

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476033 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Texas Street @ 33.935538242427, -118.136018514633

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.12 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476034 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of De Palma Street @ 33.933664487128, -118.137635886669

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475991 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of De Palma Street @ 33.934045027467, -118.137363642454

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475971 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of De Palma Street @ 33.934351016272, -118.137149065733

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475978 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of De Palma Street @ 33.934467848072, -118.137056529522

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.25 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475989 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of De Palma Street @ 33.934994145523, -118.136694431305

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475992 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of De Palma Street @ 33.935141018649, -118.136589825153

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475983 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of De Palma Street @ 33.935394707999, -118.136392682791

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475985 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of De Palma Street @ 33.935394707999, -118.136392682791

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475988 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of De Palma Street @ 33.936066758587, -118.135909885168

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.12 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475980 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of De Palma Street @ 33.936185813353, -118.135811984539

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475986 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of De Palma Street @ 33.936185813353, -118.135811984539

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.12 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475993 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Stewart & Gray Road @ 33.932695325544, - 118.138377517462

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475979 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Stewart & Gray Road @ 33.932856667790, - 118.138246089220

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475976 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Stewart & Gray Road @ 33.932867794830, - 118.138231337070

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.25 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475974 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Stewart & Gray Road @ 33.933120378251, - 118.138054311275

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.25 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475972 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2020 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Stewart & Gray Road @ 33.933140406860, - 118.138047605753

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475990 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Cleta Street @ 33.934688159028, -118.136623352766

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476030 | Resolution | None |
| Progress | Not_Started | Priority | Three |
| Actual Date | | Projected Date | 12/31/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of De Palma Street @ 33.935529341075, -118.136305510998

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475973 | Resolution | None |
| Progress | Not_Started | Priority | Three |
| Actual Date | | Projected Date | 12/31/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp

East Side South of Texas Street - 1st @ 33.935699579287, - 118.135899156332

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476068 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp

East Side South of Texas Street - 1st @ 33.935699579287, - 118.135899156332

Curb Ramp : Curb Ramp Width

Finding

The width of the curb ramp is less than required.

On-Site Finding 46.00 inches

Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.5, CA 11B-406.5.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476069 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

East Side South of Texas Street - 1st @ 33.935699579287, - 118.135899156332

Bottom Landing

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.87 inches

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$255



Code Reference ADA 302, 303, 406.2, 303.1

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476070 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

East Side South of Texas Street - 1st @ 33.935699579287, - 118.135899156332

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.40 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476071 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp

East Side South of Texas Street - 2nd @ 33.935633931912, - 118.135934025049

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476054 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp

East Side South of Texas Street - 2nd @ 33.935633931912, - 118.135934025049

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.80 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476055 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

East Side South of Texas Street - 2nd @ 33.935633931912, - 118.135934025049

Bottom Landing

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.62 inches

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$255



Code Reference ADA 302, 303, 406.2, 303.1

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476056 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

East Side South of Texas Street - 2nd @ 33.935633931912, - 118.135934025049

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.30 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476057 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp

**Southeast Corner of Texas Street @ 33.936025590078, -
118.135641664267**

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476060 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Texas Street @ 33.936025590078, - 118.135641664267

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 11.80 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476061 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp

**Southeast Corner of Texas Street @ 33.936025590078, -
118.135641664267**

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 20.40 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476062 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

**Southeast Corner of Texas Street @ 33.936025590078, -
118.135641664267**

Bottom Landing

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.62 inches

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$255



Code Reference ADA 302, 303, 406.2, 303.1

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476063 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Southeast Corner of Texas Street @ 33.936025590078, -
118.135641664267**

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 4.30 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476064 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner of Texas Street @ 33.936025590078, - 118.135641664267

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 30.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476065 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp

West Side North of Stewart & Gray Road - 1st @ 33.932695325544, - 118.138377517462

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476058 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

West Side North of Stewart & Gray Road - 1st @ 33.932695325544, - 118.138377517462

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476059 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp

West Side North of Stewart & Gray Road - 2nd @ 33.932797694452, - 118.138302415609

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476066 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

West Side North of Stewart & Gray Road - 2nd @ 33.932797694452, - 118.138302415609

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.50 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476067 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Clea Street @ 33.934316523044, -118.136890232563

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476042 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Clea Street @ 33.934316523044, -118.136890232563

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 12.10 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476043 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Cleto Street @ 33.934589130437, -118.136678338051

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476052 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Clea Street @ 33.934589130437, -118.136678338051

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 11.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476053 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Fontana Street @ 33.932206846121, -118.138460665941

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476050 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Fontana Street @ 33.932206846121, -118.138460665941

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 13.50 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476051 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Fontana Street @ 33.932322568151, -118.138368129730

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476044 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Fontana Street @ 33.932322568151, -118.138368129730

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 12.10 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476045 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Fontana Street @ 33.932478347558, -118.138251453638

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476048 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Fontana Street @ 33.932478347558, -118.138251453638

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 10.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476049 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Luxor Street @ 33.932902288645, -118.137938976288

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476046 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Luxor Street @ 33.932902288645, -118.137938976288

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 12.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476047 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Texas Street @ 33.935662861270, -118.135916590691

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476040 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Texas Street @ 33.935662861270, -118.135916590691

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 4.00 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476041 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Cleta Street @ 33.934188564171, -118.136990815401

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.70 percent for 44.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476019 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Cleto Street @ 33.934560200714, -118.136723935604

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.20 percent for 91.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476026 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Cleto Street @ 33.934764933925, -118.136563003063

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.90 percent for 63.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476025 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Fontana Street @ 33.932589618389, -118.138137459755

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.30 percent for 148.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476018 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Luxor Street @ 33.932967938126, -118.137869238853

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.80 percent for 13.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476017 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Luxor Street @ 33.933258353019, -118.137645274401

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.80 percent for 26.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476023 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South of Luxor Street @ 33.933258353019, -118.137645274401

Sidewalks : Opening

Finding

Ground surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the surface opening does not allow passage of a sphere more than ½ inch in diameter.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476024 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Texas Street @ 33.935620579898, -118.135944753885

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.20 percent for 300.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476021 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South of Texas Street @ 33.935620579898, -118.135944753885

Sidewalks : Opening

Finding

Ground surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the surface opening does not allow passage of a sphere more than ½ inch in diameter.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476022 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Texas Street @ 33.936025590078, -118.135641664267

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.60 percent for 141.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476020 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Tree South of Luxor Street @ 33.932967938126, -118.137869238853

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 62.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476029 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

East Side @ 33.936011125462, -118.135653734207

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476186 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of De Palma Street @ 33.933949336197, -118.137441426516

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476001 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of De Palma Street @ 33.934388847539, -118.137124925852

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475997 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of De Palma Street @ 33.934388847539, -118.137124925852

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 12.90 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475998 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of De Palma Street @ 33.934779398753, -118.136847317219

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475995 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of De Palma Street @ 33.934779398753, -118.136847317219

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 11.20 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475996 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of De Palma Street @ 33.935386919302, -118.136416822672

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 10.30 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475994 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of De Palma Street @ 33.935386919302, -118.136416822672

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476179 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of De Palma Street @ 33.935605002544, -118.136238455772

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475999 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of De Palma Street @ 33.935605002544, -118.136238455772

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.10 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476000 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of De Palma Street @ 33.935933239025, -118.136009126902

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476008 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of De Palma Street @ 33.935933239025, -118.136009126902

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.50 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476009 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of De Palma Street @ 33.936120166353, -118.135885745287

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476014 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of De Palma Street @ 33.936120166353, -118.135885745287

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 11.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476015 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Stewart & Gray Road @ 33.932315891884, -118.138671219349

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476012 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Stewart & Gray Road @ 33.932315891884, -118.138671219349

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 11.20 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476013 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Stewart & Gray Road @ 33.932495038192, -118.138531744480

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476006 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Stewart & Gray Road @ 33.932495038192, -118.138531744480

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 10.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476007 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Stewart & Gray Road @ 33.932572927774, -118.138460665941

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476010 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Stewart & Gray Road @ 33.932572927774, -118.138460665941

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 11.50 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476011 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Stewart & Gray Road @ 33.932756524363, -118.138338625431

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476002 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Stewart & Gray Road @ 33.932756524363, -118.138338625431

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 2.90 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476003 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Stewart & Gray Road @ 33.932926768119, -118.138195127249

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476004 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Stewart & Gray Road @ 33.932926768119, -118.138195127249

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 10.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476005 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Guy Wire North of De Palma Street @ 33.933845855981, -118.137503117323

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 65.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475982 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Guy Wire North of De Palma Street @ 33.935831986551, -118.136064112186

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 65.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475975 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of De Palma Street @ 33.933508709891, -118.137774020433

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.00 percent for 60.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475969 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of De Palma Street @ 33.933864771729, -118.137495070696

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.80 percent for 77.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475960 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of De Palma Street @ 33.934313184989, -118.137183934450

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.70 percent for 18.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475963 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of De Palma Street @ 33.934806103044, -118.136823177338

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.40 percent for 19.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475959 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of De Palma Street @ 33.934994145523, -118.136694431305

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.50 percent for 28.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475962 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

West Side

Sidewalk North of De Palma Street @ 33.935076483519, -118.136611282825

Sidewalks : Opening

Finding

Ground surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the surface opening does not allow passage of a sphere more than ½ inch in diameter.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475961 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of De Palma Street @ 33.935973294915, -118.135980963707

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.20 percent for 48.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475967 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of De Palma Street @ 33.935973294915, -118.135980963707

Sidewalks , Surface : Running Slope

Finding

Sidewalk running slope is not compliant.

On-Site Finding 11.60 percent for 2.00 feet

Recommendation

Repave the sidewalk surface with the recommended running slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,184



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475968 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of De Palma Street @ 33.936137968935, -118.135856240988

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.30 percent for 15.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475970 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of Stewart & Gray Road @ 33.932345935080, -118.138643056154

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.00 percent for 41.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475966 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of Stewart & Gray Road @ 33.932807708796, -118.138294368982

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.50 percent for 25.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475964 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of Stewart & Gray Road @ 33.932856667790, -118.138246089220

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.70 percent for 70.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475965 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Tree North of De Palma Street @ 33.935447003516, -118.136344403028

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 56.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476178 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Tree North of De Palma Street @ 33.935691790618, -118.136180788279

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 70.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475987 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Utility Box North of Stewart & Gray Road @ 33.932251354613, -118.138723522425

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 45.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475981 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Utility Pole North of De Palma Street @ 33.933864771729, -118.137495070696

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 46.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 475977 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street

Sidewalks - Exterior : Sidewalks

West Side @ 33.932240227492, -118.138751685619

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476177 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart & Gray Road to Texas Street



Downey Avenue - Stewart & Gray Road to Texas Street

Stewart & Gray Road to Texas Street
Downey, CA 90242

Date of Inspection
7/31/2017

*Estimated Facility Total: \$70,913

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Downey Avenue - Stewart and Gray Road To Imperial Highway

Stewart and Gray Road To Imperial Highway
Downey, CA 90241

Date of Inspection
12/21/2016

Prepared By

Disability Access Consultants

(800) 743-7067

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Alameda Street @ 33.927074861077, -118.142369985580

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324961 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Stewart and Gray Road @ 33.931156438966, -118.139312267303

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324960 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Boyne Street @ 33.929189116135, -118.141039609909

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326655 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Hondo Street @ 33.925013968269, -118.144150972366

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326657 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Quoit Street @ 33.924310671624, -118.144698143005

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326658 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Cole Street @ 33.930025901536, -118.140159845352

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324962 | Resolution | None |
| Progress | Not_Started | Priority | Three |
| Actual Date | | Projected Date | 12/31/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Donovan Street @ 33.924786955429, -118.144091963768

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324963 | Resolution | None |
| Progress | Not_Started | Priority | Three |
| Actual Date | | Projected Date | 12/31/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Alameda Street

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326656 | Resolution | None |
| Progress | Not_Started | Priority | Three |
| Actual Date | | Projected Date | 12/31/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Northeast Corner Of Alameda Street @ 33.927755879488, -
118.141779899597**

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325027 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of Alameda Street @ 33.927755879488, - 118.141779899597

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 10.00 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|------------------|-------------|----------------|------------|
| Record Number | 325028 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Northeast Corner Of Alameda Street @ 33.927755879488, -
118.141779899597**

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 4.30 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325029 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Northeast Corner Of Alameda Street @ 33.927755879488, -
118.141779899597**

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 16.90 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325030 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Northeast Corner Of Alameda Street @ 33.927755879488, -
118.141779899597**

Curb Ramp : Appurtenances

Finding

Utilities, gratings or other appurtenances are located on the curb ramp.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp free of appurtenances.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$1,440



Code Reference ADA 303.3, CA 11B-303.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325031 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Northeast Corner Of Alameda Street @ 33.927755879488, -
118.141779899597**

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.00 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325032 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Northeast Corner Of Donovan Street @ 33.925281041423, -
118.143705725670**

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324998 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of Donovan Street @ 33.925281041423, - 118.143705725670

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 9.00 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324999 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Northeast Corner Of Donovan Street @ 33.925281041423, -
118.143705725670**

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.50 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325000 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Northeast Corner Of Donovan Street @ 33.925281041423, -
118.143705725670**

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 13.70 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325001 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner Of Donovan Street @ 33.925281041423, - 118.143705725670

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 0.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

| | | | |
|------------------|-------------|----------------|------------|
| Record Number | 325002 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Northeast Corner Of Everest Street @ 33.923642979562, -
118.144966363907**

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 2.70 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325016 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Northeast Corner Of Everest Street @ 33.923642979562, -
118.144966363907**

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.90 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325017 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner Of Leeds Street @ 33.922636980307, - 118.145706653595

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.40 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325011 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of Leeds Street @ 33.922636980307, - 118.145706653595

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 11.00 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326604 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of Leeds Street @ 33.922636980307, - 118.145706653595

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.30 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326605 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Alameda Street @ 33.927871607566, - 118.142058849335

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326647 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Alameda Street @ 33.927871607566, - 118.142058849335

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 10.30 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326648 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Alameda Street @ 33.927871607566, - 118.142058849335

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 12.80 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326649 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Northwest Corner Of Alameda Street @ 33.927871607566, -
118.142058849335**

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 0.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326650 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Northwest Corner Of Boyne Street @ 33.929028879695, -
118.141211271286**

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 8.50 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326641 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Donovan Street @ 33.925343358372, - 118.143979310989

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326612 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Donovan Street @ 33.925343358372, - 118.143979310989

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 9.00 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326613 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Donovan Street @ 33.925343358372, - 118.143979310989

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.30 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326614 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Donovan Street @ 33.925343358372, - 118.143979310989

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 14.60 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326615 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner Of Donovan Street @ 33.925343358372, - 118.143979310989

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326616 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Northwest Corner Of Donovan Street @ 33.925343358372, -
118.143979310989**

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 32.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326617 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Hondo Street @ 33.924862626443, - 118.144311904907

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 4.69 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326621 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Northwest Corner Of Lankin Street @ 33.923366998648, -
118.145502805710**

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326631 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Lankin Street @ 33.923366998648, - 118.145502805710

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 2.80 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326632 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Lankin Street @ 33.923366998648, - 118.145502805710

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 5.30 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326633 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner Of Lankin Street @ 33.923366998648, - 118.145502805710

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.00 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326634 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Quoit Street @ 33.924025790317, - 118.144987821579

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326622 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Quoit Street @ 33.924025790317, - 118.144987821579

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.00 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326623 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner Of Quoit Street @ 33.924025790317, - 118.144987821579

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 4.00 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

| | | | |
|------------------|-------------|----------------|------------|
| Record Number | 326624 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner Of Quoit Street @ 33.924025790317, - 118.144987821579

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 0.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326625 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Southeast Corner Of Alameda Street @ 33.927635700164, -
118.141908645630**

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325012 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Southeast Corner Of Alameda Street @ 33.927635700164, -
118.141908645630**

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 11.90 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325013 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Southeast Corner Of Alameda Street @ 33.927635700164, -
118.141908645630**

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.40 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325014 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Southeast Corner Of Alameda Street @ 33.927635700164, -
118.141908645630**

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 13.40 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325015 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Southeast Corner Of Donovan Street @ 33.925134151292, -
118.143818378448**

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Slope

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 4.90 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 402, 406.4, 406.2, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325025 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Southeast Corner Of Donovan Street @ 33.925134151292, -
118.143818378448**

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 0.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325026 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Donovan Street @ 33.925134151292, - 118.143818378448

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326606 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Donovan Street @ 33.925134151292, - 118.143818378448

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.50 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326607 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Southeast Corner Of Donovan Street @ 33.925134151292, -
118.143818378448**

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 15.70 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326608 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of Everest Street @ 33.923527245739, - 118.145052194595

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Right Side Slope - Parallel Curb Ramp

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 4.50 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325003 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Leeds Street @ 33.922503439690, - 118.145835399628

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326626 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Southeast Corner Of Leeds Street @ 33.922503439690, -
118.145835399628**

Curb Ramp : Parallel Curb Ramp Left Side Slope

Finding

The running slope is greater than allowed.

On-Site Finding 8.70 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326627 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Leeds Street @ 33.922503439690, - 118.145835399628

Curb Ramp : Parallel Curb Ramp Right Side Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 2.50 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326628 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Southeast Corner Of Leeds Street @ 33.922503439690, -
118.145835399628**

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Slope

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 13.00 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 402, 406.4, 406.2, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326629 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of Leeds Street @ 33.922503439690, - 118.145835399628

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 0.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326630 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Stewart and Gray Road @ 33.931930892954, - 118.138625621796

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 6.70 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325036 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of Stewart and Gray Road @ 33.931930892954, - 118.138625621796

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.60 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 325037 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Stewart and Gray Road @ 33.931930892954, - 118.138625621796

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 9.80 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326609 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Stewart and Gray Road @ 33.931930892954, - 118.138625621796

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 2.10 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326610 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southeast Corner Of Stewart and Gray Road @ 33.931930892954, - 118.138625621796

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 13.00 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326611 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Alameda Street @ 33.927729172987, - 118.142187595367

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326642 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Alameda Street @ 33.927729172987, - 118.142187595367

Curb Ramp : Curb Ramp Width

Finding

The width of the curb ramp is less than required.

On-Site Finding 8.00 inches

Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.5, CA 11B-406.5.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326643 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Alameda Street @ 33.927729172987, - 118.142187595367

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 13.30 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326644 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Alameda Street @ 33.927729172987, - 118.142187595367

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 22.00 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326645 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Southwest Corner Of Alameda Street @ 33.927729172987, -
118.142187595367**

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 0.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326646 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Southwest Corner Of Boyne Street @ 33.928815230640, -
118.141340017319**

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326673 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Boyne Street @ 33.928815230640, - 118.141340017319

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 13.00 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326674 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Southwest Corner Of Boyne Street @ 33.928815230640, -
118.141340017319**

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 21.40 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326675 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Southwest Corner Of Boyne Street @ 33.928815230640, -
118.141340017319**

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Slope

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 5.60 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 402, 406.4, 406.2, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326676 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

**Southwest Corner Of Lankin Street @ 33.923206751255, -
118.145620822906**

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326670 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Lankin Street @ 33.923206751255, - 118.145620822906

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.00 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326671 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Lankin Street @ 33.923206751255, - 118.145620822906

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 8.20 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326672 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Quoit Street @ 33.923892251877, - 118.145116567612

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326618 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Quoit Street @ 33.923892251877, - 118.145116567612

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 18.00 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326619 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Quoit Street @ 33.923892251877, - 118.145116567612

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 8.30 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326620 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Stewart and Gray Road @ 33.932011008482, - 118.138915300369

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326635 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Stewart and Gray Road @ 33.932011008482, - 118.138915300369

Curb Ramp : Parallel Curb Ramp Left Side Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.10 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326636 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Stewart and Gray Road @ 33.932011008482, - 118.138915300369

Curb Ramp : Parallel Curb Ramp Right Side Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 2.70 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326637 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Stewart and Gray Road @ 33.932011008482, - 118.138915300369

Curb Ramp : Appurtenances

Finding

Utilities, gratings or other appurtenances are located on the curb ramp.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp free of appurtenances.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$1,440



Code Reference ADA 303.3, CA 11B-303.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326638 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner Of Stewart and Gray Road @ 33.932011008482, - 118.138915300369

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Slope

Finding

The slope at the bottom landing is greater than allowed.

On-Site Finding 4.30 percent

Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 402, 406.4, 406.2, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326639 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner Of Stewart and Gray Road @ 33.932011008482, - 118.138915300369

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.00 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326640 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Alameda Street @ 33.927257356741, -118.142198324203

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324985 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Alameda Street @ 33.927257356741, -118.142198324203

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 6.50 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324986 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Alameda Street @ 33.927560031614, -118.141973018646

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324983 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Alameda Street @ 33.927560031614, -118.141973018646

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324984 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Cole Street @ 33.927800390306, -118.141790628433

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324994 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Cole Street @ 33.927800390306, -118.141790628433

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.80 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324995 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Cole Street @ 33.928040748320, -118.141661882401

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324973 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Cole Street @ 33.928040748320, -118.141661882401

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.30 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324974 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Cole Street @ 33.928147573886, -118.141522407532

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324975 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Cole Street @ 33.928147573886, -118.141522407532

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324976 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Cole Street @ 33.929927980265, -118.140267133713

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324996 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Cole Street @ 33.929927980265, -118.140267133713

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 4.80 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324997 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Cole Street @ 33.930079313091, -118.140116938

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324971 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Cole Street @ 33.930079313091, -118.140116938

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 4.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324972 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Cole Street @ 33.930453193037, -118.139795064926

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324990 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Cole Street @ 33.930453193037, -118.139795064926

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 4.30 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324991 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Cole Street @ 33.930577819322, -118.139677047729

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324979 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Cole Street @ 33.930577819322, -118.139677047729

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.60 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324980 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Cole Street @ 33.930782562107, -118.139537572861

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found


Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190

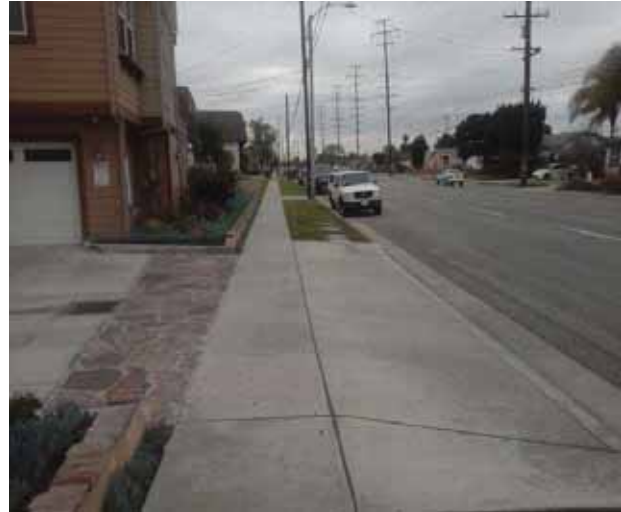

Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324981 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Cole Street @ 33.930782562107, -118.139537572861

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.90 percent


Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

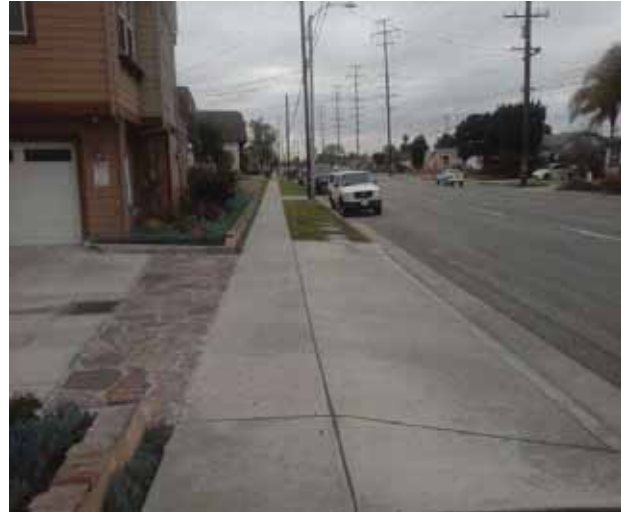

Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324982 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Donovan Street @ 33.923887800592, -118.144783973694

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324966 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Donovan Street @ 33.923887800592, -118.144783973694

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 5.50 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324967 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Donovan Street @ 33.924016887761, -118.144660592079

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324969 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Donovan Street @ 33.924016887761, -118.144660592079

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 5.20 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324970 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Leeds Street @ 33.921693288791, -118.146522045135

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326602 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Leeds Street @ 33.921693288791, -118.146522045135

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 7.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326603 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Stewart and Gray Road @ 33.931129733531, -118.139301538467

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324968 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Stewart and Gray Road @ 33.931352278571, -118.139129877090

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324992 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Stewart and Gray Road @ 33.931352278571, -118.139129877090

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 10.00 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324993 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South Of Stewart and Gray Road @ 33.931841875612, -118.138775825500

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324977 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Driveway South Of Stewart and Gray Road @ 33.931841875612, -118.138775825500

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 12.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324978 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Guy Wire South Of Cole Street @ 33.927871607566, -118.141758441925

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 60.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324965 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Leeds Street East Crossing @ 33.922547953252, -118.145771026611

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324987 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Leeds Street East Crossing @ 33.922547953252, -118.145771026611

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.60 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324988 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side

Leeds Street East Crossing @ 33.922547953252, -118.145771026611

Sidewalks : Vehicular Traffic Surface

Finding

Surface is not firm, stable or slip resistant.

On-Site Finding Not Compliant

Recommendation

Provide compliant surface at vehicular traffic.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324989 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Cole Street @ 33.930195038011, -118.139988183975

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.20 percent for 144.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324959 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

East Side

Tree South Of Donovan Street @ 33.923732005473, -118.144880533218

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 60.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 324964 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

East Side @ 33.931930892954, -118.138625621796

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found


Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400

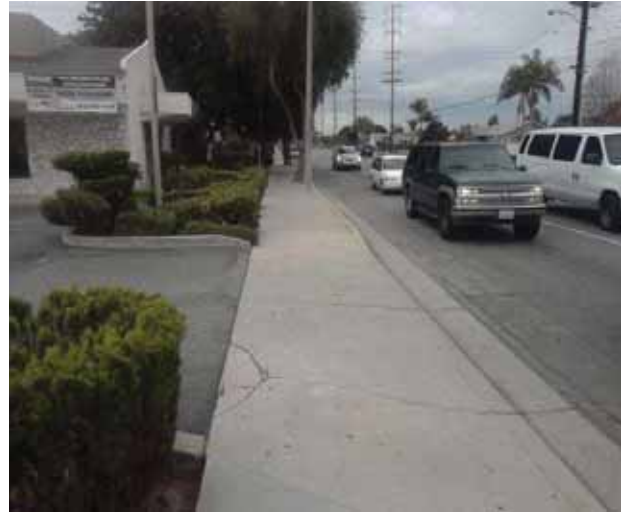

Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326601 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Bush North Of Imperial Highway @ 33.922049425, -118.146511316299

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

Finding

Sidewalk width at the obstruction is not compliant.

On-Site Finding 22.00 inches

Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, 403.5.1, CA 11B-403.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326654 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North Of Alameda Street @ 33.928236595089, -118.141704797745

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326659 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

West Side

Driveway North Of Alameda Street @ 33.928236595089, -118.141704797745

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 2.30 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326660 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North Of Alameda Street @ 33.928307811984, -118.141704797745

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326663 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

West Side

Driveway North Of Alameda Street @ 33.928307811984, -118.141704797745

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 8.00 percent


Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

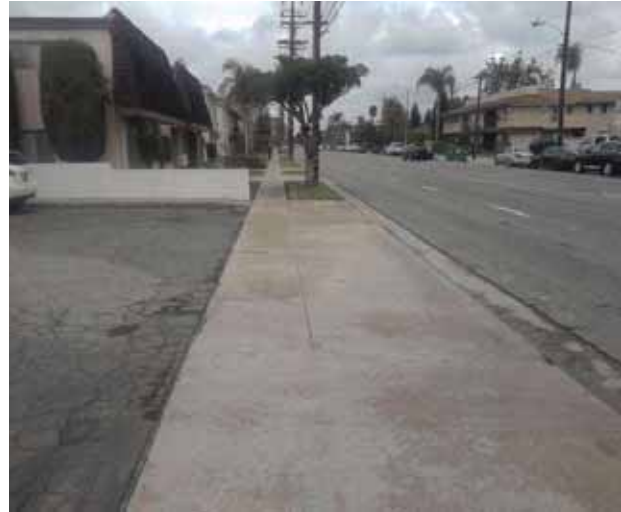

Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326664 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North Of Alameda Street @ 33.928503658139, -118.141576051712

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326666 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

West Side

Driveway North Of Alameda Street @ 33.928503658139, -118.141576051712

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.60 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326667 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North Of Alameda Street @ 33.928601581048, -118.141436576843

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326665 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North Of Donovan Street @ 33.927212845639, -118.142563104630

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326669 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North Of Imperial Highway @ 33.921906955710, -118.146629333496

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326668 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North Of Imperial Highway @ 33.922405509771, -118.146286010742

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326661 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

West Side

Driveway North Of Imperial Highway @ 33.922405509771, -118.146286010742

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.10 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326662 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Donovan Street @ 33.925539211343, -118.143829107285

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.00 percent for 146.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326653 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Imperial Highway @ 33.921906955710, -118.146629333496

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.00 percent for 115.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326652 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway

Sidewalks - Exterior : Sidewalks

West Side @ 33.921577552320, -118.146790266037

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 326651 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Stewart and Gray Road To Imperial Highway



Downey Avenue - Stewart and Gray Road To Imperial Highway

Stewart and Gray Road To Imperial Highway
Downey, CA 90241

Date of Inspection
12/21/2016

*Estimated Facility Total: \$112,052

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Downey Avenue - Texas Street to Firestone Boulevard

Texas Street to Firestone Boulevard
Downey, CA 90242

Date of Inspection
7/31/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Davis Street @ 33.936668706680, -118.135185688734

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476084 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Davis Street @ 33.936668706680, -118.135185688734

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476087 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Firestone Boulevard @ 33.939006361232, -118.133772164583

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476090 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Iowa Street @ 33.937011403509, -118.134946972132

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476088 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Iowa Street @ 33.937011403509, -118.134946972132

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.87 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476089 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Iowa Street @ 33.937186089349, -118.134835660458

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476086 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change in Level South of Iowa Street @ 33.937517657664, -118.134623765945

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476085 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Arnett Street @ 33.937517657664, -118.134885281324

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.87 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476134 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Arnett Street @ 33.937562163380, -118.134873211384

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476135 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Phlox Avenue @ 33.938777160435, -118.134171813726

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476131 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Phlox Avenue @ 33.939113173044, -118.133980035782

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476127 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Phlox Avenue @ 33.939113173044, -118.133980035782

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476132 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Phlox Avenue @ 33.939209971132, -118.133935779333

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476183 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Texas Street @ 33.936263699559, -118.135771751404

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476138 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Texas Street @ 33.936880110731, -118.135322481394

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476136 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Texas Street @ 33.937229482591, -118.135078400373

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.87 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476129 | Resolution | None |
| Progress | Not_Started | Priority | Two |
| Actual Date | | Projected Date | 06/30/2021 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change in Level North of Phlox Avenue @ 33.939084244858, -118.133998811245

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476130 | Resolution | None |
| Progress | Not_Started | Priority | Three |
| Actual Date | | Projected Date | 12/31/2022 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

**Northeast Corner of Davis Street @ 33.936924616780, -
118.135001957417**

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476159 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

**Northeast Corner of Davis Street @ 33.936924616780, -
118.135001957417**

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 2.80 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476160 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner of Davis Street @ 33.936924616780, - 118.135001957417

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 10.90 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476161 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Northeast Corner of Davis Street @ 33.936924616780, -
118.135001957417**

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 5.20 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476162 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner of Davis Street @ 33.936924616780, - 118.135001957417

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Change in Level - Curb Ramps

Finding

The transition from the top of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding Not Beveled

Recommendation

Patch the transition area at the top of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

Costing Info (Estimated)

Patch lip at curb ramp \$155



Code Reference ADA 302, 406.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476163 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

**Northeast Corner of Texas Street @ 33.936171348764, -
118.135539740324**

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476164 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

**Northeast Corner of Texas Street @ 33.936171348764, -
118.135539740324**

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 13.70 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476165 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner of Texas Street @ 33.936171348764, - 118.135539740324

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 21.60 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476166 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Northeast Corner of Texas Street @ 33.936171348764, - 118.135539740324

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 8.70 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476167 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

Northeast Corner of Texas Street @ 33.936171348764, - 118.135539740324

Bottom Landing

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.75 inches

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$255



Code Reference ADA 302, 303, 406.2, 303.1

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476168 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Northeast Corner of Texas Street @ 33.936171348764, -
118.135539740324**

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476169 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Northeast Corner of Texas Street @ 33.936171348764, -
118.135539740324**

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 32.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476170 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

**Southeast Corner of Davis Street @ 33.936746592444, -
118.135113269091**

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476109 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Davis Street @ 33.936746592444, - 118.135113269091

Curb Ramp : Curb Ramp Width

Finding

The width of the curb ramp is less than required.

On-Site Finding 45.00 inches

Recommendation

Provide a compliant curb ramp.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.5, CA 11B-406.5.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476110 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

**Southeast Corner of Davis Street @ 33.936746592444, -
118.135113269091**

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 12.90 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476111 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

**Southeast Corner of Davis Street @ 33.936746592444, -
118.135113269091**

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 4.10 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476112 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Davis Street @ 33.936746592444, - 118.135113269091

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 10.90 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3, CA 11B-406.2.2

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476113 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

Southeast Corner of Davis Street @ 33.936746592444, - 118.135113269091

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 10.70 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476114 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

Southeast Corner of Davis Street @ 33.936746592444, - 118.135113269091

Bottom Landing

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.75 inches

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$255



Code Reference ADA 302, 303, 406.2, 303.1

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476115 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

**Southeast Corner of Davis Street @ 33.936746592444, -
118.135113269091**

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 45.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476116 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

West Side North of Phlox Avenue - 1st @ 33.939254475963, - 118.133894205093

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476157 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

West Side North of Phlox Avenue - 1st @ 33.939254475963, - 118.133894205093

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 7.10 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476158 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

West Side North of Phlox Avenue - 2nd @ 33.939419143636, - 118.133798986673

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476171 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

West Side North of Phlox Avenue - 2nd @ 33.939419143636, - 118.133798986673

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 4.30 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3, CA 11B-406.5.7

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476172 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

West Side North of Phlox Avenue - 2nd @ 33.939419143636, - 118.133798986673

Curb Ramp : Appurtenances

Finding

Utilities, gratings or other appurtenances are located on the curb ramp.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp free of appurtenances.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$1,440



Code Reference ADA 303.3, CA 11B-303.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476173 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

West Side North of Phlox Avenue - 2nd @ 33.939419143636, - 118.133798986673

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476174 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

West Side North of Phlox Avenue - 3rd @ 33.939419143636, - 118.133798986673

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 8.80 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2, CA 11B-406

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476175 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

West Side North of Phlox Avenue - 3rd @ 33.939419143636, - 118.133798986673

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.30 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476176 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

West Side North of Phlox Avenue - 4th @ 33.939419143636, - 118.133798986673

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 6.50 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2, CA 11B-406.5.8

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476119 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Curb Ramps - Exterior : Curb Ramp

West Side North of Phlox Avenue - 4th @ 33.939419143636, - 118.133798986673

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to surface \$248



Code Reference CA 11B-406.5.12

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476185 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Davis Street @ 33.936537413374, -118.135291635990

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476107 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Davis Street @ 33.936537413374, -118.135291635990

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 12.20 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476108 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Firestone Boulevard @ 33.938072864804, -118.134308606386

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476097 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Firestone Boulevard @ 33.938072864804, -118.134308606386

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 11.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476098 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Firestone Boulevard @ 33.938289828534, -118.134179860353

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476101 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Firestone Boulevard @ 33.938289828534, -118.134179860353

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 12.10 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476102 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Firestone Boulevard @ 33.939255588583, -118.133625984192

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476091 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Firestone Boulevard @ 33.939255588583, -118.133625984192

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 9.40 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476092 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Firestone Boulevard @ 33.939392440792, -118.133536130190

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476093 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Firestone Boulevard @ 33.939392440792, -118.133536130190

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 10.10 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476094 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Firestone Boulevard @ 33.939934284368, -118.133137822151

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476105 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Firestone Boulevard @ 33.939934284368, -118.133137822151

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 10.90 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476106 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Iowa Street @ 33.937114879878, -118.134866505861

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476095 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Iowa Street @ 33.937114879878, -118.134866505861

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 2.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476096 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Iowa Street @ 33.937358549539, -118.134688138962

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476103 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Iowa Street @ 33.937358549539, -118.134688138962

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 12.60 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476104 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

East Side

Driveway South of Iowa Street @ 33.937474264568, -118.134643882513

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476099 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side

Driveway South of Iowa Street @ 33.937474264568, -118.134643882513

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 11.20 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476100 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South of Davis Street @ 33.936742141831, -118.135137408972

Sidewalks : Width

Finding

Sidewalk does not have enough width.

On-Site Finding 44.00 inches for 6.00 feet

Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302, CA 11B-403.5.1

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476080 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Davis Street @ 33.936742141831, -118.135137408972

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.20 percent for 245.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476081 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Davis Street @ 33.936742141831, -118.135137408972

Sidewalks , Surface : Running Slope

Finding

Sidewalk running slope is not compliant.

On-Site Finding 5.40 percent for 4.50 feet

Recommendation

Repave the sidewalk surface with the recommended running slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,184



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476082 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Firestone Boulevard @ 33.938213056815, -118.134226799011

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.80 percent for 178.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476074 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Firestone Boulevard @ 33.938912900787, -118.133833855391

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.40 percent for 250.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476073 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Firestone Boulevard @ 33.939063105024, -118.133735954762

Sidewalks , Surface : Running Slope

Finding

Sidewalk running slope is not compliant.

On-Site Finding 9.10 percent for 7.00 feet

Recommendation

Repave the sidewalk surface with the recommended running slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,184



Code Reference ADA 206, 302

Notes : Surface is Rough And Uneven For 7 Feet

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476076 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South of Firestone Boulevard @ 33.939063105024, -118.133735954762

Sidewalks : Opening

Finding

Ground surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the surface opening does not allow passage of a sphere more than ½ inch in diameter.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 302

Notes : Railroad Crossing Opening = 2.87"

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476083 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Firestone Boulevard @ 33.939375751510, -118.133553564548

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.60 percent for 130.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Notes : Surface is Rough And Uneven For 9 Feet

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476079 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Firestone Boulevard @ 33.939854176295, -118.133210241795

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.80 percent for 165.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476075 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Iowa Street @ 33.937186089349, -118.134835660458

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.60 percent for 101.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476077 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South of Iowa Street @ 33.937615570208, -118.134568780661

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.20 percent for 140.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476078 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

East Side @ 33.939934284368, -118.133137822151

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476181 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Arnett Street @ 33.937839210937, -118.134706914425

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476139 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Arnett Street @ 33.937839210937, -118.134706914425

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 10.30 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476140 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Arnett Street @ 33.938189691496, -118.134520500898

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476152 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Arnett Street @ 33.938189691496, -118.134520500898

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 6.70 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476153 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Phlox Avenue @ 33.938661447177, -118.134234845638

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476145 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Phlox Avenue @ 33.938661447177, -118.134234845638

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 10.30 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476146 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Phlox Avenue @ 33.938862832650, -118.134119510651

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476143 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Phlox Avenue @ 33.938862832650, -118.134119510651

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 12.00 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476144 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Phlox Avenue @ 33.939291192431, -118.133871406317

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476149 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Phlox Avenue @ 33.939291192431, -118.133871406317

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 6.10 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476150 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | New Value | 0 |
| Assignment | None | | |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Phlox Avenue @ 33.939291192431, -118.133871406317

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 3.50 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476151 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Texas Street @ 33.936289290725, -118.135740906

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 13.60 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476156 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Texas Street @ 33.936289290725, -118.135740906

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476184 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Texas Street @ 33.936400556577, -118.135683238506

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476147 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Texas Street @ 33.936400556577, -118.135683238506

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 15.30 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476148 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Vehicular Traffic

West Side

Driveway North of Texas Street @ 33.936538526030, -118.135566562414

Sidewalks , Vehicular Traffic : Cross Walks and Detectable Warnings

Finding

There are no detectable warnings where the pedestrian route crosses vehicular traffic.

On-Site Finding Not Found

Recommendation

Provide detectable warnings.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant detectable warnings \$190



Code Reference ADA 705,CA 11B-705.1.2.5,CA 11B-247.1.2.5

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476141 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

West Side

Driveway North of Texas Street @ 33.936538526030, -118.135566562414

Sidewalks : Vehicular Traffic Cross Slope

Finding

Cross slope at vehicular traffic is not compliant.

On-Site Finding 11.50 percent

Recommendation

Repave the surface to provide a compliant cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476142 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Guy Wire North of Arnett Street @ 33.937721271123, -118.134768605232

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 65.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476133 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Guy Wire North of Phlox Avenue @ 33.938590238940, -118.134268373251

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 65.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476128 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Guy Wire North of Phlox Avenue @ 33.939084244858, -118.133998811245

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 65.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476137 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of Arnett Street @ 33.937595542651, -118.134857118130

Sidewalks , Surface : Running Slope

Finding

Sidewalk running slope is not compliant.

On-Site Finding 6.40 percent for 14.00 feet

Recommendation

Repave the sidewalk surface with the recommended running slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,184



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476122 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

West Side

Sidewalk North of Phlox Avenue @ 33.939175479872, -118.133942484856

Sidewalks : Opening

Finding

Ground surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the surface opening does not allow passage of a sphere more than ½ inch in diameter.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 302

Notes : Railroad Crossing Opening = 2.5"

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476126 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of Texas Street @ 33.936332684425, -118.135734200478

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.30 percent for 20.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476121 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North of Texas Street @ 33.937168286986, -118.135114610195

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.00 percent for 38.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476123 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard

Sidewalks - Exterior : Sidewalks

West Side @ 33.936219193165, -118.135799914598

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Progress

| | | | |
|-------------------------|-------------|-----------------------|------------|
| Record Number | 476182 | Resolution | None |
| Progress | Not_Started | Priority | Four |
| Actual Date | | Projected Date | 06/30/2023 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Downey Avenue - Texas Street to Firestone Boulevard



Downey Avenue - Texas Street to Firestone Boulevard

**Texas Street to Firestone Boulevard
Downey, CA 90242**

Date of Inspection
7/31/2017

***Estimated Facility Total: \$72,805**

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using

