Accessibility Survey



Adwen Street & Old River School Road

Adwen Street & Old River School Road Downey, CA 90242

Date of Inspection 4/11/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Northeast Corner @ 33.944080886835, -118.151118010283

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Record Number	404157	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Northeast Corner @ 33.944080886835, -118.151118010283

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 14.60 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Record Number	404158	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Northeast Corner @ 33.944080886835, -118.151118010283

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 22.30 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

Record Number	404159	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Northeast Corner @ 33.944080886835, -118.151118010283

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 5.80 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

Record Number	404160	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner @ 33.944080886835, -118.151118010283

Top Landing

 Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 41.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number	404161	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Northwest Corner - North @ 33.944183242056, -118.151332587004

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Record Number	404237	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Northwest Corner - North @ 33.944183242056, -118.151332587004

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 12.90 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

Record Number	404238	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Northwest Corner - North @ 33.944183242056, -118.151332587004

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 13.00 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Record Number	404239	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	Naw Value	0
Assignment Designated Staff	None	New Value	0

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

Northwest Corner - North @ 33.944183242056, -118.151332587004

Bottom Landing

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.75 inches


Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$255

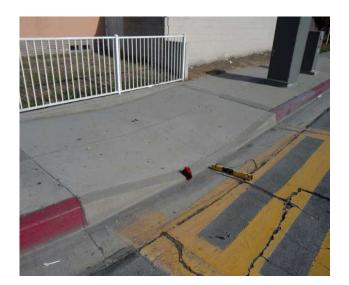

Curb Ramp , Landings And Transitions : Bottom Landing Change in

Code Reference ADA 302, 303, 406.2, 303.1

Progress

Record Number	404240	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Northwest Corner - South @ 33.944073098933, -118.151433169842

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Record Number	404241	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp

Northwest Corner - South @ 33.944073098933, -118.151433169842

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 14.00 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Record Number	404242	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Northwest Corner - South @ 33.944073098933, -118.151433169842

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 21.90 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Up to 10.00 percent Recommendation

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

Record Number	404243	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

None

Assignment New Value

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner - South @ 33.944073098933, -118.151433169842

Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Of Diagonal Curb Ramp - Clear Space

Finding

There is less than the required clear space.

On-Site Finding 41.00 inches

Recommendation

Provide sufficient clear space at the bottom of the curb ramp that does not accumulate water.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$255



Code Reference ADA 406, 406.6, 406.1, 405.10

Progress

Record Number	404244	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Northwest Corner - South @ 33.944073098933, -118.151433169842

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 10.10 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Record Number	404245	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner - South @ 33.944073098933, -118.151433169842

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.70 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Record Number	404246	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner - South @ 33.944073098933, -118.151433169842

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings

Finding

There is not enough top landing clear length.

On-Site Finding 28.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number	404247	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Southeast Corner @ 33.943952942637, -118.151205182076

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number	404256	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Curb Ramps - Exterior : Curb Ramp

Southeast Corner @ 33.943952942637, -118.151205182076

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 10.90 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number	404257	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
A -t 1 Ct	¢0.00	Combuscher	

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Southeast Corner @ 33.943952942637, -118.151205182076

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 16.90 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

Record Number	404258	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

\$0.00 **Actual Cost**

Comments No Comments

New Value **Assignment** None

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner @ 33.943952942637, -118.151205182076

Bottom Landing

Finding

There is less than the required clear space.

On-Site Finding 30.00 inches

Recommendation

Provide sufficient clear space at the bottom of the curb ramp that does not accumulate water.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$255



Curb Ramp , Landings and Transitions : Bottom Landing Of Diagonal

Curb Ramp - Clear Space

Code Reference ADA 406, 406.6, 406.1, 405.10

Progress

Record Number	404259	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner @ 33.943952942637, -118.151205182076

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 39.50 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Record Number	404260	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Southwest Corner @ 33.943948492400, -118.151527047157

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Record Number	404248	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp

Southwest Corner @ 33.943948492400, -118.151527047157

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 14.10 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number	404249	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None New Value

Southwest Corner @ 33.943948492400, -118.151527047157

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 19.10 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Record Number	404250	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner @ 33.943948492400, -118.151527047157

Bottom Landing

Finding

There is less than the required clear space.

On-Site Finding 33.00 inches

Recommendation

Provide sufficient clear space at the bottom of the curb ramp that does not accumulate water.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$255



Curb Ramp , Landings and Transitions : Bottom Landing Of Diagonal

Curb Ramp - Clear Space

Code Reference ADA 406, 406.6, 406.1, 405.10

Progress

Record Number	404251	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner @ 33.943948492400, -118.151527047157

Bottom Landing

Curb Ramp : Bottom Landing Slope

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 8.50 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Code Reference ADA 406, 406.2,CA 11B-406.5.8

Record Number	404252	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner @ 33.943948492400, -118.151527047157

Bottom Landing

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding Not Beveled

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

Costing Info (Estimated)

Patch lip at curb ramp \$255



Curb Ramp , Landings and Transitions : Bottom Landing Change in

Level - Curb Ramps

Code Reference ADA 302, 406.2

Progress

Record Number	404253	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner @ 33.943948492400, -118.151527047157

Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 4.00 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Record Number	404254	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner @ 33.943948492400, -118.151527047157

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 28.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Record Number	404255	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Walking Surface

Intersection

East Crossing @ 33.944015245923, -118.151159584522

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Progress

Record Number	404162	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Assignment None New Value 0

No Comments

Designated Staff

Comments

Intersections - Exterior : Intersections , Walking Surface

Intersection

North Crossing @ 33.944128726791, -118.151219934225

Intersections , Walking Surface : Slope

Finding

Intersection walking surface slope is not compliant.

On-Site Finding 7.20 percent

Recommendation

Repave the walking surface with recommended slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

\$1,260



Code Reference

Notes: Spalled concrete continues for 15 feet.

Progress

Record Number404163ResolutionNoneProgressNot_StartedPrioritySeven

Actual Date Projected Date

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Designated Staff

06/30/2032

Intersections - Exterior : Intersections , Walking Surface

Intersection

North Crossing @ 33.944128726791, -118.151219934225

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Notes: Spalled concrete continues for 15 feet.

Progress

Actual Cost

Resolution **Record Number** 404164 None **Progress** Not_Started **Priority** Seven **Actual Date Projected Date** 06/30/2032

Contractor

\$0.00

Comments No Comments

New Value 0 **Assignment** None

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To East Crossing @ 33.944053072895, -118.151096552610

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 159.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

 Record Number
 404201
 Resolution
 None

 Progress
 Not_Started
 Priority
 Seven

 Actual Date
 Projected Date
 06/30/20

Actual Date Projected Date 06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To East Crossing @ 33.944053072895, -118.151096552610

Intersections , Pedestrian Signal Controls : Push Button Height

Finding

Push button height is not compliant.

On-Site Finding 39.75 inches

Recommendation

Provide a compliant push button.

Recommendation 41.00 - 48.00 inches

Costing Info (Estimated)

\$900



Code Reference ADA 308, 308.3,CA MUTCD 4E.09,CA MUTCD 4E.08

Progress

Record Number	404202	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Northeast Corner To East Crossing @ 33.944053072895, -118.151096552610

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	404203	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Northeast Corner To East Crossing @ 33.944053072895, -118.151096552610

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404204	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersection

Northeast Corner To East Crossing @ 33.944053072895, -118.151096552610

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number404205ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Intersection

Northeast Corner To East Crossing @ 33.944053072895, -118.151096552610

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7,CA MUTCD 4E.08

Progress

Record Number	404206	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersection

Northeast Corner To East Crossing @ 33.944053072895, -118.151096552610

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Actual Cost

Record Number 404207 Resolution None **Progress** Not_Started **Priority** Seven **Actual Date Projected Date** 06/30/2032 Contractor

Comments No Comments

\$0.00

Assignment **New Value** 0 None

Intersection

Northeast Corner To East Crossing @ 33.944053072895, -118.151096552610

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404208	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northeast Corner To East Crossing @ 33.944053072895, -118.151096552610

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number404209ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Intersection

Northeast Corner To East Crossing @ 33.944053072895, -118.151096552610

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404210	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Northeast Corner To East Crossing @ 33.944053072895, -118.151096552610

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404211	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To North Crossing @ 33.944113150994, -118.151113986969

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 128.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number404189ResolutionNoneProgressNot_StartedPrioritySeven

Actual Date Projected Date 06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To North Crossing @ 33.944113150994, -118.151113986969

Intersections , Pedestrian Signal Controls : Push Button Height

Finding

Push button height is not compliant.

On-Site Finding 40.00 inches

Recommendation

Provide a compliant push button.

Recommendation 41.00 - 48.00 inches

Costing Info (Estimated)

\$900



Code Reference ADA 308, 308.3,CA MUTCD 4E.09,CA MUTCD 4E.08

Progress

Record Number	404190	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northeast Corner To North Crossing @ 33.944113150994, -118.151113986969

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 4.30 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number	404191	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Intersection

Northeast Corner To North Crossing @ 33.944113150994, -118.151113986969

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404192	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Northeast Corner To North Crossing @ 33.944113150994, -118.151113986969

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404193	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersection

Northeast Corner To North Crossing @ 33.944113150994, -118.151113986969

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD,CA MUTCD 4E.08

Progress

Record Number	404194	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersection

Northeast Corner To North Crossing @ 33.944113150994, -118.151113986969

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7,CA MUTCD 4E.08

Progress

Record Number	404195	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Northeast Corner To North Crossing @ 33.944113150994, -118.151113986969

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	404196	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersection

Northeast Corner To North Crossing @ 33.944113150994, -118.151113986969

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404197	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Northeast Corner To North Crossing @ 33.944113150994, -118.151113986969

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404198	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersection

Northeast Corner To North Crossing @ 33.944113150994, -118.151113986969

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404199	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersection

Northeast Corner To North Crossing @ 33.944113150994, -118.151113986969

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404200	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To North Crossing @ 33.944162103488, -118.151344656944

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 85.00 inches


Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900

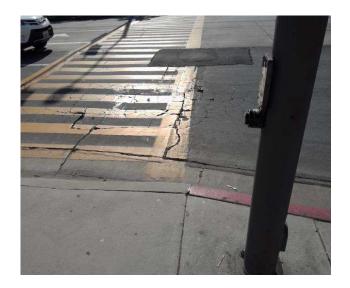

Code Reference CA MUTCD 4E.08

Progress

Record Number404224ResolutionNoneProgressNot_StartedPrioritySeven

Actual Date Projected Date 06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To North Crossing @ 33.944162103488, -118.151344656944

Intersections , Pedestrian Signal Controls : Push Button Height

Finding

Push button height is not compliant.

On-Site Finding 40.00 inches

Recommendation

Provide a compliant push button.

Recommendation 41.00 - 48.00 inches

Costing Info (Estimated)

\$900



Code Reference ADA 308, 308.3,CA MUTCD 4E.09,CA MUTCD 4E.08

Progress

Record Number	404225	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To North Crossing @ 33.944162103488, -118.151344656944

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Length

Finding

There is not enough clear ground space at the push button.

On-Site Finding 15.00 inches

Recommendation

Provide compliant clear ground space at the push button.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unassigned



Code Reference CA MUTCD 4E.08

Progress

Record Number	404226	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To North Crossing @ 33.944162103488, -118.151344656944

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 4.40 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number	404227	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersection

Northwest Corner To North Crossing @ 33.944162103488, -118.151344656944

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD,CA MUTCD 4E.08

Progress

Record Number	404228	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersection

Northwest Corner To North Crossing @ 33.944162103488, -118.151344656944

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

See Recommendation Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404229	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersection

Northwest Corner To North Crossing @ 33.944162103488, -118.151344656944

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404230	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersection

Northwest Corner To North Crossing @ 33.944162103488, -118.151344656944

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7,CA MUTCD 4E.08

Progress

Record Number	404231	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersection

Northwest Corner To North Crossing @ 33.944162103488, -118.151344656944

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number404232ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Intersection

Northwest Corner To North Crossing @ 33.944162103488, -118.151344656944

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found


Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900

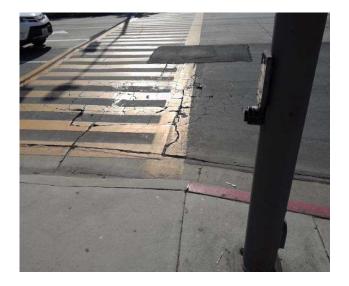

Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404233	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersection

Northwest Corner To North Crossing @ 33.944162103488, -118.151344656944

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404234	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersection

Northwest Corner To North Crossing @ 33.944162103488, -118.151344656944

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404235	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersection

Northwest Corner To North Crossing @ 33.944162103488, -118.151344656944

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404236	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To West Crossing @ 33.944085337065, -118.151413053274

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 108.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number404177ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To West Crossing @ 33.944085337065, -118.151413053274

Intersections , Pedestrian Signal Controls : Push Button Height

Finding

Push button height is not compliant.

On-Site Finding 40.00 inches

Recommendation

Provide a compliant push button.

Recommendation 41.00 - 48.00 inches

Costing Info (Estimated)

\$900



Code Reference ADA 308, 308.3,CA MUTCD 4E.09,CA MUTCD 4E.08

Progress

Record Number	404178	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Northwest Corner To West Crossing @ 33.944085337065, -118.151413053274

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 6.40 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number	404179	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersection

Northwest Corner To West Crossing @ 33.944085337065, -118.151413053274

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD,CA MUTCD 4E.08

Record Number	404180	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Northwest Corner To West Crossing @ 33.944085337065, -118.151413053274

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number 404181 Resolution None **Progress** Not Started **Priority** Seven **Actual Date Projected Date** 06/30/2032 Contractor **Actual Cost** \$0.00 Comments No Comments **Assignment New Value** 0 None

Intersection

Northwest Corner To West Crossing @ 33.944085337065, -118.151413053274

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404182	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersection

Northwest Corner To West Crossing @ 33.944085337065, -118.151413053274

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7,CA MUTCD 4E.08

Progress

Record Number	404183	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersection

Northwest Corner To West Crossing @ 33.944085337065, -118.151413053274

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number	404184	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersection

Northwest Corner To West Crossing @ 33.944085337065, -118.151413053274

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404185	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Northwest Corner To West Crossing @ 33.944085337065, -118.151413053274

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404186	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersection

Northwest Corner To West Crossing @ 33.944085337065, -118.151413053274

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404187	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersection

Northwest Corner To West Crossing @ 33.944085337065, -118.151413053274

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	404188	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To East Crossing @ 33.943939591927, -118.151242733002

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 126.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

Record Number404166ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southeast Corner To East Crossing @ 33.943939591927, -118.151242733002

Intersections , Pedestrian Signal Controls : Push Button Height

Finding

Push button height is not compliant.

On-Site Finding 36.00 inches

Recommendation

Provide a compliant push button.

Recommendation 41.00 - 48.00 inches

Costing Info (Estimated)

\$900



Code Reference ADA 308, 308.3,CA MUTCD 4E.09,CA MUTCD 4E.08

Progress

Record Number	404167	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

Assignment None **New Value** 0

Intersection

Southeast Corner To East Crossing @ 33.943939591927, -118.151242733002

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD,CA MUTCD 4E.08

Record Number	404168	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Signage

Intersection

Southeast Corner To East Crossing @ 33.943939591927, -118.151242733002

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	404169	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Southeast Corner To East Crossing @ 33.943939591927, -118.151242733002

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	404170	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Southeast Corner To East Crossing @ 33.943939591927, -118.151242733002

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7,CA MUTCD 4E.08

Record Number	404171	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Southeast Corner To East Crossing @ 33.943939591927, -118.151242733002

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

404172 Resolution **Record Number** None **Progress** Not_Started **Priority** Seven **Actual Date Projected Date** 06/30/2032 Contractor **Actual Cost** \$0.00 Comments No Comments Assignment **New Value** 0 None **Designated Staff**

Intersection

Southeast Corner To East Crossing @ 33.943939591927, -118.151242733002

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	404173	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Indicator

Intersection

Southeast Corner To East Crossing @ 33.943939591927, -118.151242733002

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	404174	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Southeast Corner To East Crossing @ 33.943939591927, -118.151242733002

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	404175	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Southeast Corner To East Crossing @ 33.943939591927, -118.151242733002

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	404176	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.943964068227, -118.151537775993

Intersections , Pedestrian Signal Controls $\,:\,$ Push Button - Distance from Crosswalk

Finding

Push button distance from crosswalk is not compliant.

On-Site Finding 164.00 inches

Recommendation

Provide a compliant push button.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$900



Code Reference CA MUTCD 4E.08

Progress

 Record Number
 404212
 Resolution
 None

 Progress
 Not_Started
 Priority
 Seven

Actual Date Projected Date 06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.943964068227, -118.151537775993

Intersections , Pedestrian Signal Controls : Push Button Height

Finding

Push button height is not compliant.

On-Site Finding 40.00 inches

Recommendation

Provide a compliant push button.

Recommendation 41.00 - 48.00 inches

Costing Info (Estimated)

\$900



Code Reference ADA 308, 308.3,CA MUTCD 4E.09,CA MUTCD 4E.08

Progress

Record Number	404213	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersections - Exterior : Intersections , Pedestrian Signal Controls

Intersection

Southwest Corner To West Crossing @ 33.943964068227, -118.151537775993

Intersections , Pedestrian Signal Controls : Push Button - Clear Ground Space Slope

Finding

The clear ground space is not level.

On-Site Finding 7.70 percent

Recommendation

Provide compliant level clear ground space at the control.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

\$1,260



Code Reference CA 11B-305.2,CA MUTCD 4E.08

Progress

Record Number	404214	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Intersection

Southwest Corner To West Crossing @ 33.943964068227, -118.151537775993

Intersections , Pedestrian Signal Signage : Tactile Arrow

Finding

Tactile arrow is either not raised enough or does not contrast with background.

On-Site Finding Not Compliant

Recommendation

Make sure that the tactile arrow is raised at least 1/32 inch and contrasts with background.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	404215	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Southwest Corner To West Crossing @ 33.943964068227, -118.151537775993

Intersections , Pedestrian Signal Signage : Universal Tactile

Finding

Either universal tactile or universal symbol is not provided at the signal.

On-Site Finding Not Found

Recommendation

Universal tactile and universal symbol must be provided at the signal (3 braille dots forming an equilateral triangle).

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number	404216	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Intersection

Southwest Corner To West Crossing @ 33.943964068227, -118.151537775993

Intersections , Pedestrian Signal Signage : Street Name Information

Finding

There is no street name information related signage at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant signage that includes street name.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	404217	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Southwest Corner To West Crossing @ 33.943964068227, -118.151537775993

Intersections , Pedestrian Signal Signage : No Color Coded Bands

Finding

There are no color coded bands provided at the signal.

On-Site Finding Not Found

Recommendation

Provide 2" wide yellow band and 1" wide dark border bands above and below the yellow band.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA 11B-703.7.2.7,CA MUTCD 4E.08

Record Number	404218	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Southwest Corner To West Crossing @ 33.943964068227, -118.151537775993

Intersections , Pedestrian Signal Signage : Crosswalk Map

Finding

There is no crosswalk map provided at the signal.

On-Site Finding Not Found

Recommendation

Provide a crosswalk map.

Recommendation See Recommendation

Costing Info (Estimated)

\$158



Code Reference CA MUTCD 4E.08

Progress

Record Number404219ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Assignment None **New Value** 0

No Comments

Designated Staff

Comments

Intersection

Southwest Corner To West Crossing @ 33.943964068227, -118.151537775993

Intersections , Pedestrian Signal Indicator : Locator Tone

Finding

No locator tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide locator tone for the indicator.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	404220	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Southwest Corner To West Crossing @ 33.943964068227, -118.151537775993

Intersections , Pedestrian Signal Indicator : Walk Interval Tone

Finding

No walk interval tone provided for the pedestrian signal indicator.

On-Site Finding Not Found

Recommendation

Provide compliant walk interval tone.

Recommendation See Recommendation

Costing Info (Estimated)

\$150



Code Reference CA MUTCD, CA MUTCD 4E.08

Record Number	404221	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Intersection

Southwest Corner To West Crossing @ 33.943964068227, -118.151537775993

Intersections , Pedestrian Signal Indicator : Vibro-tactile Indicator

Finding

There is no vibro-tactile indication at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant vibro-tactile indicator at the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD,CA MUTCD 4E.08

Progress

Record Number	404222	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Intersection

Southwest Corner To West Crossing @ 33.943964068227, -118.151537775993

Intersections , Pedestrian Signal Indicator : Speech Walk Message

Finding

Speech walk message is not provided at the signal.

On-Site Finding Not Found

Recommendation

Provide compliant speech walk message for the signal.

Recommendation See Recommendation

Costing Info (Estimated)

\$900



Code Reference CA MUTCD, CA MUTCD 4E.08

Progress

Record Number404223ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Intersections - Exterior : Intersections , Walking Surface

Intersection

West Crossing @ 33.944010795689, -118.151476085186

Intersections , Walking Surface : Crosswalk - Detectable Warnings

Finding

There are no detectable warnings provided for the crosswalk.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings for the crosswalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$240



Code Reference

Progress

Record Number	404165	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0



Adwen Street & Old River School Road

Adwen Street & Old River School Road Downey, CA 90242

Date of Inspection 4/11/2017

*Estimated Facility Total: \$71,299

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



Adwen Street - Old River School Road To Mitla Avenue

Old River School Road To Mitla Avenue Downey, CA 90242

Date of Inspection 4/24/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Adwen Street - Old River School Road To Mitla Avenue

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Old River School Road @ 33.945365880948, - 118.153942376375

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	410768	Resolution	None
Progress	Not_Started	Priority	One
Actual Date		Projected Date	06/30/2018
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Ryerson Avenue @ 33.946112392429, -118.155335783958

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	410776	Resolution	None
Progress	Not_Started	Priority	One
Actual Date		Projected Date	06/30/2018

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Ryerson Avenue @ 33.946886710386, -118.157010823488

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 2.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number410771ResolutionNoneProgressNot_StartedPriorityOne

Actual Date Projected Date 06/30/2018

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Mitla Avenue @ 33.944322311452, -118.151902556419

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

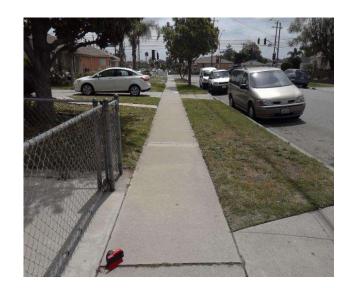

Code Reference ADA 206, 302

Progress

Record Number	410791	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Mitla Avenue @ 33.944602674663, -118.152414858341

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	410794	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Mitla Avenue @ 33.944792920602, -118.152775615454

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

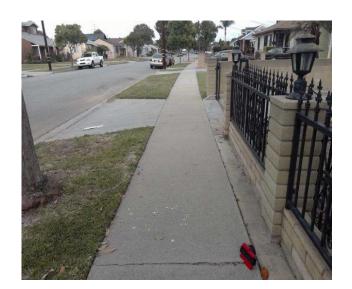

Code Reference ADA 206, 302

Progress

Record Number	410795	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Assignment None **New Value** 0

No Comments

Designated Staff

Comments

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Mitla Avenue @ 33.945232375969, -118.153438121080

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	410792	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Mitla Avenue @ 33.945263527150, -118.153474330902

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	410788	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Mitla Avenue @ 33.945656253554, -118.154154270887

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.25 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number410787ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2020

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Mitla Avenue @ 33.945788645333, -118.154399693012

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

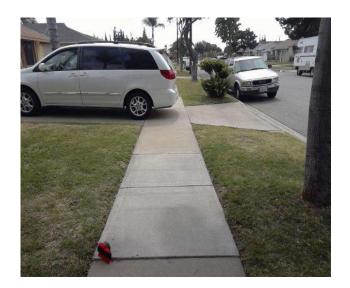

Code Reference ADA 206, 302

Progress

Record Number410793ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Mitla Avenue @ 33.945808670962, -118.154435902834

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

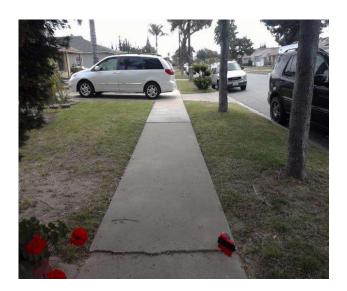

0

Code Reference ADA 206, 302

None

Progress

Record Number	410785	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Mitla Avenue @ 33.946011152061, -118.154804706573

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	410796	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Mitla Avenue @ 33.946396087326, -118.155519515276

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	410797	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Mitla Avenue @ 33.946413887758, -118.155557066202

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	410789	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Mitla Avenue @ 33.946647518091, -118.156145811081

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	410790	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Mitla Avenue @ 33.947075838702, -118.157036304474

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	410786	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Old River School Road @ 33.944036384527, - 118.151712119579

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

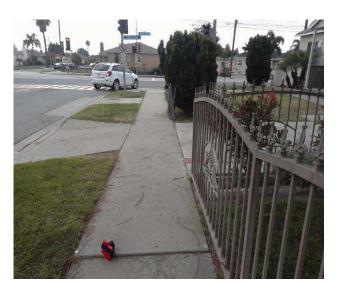

Code Reference ADA 206, 302

Record Number	410781	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Old River School Road @ 33.944600449562, - 118.152744770050

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	410764	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Old River School Road @ 33.944657189624, - 118.152854740620

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	410767	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Old River School Road @ 33.944670540222, - 118.152881562710

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

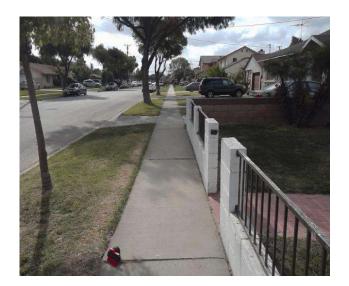

Code Reference ADA 206, 302

Record Number	410765	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Old River School Road @ 33.945309141358, - 118.153848499060

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	410763	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Old River School Road @ 33.945809783497, - 118.154769837856

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

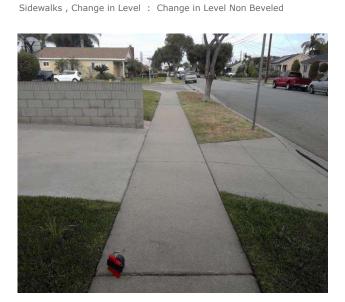

Code Reference ADA 206, 302

Record Number	410770	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Ryerson Avenue @ 33.946342686006, -118.155777007341

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

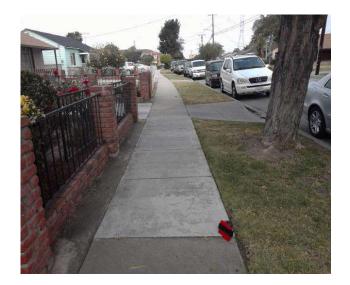

Code Reference ADA 206, 302

Progress

Record Number	410774	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Ryerson Avenue @ 33.946353811284, -118.155810534954

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	410769	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Ryerson Avenue @ 33.946758770405, -118.156741261482

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number410779ResolutionNoneProgressNot_StartedPriorityTwoActual DateProjected Date06/30/2021Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Ryerson Avenue @ 33.946921198522, -118.157067149878

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	410773	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Ryerson Avenue @ 33.946928986164, -118.157075196505

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	410778	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Ryerson Avenue @ 33.947142589772, -118.157469481230

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	410777	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Old River School Road @ 33.944591549156, - 118.152721971273

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	410775	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Old River School Road @ 33.945763057022, - 118.154675960541

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

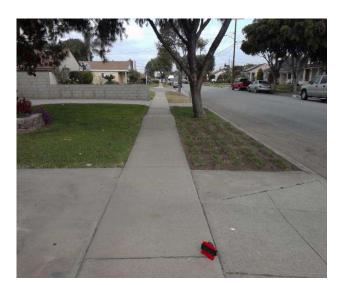

Code Reference ADA 206, 302

Record Number	410780	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Ryerson Avenue @ 33.946122405206, -118.155354559422

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	410766	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Ryerson Avenue @ 33.946697581650, -118.156642019749

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number410762ResolutionNoneProgressNot_StartedPriorityThreeActual DateProjected Date12/31/2022Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East Of Mitla Avenue @ 33.946556291085, -118.155905753374

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.90 percent for 76.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	410783	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East Of Mitla Avenue @ 33.946667543518, -118.156204819679

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.20 percent for 100.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number410784ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks

North Side @ 33.947486356952, -118.157777935266

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Record Number	410782	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Old River School Road @ 33.944036384527, -118.151712119579

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.90 percent for 65.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	410759	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Old River School Road @ 33.944709479453, -118.152956664562

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.80 percent for 80.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	410760	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Old River School Road @ 33.944970928112, -118.153371065855

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.60 percent for 50.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	410755	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Old River School Road @ 33.945156723055, -118.153619170189

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.60 percent for 134.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	410757	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Old River School Road @ 33.945365880948, -118.153942376375

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.40 percent for 100.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	410747	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Old River School Road @ 33.945521636492, -118.154230713844

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.40 percent for 98.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



0

Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	410746	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

New Value

Actual Cost \$0.00 Contractor

None

Comments No Comments

Designated Staff

Assignment

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Old River School Road @ 33.945667378922, -118.154513686895

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.70 percent for 56.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	410756	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/20

Actual Date Projected Date 06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Old River School Road @ 33.945791982938, -118.154737651348

Sidewalks , Surface : Running Slope

Finding

Sidewalk running slope is not compliant.

On-Site Finding 8.20 percent for 13.00 feet

Recommendation

Repave the sidewalk surface with the recommended running slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,184



Code Reference ADA 206, 302

Progress

Record Number410761ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Old River School Road @ 33.945809783497, -118.154769837856

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.70 percent for 67.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number410758ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Ryerson Avenue @ 33.946067891183, -118.155252635479

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.60 percent for 100.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	410751	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Ryerson Avenue @ 33.946229208089, -118.155546337366

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.60 percent for 78.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	410754	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Ryerson Avenue @ 33.946369386670, -118.155849426985

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.80 percent for 100.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	410750	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Ryerson Avenue @ 33.946478414295, -118.156145811081

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.30 percent for 100.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	410752	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Ryerson Avenue @ 33.946598567027, -118.156451582909

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.50 percent for 100.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	410748	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Assignment None **New Value** 0

No Comments

Designated Staff

Comments

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Ryerson Avenue @ 33.946758770405, -118.156741261482

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.10 percent for 100.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	410749	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Ryerson Avenue @ 33.947073613665, -118.157351464033

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.80 percent for 181.00 feet


Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

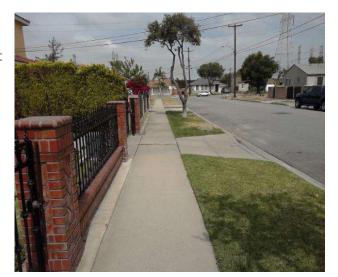

Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	410753	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Tree West Of Ryerson Avenue @ 33.946637505376, -118.156513273716

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 63.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



0

Code Reference ADA 206, 307.4,CA 11B-307.4

None

Progress

Record Number	410772	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

Sidewalks - Exterior : Sidewalks

South Side @ 33.943952942637, -118.151557892561

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found

Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400



Code Reference ADA 206, 302

Record Number	410745	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			



Adwen Street - Old River School Road To Mitla Avenue

Old River School Road To Mitla Avenue Downey, CA 90242

Date of Inspection 4/24/2017

*Estimated Facility Total: \$30,884

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



Adwen Street - Rives Avenue To Old River School Road

Rives Avenue To Old River School Road Downey, CA 90242

Date of Inspection 4/10/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Old River School Road @ 33.942735794296, - 118.148620873690

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	403464	Resolution	None
Progress	Not_Started	Priority	One
Actual Date		Projected Date	06/30/2018
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Old River School Road @ 33.942749145195, - 118.148657083511

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.50 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

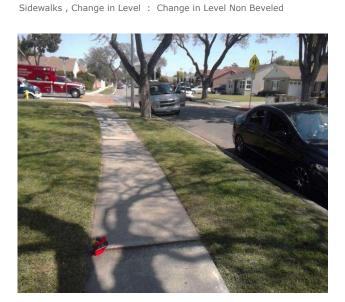

Code Reference ADA 206, 302

Progress

Record Number	403459	Resolution	None
Progress	Not_Started	Priority	One
Actual Date		Projected Date	06/30/2018
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Old River School Road @ 33.942764721241, - 118.148686587811

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.50 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

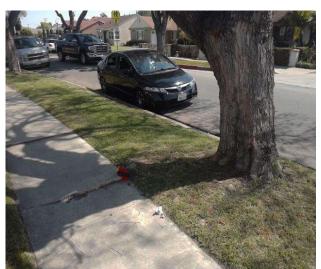

Code Reference ADA 206, 302

Record Number	403454	Resolution	None
Progress	Not_Started	Priority	One
Actual Date		Projected Date	06/30/2018
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Horley Avenue @ 33.941014623383, -118.145407587290

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.25 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	403462	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2020
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Horley Avenue @ 33.941109194117, -118.145579248667

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	403461	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Horley Avenue @ 33.941121432674, -118.145602047443

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	403458	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Horley Avenue @ 33.941130333443, -118.145623505116

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.12 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	403455	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Julius Avenue @ 33.942008167141, -118.147226125002

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	403466	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Julius Avenue @ 33.942370868916, -118.147893995047

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.72 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	403463	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Old River School Road @ 33.942709092492, - 118.148583322763

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.12 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

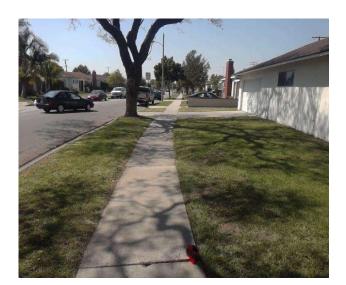

Code Reference ADA 206, 302

Record Number	403456	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Old River School Road @ 33.942817012232, - 118.148807287216

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

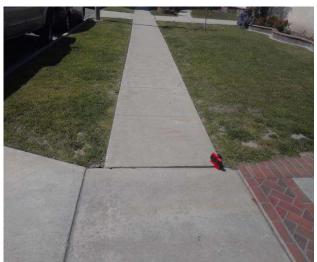

Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Record Number	403460	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Old River School Road @ 33.943047314724, - 118.149208277464

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

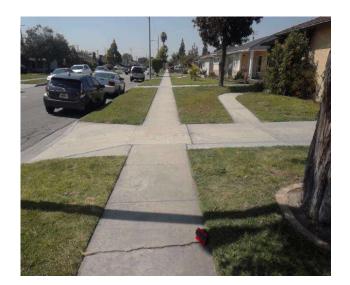

Code Reference ADA 206, 302

Record Number	403457	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Old River School Road @ 33.943417835, -118.149900287390

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	403453	Resolution	None
Progress	Not_Started	Priority	Two
			0.0100

Actual Date Projected Date 06/30/2021

Actual Cost \$0.00 **Contractor**

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Julius Avenue @ 33.942961646720, -118.149354457855

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	403433	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Julius Avenue @ 33.943068453569, -118.149559646845

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

	402424	B 1.11	B.I.
Record Number	403434	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Rives Avenue @ 33.941230467022, -118.146102279425

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

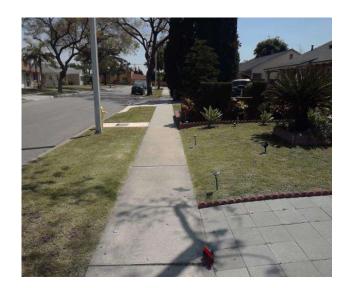

Code Reference ADA 206, 302

Progress

403442	Resolution	None
Not_Started	Priority	Two
	Projected Date	06/30/2021
\$0.00	Contractor	
	Not_Started	Not_Started

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Rives Avenue @ 33.941264957449, -118.146135807037

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.62 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	403441	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Rives Avenue @ 33.941634337927, -118.146825134754

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	403439	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Rives Avenue @ 33.941643238642, -118.146854639053

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	403437	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Rives Avenue @ 33.941643238642, -118.146854639053

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

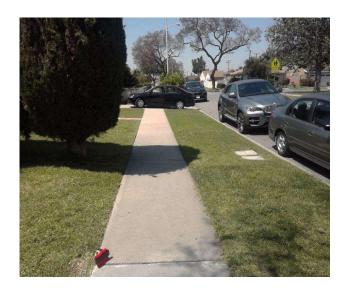

Code Reference ADA 206, 302

Record Number	403440	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Rives Avenue @ 33.942478789085, -118.148403614759

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.75 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	403435	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Julius Avenue @ 33.942328590875, -118.147820234299

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	403465	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Old River School Road @ 33.942972772440, - 118.149075508118

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches


Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198

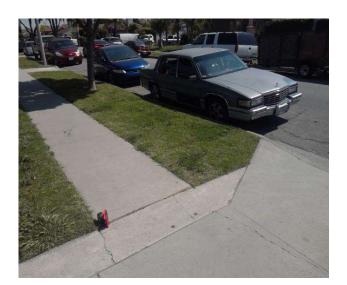

Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Record Number	403451	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Old River School Road @ 33.943055102720, - 118.149235099554

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Sidewalks , Change in Level : Change in Level Non Beveled

Code Reference ADA 206, 302

Record Number	403452	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Rives Avenue @ 33.941615423906, -118.146799653769

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	403436	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Rives Avenue @ 33.941941412045, -118.147409856319

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	403443	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Rives Avenue @ 33.942496590336, -118.148439824581

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.37 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Record Number	403438	Resolution	None
Progress	Not_Started	Priority	Three
Actual Date		Projected Date	12/31/2022
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Northeast Corner Of Julius Avenue @ 33.942574470769, - 118.148288279772

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Record Number	403410	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of Julius Avenue @ 33.942574470769, - 118.148288279772

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 12.00 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Record Number	403411	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp

Northeast Corner Of Julius Avenue @ 33.942574470769, - 118.148288279772

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 3.10 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3,CA 11B-406.5.7

Progress

Record Number	403412	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Northeast Corner Of Julius Avenue @ 33.942574470769, - 118.148288279772

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 15.00 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Record Number	403413	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northeast Corner Of Julius Avenue @ 33.942574470769, - 118.148288279772

Bottom Landing

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding Not Beveled

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

Costing Info (Estimated)

Patch lip at curb ramp \$255



Curb Ramp , Landings and Transitions : Bottom Landing Change in

Code Reference ADA 302, 406.2

Progress

Record Number403414ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Northwest Corner Of Julius Avenue @ 33.942650125978, - 118.148453235626

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number	403479	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Julius Avenue @ 33.942650125978, - 118.148453235626

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 9.00 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number403480ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Northwest Corner Of Julius Avenue @ 33.942650125978, - 118.148453235626

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 16.00 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

Record Number	403481	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp, Landings and Transitions

Northwest Corner Of Julius Avenue @ 33.942650125978, - 118.148453235626

Bottom Landing

Finding

There is less than the required clear space.

On-Site Finding 26.00 inches

Recommendation

Provide sufficient clear space at the bottom of the curb ramp that does not accumulate water.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$255



Curb Ramp , Landings and Transitions : Bottom Landing Of Diagonal

Code Reference ADA 406, 406.6, 406.1, 405.10

Progress

Record Number	403482	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner Of Julius Avenue @ 33.942650125978, - 118.148453235626

Bottom Landing

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding Not Beveled

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

Costing Info (Estimated)

Patch lip at curb ramp \$255



Curb Ramp , Landings and Transitions : Bottom Landing Change in

Code Reference ADA 302, 406.2

Progress

Record Number403483ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner Of Julius Avenue @ 33.942650125978, - 118.148453235626

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 4.00 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions : Top Landing Slope

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	403484	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp, Landings and Transitions

Northwest Corner Of Julius Avenue @ 33.942650125978, - 118.148453235626

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 40.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number	403485	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None **New Value** 0

Northwest Corner Of Rives Avenue @ 33.940933403727, - 118.145250678062

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number403473ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Curb Ramps - Exterior : Curb Ramp

Northwest Corner Of Rives Avenue @ 33.940933403727, - 118.145250678062

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 11.30 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number403474ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Northwest Corner Of Rives Avenue @ 33.940933403727, - 118.145250678062

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 24.20 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

Record Number	403475	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings And Transitions

Northwest Corner Of Rives Avenue @ 33.940933403727, - 118.145250678062

Bottom Landing

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding 0.62 inches

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch lip at curb ramp \$255



Curb Ramp , Landings And Transitions : Bottom Landing Change in

Code Reference ADA 302, 303, 406.2, 303.1

Progress

Record Number	403476	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner Of Rives Avenue @ 33.940933403727, - 118.145250678062

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.50 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions : Top Landing Slope

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	403477	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		

New Value

Designated Staff

Assignment

None

0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner Of Rives Avenue @ 33.940933403727, - 118.145250678062

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 32.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number403478ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Southeast Corner Of Julius Avenue @ 33.942601172615, - 118.148710727692

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number	403467	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Southeast Corner Of Julius Avenue @ 33.942601172615, - 118.148710727692

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 8.90 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number403468ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Southeast Corner Of Julius Avenue @ 33.942601172615, - 118.148710727692

Curb Ramp : Curb Ramp - Cross Slope

Finding

The cross slope is greater than allowed.

On-Site Finding 6.20 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 402, 406.1, 405.3,CA 11B-406.5.7

Progress

 Record Number
 403469
 Resolution
 None

 Progress
 Not_Started
 Priority
 Seven

Actual Date Projected Date 06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Southeast Corner Of Julius Avenue @ 33.942601172615, - 118.148710727692

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 20.90 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

Record Number	403470	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of Julius Avenue @ 33.942601172615, - 118.148710727692

Bottom Landing

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding Not Beveled

Recommendation

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

Costing Info (Estimated)

Patch lip at curb ramp \$255

Curb Ramp , Landings and Transitions : Bottom Landing Change in Level - Curb Ramps



Code Reference ADA 302, 406.2

Progress

Record Number403471ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southeast Corner Of Julius Avenue @ 33.942601172615, - 118.148710727692

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.00 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions : Top Landing Slope

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Record Number	403472	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Southwest Corner Of Julius Avenue @ 33.942676827801, - 118.148851543665

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Record Number	403421	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Southwest Corner Of Julius Avenue @ 33.942676827801, - 118.148851543665

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 14.60 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



0

Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number403422ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

New Value

None

Comments No Comments

Designated Staff

Assignment

Southwest Corner Of Julius Avenue @ 33.942676827801, - 118.148851543665

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 21.30 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

Resolution 403423 **Record Number** None **Progress** Not_Started **Priority** Seven **Actual Date Projected Date** 06/30/2032 Contractor **Actual Cost** \$0.00 Comments No Comments **New Value** 0 **Assignment** None

Curb Ramps - Exterior : Curb Ramp, Landings and Transitions

Southwest Corner Of Julius Avenue @ 33.942676827801, - 118.148851543665

Bottom Landing

Finding

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding Not Beveled

Recommendation


Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

Costing Info (Estimated)

Patch lip at curb ramp \$255

Curb Ramp , Landings and Transitions $\,:\,$ Bottom Landing Change in Level - Curb Ramps

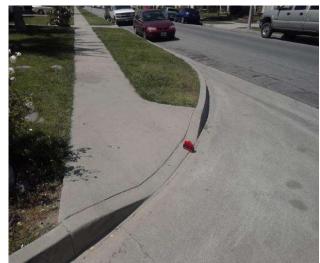

Code Reference ADA 302, 406.2

Progress

Record Number	403424	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
comments	140 Comments		
Assignment	None	New Value	0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner Of Julius Avenue @ 33.942676827801, - 118.148851543665

Top Landing

Finding

The transition from the top of the curb ramp to the walk, gutter, or street is abrupt.

On-Site Finding Not Beveled

Recommendation

Patch the transition area at the top of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation See Recommendation

Costing Info (Estimated)

Patch lip at curb ramp \$155



Curb Ramp , Landings and Transitions : Top Landing Change in Level

Code Reference ADA 302, 406.2

Progress

Record Number403425ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Rives Avenue @ 33.940814355600, - 118.145328462124

Curb Ramp : No Detectable Warnings

Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

On-Site Finding Not Found

Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

Costing Info (Estimated)

Provide detectable warning to \$248 surface



Code Reference CA 11B-406.5.12

Progress

Record Number	403415	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Rives Avenue @ 33.940814355600, - 118.145328462124

Curb Ramp : Not Wholly Contained Within The Marked Crossing

Finding

The curb ramp is not wholly contained within the marked crossing.

On-Site Finding Not Found

Recommendation

Provide a marked crossing on the path of travel; make certain the curb ramp is wholly contained within the marked crossing.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$800



Code Reference ADA 406, 406.5

Progress

Record Number403416ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Rives Avenue @ 33.940814355600, - 118.145328462124

Curb Ramp : Curb Ramp Slope

Finding

The running slope is greater than allowed.

On-Site Finding 10.50 percent

Recommendation

Provide a compliant curb ramp.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Install curb ramp \$1,300



Code Reference ADA 406, 406.1, 405.2,CA 11B-406

Progress

Record Number	403417	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp

Southwest Corner Of Rives Avenue @ 33.940814355600, - 118.145328462124

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 19.60 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

Record Number403418ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner Of Rives Avenue @ 33.940814355600, - 118.145328462124

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 2.80 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions : Top Landing Slope

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

Record Number	403419	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments Assignment	No Comments None	New Value	0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Southwest Corner Of Rives Avenue @ 33.940814355600, - 118.145328462124

Top Landing

Finding

There is not enough top landing clear length.

On-Site Finding 32.00 inches

Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Provide compliant landing \$240



Curb Ramp , Landings and Transitions : Top Landing Clear Length -

Code Reference ADA 406, 406.4,CA 11B-406.5.3

Progress

Record Number403420ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East Of Horley Avenue @ 33.941014623383, -118.145407587290

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.00 percent for 45.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

 Record Number
 403450
 Resolution
 None

 Progress
 Not_Started
 Priority
 Seven

Actual Date Projected Date 06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East Of Julius Avenue @ 33.942563344997, -118.148245364428

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.10 percent for 185.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	403448	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East Of Julius Avenue @ 33.942563344997, -118.148245364428

Sidewalks , Surface : Running Slope

Finding

Sidewalk running slope is not compliant.

On-Site Finding 10.90 percent for 6.00 feet

Recommendation

Repave the sidewalk surface with the recommended running slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,184



Code Reference ADA 206, 302

Progress

Record Number	403449	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

No Comments

Assignment None New Value 0

Designated Staff

Comments

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East Of Old River School Road @ 33.943417835, -118.149900287390

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.00 percent for 507.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	403447	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East Of Old River School Road @ 33.943906215142, -118.150806874037

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.40 percent for 137.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	403446	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

North Side @ 33.944063085915, -118.151087164879

Sidewalks : Turn Area

Finding

Turn area is not level.

On-Site Finding Not Level


Recommendation

Make sure that the turn area is level.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260

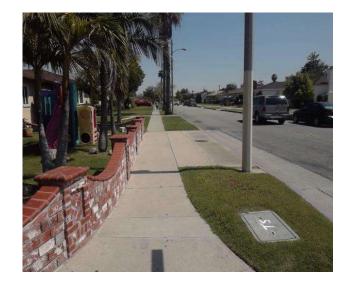

Code Reference ADA 206, 302

Progress

Record Number	403445	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Rives Avenue South Crossing @ 33.940774301986, -118.145254701376

Sidewalks : Vehicular Traffic Slope

Finding

Slope at vehicular traffic is not compliant.

On-Site Finding 7.20 percent

Recommendation

Repave the surface to provide a compliant slope.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference

Progress

Record Number	403444	Resolution	None
Progress	Not_Started	Priority	Seven

Actual Date Projected Date 06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Julius Avenue @ 33.943068453569, -118.149559646845

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.10 percent for 180.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	403428	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Rives Avenue @ 33.940923390340, -118.145536333323

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.00 percent for 78.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Notes: Surface is rough and uneven for 6 feet.

Progress

Record Number	403429	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Rives Avenue @ 33.941141459402, -118.145933300257

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.70 percent for 50.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	403430	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Rives Avenue @ 33.941280533767, -118.146192133427

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.00 percent for 269.00 feet


Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

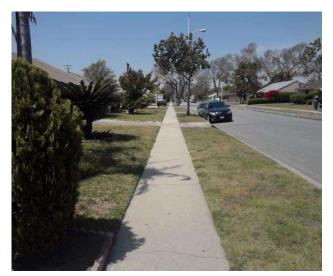

Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	403432	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Rives Avenue @ 33.942221783098, -118.147903382778

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.10 percent for 215.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	403427	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032

Actual Cost \$0.00 Contractor

Comments No Comments

Assignment None New Value 0

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West Of Rives Avenue @ 33.942583371386, -118.148667812347

Sidewalks : Opening

Finding

Ground surface has an opening that is not compliant.

On-Site Finding Not Compliant


Recommendation

Make sure that the surface opening does not allow passage of a sphere more than ½ inch in diameter.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned

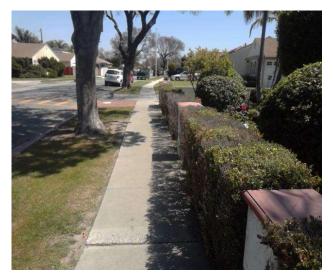

Code Reference ADA 302

Progress

Record Number403431ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Sidewalks - Exterior : Sidewalks

South Side @ 33.940835494999, -118.145360648632

Sidewalks : 60X60 Turn Area

Finding

There is no 60X60 turn area at every 200 feet.

On-Site Finding Not Found


Recommendation

Provide a 60X60 turn every 200 feet on the sidewalk.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400

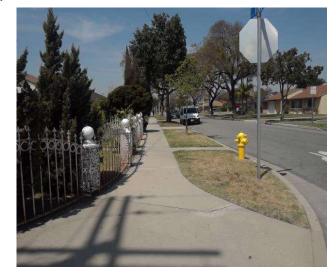

Code Reference ADA 206, 302

Progress

Record Number	403426	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			



Adwen Street - Rives Avenue To Old River School Road

Rives Avenue To Old River School Road Downey, CA 90242

Date of Inspection 4/10/2017

*Estimated Facility Total: \$49,043

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using

