
Accessibility Survey

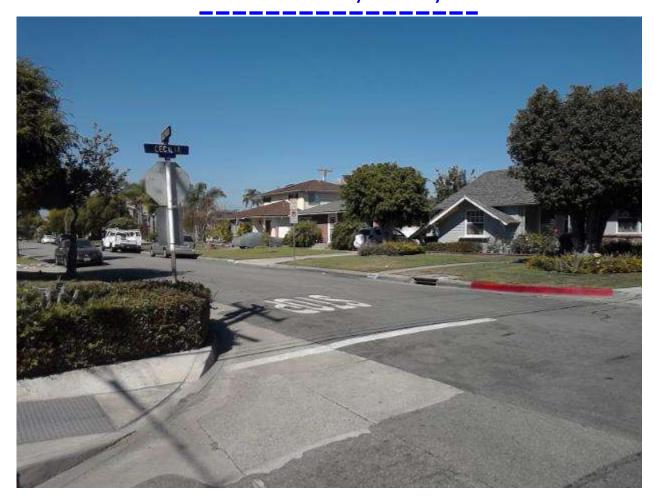

City of Downey Shellyfield Road - Cecilia Street to Gotham Street

Cecilia Street to Gotham Street Downey, CA 90242

Date of Inspection 6/9/2017

Prepared By

Disability Access Consultants

(800) 743-7067

Curb Ramps - Exterior : Curb Ramp

Northeast Corner of Cecilia Street @ 33.938481201211, - 118.120573014021

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 18.90 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

Record Number444767ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Curb Ramps - Exterior : Curb Ramp

Northwest Corner of Cecilia Street @ 33.938545733761, - 118.120709806681

Curb Ramp : Side Flare Slope

Finding

The slope of the curb ramp side flare is greater than allowed.

On-Site Finding 17.60 percent

Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

Costing Info (Estimated)

Install flared sides \$1,300



Code Reference ADA 406, 406.3,CA 11B-406.2.2

Progress

Record Number444768ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None **New Value** 0

Curb Ramps - Exterior : Curb Ramp

Northwest Corner of Cecilia Street @ 33.938545733761, - 118.120709806681

Bottom Landing

Finding

The bottom landing of the curb ramp is on the street, and the slope of the bottom landing is not compliant.

On-Site Finding 5.80 percent

Recommendation

Ensure the bottom landing slope is compliant and provides a smooth transition.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Repave landing \$1,260



Curb Ramp : Bottom Landing Slope

Code Reference ADA 406, 406.2,CA 11B-406.5.8

Progress

Record Number444769ResolutionNoneProgressNot_StartedPrioritySevenActual DateProjected Date06/30/2032Actual Cost\$0.00Contractor

Comments No Comments

Assignment None New Value 0

Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

Northwest Corner of Cecilia Street @ 33.938545733761, - 118.120709806681

Top Landing

Finding

The slope at the top landing is greater than allowed.

On-Site Finding 3.00 percent

Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Provide compliant landing \$1,260



Curb Ramp , Landings and Transitions : Top Landing Slope

Code Reference ADA 402, 406.4, 403.3, 406.1,CA 11B-406.5.3

Progress

| Record Number | 444770 | Resolution | None |
|-------------------------|-------------|-----------------------|------------|
| Progress | Not_Started | Priority | Seven |
| Actual Date | | Projected Date | 06/30/2032 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Shellyfield Road - Cecilia Street to Gotham Street

Sidewalks - Exterior : Sidewalks

East Side @ 33.938481201211, -118.120573014021

Sidewalks : No Sidewalk

Finding

No sidewalk exists at the location.

On-Site Finding Not Found

Recommendation

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 206

Progress

| Record Number | 444771 | Resolution | None |
|----------------------|-------------|-----------------------|------------|
| Progress | Not_Started | Priority | Seven |
| Actual Date | | Projected Date | 06/30/2037 |
| Actual Cost | \$0.00 | Contractor | |
| Comments | No Comments | | |
| Assignment | None | New Value | 0 |
| Designated Staff | | | |

Shellyfield Road - Cecilia Street to Gotham Street

Sidewalks - Exterior : Sidewalks

West Side @ 33.938515692753, -118.120636045933

Sidewalks : No Sidewalk

Finding

No sidewalk exists at the location.

On-Site Finding Not Found

Recommendation

No action necessary until a sidewalk is provided.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned



Code Reference ADA 206

Progress

| Record Number | 444766 | Resolution | None |
|---------------|-------------|-----------------------|------------|
| Progress | Not_Started | Priority | Seven |
| Actual Date | | Projected Date | 06/30/2037 |
| Actual Cost | \$0.00 | Contractor | |
| | | | |

Comments No Comments

Assignment None **New Value** 0



Shellyfield Road - Cecilia Street to Gotham Street

Cecilia Street to Gotham Street Downey, CA 90242

Date of Inspection 6/9/2017

*Estimated Facility Total: \$5,120

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using

