

Accessibility Survey



City of Downey Carfax Avenue - Cul-de-sac to Foster Road

Carfax Avenue - Cul-de-sac to Foster Road
Downey, CA 90424

Date of Inspection
12/12/2016

Prepared By

Disability Access Consultants

(800) 743-7067

Carfax Avenue - Cul-de-sac to Foster Road

Sidewalks - Exterior : Sidewalks , Change in Level

East Side

Change In Level South Of Cul-de-sac @ 33.913370990576, -118.112576007843

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	319442	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Carfax Avenue - Cul-de-sac to Foster Road

Sidewalks - Exterior : Sidewalks , Change in Level

West Side

Change In Level North Of Foster Road @ 33.913061587515, -118.112640380859

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 1.00 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	319445	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Carfax Avenue - Cul-de-sac to Foster Road

Sidewalks - Exterior : Sidewalks , Surface

East Side

Sidewalk South Of Cul-de-sac @ 33.913346505482, -118.112554550171

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 5.20 percent for 45.00 feet


Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092

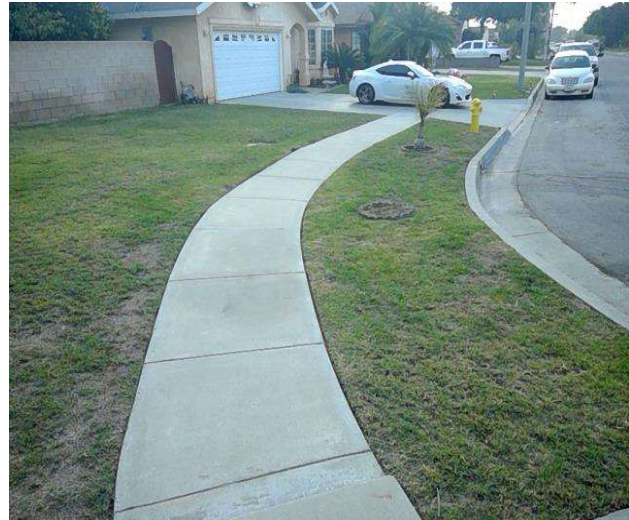

Code Reference ADA 206, 302, CA 11B-403.3

Progress

Record Number	319440	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Carfax Avenue - Cul-de-sac to Foster Road

Sidewalks - Exterior : Sidewalks

East Side

Sidewalk South Of Cul-de-sacv @ 33.913155076328, -118.112484812737

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 1166.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	319441	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Carfax Avenue - Cul-de-sac to Foster Road

Sidewalks - Exterior : Sidewalks

West Side

Sidewalk North Of Foster Road @ 33.910067665349, -118.11173112003

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 1149.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	319444	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Carfax Avenue - Cul-de-sac to Foster Road

Sidewalks - Exterior : Sidewalks , Surface

West Side

Sidewalk North Of Foster Road @ 33.913322020382, -118.112726211548

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.40 percent for 33.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

Record Number	319443	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Carfax Avenue - Cul-de-sac to Foster Road

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

West Side

Tree North Of Foster Road @ 33.913322020382, -118.112726211548

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 69.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4,CA 11B-307.4

Progress

Record Number	319446	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Carfax Avenue - Cul-de-sac to Foster Road



Carfax Avenue - Cul-de-sac to Foster Road

Carfax Avenue - Cul-de-sac to Foster Road
Downey, CA 90424

Date of Inspection
12/12/2016

***Estimated Facility Total: \$5,100**

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using

