

Accessibility Survey



City of Downey Belcher Street - Carfax Avenue to Faust Avenue

Belcher Street - Carfax Avenue to Faust Avenue
Downey, CA 90424

Date of Inspection
12/12/2016

Prepared By
Disability Access Consultants
(800) 743-7067

Belcher Street - Carfax Avenue to Faust Avenue

Sidewalks - Exterior : Sidewalks , Change in Level

South Side

Change In Level West Of Carfax Avenue @ 33.910597452543, -118.112187087536

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	319456	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Carfax Avenue to Faust Avenue

Sidewalks - Exterior : Sidewalks

North Side

Sidewalk East Of Faust Avenue @ 33.910719881888, -118.115086555481

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 992.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	319451	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Carfax Avenue to Faust Avenue

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk South Of Carfax Avenue @ 33.910604130512, -118.112616240978

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 80.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	319455	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Carfax Avenue to Faust Avenue

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West Of Carfax Avenue @ 33.910597452543, -118.113474547863

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 493.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	319454	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Belcher Street - Carfax Avenue to Faust Avenue

Sidewalks - Exterior : Sidewalks , Surface

South Side

Sidewalk West Of Carfax Avenue @ 33.910604130512, -118.112002015114

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.30 percent for 175.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

Record Number	319453	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Belcher Street - Carfax Avenue to Faust Avenue

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Tree West Of Carfax Avenue @ 33.910601904522, -118.113209009171

Sidewalks , Hazards & Gratings : Overhead Obstruction Height

Finding

Overhead obstruction height is not compliant.

On-Site Finding 71.00 inches

Recommendation

Provide a compliant vertical clearance height.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned



Code Reference ADA 206, 307.4, CA 11B-307.4

Progress

Record Number	319457	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Belcher Street - Carfax Avenue to Faust Avenue

Sidewalks - Exterior : Sidewalks

South Side @ 33.910608582491, -118.111878633499

Sidewalks : Turn Area

Finding

Turn area is not level.

On-Site Finding Not Level

Recommendation

Make sure that the turn area is level.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302

Progress

Record Number	322338	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Belcher Street - Carfax Avenue to Faust Avenue



Belcher Street - Carfax Avenue to Faust Avenue

**Belcher Street - Carfax Avenue to Faust Avenue
Downey, CA 90424**

Date of Inspection
12/12/2016

***Estimated Facility Total: \$6,330**

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Belcher Street - Corrigan Avenue To Cul-de-sac

Corrigan Avenue To Cul-de-sac
Downey, CA 90242

Date of Inspection
12/5/2016

Prepared By
Disability Access Consultants
(800) 743-7067

Belcher Street - Corrigan Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks , Change in Level

North Side

Change In Level East Of Corrigan Avenue @ 33.910755497665, -118.126567751169

Sidewalks , Change in Level : Change in Level Non Beveled

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Remove tripping hazards \$198



Code Reference ADA 206, 302

Progress

Record Number	314255	Resolution	None
Progress	Not_Started	Priority	Two
Actual Date		Projected Date	06/30/2021
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Corrigan Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

North Side

Curb Northeast Corner Of Corrigan Avenue @ 33.910759949636, -118.126652240753

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

Finding

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



Code Reference ADA 402, 303, 406, 403.4, 303.4

Progress

Record Number	314254	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Corrigan Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks

North Side

Sidewalk East Of Corrigan Avenue @ 33.910738802772, -118.126304894686

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 246.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	314252	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Corrigan Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East Of Corrigan Avenue @ 33.910738802772, -118.126492649317

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 4.10 percent for 51.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302,CA 11B-403.3

Progress

Record Number	314253	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Corrigan Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Curb Southeast Corner Of Corrigan Avenue @ 33.910621938426, -118.126671016216

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

Finding

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



Code Reference ADA 402, 303, 406, 403.4, 303.4

Progress

Record Number	314251	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Corrigan Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West Of Corrigan Avenue @ 33.910631955376, -118.126161396503

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 42.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	314250	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Corrigan Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West Of Corrigan Avenue @ 33.910683153103, -118.125565946102

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 195.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	314249	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Corrigan Avenue To Cul-de-sac



Belcher Street - Corrigan Avenue To Cul-de-sac

Corrigan Avenue To Cul-de-sac
Downey, CA 90242

Date of Inspection
12/5/2016

*Estimated Facility Total: \$10,070

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Belcher Street - Hanwell Avenue To Cul-de-sac

Hanwell Avenue To Cul-de-sac
Downey, CA 90242

Date of Inspection
12/3/2016

Prepared By

Disability Access Consultants

(800) 743-7067

Belcher Street - Hanwell Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

North Side

Curb Northeast Corner Of Hanwell Avenue @ 33.910762175621, -118.137992620468

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

Finding

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



Code Reference ADA 402, 303, 406, 403.4, 303.4

Progress

Record Number	313332	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Hanwell Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

North Side

Curb Northeast Corner Of Whitewood Avenue @ 33.910646424302, - 118.135621547699

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

Finding

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



Code Reference ADA 402, 303, 406, 403.4, 303.4

Progress

Record Number	313333	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Hanwell Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

North Side

Curb Northwest Corner Of Whitewood Avenue @ 33.910637520348, - 118.135793209076

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

Finding

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



Code Reference ADA 402, 303, 406, 403.4, 303.4

Progress

Record Number	313331	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Hanwell Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks

North Side

Sidewalk East Of Hanwell Avenue @ 33.910757723651, -118.137968480587

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 688.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	313330	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments		
Assignment	None	New Value	0
Designated Staff			

Belcher Street - Hanwell Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks

North Side

Sidewalk East Whitewood Avenue @ 33.910646424302, -118.135621547699

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 229.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	313329	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Hanwell Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Curb Southeast Corner Of Hanwell Avenue @ 33.910605243507, -118.138047605753

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

Finding

There is a curb on the designated path of travel.

On-Site Finding Not Compliant


Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500

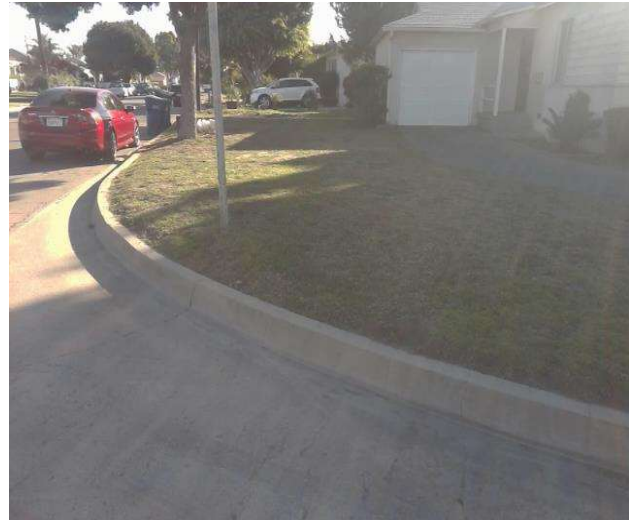

Code Reference ADA 402, 303, 406, 403.4, 303.4

Progress

Record Number	313328	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Hanwell Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Curb Southeast Of Birdvale Drive @ 33.910499508940, -118.136053383350

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

Finding

There is a curb on the designated path of travel.

On-Site Finding Not Compliant


Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500

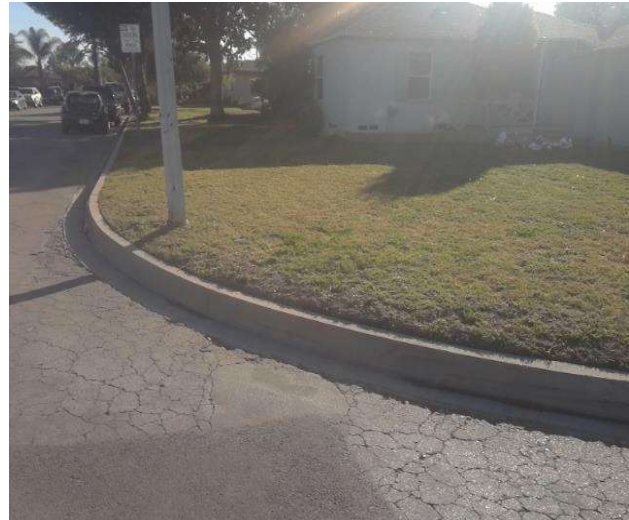

Code Reference ADA 402, 303, 406, 403.4, 303.4

Progress

Record Number	313327	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Hanwell Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks , Hazards & Gratings

South Side

Curb Southwest Of Birdvale Drive @ 33.910515090885, -118.136187493801

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

Finding

There is a curb on the designated path of travel.

On-Site Finding Not Compliant

Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

Costing Info (Estimated)

Install curb ramp \$2,500



Code Reference ADA 402, 303, 406, 403.4, 303.4

Progress

Record Number	313326	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Hanwell Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West Of Birdvale Drive @ 33.910515090885, -118.136187493801

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 567.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	313324	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Hanwell Avenue To Cul-de-sac

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West Of Cul-de-sac @ 33.910512864893, -118.134983181953

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 336.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	313325	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Hanwell Avenue To Cul-de-sac



Belcher Street - Hanwell Avenue To Cul-de-sac

Hanwell Avenue To Cul-de-sac
Downey, CA 90242

Date of Inspection
12/3/2016

*Estimated Facility Total: \$20,040

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using



Accessibility Survey



City of Downey Belcher Street - Woodruff Avenue to Eastbrook Avenue

Belcher Street - Woodruff Avenue to Eastbrook Avenue
Downey, CA 90424

Date of Inspection
12/10/2016

Prepared By

Disability Access Consultants

(800) 743-7067

Belcher Street - Woodruff Avenue to Eastbrook Avenue

Sidewalks - Exterior : Sidewalks

North Side

Sidewalk East Of Eastbrook Avenue @ 33.910742141751, -118.119850158691

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 874.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	318687	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Woodruff Avenue to Eastbrook Avenue

Sidewalks - Exterior : Sidewalks , Surface

North Side

Sidewalk East Of Ibbetson Avenue @ 33.911409934910, -118.117344975472

Sidewalks , Surface : Cross Slope

Finding

Sidewalk cross slope is not compliant.

On-Site Finding 3.00 percent for 112.00 feet

Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface \$1,092



Code Reference ADA 206, 302, CA 11B-403.3

Progress

Record Number	318686	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2032
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Woodruff Avenue to Eastbrook Avenue

Sidewalks - Exterior : Sidewalks

South Side

Sidewalk West Of Woodruff Avenue @ 33.911256342946, -118.117200136185

Sidewalks : Missing Sidewalk

Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

On-Site Finding 922.00 feet

Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,260



Code Reference ADA 206, 302,CA 11B-302,CA 11B-206

Progress

Record Number	318688	Resolution	None
Progress	Not_Started	Priority	Seven
Actual Date		Projected Date	06/30/2037
Actual Cost	\$0.00	Contractor	
Comments	No Comments	New Value	0
Assignment	None		
Designated Staff			

Belcher Street - Woodruff Avenue to Eastbrook Avenue



Belcher Street - Woodruff Avenue to Eastbrook Avenue

**Belcher Street - Woodruff Avenue to Eastbrook Avenue
Downey, CA 90424**

Date of Inspection
12/10/2016

***Estimated Facility Total: \$3,612**

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

Disability Access Consultants

(800) 743-7067

Prepared Using

