

# Accessibility Survey

---



## City of Downey Glynn Avenue - Eucalyptus Street To Cul-de-sac

Eucalyptus Street To Cul-de-sac  
Downey, CA 90242

Date of Inspection  
1/31/2017

Prepared By  
**Disability Access Consultants**  
(800) 743-7067

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Sidewalks - Exterior : Sidewalks , Change in Level

---

#### West Side

#### Change In Level North Of Donovan Street @ 33.925360050404, -118.142542988062

Sidewalks , Change in Level : Change in Level Non Beveled

#### Finding

There is a change in elevation greater than recommended value.

**On-Site Finding** 0.50 inches


#### Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

#### Costing Info (Estimated)

Remove tripping hazards \$198

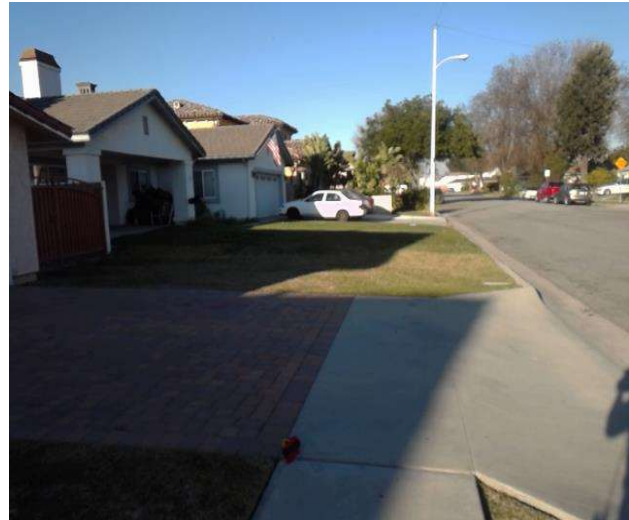

**Code Reference** ADA 206, 302

#### Progress

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 347958      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Two        |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2021 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments | <b>New Value</b>      | 0          |
| <b>Assignment</b>       | None        |                       |            |
| <b>Designated Staff</b> |             |                       |            |

**Glynn Avenue - Eucalyptus Street To Cul-de-sac**

**Curb Ramps - Exterior : Curb Ramp , Landings And Transitions**

---

**Northwest Corner Of Donovan Street @ 33.924851498357, - 118.142931908369**

**Bottom Landing**

**Finding**

The transition from the bottom of the curb ramp to the walk, gutter, or street is abrupt.

**On-Site Finding** 0.75 inches

**Recommendation**

Patch the transition area at the bottom of the curb ramp so that the transition is flush and free of abrupt changes.

Recommendation Up to 0.50 inches

**Costing Info (Estimated)**

Patch lip at curb ramp \$255

Curb Ramp , Landings And Transitions : Bottom Landing Change in Level



**Code Reference** ADA 302, 303, 406.2, 303.1

**Progress**

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 349132      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments | <b>New Value</b>      | 0          |
| <b>Assignment</b>       | None        |                       |            |
| <b>Designated Staff</b> |             |                       |            |

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

---

#### Northwest Corner Of Donovan Street @ 33.924851498357, - 118.142931908369

##### Top Landing

Curb Ramp , Landings and Transitions : Top Landing Slope

##### Finding

The slope at the top landing is greater than allowed.

**On-Site Finding** 4.50 percent

##### Recommendation

Provide a top landing surface that does not exceed the maximum slope and cross slope. Provide a sufficient maneuvering clearance that does not accumulate water.

Recommendation Up to 2.08 percent

##### Costing Info (Estimated)

Provide compliant landing \$1,260



**Code Reference** ADA 402, 406.4, 403.3, 406.1, CA 11B-406.5.3

### Progress

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 347970      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments |                       |            |
| <b>Assignment</b>       | None        | <b>New Value</b>      | 0          |
| <b>Designated Staff</b> |             |                       |            |

**Glynn Avenue - Eucalyptus Street To Cul-de-sac**

**Curb Ramps - Exterior : Curb Ramp , Landings and Transitions**

---

**Northwest Corner Of Donovan Street @ 33.924851498357, - 118.142931908369**

**Top Landing**

**Finding**

There is not enough top landing clear length.

**On-Site Finding** 28.00 inches

**Recommendation**

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

**Costing Info (Estimated)**

Provide compliant landing \$240

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings



**Code Reference** ADA 406, 406.4,CA 11B-406.5.3

**Progress**

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 347972      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments |                       |            |
| <b>Assignment</b>       | None        | <b>New Value</b>      | 0          |
| <b>Designated Staff</b> |             |                       |            |

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Curb Ramps - Exterior : Curb Ramp

#### Northwest Corner Of Donovan Street @ 33.924851498357, - 118.142931908369

Curb Ramp : No Detectable Warnings

#### Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

#### Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

#### Costing Info (Estimated)

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

### Progress

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 349130      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments | <b>New Value</b>      | 0          |
| <b>Assignment</b>       | None        |                       |            |
| <b>Designated Staff</b> |             |                       |            |

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Curb Ramps - Exterior : Curb Ramp

#### Northwest Corner Of Donovan Street @ 33.924851498357, - 118.142931908369

Curb Ramp : Side Flare Slope

#### Finding

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 13.90 percent

#### Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

#### Costing Info (Estimated)

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3, CA 11B-406.2.2

### Progress

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 349131      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments |                       |            |
| <b>Assignment</b>       | None        | <b>New Value</b>      | 0          |
| <b>Designated Staff</b> |             |                       |            |

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

---

#### Southwest Corner Of Donovan Street @ 33.924721299643, - 118.143028467894

##### Bottom Landing

Curb Ramp , Landings and Transitions : Bottom Landing Slope

##### Finding

The slope at the bottom landing is greater than allowed.

**On-Site Finding** 3.00 percent

##### Recommendation

Provide a compliant bottom landing that does not exceed the maximum slope requirements.

Recommendation Up to 2.08 percent

##### Costing Info (Estimated)

Provide compliant landing \$240



**Code Reference** ADA 402, 406.4, 406.2, 403.3, 406.1, CA 11B-406.5.3

### Progress

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 347954      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments |                       |            |
| <b>Assignment</b>       | None        | <b>New Value</b>      | 0          |
| <b>Designated Staff</b> |             |                       |            |



## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Curb Ramps - Exterior : Curb Ramp , Landings and Transitions

---

#### Southwest Corner Of Donovan Street @ 33.924721299643, - 118.143028467894

##### Top Landing

##### Finding

There is not enough top landing clear length.

**On-Site Finding** 26.00 inches

##### Recommendation

Provide a level top landing with enough clear length.

Recommendation At least 48.00 inches

##### Costing Info (Estimated)

Provide compliant landing \$240

Curb Ramp , Landings and Transitions : Top Landing Clear Length - Landings



**Code Reference** ADA 406, 406.4,CA 11B-406.5.3

### Progress

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 347955      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments | <b>New Value</b>      | 0          |
| <b>Assignment</b>       | None        |                       |            |
| <b>Designated Staff</b> |             |                       |            |

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Curb Ramps - Exterior : Curb Ramp

**Southwest Corner Of Donovan Street @ 33.924721299643, -  
118.143028467894**

Curb Ramp : No Detectable Warnings

#### Finding

The curb ramp does not provide a detectable warning surface which includes truncated domes.

**On-Site Finding** Not Found

#### Recommendation

Provide compliant detectable warnings to surface.

Recommendation See Recommendation

#### Costing Info (Estimated)

Provide detectable warning to surface \$248



**Code Reference** CA 11B-406.5.12

### Progress

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 349127      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments | <b>New Value</b>      | 0          |
| <b>Assignment</b>       | None        |                       |            |
| <b>Designated Staff</b> |             |                       |            |

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Curb Ramps - Exterior : Curb Ramp

#### Southwest Corner Of Donovan Street @ 33.924721299643, - 118.143028467894

Curb Ramp : Side Flare Slope

#### Finding

The slope of the curb ramp side flare is greater than allowed.

**On-Site Finding** 19.50 percent

#### Recommendation

Provide curb ramp side flares with a compliant slope.

Recommendation Up to 10.00 percent

#### Costing Info (Estimated)

Install flared sides \$1,300



**Code Reference** ADA 406, 406.3, CA 11B-406.2.2

### Progress

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 349128      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments | <b>New Value</b>      | 0          |
| <b>Assignment</b>       | None        |                       |            |
| <b>Designated Staff</b> |             |                       |            |

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Sidewalks - Exterior : Sidewalks , Hazards & Gratings

---

#### East Side

#### Curb Northeast Corner Of Donovan Street @ 33.924783617001, -118.142765611410

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

#### Finding

There is a curb on the designated path of travel.

**On-Site Finding** Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

#### Progress

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 347963      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments | <b>New Value</b>      | 0          |
| <b>Assignment</b>       | None        |                       |            |
| <b>Designated Staff</b> |             |                       |            |

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Sidewalks - Exterior : Sidewalks , Hazards & Gratings

---

#### East Side

#### **Curb Northeast Corner Of Eucalyptus Street @ 33.923963472405, - 118.143394589424**

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

#### **Finding**

There is a curb on the designated path of travel.

**On-Site Finding** Not Compliant

#### **Recommendation**

Provide a compliant curb ramp.

Recommendation See Recommendation

#### **Costing Info (Estimated)**

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

#### **Progress**

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 347967      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments | <b>New Value</b>      | 0          |
| <b>Assignment</b>       | None        |                       |            |
| <b>Designated Staff</b> |             |                       |            |

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Sidewalks - Exterior : Sidewalks , Hazards & Gratings

---

#### East Side

#### Curb Northeast Corner Of Orange Street @ 33.925532534545, -118.142184913158

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

#### Finding

There is a curb on the designated path of travel.

**On-Site Finding** Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

#### Progress

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 347966      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments | <b>New Value</b>      | 0          |
| <b>Assignment</b>       | None        |                       |            |
| <b>Designated Staff</b> |             |                       |            |

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Sidewalks - Exterior : Sidewalks , Hazards & Gratings

---

#### East Side

#### Curb Southeast Corner Of Donovan Street @ 33.924636726012, -118.142870217562

Sidewalks , Hazards & Gratings : Curb is on Path of Travel

#### Finding

There is a curb on the designated path of travel.

**On-Site Finding** Not Compliant

#### Recommendation

Provide a compliant curb ramp.

Recommendation See Recommendation

#### Costing Info (Estimated)

Install curb ramp \$2,500



**Code Reference** ADA 402, 303, 406, 403.4, 303.4

#### Progress

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 347965      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments | <b>New Value</b>      | 0          |
| <b>Assignment</b>       | None        |                       |            |
| <b>Designated Staff</b> |             |                       |            |

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Sidewalks - Exterior : Sidewalks

---

#### East Side

#### Sidewalk South Of Cul-de-sac @ 33.926766620561, -118.141342699528

Sidewalks : Missing Sidewalk

#### Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

**On-Site Finding** 460.00 feet

#### Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

#### Costing Info (Estimated)

\$1,260



**Code Reference** ADA 206, 302,CA 11B-302,CA 11B-206

### Progress

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 347962      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2037 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments | <b>New Value</b>      | 0          |
| <b>Assignment</b>       | None        |                       |            |
| <b>Designated Staff</b> |             |                       |            |



## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Sidewalks - Exterior : Sidewalks

---

#### East Side

#### Sidewalk South Of Donovan Street @ 33.924266158982, -118.143157213926

Sidewalks : Width

#### Finding

Sidewalk does not have enough width.

**On-Site Finding** 46.00 inches for 107.00 feet

#### Recommendation

Widen the sidewalk to the recommended value.

Recommendation At least 48.00 inches

#### Costing Info (Estimated)

\$1,260



**Code Reference** ADA 206, 302, CA 11B-403.5.1

### Progress

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 347959      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments | <b>New Value</b>      | 0          |
| <b>Assignment</b>       | None        |                       |            |
| <b>Designated Staff</b> |             |                       |            |

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Sidewalks - Exterior : Sidewalks , Surface

---

#### East Side

#### Sidewalk South Of Donovan Street @ 33.924266158982, -118.143157213926

Sidewalks , Surface : Cross Slope

#### Finding

Sidewalk cross slope is not compliant.

**On-Site Finding** 4.20 percent for 40.00 feet

#### Recommendation

Repave the sidewalk surface with the recommended cross slope.

Recommendation Up to 2.08 percent

#### Costing Info (Estimated)

Repave surface \$1,092



**Code Reference** ADA 206, 302, CA 11B-403.3

#### Progress

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 347960      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments | <b>New Value</b>      | 0          |
| <b>Assignment</b>       | None        |                       |            |
| <b>Designated Staff</b> |             |                       |            |

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Sidewalks - Exterior : Sidewalks

---

#### East Side

#### Sidewalk South Of Donovan Street @ 33.924266158982, -118.143157213926

Sidewalks : Opening

#### Finding

Ground surface has an opening that is not compliant.

**On-Site Finding** Not Compliant

#### Recommendation

Make sure that the surface opening does not allow passage of a sphere more than 1/2 inch in diameter.

Recommendation See Recommendation

#### Costing Info (Estimated)

Unassigned



**Code Reference** ADA 302

#### Progress

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 347961      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments | <b>New Value</b>      | 0          |
| <b>Assignment</b>       | None        |                       |            |
| <b>Designated Staff</b> |             |                       |            |

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Sidewalks - Exterior : Sidewalks , Hazards & Gratings

---

#### East Side

#### Utility Pole South Of Donovan Street @ 33.924302881913, -118.143125027418

Sidewalks , Hazards & Gratings : Sidewalk Width at Obstruction

#### Finding

Sidewalk width at the obstruction is not compliant.

**On-Site Finding** 33.50 inches

#### Recommendation

Sidewalk width at the obstruction shall have the recommended value.

Recommendation At least 48.00 inches

#### Costing Info (Estimated)

\$1,260



**Code Reference** ADA 206, 302, 403.5.1, CA 11B-403.5

#### Progress

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 347964      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments | <b>New Value</b>      | 0          |
| <b>Assignment</b>       | None        |                       |            |
| <b>Designated Staff</b> |             |                       |            |

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Sidewalks - Exterior : Sidewalks

---

#### West Side

#### Sidewalk North Of Donovan Street @ 33.925396772864, -118.142505437136

Sidewalks : Missing Sidewalk

#### Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

**On-Site Finding** 631.00 feet

#### Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

#### Costing Info (Estimated)

\$1,260



**Code Reference** ADA 206, 302,CA 11B-302,CA 11B-206

### Progress

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 347956      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2037 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments | <b>New Value</b>      | 0          |
| <b>Assignment</b>       | None        |                       |            |
| <b>Designated Staff</b> |             |                       |            |

## Glynn Avenue - Eucalyptus Street To Cul-de-sac

### Sidewalks - Exterior : Sidewalks

---

#### West Side

#### Sidewalk North Of Eucalyptus Street To Cul-de-sac @ 33.923941215996, - 118.143581002951

Sidewalks : Missing Sidewalk

#### Finding

Section of sidewalk is missing and consists of dirt, grass or gravel.

**On-Site Finding** 120.00 feet

#### Recommendation

Provide a compliant sidewalk for the missing section.

Recommendation See Recommendation

#### Costing Info (Estimated)

\$1,260



**Code Reference** ADA 206, 302,CA 11B-302,CA 11B-206

### Progress

---

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 347957      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2037 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments |                       |            |
| <b>Assignment</b>       | None        | <b>New Value</b>      | 0          |
| <b>Designated Staff</b> |             |                       |            |

**Glynn Avenue - Eucalyptus Street To Cul-de-sac**

**Sidewalks - Exterior : Sidewalks**

**West Side @ 33.923941215996, -118.143581002951**

Sidewalks : Turn Area

**Finding**

Turn area is not level.

**On-Site Finding** Not Level

**Recommendation**

Make sure that the turn area is level.

Recommendation See Recommendation

**Costing Info (Estimated)**

\$1,260



**Code Reference** ADA 206, 302

**Progress**

|                         |             |                       |            |
|-------------------------|-------------|-----------------------|------------|
| <b>Record Number</b>    | 349129      | <b>Resolution</b>     | None       |
| <b>Progress</b>         | Not_Started | <b>Priority</b>       | Seven      |
| <b>Actual Date</b>      |             | <b>Projected Date</b> | 06/30/2032 |
| <b>Actual Cost</b>      | \$0.00      | <b>Contractor</b>     |            |
| <b>Comments</b>         | No Comments |                       |            |
| <b>Assignment</b>       | None        | <b>New Value</b>      | 0          |
| <b>Designated Staff</b> |             |                       |            |

**Glynn Avenue - Eucalyptus Street To Cul-de-sac**



**Glynn Avenue - Eucalyptus Street To Cul-de-sac**

**Eucalyptus Street To Cul-de-sac  
Downey, CA 90242**

Date of Inspection  
1/31/2017

**\*Estimated Facility Total: \$24,181**

\*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared By

**Disability Access Consultants**

(800) 743-7067

Prepared Using

